

F/6 13/13

NUM--ETC(U)

MAY 81

DACW31-81-C-0027

NE

1 OF 1
AD A
01234

END
DATE
FILMED
8-8
DTIC

LEVEL

OHIO RIVER BASIN
TRIBUTARY TO CENTER BRANCH-PIGEON CREEK
WASHINGTON COUNTY

(1)
52

PENNSYLVANIA

NDI No. PA 01144
PENN DER No. 63-88


MINE No. 60 - POND 5

BETHLEHEM MINES CORPORATION
ELLSWORTH-BUTLER DIVISION

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM

PAG 31-81-C-0027

DTIC
ELECTE
JUL 10 1981
D
C

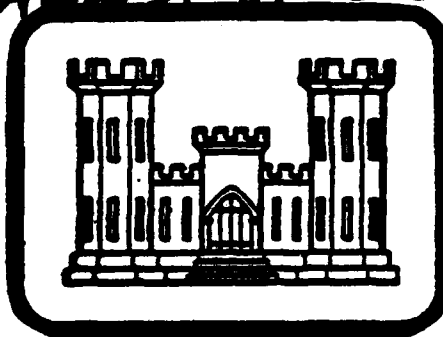

PREPARED FOR **A**

DEPARTMENT OF THE ARMY
BALTIMORE DISTRICT, CORPS OF ENGINEERS
BALTIMORE, MARYLAND 21203

BY

ACKENHEIL & ASSOCIATES GEO SYSTEMS, INC.
CONSULTING ENGINEERS
1000 BANKSVILLE ROAD
PITTSBURGH, PENNSYLVANIA 15216

MAY 1981

DISTRIBUTION STATEMENT A
Approved for public release;
Distribution Unlimited

81 7 10 019

AD A101234

DTIC FILE COPY

*Original contains color
plates: All DTIC reproductions
will be in black and
white*


⑥
National Dam Inspection Program. Mine
Number 60-Pond 5 (NDI Number PA 01144,
PENN DER Number 63-88), Ohio River Basin,
Tributary to Center Branch-Pigeon Creek,
Washington County, Pennsylvania.
Phase I Inspection report.

OHIO RIVER BASIN

MINE NO. 60-POND 5
WASHINGTON COUNTY, COMMONWEALTH OF PENNSYLVANIA
NDI NO. PA 01144
PennDER NO. 63-88

15 14131-81-1-0727
BETHLEHEM MINES CORPORATION
ELLSWORTH-BUTLER DIVISION

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM

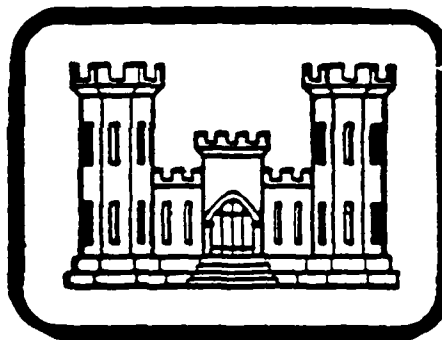

Prepared for: DEPARTMENT OF THE ARMY
Baltimore District, Corps of Engineers
Baltimore, Maryland 21203

Prepared by: ACKENHEIL & ASSOCIATES GEO SYSTEMS, INC.
Consulting Engineers
1000 Banksville Road
Pittsburgh, Pennsylvania 15216

Date: May 1981

DISTRIBUTION STATEMENT A
Approved for public release
Distribution Unlimited

411785

71

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams for Phase I investigations. Copies of these guidelines may be obtained from the Department of the Army, Office of Chief of Engineers, Washington, D.C. 20314.

The purpose of a Phase I investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon visual observations and review of available data. Detailed investigations and analyses involving topographic mapping, subsurface investigations, materials testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify the need for such studies which should be performed by the owner.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of the dam depends on numerous and constantly changing internal and external factors which are evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some time in the future. Only through frequent inspections can unsafe conditions be detected and only through continued care and maintenance can these conditions be prevented or corrected.

Phase I investigations are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the spillway design flood is based on the estimated "Probable Maximum Flood" (PMF) for the region (greatest reasonably possible storm runoff), or fractions thereof. The spillway design flood provides a measure of relative spillway capacity and serves as an aid in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition, and the downstream damage potential.

Accession For	
NTIS GRA&I	
DTIC TAB	
Unannounced	
Justification for	
2m 50 per	
file	
By	
Distribution/	
Availability Codes	
1	
A	

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM

SYNOPSIS OF ASSESSMENT AND RECOMMENDATIONS

NAME OF DAM:	Mine No. 60-Pond 5
STATE LOCATION:	Pennsylvania
COUNTY LOCATION:	Washington
STREAM:	Unnamed tributary to Center Branch - Pigeon Creek.
DATE OF INSPECTIONS:	18 March 1981 and 26 March 1981
COORDINATES:	Lat. 40°08'48" Long. 80°03'47"

ASSESSMENT

Based on a review of available information and visual observations of conditions as they existed on the date of the field inspections, the general condition of the Mine No. 60-Pond 5 is considered to be fair.

This assessment is based primarily on visual observations of embankment, spillway and seepage conditions and hydrology/hydraulic analyses of reservoir/spillway capacity.

The structure is classified as an "intermediate" size, "high" hazard dam. Corps of Engineers guidelines recommend the Probable Maximum Flood (PMF) as the Spillway Design Flood for an "intermediate" size, "high" hazard dam. The Mine No. 60-Pond 5's Spillway Design Flood is the Probable Maximum Flood. Spillway capacity is "adequate" because the non-overtopping flood discharge was found, by using the HEC-1 computer program, to be in excess of 100 percent of the PMF.

The Phase I investigation of Mine No. 60-Pond 5 revealed deficiencies and conditions which should be corrected or improved through implementation of the following recommended remedial, monitoring and/or improvement efforts.

RECOMMENDATIONS

1. Emergency Operation and Warning Plan: The owner should develop an Emergency Operation and Warning Plan including:
 - a. Guidelines for evaluating inflow during periods of heavy precipitation or runoff.
 - b. Procedures for around the clock surveillance during periods of heavy precipitation or runoff.

SYNOPSIS OF ASSESSMENT AND RECOMMENDATIONS (CONT'D)
Mine No. 60-Pond 5

c. Procedures for drawdown of the reservoir under emergency conditions.

d. Procedures for notifying downstream residents and public officials, in case evacuation of downstream areas is necessary.

2. Remedial Work: The visual inspection disclosed three deficiencies which should be corrected or monitored. These include:

a. Improving the drainage of the embankment crest by removing wheel ruts.


b. Removing the silt fence from the spillway channel and realigning the discharge channel to direct flows away from the right groin.

c. Implementation of a regularly scheduled monitoring program to observe the seepage zones for changes in water quality and/or quantity.

3. Abandonment: As an alternative to the recommendations presented above, the owner should develop and implement a plan to make the facility incapable of impounding water. Such an abandonment plan should conform to all applicable local, state and federal regulations, and all regulatory approvals should be obtained prior to the start of abandonment construction operations.

SYNOPSIS OF ASSESSMENT AND RECOMMENDATIONS (CONT'D)
Mine No. 60-Pond 5

Samuel G. Mazzella 8 May 1981
Samuel G. Mazzella Date
Project Engineer

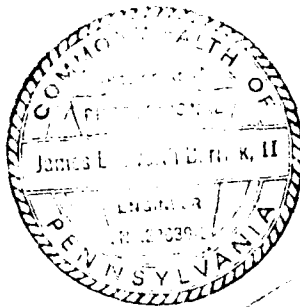

James P. Hannan 8 May 1981
James P. Hannan Date
Project Engineer

James E. Barrick 8 May 81
James E. Barrick, P.E. Date
PA Registration No. 022639-E

Approved by:

James W. Peck
James W. Peck, Colonel
Corps of Engineers
District Engineer

22 May 81
Date

MINE No. 60 - POND 5



OVERVIEW

TABLE OF CONTENTS

	<u>Page</u>
PREFACE	i
SYNOPSIS OF ASSESSMENT AND RECOMMENDATIONS	ii
OVERVIEW PHOTOGRAPH	v
SECTION 1 - PROJECT INFORMATION	
1.1 General	1
1.2 Description of Project	1
1.3 Pertinent Data	3
SECTION 2 - ENGINEERING DATA	
2.1 Design	5
2.2 Construction	5
2.3 Operation	5
2.4 Evaluation	5
SECTION 3 - VISUAL INSPECTION	
3.1 Findings	7
3.2 Evaluation	9
SECTION 4 - OPERATIONAL FEATURES	
4.1 Procedure	11
4.2 Maintenance of Dam	11
4.3 Inspection of Dam	11
4.4 Warning Procedure	11
4.5 Evaluation	11
SECTION 5 - HYDROLOGY AND HYDRAULICS	
5.1 Evaluation of Features	12
SECTION 6 - STRUCTURAL STABILITY	
6.1 Available Information	14
6.2 Evaluation	14
SECTION 7 - ASSESSMENT AND RECOMMENDATIONS	
7.1 Assessment	16
7.2 Recommendations	16

TABLE OF CONTENTS (cont'd)

	<u>Page</u>
APPENDIX A - VISUAL INSPECTION CHECKLIST	
Visual Observations Checklist I	A1
Field Sketch	A10
Field Sections A-A and B-B	A11
Field Section C-C an Spillway Detail	A12
APPENDIX B - ENGINEERING DATA CHECKLIST	
APPENDIX C - PHOTOGRAPHS	
Photo Key Map	C1
Photos 1 through 16	C2
Photo Descriptions	C6
APPENDIX D - HYDROLOGY AND HYDRAULICS ANALYSES	
Methodology	D1
Engineering Data	D3
HEC-1 Data Base	D4
Loss Rate and Base Flow Parameters	D5
Elevation-Area-Capacity Relationship	D5
Dam Overtop Parameters	D7
Spillway Parameters	D7
Program Schedule	D7
HEC-1 Computer Analysis	D8
Hydrologic Performance Plot	D11
APPENDIX E - PLATES	
List of Plates	E1
Plates I and II	E2
APPENDIX F - GEOLOGY	
Geomorphology	F1
Structure	F1
Stratigraphy	F1
Mining Activity	F1
Geologic Map	F2
Geologic Column	F3

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM
MINE NO. 60-POND 5
NATIONAL I. D. NO. PA 01144
PennDER No. 63-88

SECTION 1
PROJECT INFORMATION

1.1 GENERAL

a. Authority: The Phase I investigation was performed pursuant to authority granted by Public Law 92-367 (National Dam Inspection Act) to the Secretary of the Army, through the Corps of Engineers, to conduct inspections of dams throughout the United States.

b. Purpose: The purpose of the investigation is to make a determination on whether or not the dam constitutes a hazard to human life or property.

1.2 DESCRIPTION OF PROJECT

a. Dam and Appurtenances:

(1) Embankment: The Mine No. 60-Pond 5 embankment was constructed as a earthfill structure. The embankment is 1100 feet long, with a toe to crest height of 78.7 feet and a crest width of about 20 feet. The embankment's upstream slope was measured to be 2.9H:1V above the waterline; the downstream slope was measured to vary from 3.0H:1V to 2.8H:1V.

(2) Principal (and Emergency) Spillway: The principal (and emergency) spillway for the Mine No. 60-Pond 5 consists of a 12 foot wide trapezoidal open channel in the right abutment. A silt fence is located across the spillway crest.

(3) Outlet Works: An outlet works consisting of a submerged pump and pipeline is located near the upstream end of the impoundment. The partially clarified pond water is returned to the Mine No. 60 Preparation Plant for reuse in the coal cleaning process.

(4) Freeboard Conditions: Freeboard between the low point on the embankment and the spillway crest is 2.6 feet.

(5) Downstream Conditions: The unnamed creek below the Mine No. 60-Pond 5 flows through an uninhabited valley for about 1.4 miles to a confluence with the Center Branch of Pigeon Creek. Pigeon Creek flows into the Monongahela River near Monongahela, Pennsylvania. In the first 5 miles below the dam, at least 5 inhabited dwellings, several major secondary roads, a railyard and a reservoir lie within the limits of the affected floodplain.

(6) Reservoir: The Mine No. 60-Pond 5 is about 700 feet long at the operating pool elevation and has a surface area of 11.2 acres. When the pool is at the crest of the dam, the reservoir length increases to 750 feet and the surface area would be about 11.9 acres.

(7) Watershed: The watershed contributing to the Mine No. 60-Pond 5 is a woodland. The watershed, 32 acres, is completely owned by the Bethlehem Mines Corporation.

b. Location: Mine No. 60-Pond 5 is located at the headwaters of an unnamed tributary to the Center Branch of Pigeon Creek, in Somerset Township, Washington County, Pennsylvania. The pond is approximately 3 miles northwest of Ellsworth, Pennsylvania.

c. Size Classification: The dam has a maximum storage capacity of 217 acre-feet and a toe to crest height of 78.7 feet. Based on the Corps of Engineers guidelines, this dam is classified as an "intermediate" size structure.

d. Hazard Classification: The Mine No. 60-Pond 5 is classified as a "high" hazard dam. In the event of a dam failure, at least 5 inhabited dwellings, several roads, a railroad and a reservoir could be subjected to substantial damage and the loss of more than a few lives could result.

e. Ownership: The No. Mine 60-Pond 5 is owned by the Bethlehem Mines Corporation. Correspondence can be addressed to:

Bethlehem Mines Corporation
Ellsworth-Butler Division
P. O. Box 143
Eighty-Four, Pennsylvania 15330
Attention: Mr. D. F. Patterson, Chief Engineer
(412) 228-5500

f. Purpose of Dam: The Mine No. 60-Pond 5 was constructed to serve as a holding and settling impoundment for fine coal refuse slurry from the Mine No. 60 Coal Preparation Plant.

g. Design and Construction History: The dam was designed by Bethlehem Mines Corporation, Ellsworth-Butler Division and was constructed in two stages. Stage I was placed to Elevation 1150 during the Summer of 1972 and Stage II was raised to Elevation 1175 during the Summer of 1975. Construction work was performed by Patsy Boccabello and Sons, Inc., of Bentleyville, Pennsylvania.

h. Normal Operating Procedure: The Mine No. 60-Pond 5 was designed to operate as an uncontrolled structure. Under normal operating conditions, the operating pool level is maintained by the outlet works. A spillway provides for a maximum operating pool elevation of about 1172.5.

Inflow to the Mine No. 60-Pond 5 includes runoff from the watershed above and fine coal refuse slurry from the Mine No. 60 Preparation Plant.

1.3 PERTINENT DATA

- | | | |
|----|--|---------------|
| a. | <u>Drainage Area</u> | 0.05 sq. mi. |
| b. | <u>Discharge</u> | |
| | Maximum flood at Dam Facility | Unknown |
| | Spillway Capacity at Top of Dam | 155 cfs |
| c. | <u>Elevation (feet above MSL)</u> | |
| | Design Top of Dam | Unknown |
| | Current Top of Dam (low point) | 1175.1 |
| | Spillway Crest | 1172.5 |
| | Operating Pool (on date of inspection) | 1172.5 |
| | Toe of Embankment | 1096.4 |
| d. | <u>Reservoir Length</u> | |
| | Length of Maximum Pool | 750 feet |
| | Length of Operating Pool | 700 feet |
| e. | <u>Reservoir Storage</u> | |
| | Design Top of Dam | Unknown |
| | Current Top of Dam | 217 acre-feet |
| | Spillway Crest | 187 acre-feet |
| f. | <u>Reservoir Surface</u> | |
| | Design Top of Dam | Unknown |
| | Current Top of Dam | 11.9 acres |
| | Spillway Crest | 11.2 acres |

g. Embankment

Type	Earth
Length	1100 feet
Height	78.7 feet
Crest Width	20 feet
Slopes	
Downstream	3.0H:1V to 2.8 H:1V
Upstream	2.9 H:1V
Impervious Core	Unknown
Cutoff Provisions	Unknown
Grout Curtain	Unknown

h. Emergency Spillway

Type	Trapezoidal Open Channel
Location	Right Abutment
Overflow Crest Length	12 feet
Crest Elevation	1172.5 feet

i. Outlet Works

Type	Submerged Pump
Location	Near Upstream End of Impoundment

SECTION 2 ENGINEERING DATA

2.1 DESIGN

a. Data Available: The files of the Commonwealth of Pennsylvania, Department of Environmental Resources (PennDER), were reviewed but no engineering data relating to the original design of the facility were found.

All available design and construction information was obtained from representatives of Bethlehem Mines Corporation.

b. Design History: The dam was designed by Bethlehem Mines Corporation, Ellsworth-Butler Division in 1972. The owner provided the topographic drawing listed in Appendix B and reproduced in Appendix E.

2.2 CONSTRUCTION

Mine No. 60-Pond 5 were constructed in two stages by Patsy Boccabello and Sons, Inc. of Bentleyville, Pennsylvania. Stage I to Elevation 1150 was placed during the Summer of 1972 and Stage II to Elevation 1175 was placed in 1975.

2.3 OPERATION

The dam is designed to operate without a dam tender. The principal (and emergency) spillway is a 12 foot wide trapezoidal open channel in the right abutment.

The outlet works is an electric motor driven pump which returns partially clarified pond water to the Mine No. 60 Preparation Plant. There is no information available on the operation of the outlet works pump system.

Performance and operation records are not maintained. The impoundment zone is almost filled with fine coal refuse sediments.

2.4 EVALUATION

a. Availability: There was no engineering data available in the files of PennDER, Bureau of Dams and Waterway Management. The owner provided the topographic map listed in Appendix B and reproduced in Appendix E.

b. Adequacy: The limited available engineering information, was supplemented by field inspections and supporting engineering analyses and is considered adequate for the purpose of this Phase I Inspection Report.

c. Validity: Based on the review of the available information, there appears to be no reason to question the validity of the limited available engineering data.

SECTION 3
VISUAL INSPECTION

3.1 FINDINGS

a. General: The field inspection of Mine No. 60-Pond 5 was performed on 18 March 1981 and 26 March 1981 and consisted of:

(1) Visual observations of the embankment crest and slopes, groins and abutments;

(2) Visual observations of the principal (and emergency) spillway including approach channel, overflow crest, and discharge channel;

(3) Visual observations of the embankment's downstream toe area including drainage channels and surficial conditions;

(4) Visual observations of downstream conditions and evaluation of the downstream hazard potential;

(5) Visual observations of the reservoir shoreline and watershed;

(6) Visual observations of the outlet works;

(7) Transit stadia surveys of relative elevations along the embankment crest centerline, spillway, and across the embankment slopes.

The visual observations were made during periods when the reservoir was at normal operating level.

The visual observations checklist, field sketch, field sections, and details containing the observations and comments of the field inspection team are contained in Appendix A. Specific observations are illustrated on photographs in Appendix C. Detailed findings of the field inspection are presented in the following sections.

b. Embankment:

(1) Crest: The crest of the embankment was generally straight and level throughout its length. No offsets or indications of misalignment were observed that would indicate anomalous movement of the embankment. The crest was lightly vegetated, and contained a number of barren areas including wheel ruts, some of which contained standing water.

(2) Upstream Slope: The upstream slope was densely vegetated with grass and brush. There were no indications of erosion or slope instability on the upstream slope.

(3) Downstream Slope: The downstream slope was generally uniform and completely covered with a thick stand of grass and small brush. The slope was generally uniform from toe to crest and from abutment to abutment. No sloughs, scarps or significant bulges were observed on the downstream slope.

The embankment groins (junction of embankment and abutment) were in good condition. They were heavily vegetated and there were no indications of erosion or instability.

c. Abutments: Both abutments were cleared of trees and contained only grass and brush. There were no signs of slope instability, seepage, or significant erosion of either abutment.

d. Seepage: Two seepage zones were observed in the immediate vicinity of the downstream toe of the embankment.

The first zone was approximately half way between the embankment crest and the valley bottom. The seepage emanated from a spring located in soil materials in a small depression in the groin; "blackwater" staining and deposition of very fine coal refuse sediments were observed immediately below the discharge point. Some swamp type vegetation was noted in the immediate vicinity of the spring as well as along the drainage channel that carried the flow over the left abutment to the valley bottom below. The spring flow was visually estimated to be less than 1/2 gallon per minute.

The second seepage zone was in the valley bottom immediately below the toe of the embankment. The seepage flow was less concentrated than above and appeared to emanate from soil materials. Considerable swamp type vegetation was growing in the vicinity and the local soils were generally very soft. No "blackwater" staining was observed.

Total seepage flow below the dam was estimated visually to be 1 to 2 gallons per minute, including the flow from the spring described above.

e. Principal (and Emergency) Spillway:

(1) Approach Channel: The approach channel to the spillway did not contain any significant obstructions that might reduce the capacity of the spillway during high flows.

(2) Overflow Crest: The overflow crest of the spillway contained a silt fence designed to separate the fine coal refuse from discharging flows. The fence would probably be a significant obstruction to low flows but would be washed away by higher flows in the spillway.

(3) Discharge Channel: The discharge channel crosses the right abutment and discharges to the abutment slope above the toe of the embankment. The channel was partially vegetated with grass and brush but did not appear to be eroded or unstable.

f. Outlet Works: The outlet works consists of a 1,000 gallon per minute pump feeding a six inch (nominal) diameter steel pipe. The system is designed to return partially clarified pond water to the Ellsworth Mine No. 60 Preparation Plant for reuse in the coal preparation process.

g. Reservoir:

(1) Slopes: The slopes of the reservoir were observed to be generally mild to moderately steep and were barren to grass and brush covered. There were no indications of significant slope instability or erosion anywhere within the impoundment zone.

(2) Inlet Stream: Because of the location of the reservoir at the upper end of the watershed, there is no defined inlet stream to Pond 5.

(3) Sedimentation: Pond 5 is almost full of fine coal refuse sediments deposited by a pipeline from the Ellsworth Mine No. 60 Coal Preparation Plant.

(4) Watershed: The watershed contributing to Pond 5 is quite small and entirely undeveloped. It is almost completely wooded.

h. Downstream Conditions:

(1) Channel: The downstream channel for Pond 5 flows through an undeveloped valley for a distance of approximately 1.3 miles. In this reach, it passes beneath three township roads and a railyard at Mine No. 60. The channel joins the Center Branch of Pigeon Creek approximately 1.4 miles below the dam.

(2) Floodplain Conditions: In the first five miles below Pond 5 at least five inhabited dwellings lie on the floodplain at elevations low enough to possibly be affected by high flows.

3.2 EVALUATION

The following evaluations are based on the results of the visual inspections performed on 18 March and 26 March 1981.

a. Embankment: The condition of Mine No. 60-Pond 5 embankment was good. No deficiencies were observed anywhere on the upstream or downstream slopes of the embankment. Minor wheel rutting with some standing water was observed on the crest.

b. Principal (and Emergency) Spillway: The spillway was considered to be in poor condition. This is based on the observed silt fence obstruction in the channel and the discharge channel alignment that directs spillway flows into the embankment's right groin.

c. Seepage Zones: The two seepage zones below the embankment appeared to be stable in terms of discharge water quality and quantity. Neither seepage zone appeared to pose an immediate threat to the dam. Although the upper zone (spring fed) showed "blackwater" stains and deposition of very fine coal refuse sediments immediately below the discharge point, the condition did not appear to represent an active deficiency. In the lower zone, no discolored flows, sediment deposits, or recent erosion were observed.

SECTION 4 OPERATIONAL FEATURES

4.1 PROCEDURE

Reservoir pool level is maintained by the overflow crest of the principal (and emergency) spillway.

The outlet works consists of a submerged pump system which draws off the partially clarified pond water and returns it to the Mine No. 60 Preparation Plant.

There are no reported pipes through the embankment. Fine coal refuse slurry is pumped to the facility through a 6 inch pipe that discharges into the pond near the center of the embankment.

Normal operating procedure does not require a dam tender.

4.2 MAINTENANCE OF DAM

The embankment and appurtenances are maintained by the Bethlehem Mines Corporation. Maintenance reportedly consists of periodically repairing eroded areas and making miscellaneous repairs as necessary.

4.3 INSPECTION OF DAM

The Bethlehem Mines Corporation is required by the State of Pennsylvania to inspect the dam annually and make needed repairs.

The Bethlehem Mines Corporation is required by the Mine Safety and Health Administration (MSHA) to inspect the dam at least once every seven days and to make an annual report and certification of the dam.

4.4 WARNING PROCEDURE

There is no warning system and no formal emergency procedure to alert or evacuate downstream residents upon threat of a dam failure.

4.5 EVALUATION

The maintenance program should be continued. However, there are no written operation, maintenance or inspection procedures, nor is there a warning system or formal emergency procedure for this dam. These procedures should be developed in the form of checklists and step by step instructions, and should be implemented as necessary.

SECTION 5
HYDROLOGY/HYDRAULICS

5.1 EVALUATION OF FEATURES

a. Design Data: The Mine No. 60-Pond 5 has a watershed of 32 acres which is vegetated primarily by woodland. The watershed is about 1,400 feet long and 1,200 feet wide and has a maximum elevation of 1,240 feet (MSL).

The impoundment is used to settle out the fines from a coal preparation plant slurry.

At the emergency spillway crest elevation (maximum operating pool) 1172.5, the pond has a surface area of 11 acres and a storage capacity of 187 acre-feet. The emergency spillway consists of a grass lined trapezoidal open channel in the right abutment. The spillway has a 12 foot base width and side slopes of 2.7H:1V and 4.1H:1V.

There was no information available on the design capacity requirements of the spillway and no hydrologic calculations were found relating reservoir/spillway performance to the Probable Maximum Flood (PMF) or fractions thereof.

b. Experience Data: Records are not kept of reservoir level or rainfall amounts. There is no record or report of the embankment ever being overtopped.

c. Visual Observations: On the date of the field inspection, a silt fence was observed in the overflow crest area of the spillway. The fence appeared capable of obstructing low flows but would probably be destroyed by higher flows. Only a subjective evaluation of its effect could be made. Its existence was not considered in the HEC-1 analysis.

The pool elevation at the time of the inspection was about 2.6 feet below the crest of the dam.

d. Overtopping Potential: Overtopping potential was investigated through the development of the Probable Maximum Flood (PMF) for the watershed and the subsequent routing of the PMF and fractions of the PMF through the reservoir and spillway. The Corps of Engineers guidelines recommend the the Probable Maximum Flood (PMF) as the Spillway Design Flood (SDF) for "intermediate" size, "high" hazard dams.

Hydrometeorological Report No. 33 indicates the adjusted 24 hour Probable Maximum Precipitation (PMP) for the subject site is 19.4 inches. No calculations are available to indicate whether the reservoir and spillway are sized to pass a flood corresponding to the runoff from 19.4 inches of rainfall in 24 hours. Consequently, an evaluation of the reservoir/spillway system was performed to determine whether the dam's spillway capacity is adequate under current Corps of Engineers guidelines.

The Corps of Engineers, Baltimore District, has directed that the HEC-1 Dam Safety Version computer program be utilized. The program was prepared by the Hydrologic Engineering Center (HEC), U.S. Army Corps of Engineers, Davis, California, July 1978. The major methodologies and key input data for this program are discussed briefly in Appendix D.

The peak inflow to the Mine No. 60-Pond 5 was determined by HEC-1 to be 204 cfs for a full PMF (and SDF).

e. Spillway Adequacy: The capacity of the combined reservoir and spillway system was determined to be 155 cfs which is in excess of 100% of the PMF calculated by HEC-1. According to Corps of Engineers' guidelines, the combined reservoir/spillway capacity of the Mine No. 60-Pond 5 is "adequate".

SECTION 6
STRUCTURAL STABILITY

6.1 AVAILABLE INFORMATION

a. Design and Construction Data: No design documentation or calculations were available for review. The owner provided the topographic map that is cited in Appendix B and presented in Appendix E.

b. Operating Records: There are no written operating records or procedures for this dam.

c. Visual Observations:

(1) Embankment: The field inspection disclosed no evidence of a high ground water level in the embankment. There was no pronounced "line of seepage"; and no significant buldges, surface sloughs, or cracking were observed. Two seepage zones were observed in the vicinity of the toe of the embankment. The zones contained soft and swampy conditions and a small amount of seepage was flowing from each zone. Field measurements indicated a relatively flat downstream slope varying from 3.0H:1V near the crest, to 2.8H:1V near the toe.

The embankment's upstream slope was densely vegetated with grass and brush. There were no indications of erosion or slope instability.

(2) Principal (and Emergency) Spillway: The spillway was partially vegetated with grass and brush and did not appear to be eroded or unstable.

d. Performance: No information was available on performance of Mine No. 60-Pond 5 since its construction in 1972.

6.2 EVALUATION

a. Design Documents: No design documentation was available to evaluate the structure.

b. Embankment: Based on the results of the visual observations of embankment slopes, materials and seepage conditions, Mine No. 60-Pond 5 appears to have an adequate margin of safety against sliding.

The two seepage zones observed at the toe of the downstream slope do not appear to constitute an immediate threat to the dam.

c. Principal (and Emergency) Spillway: Structurally, the spillway appeared to be functional.

d. Seismic Stability: According to the Seismic Risk Map of the United States, Mine No. 60-Pond 5 is located in Zone 1 where damage due to earthquakes would most likely be minor.

A dam located in Seismic Zone 1 may be assumed to present no hazard from an earthquake provided static stability conditions are satisfactory and conventional safety margins exist. No calculations were developed to verify this assessment, however.

SECTION 7
ASSESSMENT AND RECOMMENDATIONS

7.1 ASSESSMENT

a. Evaluation:

(1) Embankment: Mine No. 60-Pond 5's embankment is considered to be in good condition. This is based on visual observations that revealed only minor deficiencies.

(2) Principal (and Emergency) Spillway: The spillway is considered to be in poor condition. This is based on an obstruction in the overflow crest area and a poor alignment that directs discharge channel flows into the right downstream groin.

The Spillway Design Flood for Mine 60-Pond 5 was the Probable Maximum Flood. The combined reservoir spillway capacity was determined by HEC-1 to be in excess of 100% of the PMF.

(3) Seepage Zones: The seepage zones at the downstream toe of the embankment represent potential deficiencies if changes in water quality and quantity should occur. On the date of the field inspection, however, there were no indications that these zones pose an immediate threat to the dam.

(4) Emergency Plans: The lack of a documented emergency operation and warning plan is considered to be a deficiency.

b. Adequacy of Information: The information available on design, construction, operation and performance history in combination with visual observations and hydrology and hydraulic calculations was sufficient to evaluate the embankment and appurtenant structures in accordance with the Phase I investigation guidelines.

c. Urgency: The recommendations presented in Section 7.2a and 7.2b should be implemented immediately.

d. Necessity for Additional Studies: None.

7.2 RECOMMENDATIONS

a. Emergency Operation and Warning Plan: The owner should develop an Emergency Operation and Warning Plan including:

(1) Guidelines for evaluating inflow during periods of heavy precipitation or runoff.

(2) Procedures for around the clock surveillance during periods of heavy precipitation or runoff.

(3) Procedures for drawdown of the reservoir under emergency conditions.

(4) Procedures for notifying downstream residents and public officials, in case evacuation of downstream areas is necessary.

b. Remedial Work: The visual inspection disclosed three deficiencies which should be corrected or monitored. These include:

(1) Improving the drainage of the embankment crest by removing wheel ruts.

(2) Removing the silt fence from the spillway channel and realigning the discharge channel to direct flows away from the right groin.

(3) Implementation of a regularly scheduled monitoring program to observe the seepage zones for changes in water quality and/or quantity.

c. Abandonment: As an alternative to the recommendations presented above, the owner should develop and implement a plan to make the facility incapable of impounding water. Such an abandonment plan should conform to all applicable local, state and federal regulations; and all regulatory approvals should be obtained prior to the start of abandonment construction operations.

APPENDIX A
VISUAL INSPECTION CHECKLIST

VISUAL OBSERVATIONS CHECKLIST I
(NON-MASONRY IMPOUNDING STRUCTURE)

Name of Dam Mine No. 60-Pond 5 County Washington State Pennsylvania National ID # PA 01144
Type of Dam Earth Hazard Category High

Dates of Inspection 18 March 1981 Weather Partly cloudy, cool Temperature 35°F
26 March 1981 Partly cloudy, mild 50°F

Pool Elevation at Time of Inspection 1172.5 (MSL)
Tailwater at Time of Inspection None

Inspection Personnel: 18 March 1981 Ackenheil & Associates, Geotechnical Engineer
J. P. Hannan Ackenheil & Associates, Civil Engineer
S. G. Mazzella
26 March 1981 Ackenheil & Associates, Project Manager
J. E. Barrick, P.E. and Hydrologist

Recorder J. E. Barrick

GEO Project G80138-F
PENNDER I.D. No. 65-88

EMBANKMENT

<u>VISUAL EXAMINATION OF</u>	<u>OBSERVATIONS</u>	<u>REMARKS OR RECOMMENDATIONS</u>
SURFACE CRACKS	None observed.	
UNUSUAL MOVEMENT OR CRACKING AT OR BEYOND THE TOE	None observed.	
SLOUGHING OR EROSION OF EMBANKMENT AND ABUTMENT SLOPES	None observed.	
VERTICAL AND HORIZONTAL ALIGNMENT OF THE CREST	The embankment crest was straight and approximately level throughout its length. The crest pitched slightly toward the impoundment near the left end of the embankment.	
RIPRAP FAILURES	None observed.	
SETTLEMENT	None observed.	

EMBANKMENT (CONTINUED)

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
JUNCTION OF EMBANKMENT AND ABUTMENT	Both embankment groins appeared to be in good condition. No erosion, seepage, or unstable conditions were noted along either the right groin. A seepage zone was located in the left groin as discussed under "Any Noticeable Seepage" below.	
JUNCTION OF EMBANKMENT AND SPILLWAY	No junction exists. Spillway is excavated entirely into natural ground of the right abutment.	
ANY NOTICEABLE SEEPAGE	Two zones of seepage were observed just beyond the downstream toe of the embankment. The first zone was located approximately halfway between the valley bottom and the embankment crest in a small depression at the embankment groin. Some water-related vegetation was growing in the vicinity. Flow from a spring in the area was visually estimated to be less than 1/2 gallon per minute. "Blackwater" staining and deposition of very fine coal refuse sediments were observed immediately below the spring.	The second seepage zone was located in the valley bottom just beyond the toe of the dam. Considerable cattails and water-related vegetation were growing in the vicinity, and soils were observed to be very soft. Flow from this area was more diffuse than above and was estimated to be 1 to 2 gallons per minute, including the flow from the spring discussed above. No flow discoloration or sedimentation indicative of movement of fine soil particles was observed in the vicinity of the lower seepage zone.

EMBANKMENT (CONTINUED)

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
STAFF GAUGE AND RECORDER	None observed.	
DRAINS	None observed.	
SURFICIAL CONDITIONS	<p>The embankment crest was partially vegetated by grass and small brush. Barren spots were observed and several areas contained wheel ruts, some with ponded water.</p> <p>The upstream slope of the embankment was densely vegetated with grass and brush. There were no signs of erosion or instability of the upstream slope.</p> <p>The downstream slope was generally uniform from toe to crest and abutment to abutment. Some local unevenness was noted, including a disturbed area near the center of the embankment, at the crest, that appeared to be the result of heavy equipment moving on the embankment slope. In general, the downstream slope was densely vegetated by grass and brush. There were no signs of erosion or slope instability anywhere on the downstream slope.</p>	

PRINCIPAL (AND EMERGENCY) SPILLWAY

<u>VISUAL EXAMINATION OF</u>	<u>OBSERVATIONS</u>	<u>REMARKS OR RECOMMENDATIONS</u>
APPROACH CHANNEL	The approach channel was clear of obstructions that might hinder performance of the spillway during high flows.	
OVERFLOW SECTION	The overflow section contained a silt fence constructed of reinforcing rod fence posts that supported a fabric filter material designed to filter fine coal refuse from water discharging through the spillway. The silt fence did not appear substantial enough to withstand high flows in the spillway. However, lower flows could be significantly retarded by the fence.	
DISCHARGE CHANNEL	The discharge channel is an open ditch that crosses the right abutment and discharges directly to the hillside above the toe of the dam. The channel was partially vegetated on the date of inspection, but there were no signs of significant erosion or channel side slope instability.	

OUTLET WORKS

<u>VISUAL EXAMINATION OF</u>	<u>OBSERVATIONS</u>	<u>REMARKS OR RECOMMENDATIONS</u>
PUMP	Water is removed from Pond 5 by a pump located at the rear of the reservoir. The pump is a 75 horsepower, 1000-gallon-per-minute unit which supplies a 6" diameter (nominal) steel pipeline. The water is returned to the Ellsworth Mine No. 60 preparation plant for reuse in the coal preparation process.	

INSTRUMENTATION

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
MONUMENTATION/SURVEYS	None observed.	
WEIRS	None observed.	
PIEZOMETERS	None observed.	
OBSERVATION WELLS	None observed.	

RESERVOIR


VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
SLOPES	The reservoir slopes were mild to moderately steep, and were either barren, grass-, or brush-covered. There were no signs of significant slope instability anywhere within the limits of the impoundment.	
SEDIMENTATION	Pond 5 is almost full of fine coal refuse sediments.	
INLET STREAM	Pond 5 is located very high in the watershed and has no defined inlet stream.	
WATERSHED	On the day of inspection, the watershed for Pond 5 was completely undeveloped and entirely wooded. The watershed is extremely small, extending only to the ridge line immediately behind the pond.	

DOWNSTREAM CONDITIONS

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
CHANNEL (OBSTRUCTIONS, DEBRIS, ETC.)	<p>The downstream channel passes through an uninhabited valley for approximately 1.4 miles where it joins the Center Branch of Pigeon Creek. In this reach, the creek passes beneath three township roads and a Conrail railyard below the Mine No. 60 complex.</p> <p>Approximately three miles below the dam, Center Branch joins Pigeon Creek. At 3.5 miles, Pigeon Creek enters a reservoir above the Ellsworth Mine No. 51 complex on the outskirts of Ellsworth, Pennsylvania.</p>	
APPROXIMATE NUMBER OF HOMES AND POPULATION	In the first five miles below Pond 5, there are at least five inhabited dwellings that lie at elevations low enough to possibly be affected by high flows in Pigeon Creek.	

TOTAL ESTIMATED
SEEPAGE 1102 G.P.M.

STRAW BALES
SPILLWAY DISCHARGES TO
ABUTMENT SLOPE ABOVE
TOE OF DAM

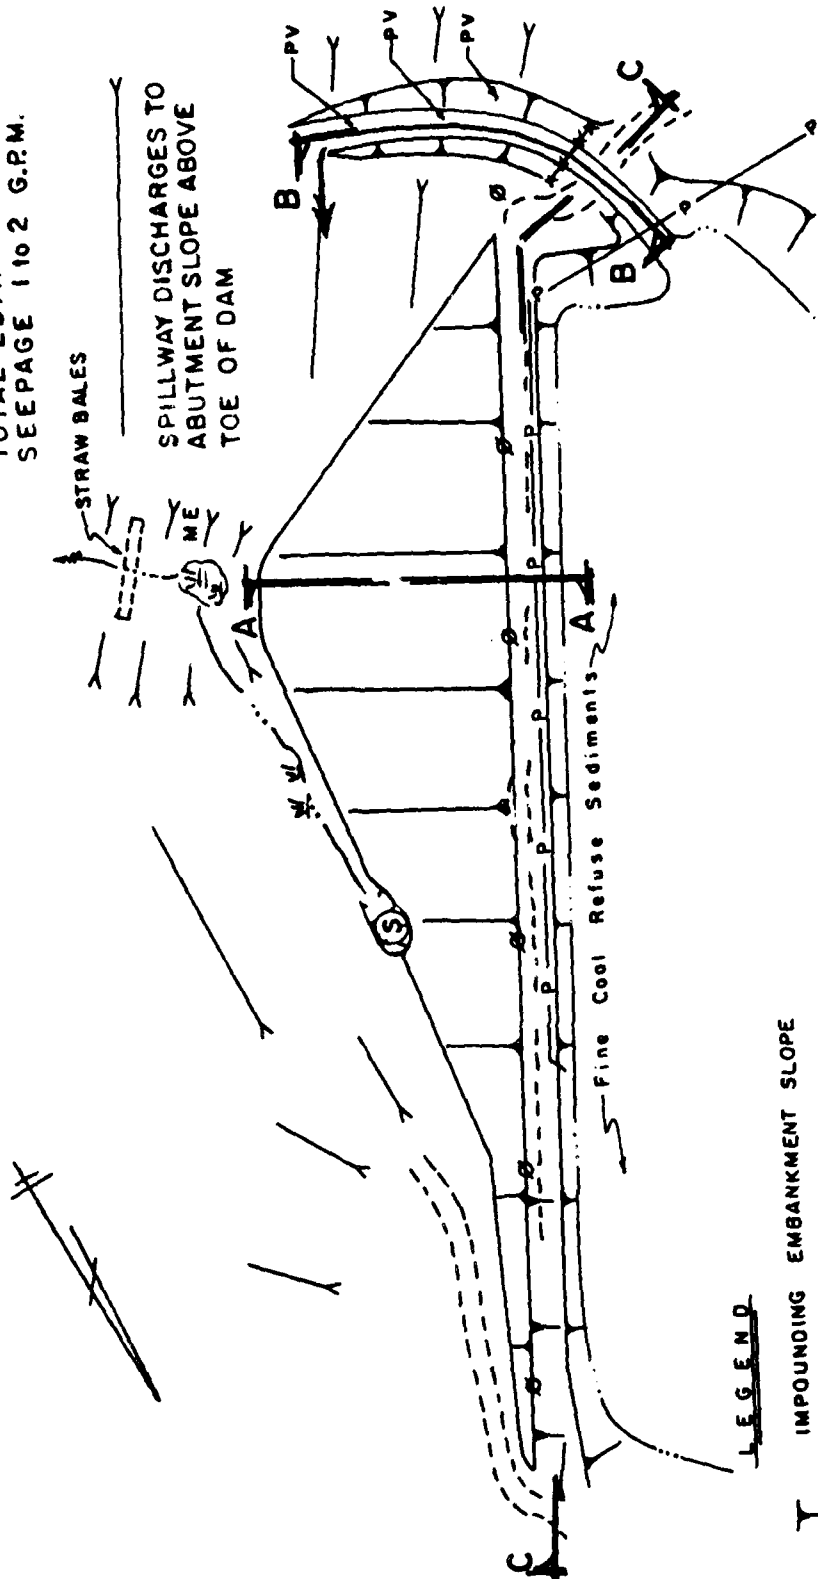

- NOTES**
1. SEE DRAWING 80138F-2 FOR FIELD SECTIONS A-A AND B-B
 2. SEE DRAWING 80138F-3 FOR FIELD SECTION C-C AND SPILLWAY DETAIL

LEGEND


- IMPOUNDING EMBANKMENT SLOPE
- OTHER SLOPES
- STREAM OR SHORELINE
- MINOR EROSION
- PARTIALLY VEGETATED
- UTILITY POLE
- WHEEL RUTS
- DEPRESSION
- SWAMP OR MARSH
- PIPELINE
- FENCE
- SPRING

DATE: MAY 1981
SCALE: NONE
DR: JF CK: JEB
DWG. NO. 80138F-1


MINE No. 60 - POND 5
NATIONAL DAM INSPECTION PROGRAM

ACKENHEIL & ASSOCIATES CONSULTING ENGINEERS
ORO SYSTEMS, INC.
1000 BANKSVILLE RD./PITTSBURGH, PA 15216

FIELD
SKETCH



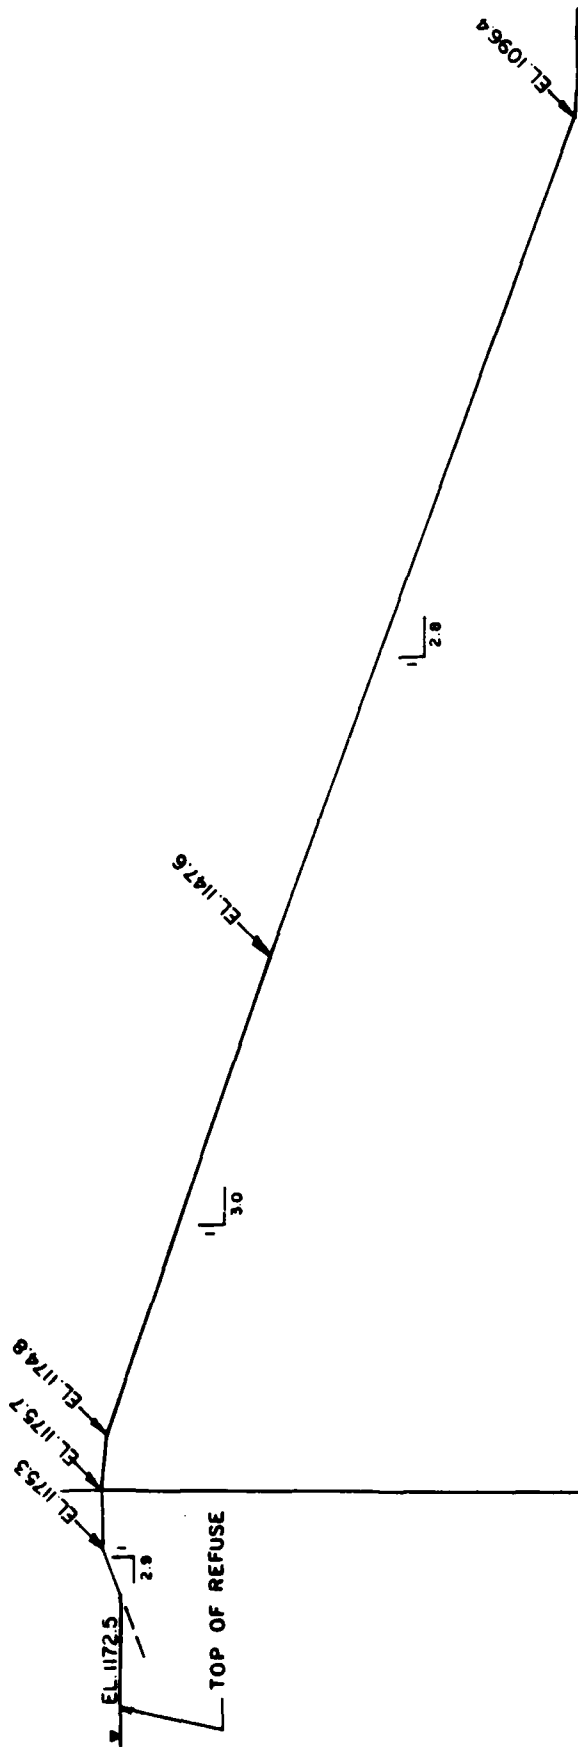


SECTION A-A
SCALE 1" = 30'

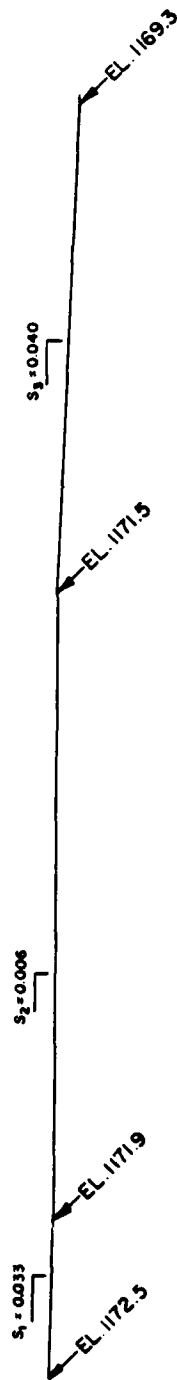

SECTION B-B
SCALE 1" = 20'

DATE: MAY 1981		MINE No. 60 - POND 5		FIELD SECTIONS A - A and B - B
SCALE: AS SHOWN		NATIONAL DAM INSPECTION PROGRAM		
DR: JF	CK: JEB	ACKENHEIL & ASSOCIATES CONSULTING ENGINEERS		
DWG. NO. 80138F- 2		GEO SYSTEMS, INC. 1000 BANKSVILLE RD./PITTSBURGH PA 15216		

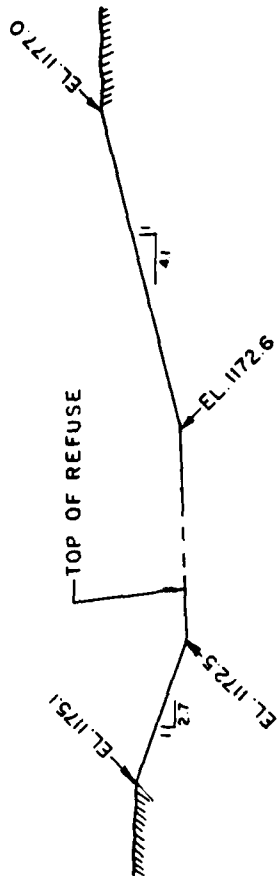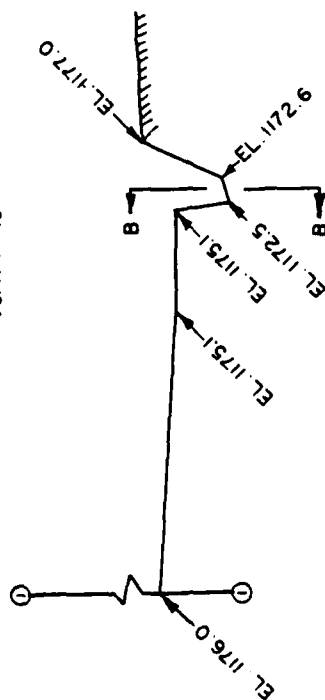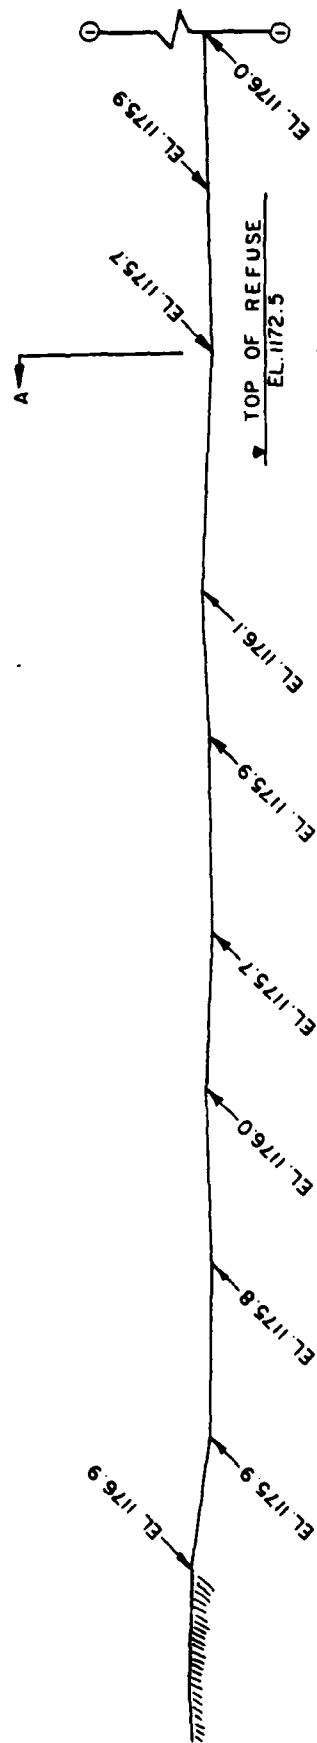

SPILLWAY DETAIL
SCALE 1"=10'

DATE: MAY 1981	MINE No. 60 - POND 5		FIELD SECTION C-C AND
SCALE: AS SHOWN	NATIONAL DAM INSPECTION PROGRAM		
DR: JF	CK: JEB	ACKENHEIL & ASSOCIATES	SPILLWAY DETAIL
DWG. NO. 80138F- 3		GEO SYSTEMS, INC. 1000 BANKSVILLE RD./PITTSBURGH, PA. 15216	

APPENDIX B
ENGINEERING DATA CHECKLIST

CHECK LIST
ENGINEERING DATA
DESIGN, CONSTRUCTION, OPERATION
PHASE I

NAME OF DAM Mine No. 60-Pond 5
NDI No. PA 01144

ITEM	REMARKS
Design Drawings	None available.
As-Built Drawings	None available.
Regional Vicinity Map	U.S.G.S. 7-1/2 minute Hacket, Pennsylvania Quadrangle Map.
*Construction History	Constructed in stages by Patsy Boccabella and Sons, Inc., Bentleyville, Pennsylvania between 1972 and 1975. Stage I to Elevation 1150 completed in 1972. Stage II to Elevation 1975 completed in 1975.
Typical Sections of Dam	None available.
Outlets-Plan Details Constraints Discharge Ratings	None available.
Rainfall/Reservoir Records	None available.

ITEM	REMARKS
Design Reports	None available.
Geology Reports	None available.
Design Computations	None available.
Hydrology and Hydraulics	None available.
Dam Stability	None available.
Seepage Studies	None available.
Materials Investigations, Boring Records, Laboratory, Field	None available.
*Post-Construction Surveys of Dam	See topographic map of Mine 60, Lake Calydon, November 1978. **
Borrow Sources	Data not available.
Monitoring Systems	None available.
Modifications	None reported.

ITEM	REMARKS
High Pool Records	None reported.
Post-Construction Engineering Studies and Reports	None available.
Maintenance/Operation Records	None available.
Spillway - Plan Sections Details	None available.
Operating Equipment Plans and Details	None available.
Specifications	None available.
Miscellaneous	No additional information available.
Prior Accidents or Failure of Dam, Description Reports	None.

*Drawings obtained from Bethlehem Mines Corporation, Ellsworth-Butler Division.

**Reduced size reproductions contained in Appendix E.

APPENDIX C
PHOTOGRAPHS



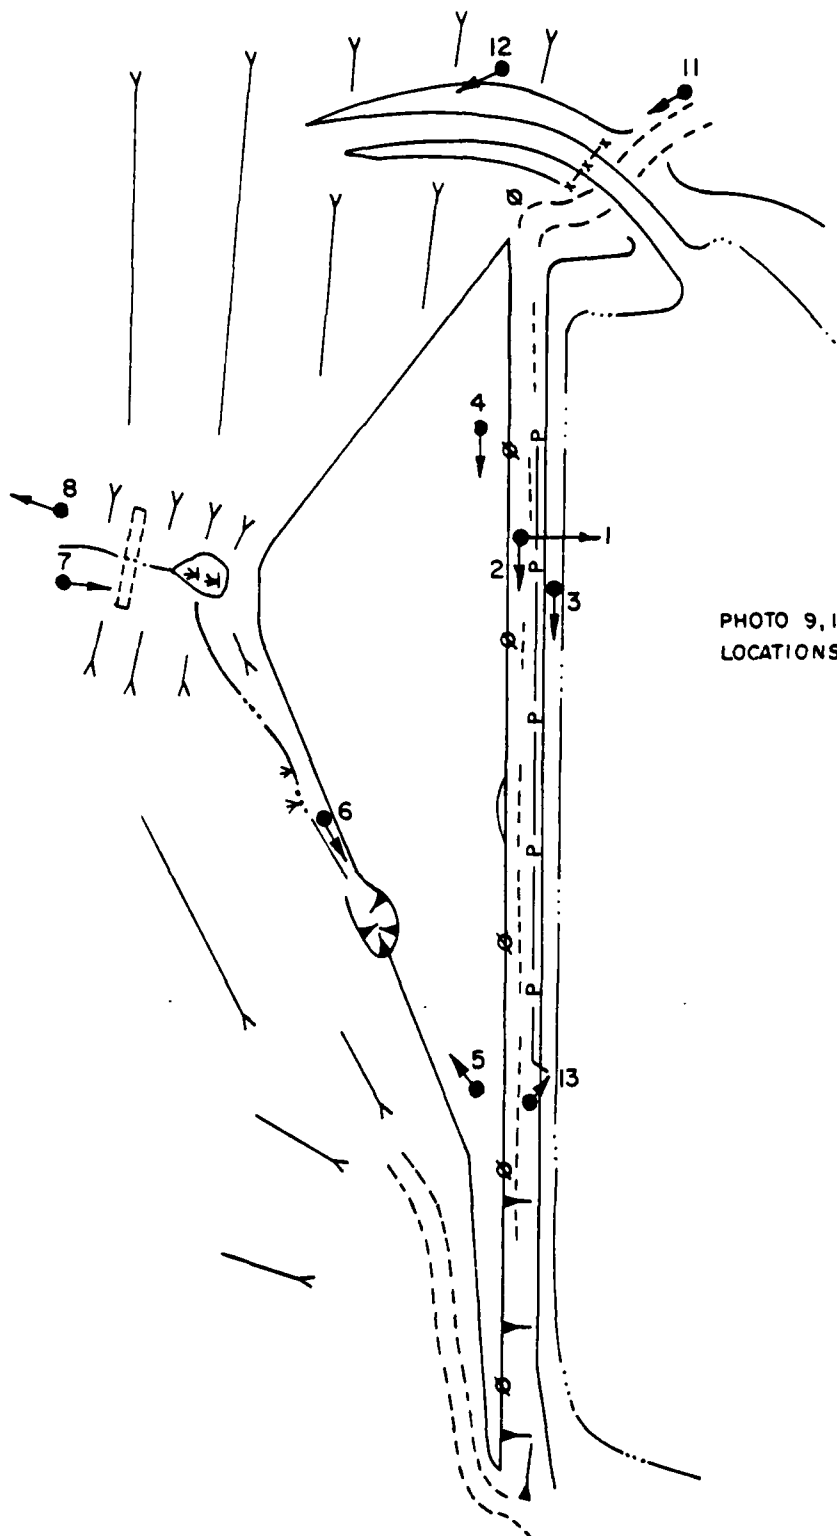


PHOTO 9, 10, 14, 15 & 16
LOCATIONS ARE NOT SHOWN

DATE: MAY 1981		MINE No. 60 - POND 5 NATIONAL DAM INSPECTION PROGRAM	PHOTO KEY MAP
SCALE: NONE			
DR: JF	CK: JEB	ACKENHEIL & ASSOCIATES CONSULTING GEO SYSTEMS, INC. ENGINEERS 1000 BANKSVILLE RD/PITTSBURGH PA 15216	
DWG. NO. 80138F			




MINE NO 60 - POND 5

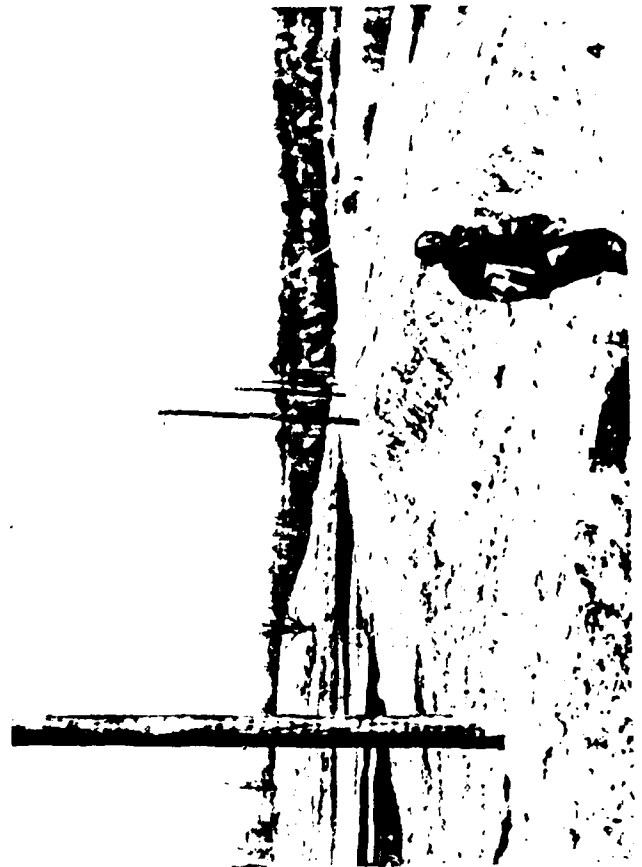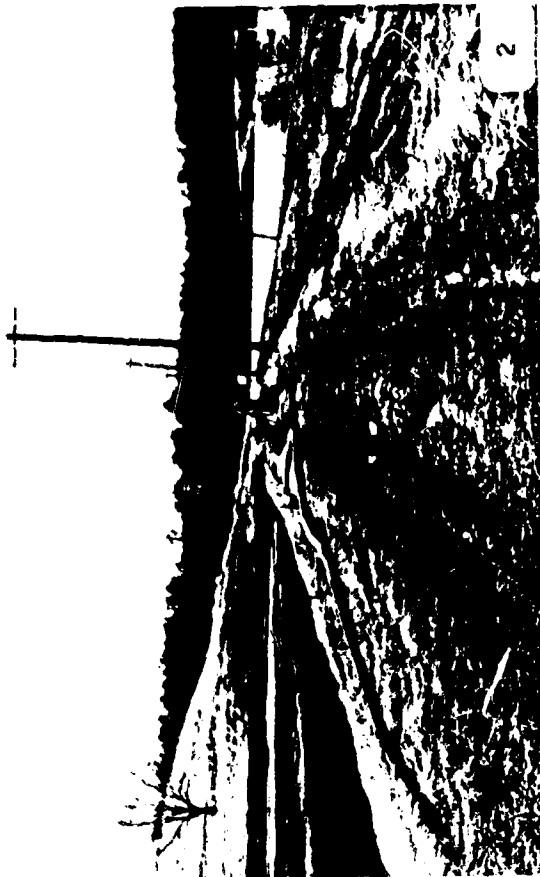

MINE NO 60 - POND 5



MINE NO 60 -- POND 5

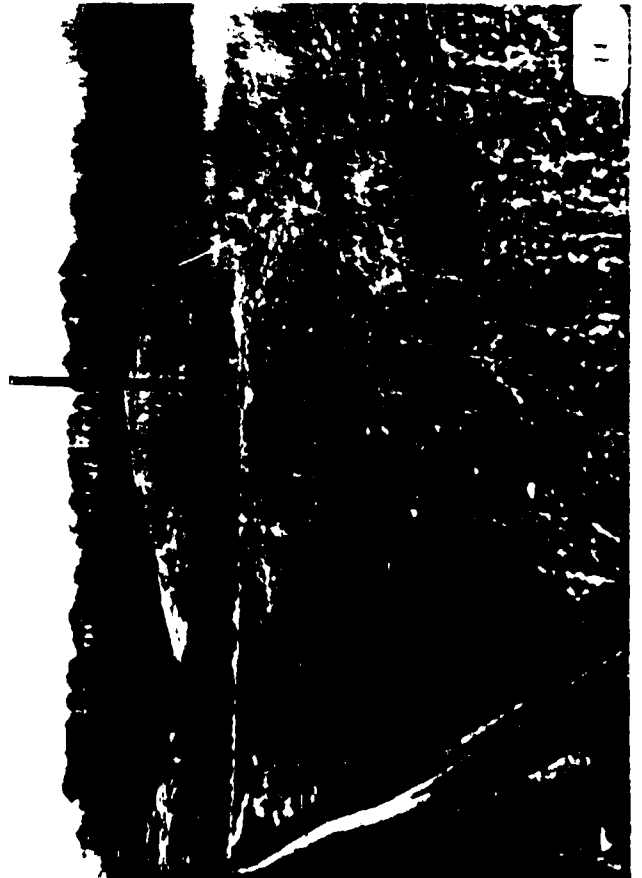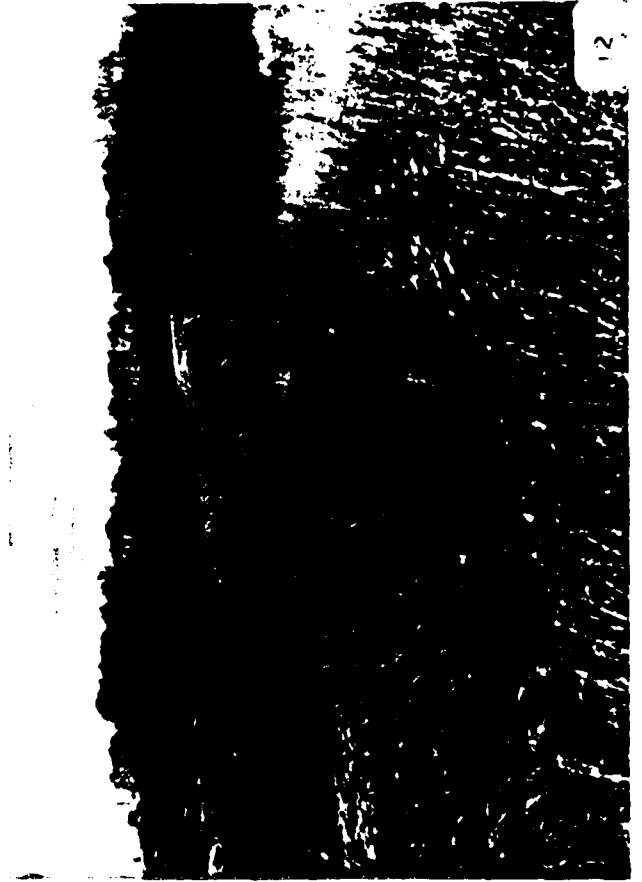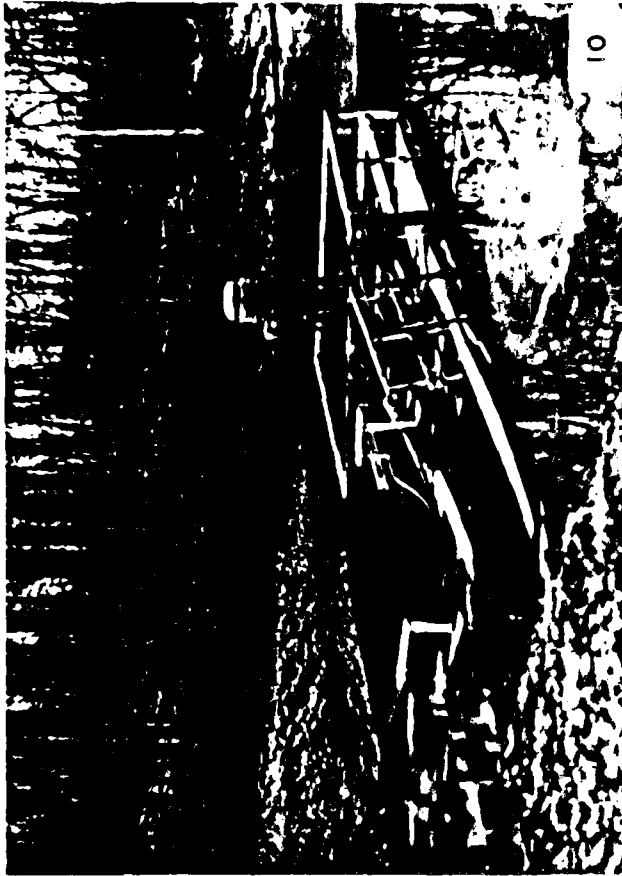

MINE NO 60 - POND 5



PHOTO DESCRIPTIONS

- Photo 1 Pond Overview taken from embankment crest.
- Photo 2 Embankment Crest showing slurry inflow pipe.
- Photo 3 Upstream Slope.
- Photo 4 Downstream Slope.
- Photo 5 Downstream Slope and Toe Area. Upper seepage zone is located in the groin area, to the right of the tree in the left center portion of the photo.
- Photo 6 Close Up of Seepage Zone in the Left Groin. Note fine coal refuse ("blackwater") staining.
- Photo 7 Toe of Embankment and Straw Bales.
- Photo 8 Swampy Area Downstream of Toe.
- Photo 9 Upstream End of Pond.
- Photo 10 Outlet Works Pump.
- Photo 11 Principal (and Emergency) Spillway Entrance and silt fence.
- Photo 12 Spillway Discharge Channel.
- Photo 13 Slurry Pipeline Discharge Point.
- Photo 14 Downstream Hazard.
- Photo 15 Downstream Hazard.
- Photo 16 Downstream Hazards.

APPENDIX D
HYDROLOGY AND HYDRAULICS
ANALYSES

APPENDIX D
HYDROLOGY AND HYDRAULICS
ANALYSES

Methodology: The dam overtopping analysis was accomplished using the systemized computer program HEC-1 (Dam Safety Version), July 1978, prepared by the Hydrologic Engineering Center, U.S. Army Corps of Engineers, Davis, California. A brief description of the methodology used in the analysis is presented below.

1. Precipitation: The Probable Maximum Precipitation (PMP) is derived and determined from regional charts prepared from past rainfall records including "Hydrometeorological Report No. 33" prepared by the U.S. Weather Bureau.

The index rainfall is reduced from 10% to 20% depending on watershed size by utilization of what is termed the HOP Brook adjustment factor. Distribution of the total rainfall is made by the computer program using distribution methods developed by the Corps.

2. Inflow Hydrograph: The hydrologic analysis used in development of the overtopping potential is based on applying a hypothetical storm to a unit hydrograph to obtain the inflow hydrograph for reservoir routing.

The unit hydrograph is developed using the Snyder method. This method requires calculation of several key parameters. The following list gives these parameters, their definition and how they were obtained for these analyses.

<u>Parameter</u>	<u>Definition</u>	<u>Where Obtained</u>
Ct	Coefficient representing variations of watershed	From Corps of Engineers*
L	Length of main stream channel	From U.S.G.S. 7.5 minute topographic map
Lca	Length on main stream to centroid of watershed	From U.S.G.S. 7.5 minute topographic map
Cp	Peaking coefficient	From Corps of Engineers*
A	Watershed size	From U.S.G.S. 7.5 minute topographic map

3. Routing: Reservoir routing is accomplished by using Modified Puls routing techniques where the flood hydrograph is routed through reservoir storage. Hydraulic capacities of the spillway and the crest of the dam are used as outlet controls in the routing.

The hydraulic capacity of an outlet works can either be calculated and input or sufficient dimensions input and the program will calculate an elevation-discharge relationship.

Storage in the pool area is defined by an area-elevation relationship from which the computer calculates storage. Surface areas are either planimetered from available mapping or U.S.G.S. 7.5 minute series topographic maps or taken from reasonably accurate design data.

4. Dam Overtopping: Using given percentages of the PMF the computer program will calculate the percentage of the PMF which can be controlled by the reservoir and spillway without the dam overtopping.

*Developed by the Corps of Engineers on a regional basis for Pennsylvania.

HYDROLOGIC AND HYDRAULIC
ENGINEERING DATA

DRAINAGE AREA CHARACTERISTICS: Predominately woodland and
water surface.

ELEVATION-TOP NORMAL POOL (STORAGE
CAPACITY): 1172.5 (187 acre-feet)

ELEVATION-TOP FLOOD CONTROL POOL (STORAGE
CAPACITY): 1175.1 (217 acre-feet)

ELEVATION-MAXIMUM DESIGN POOL: Unknown

ELEVATION-TOP DAM: 1175.1 (minimum)

OVERFLOW SECTION (Principal and Emergency Spillway)

- a. Elevation 1172.5 (minimum)
- b. Type Broad crested weir in trapezoidal open channel
- c. Width 90 feet
- d. Length 12 feet
- e. Location Spillover Right Abutment
- f. Number and Type of Gates None

OUTLET WORKS AND DRAWDOWN FACILITY

- a. Type Submerged pump
- b. Location Near upstream end of pond
- c. Entrance Invert Unknown
- d. Exit Inverts Unknown

HYDROMETEOROLOGICAL GAGES

- a. Type None
- b. Location N/A
- c. Records None

MAXIMUM REPORTED NON-DAMAGING
DISCHARGE None reported

HEC-1 DAM SAFETY VERSION
HYDROLOGY AND HYDRAULIC ANALYSIS
DATA BASE

NAME OF DAM: Mine No. 60-Pond 5 NDI NO. PA 01144

Probable Maximum Precipitation (PMP) 24.2*

Drainage Area 0.05 sq. mi.

Reduction of PMP Rainfall for Data Fit 0.8 (24.2)
Reduce by 20%, therefore PMP rainfall =19.4 inches

Adjustments of PMF for Drainage Area (Zone 7)

6 hrs.	102%
12 hrs.	120%
24 hrs.	130%
48 hrs.	140%

Snyder Unit Hydrograph Parameters

Zone	29**
C _p	0.5
C _t	1.6
L	0.27 mile
L _{ca}	0.13 mile
$t_p = C_t (L \cdot L_{ca})^{0.3} =$	0.59 hours

Loss Rates

Initial Loss	1.0 inch
Constant Loss Rate	0.05 inch/hour

Base Flow Generation Parameters

Flow at Start of Storm	1.5 cfs/sq.mi=0.08 cfs
Base Flow Cutoff	0.05 x Q peak
Recession Ratio	2.0

Overflow Section Data (Assume Rectangular Cross-Section)

Crest Length	12 feet
Crest Elevation	1172.5
Freeboard	2.6 feet
Discharge Coefficient	3.09
Exponent	1.5
Discharge Capacity	155 cfs

* Hydrometeorological Report 33

**Hydrological zone defined by Corps of Engineers, Baltimore District, for determining Snyder's Coefficients (C_p and C_t).

ACKENHEIL & ASSOCIATES
GEO Systems, Inc.
1000 Banksville Road
PITTSBURGH, PA. 15216
(412) 531-7111

Job MINE 60 - ROUNDS Job No SO138F
Subject HEC-1 INPUT DATA
Made By JEB Date 4/17/01 Checked SGM Date 17 Apr. 05

LOSS RATE AND BASE FLOW PARAMETERS


AS RECOMMENDED BY THE CORPS OF ENGINEERS,
BALTIMORE DISTRICT:

STZTL = 1 INCH
CUSTL = 0.5 INCH/HOUR
STZTG = 1.5 CFS/SQ. MI.
QRCSN = 0.05 (5% OF PEAK FLOW)
RTNOR = 2.0

ELEVATION - DRED-CAPACITY RELATIONSHIP

- AVAILABLE DATA:
- USGS 7 1/2 MIN HACKETT QUAD
PHOTO REVISED 1979
 - PHASE I INVESTIGATION FIELD
MEASUREMENTS
 - PLATE II AT 1" = 50 FT

ESTIMATED SECTION:

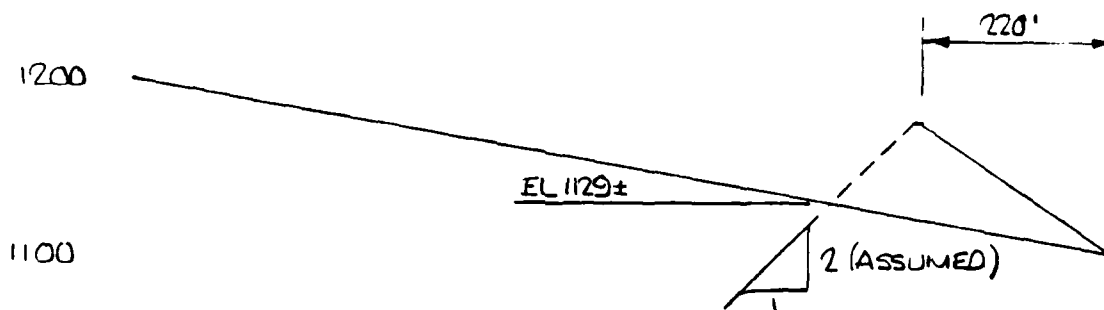

ESTIMATED SURFACE DRED: ASSUME POOL EL = 1165
IN 1979, THEN

$$A_{1165} \approx 9.2 \text{ ACRES}$$

ACKENHEIL & ASSOCIATES
GEO Systems, Inc.
1000 Banksville Road
PITTSBURGH, PA. 15216
(412) 531-7111

Job MIDGE-POUND S Job No. ED138 F
Subject HEC 1 INPUT DATA AND PROJECT COST
Made By EB Date 4/17/81 Checked SGM Date 17 APR. 81

ESTIMATED INITIAL STORAGE: USE CIVIL MODEL

$$V_{1165} = \frac{A_b h}{3} \\ = \frac{9.2(36)}{3} = 110 \text{ ACRE- FEET}$$

DRED-ELEVATION RELATIONSHIP:

DRED	\$A	0.0	9.2	20.2
ELEVATION	\$E	1129	1165	1200

PROJECT DATA:

RESERVOIR SURFACE - CURRENT TOP OF DAM = 1175.1

$$A_{1165} = 9.2 \text{ ACR.} \quad \bar{r}_{65} = 0.5345$$

$$\bar{r}_{75.1} = 0.6088 \Rightarrow A_{75.1} \approx 11.9 \text{ ACR.}$$

$$A_{1200} = 20.2 \text{ ACR.} \quad \bar{r}_{00} = 0.7920$$

- SPILLWAY CREST = 1172.5

$$\bar{r}_{72.5} = 0.5897 \Rightarrow A_{72.5} = 11.2 \text{ ACR.}$$

RESERVOIR STORAGE - CURRENT TOP OF DAM = 1175.1

$$V_{1165} = 110 \text{ ACRE- FEET}$$

$$V_{1175.1} = 110 + 10.1 \left(\frac{1}{3} \right) (11.9 + \sqrt{9.2(11.9)} + 9.2) \\ = 216 \text{ ACRE- FEET}$$

- SPILLWAY CREST = 1172.5

$$V_{1172.5} = 110 + 7.5 \left(\frac{1}{3} \right) (30.55) = 186 \text{ ACRE- FEET}$$

DC6

ACKENHEIL & ASSOCIATES
GEO Systems, Inc.
1000 Banksville Road
PITTSBURGH, PA 15216
(412) 531-7111

Job MINE 60, POND 5 Job No 80138F
Subject DATA Input
Made By JPH Date 9/31/81 Checked SGM Date 3/31/81


DAM OVERTOP PARAMETERS

Top of Dam Elevation (Minimum)	1175.1
Length of Dam (excluding spillway)	1100 feet
Coefficient of Discharge	3.09

SPILLWAY PARAMETERS

Crest Elevation	1172.5
Crest Length	12 feet
Coefficient of Discharge	3.09

PROGRAM SCHEDULE

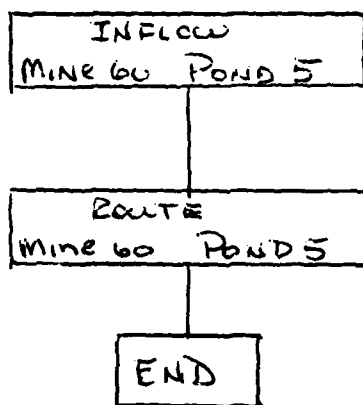

 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 26 FEB 79

1	A1	NATIONAL PROGRAM FOR THE INSPECTION OF NON FEDERAL DAMS									
2	A2	HYDROLOGIC AND HYDRAULIC ANALYSIS OF SLURRY IMPOUNDMENT #5									
3	A3	PROBABLE MAXIMUM FLOOD PMF/UNIT HYDROGRAPH BY SNYDER'S METHOD									
4	B	300	0	10	0	0	0	0	0	-4	0
5	B1	5									
6	J	1	2	1							
7	J1	1.	.5								
8	K	0	1								
9	K1	INFLOW HYDROGRAPH FOR SLURRY IMPOUNDMENT #5, MINE 60									
10	M	1	1	0.05	0.05						1
11	P		24.2	102	120	130	140				
12	T							1.0	.05		
13	W	0.59	0.5								
14	X	-1.5	-0.05	2.0							
15	K	1	2								1
16	K1	ROUTING AT SLURRY IMPOUNDMENT #5, MINE 60									
17	Y			1	1						
18	Y1	1									-1172.5
19	\$A	0.	9.2	20.2							
20	\$E1129.0	1165.0	1200.0								
21	\$S1172.5	12.0	3.09	1.5							
22	\$D1175.1	3.09	1.5	1100.							
23	K	99									
24	A										
25	A										
26	A										
27	A										
28	A										

PREVIEW OF SEQUENCE OF STREAM NETWORK CALCULATIONS

RUNOFF HYDROGRAPH AT	1
ROUTE HYDROGRAPH TO	2
END OF NETWORK	

 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 26 FEB 79

RUN DATE: 1 MAY 81
 RUN TIME: 8.14.23

NATIONAL PROGRAM FOR THE INSPECTION OF NON FEDERAL DAMS
 HYDROLOGIC AND HYDRAULIC ANALYSIS OF SLURRY IMPOUNDMENT #5
 PROBABLE MAXIMUM FLOOD PMF/UNIT HYDROGRAPH BY SNYDER'S METHOD

JOB SPECIFICATION										
NQ	NHR	NMIN	IDAY	IHR	IMIN	METRC	IPLT	IPRT	NSTAN	
300	0	10	0	0	0	0	0	-4	0	
			JOPER	NWT	LROPT	TRACE				
			5	0	0	0				

MULTI-PLAN ANALYSES TO BE PERFORMED
 NPLAN= 1 NRTIO= 2 LRTIO= 1

RTIOS= 1.00 0.50

SUB-AREA RUNOFF COMPUTATION

INFLOW HYDROGRAPH FOR SLURRY IMPOUNDMENT #5, MINE 60

ISTAQ	ICOMP	IECON	ITAPE	JPLT	JPRT	INAME	ISTAGE	IAUTO
1	0	0	0	0	0	1	0	0

HYDROGRAPH DATA									
IHYDG	IUHG	TAREA	SNAP	TRSDA	TRSPC	RATIO	ISNOW	ISAME	LOCAL
1	1	0.05	0.0	0.05	0.0	0.0	0	1	0

PRECIP DATA								
SPFE	PMS	R6	R12	R24	R48	R72	R96	
0.0	24.20	102.00	120.00	130.00	140.00	0.0	0.0	

TRSPC COMPUTED BY THE PROGRAM IS 0.800

LOSS DATA										
LROPT	STRKR	DLTKR	RTIOL	ERAIN	STRKS	RTIOK	STRTL	CNSTL	ALSMX	RTIMP
0	0.0	0.0	1.00	0.0	0.0	1.00	1.00	0.05	0.0	0.0

UNIT HYDROGRAPH DATA
TP= 0.59 CP=0.50 NTA= 0

RECESSION DATA
STRTQ= -1.50 QRCSN= -0.05 RTIOR= 2.00

UNIT HYDROGRAPH 28 END-OF-PERIOD ORDINATES, LAG= 0.59 HOURS, CP= 0.50 VOL= 1.00									
4.	13.	23.	26.	24.	19.	16.	13.	10.	9.
7.	6.	5.	4.	3.	3.	2.	2.	1.	1.
1.	1.	1.	0.	0.	0.	0.	0.		

END-OF-PERIOD FLOW													
MO.DA	HR.MN	PERIOD	RAIN	EXCS	LOSS	COMP Q	MO.DA	HR.MN	PERIOD	RAIN	EXCS	LOSS	COMP Q

SUM 27.10 24.68 2.42 4777.
(688.)(627.)(61.)(135.27)

HYDROGRAPH ROUTING

ROUTING AT SLURRY IMPOUNDMENT #5, MINE 60

ISTAQ	ICOMP	IECON	ITAPE	JPLT	JPRT	INAME	ISTAGE	IAUTO
2	1	0	0	0	0	1	0	0

ROUTING DATA							
QLOSS	CLOSS	AVG	IRES	ISAME	IOPT	IPMP	LSTR
0.0	0.0	0.0	1	1	0	0	0

NSTPS	NSTD	LAG	AMSKK	X	TSK	STORA	LSPRAT
1	0	0	0.0	0.0	0.0	-1173.	0

SURFACE AREA=	0.	9.	20.
CAPACITY=	0.	110.	612.
ELEVATION=	1129.	1165.	1200.

CREL	SPWID	COQW	EXPW	ELEV	COQL	CAREA	EXPL
1172.5	12.0	3.1	1.5	0.0	0.0	0.0	0.0

DAM DATA			
TOPEL	COQD	EXPD	DAMWID
1175.1	3.1	1.5	1100.

PEAK OUTFLOW IS 113. AT TIME 41.50 HOURS

PEAK OUTFLOW IS 51. AT TIME 41.67 HOURS

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIOS APPLIED TO FLOWS	
				RATIO 1 1.00	RATIO 2 0.50
HYDROGRAPH AT	1	0.05	1	204.	102.
	(0.13)	(5.77)(2.89)(
ROUTED TO	2	0.05	1	113.	51.
	(0.13)	(3.21)(1.44)(

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1		INITIAL VALUE		SPILLWAY CREST		TOP OF DAM	
	ELEVATION		1172.50		1172.50		1175.10
	STORAGE		187.		187.		217.
	OUTFLOW		0.		0.		155.
RATIO OF PMF	MAXIMUM RESERVOIR W.S.ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
1.00	1174.60	0.0	211.	113.	0.0	41.50	0.0
0.50	1173.73	0.0	201.	51.	0.0	41.67	0.0


ACKENHEIL & ASSOCIATES

GEO Systems, Inc.
1000 Banksville Road
PITTSBURGH, PA. 15216
(412) 531-7111

Job MINE No. 60 - POND 5 Job No. 80138-F

Subject HYDROLOGIC PERFORMANCE PLOT

Made By SGM Date 20 APR. 81 Checked TJ Date 4/20/81

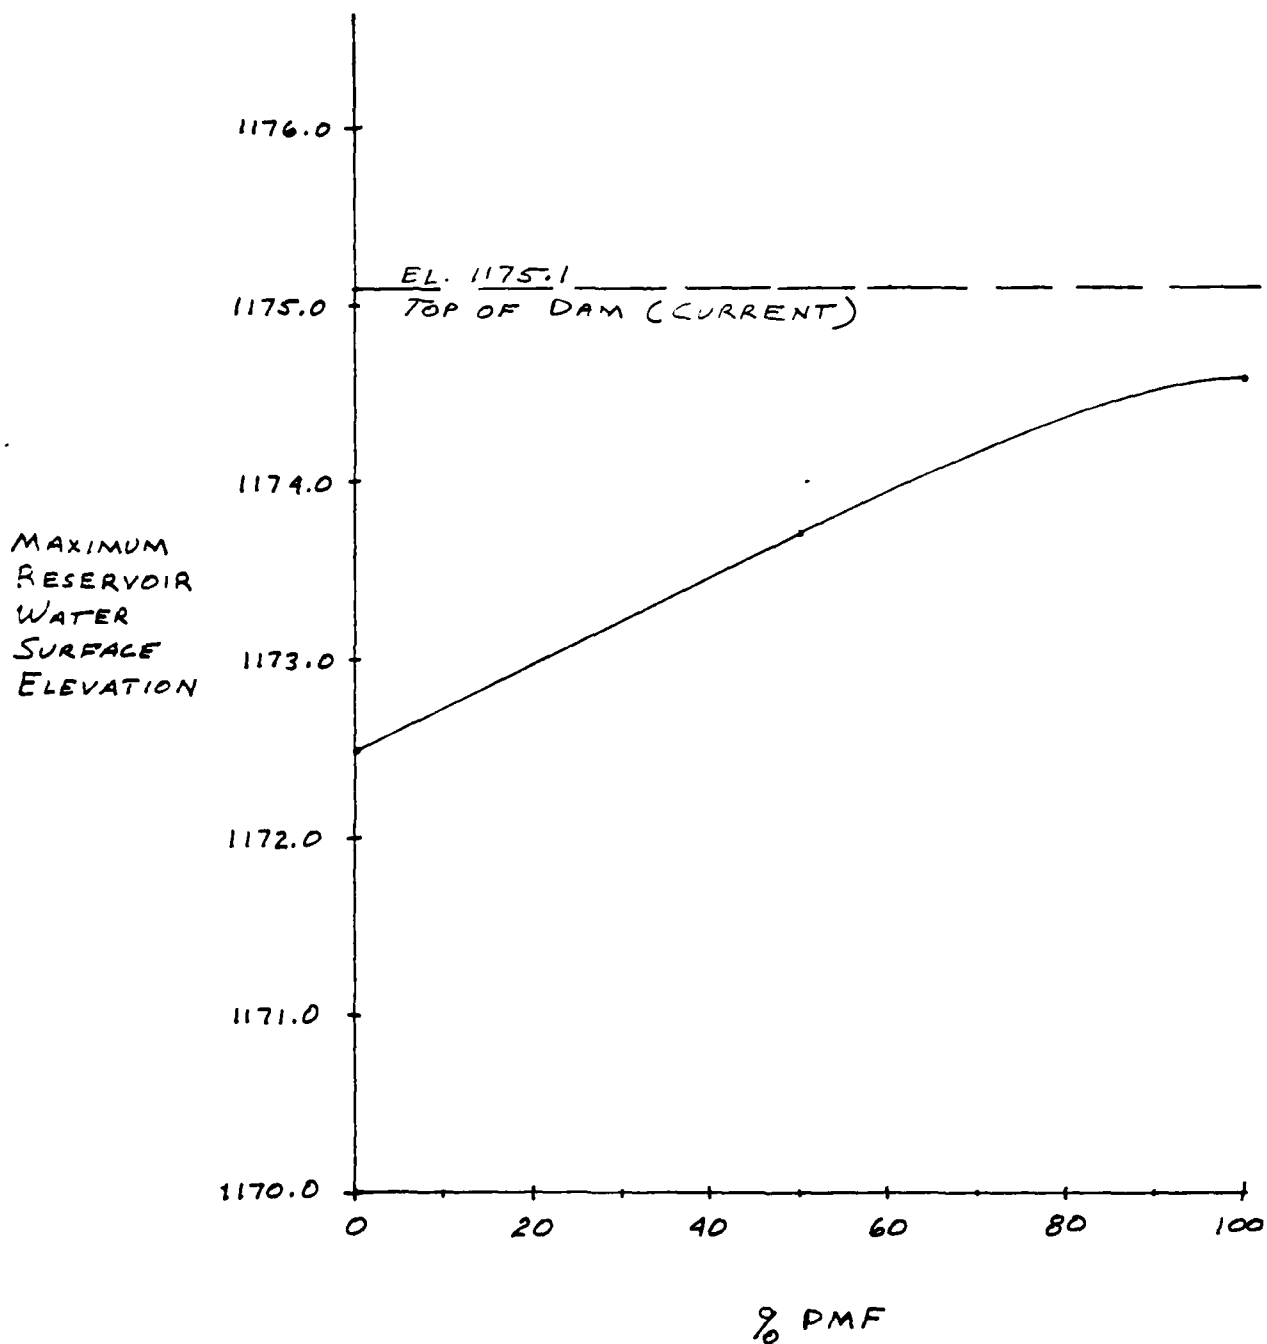


APPENDIX E

PLATES


LIST OF PLATES

- Plate I Regional Vicinity Map.
- Plate II Topographic Map of Mine 60 Lake Calydone for
Bethlehem Mines Corporation, Ellsworth Division,
dated November 1978.

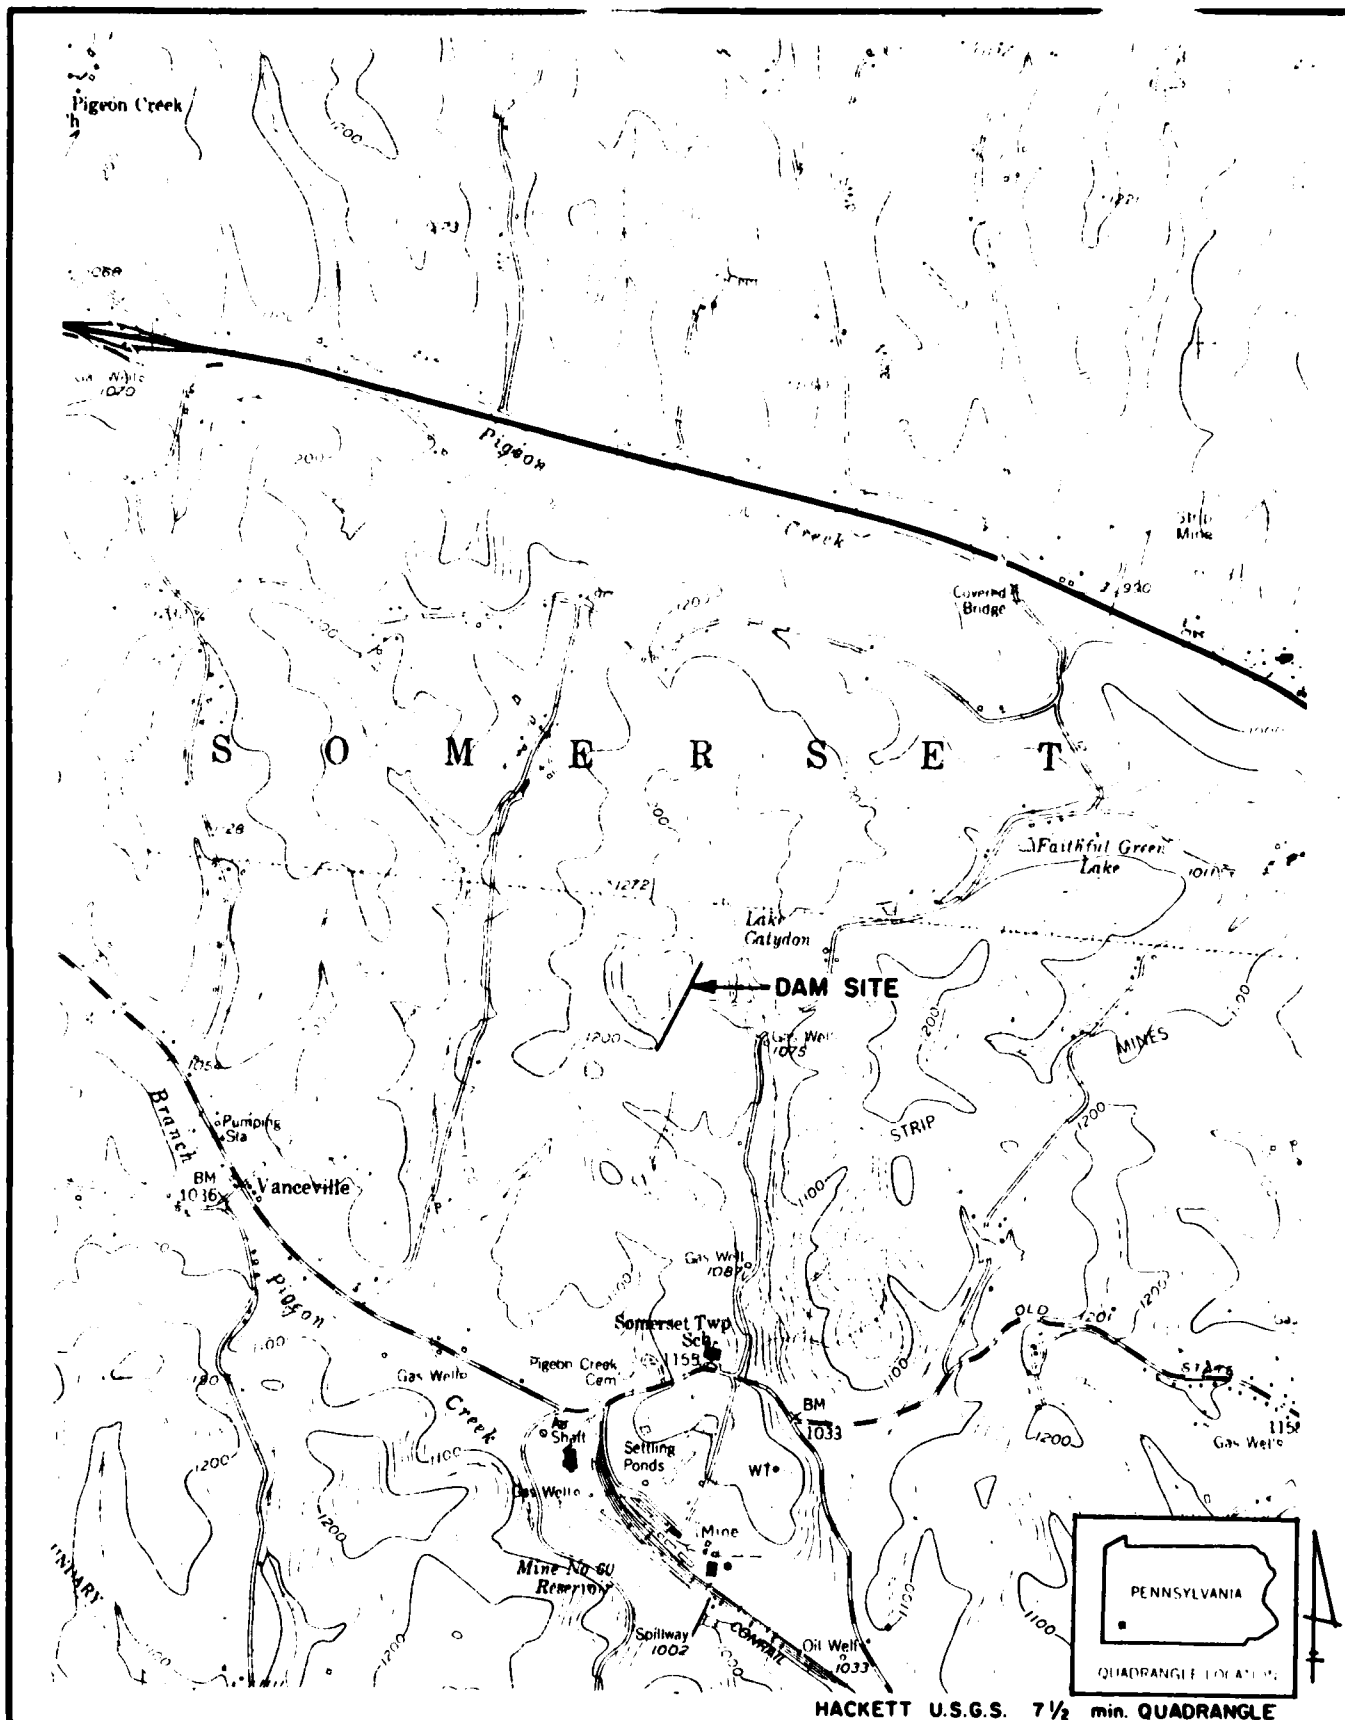

HACKETT U.S.G.S. 7 1/2 min. QUADRANGLE

DATE: MAY 1981		MINE No. 60 - POND 5 NATIONAL DAM INSPECTION PROGRAM		REGIONAL VICINITY MAP
SCALE: 1"=2000'				
DR: JF	CK:	ACKENHEIL & ASSOCIATES CONSULTING GEO SYSTEMS, INC. ENGINEERS 1000 BANKSVILLE RD/PITTSBURGH, PA 15216		
PLATE I				

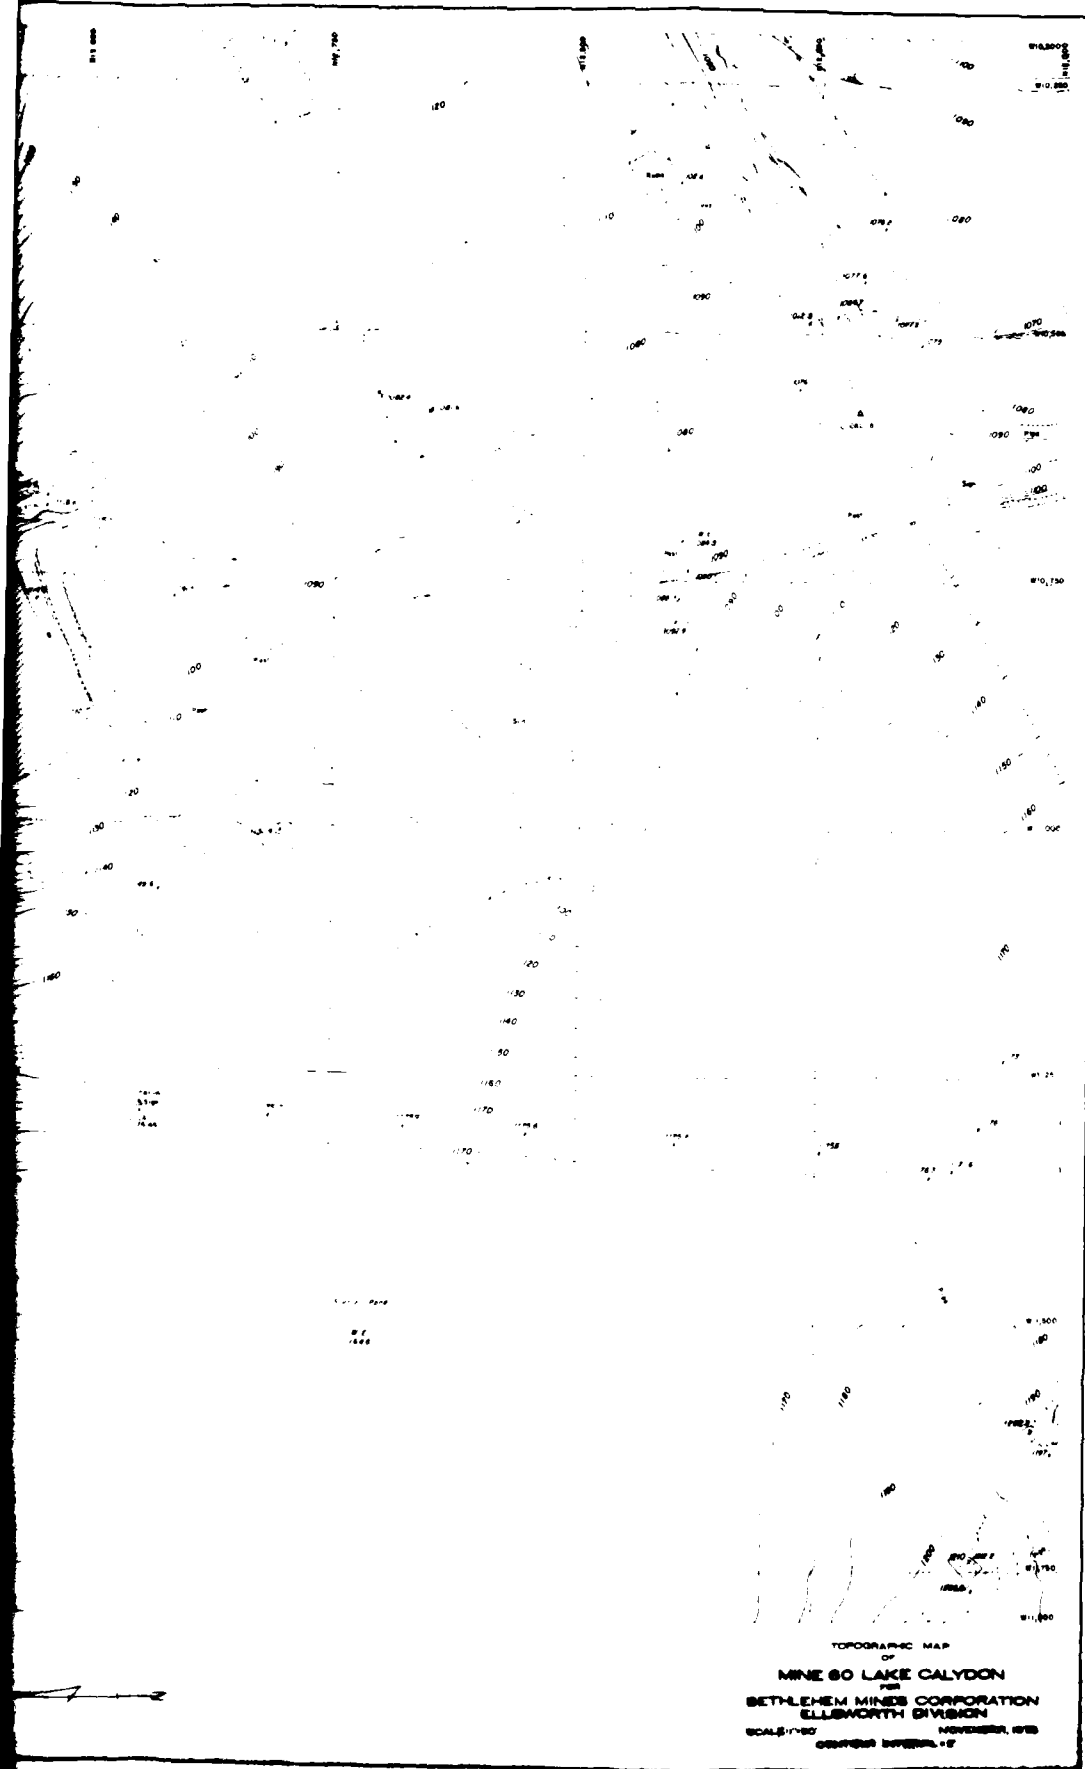

2

PLATE II

APPENDIX F

GEOLOGY

GEOLOGY

Geomorphology

The Mine No. 60-Pond 5 Dam is located within the Pittsburgh Plateau section of the Appalachian Plateau Physiographic Province. This area is characterized by gently folded sedimentary rocks which have been incised by streams to form steep sided valleys. The site is located at the head of an unnamed tributary to the Center Branch of Pigeon Creek. The valley bottom of the unnamed tributary is about 200 feet below the adjacent hilltops. These rounded hilltops are at Elevation 1200 to 1300 feet, and in a regional sense are part of a broad, undulating plateau.

Structure


The site lies on the eastern flank of the Amity Anticline, the axis of which plunges to the southwest. Strata in the immediate vicinity of the dam dip to the south at an average rate of about 0.3° . Faulting has not been documented in the area of the dam and no observations were made that would indicate faulting in the rocks outcropping around the dam.

Stratigraphy

Rocks outcropping in the immediate vicinity of the site belong to the Pennsylvania Age, Casselman and Monongahela Formations and the Permian Age, Waynesburg and Washington Formations. The major rock types in all these formations are cyclic sequences of shale, limestone, sandstone, and coal.

Mining Activity

The Pittsburgh Coal Seam, the lowermost unit of the Monongahela Formation, lies about 300 feet below the dam and has been extensively deep mined. The Waynesburg Coal Seam, which is the lowermost unit of the Waynesburg Formation, lies beneath the dam and has been unaffected by deep mining.

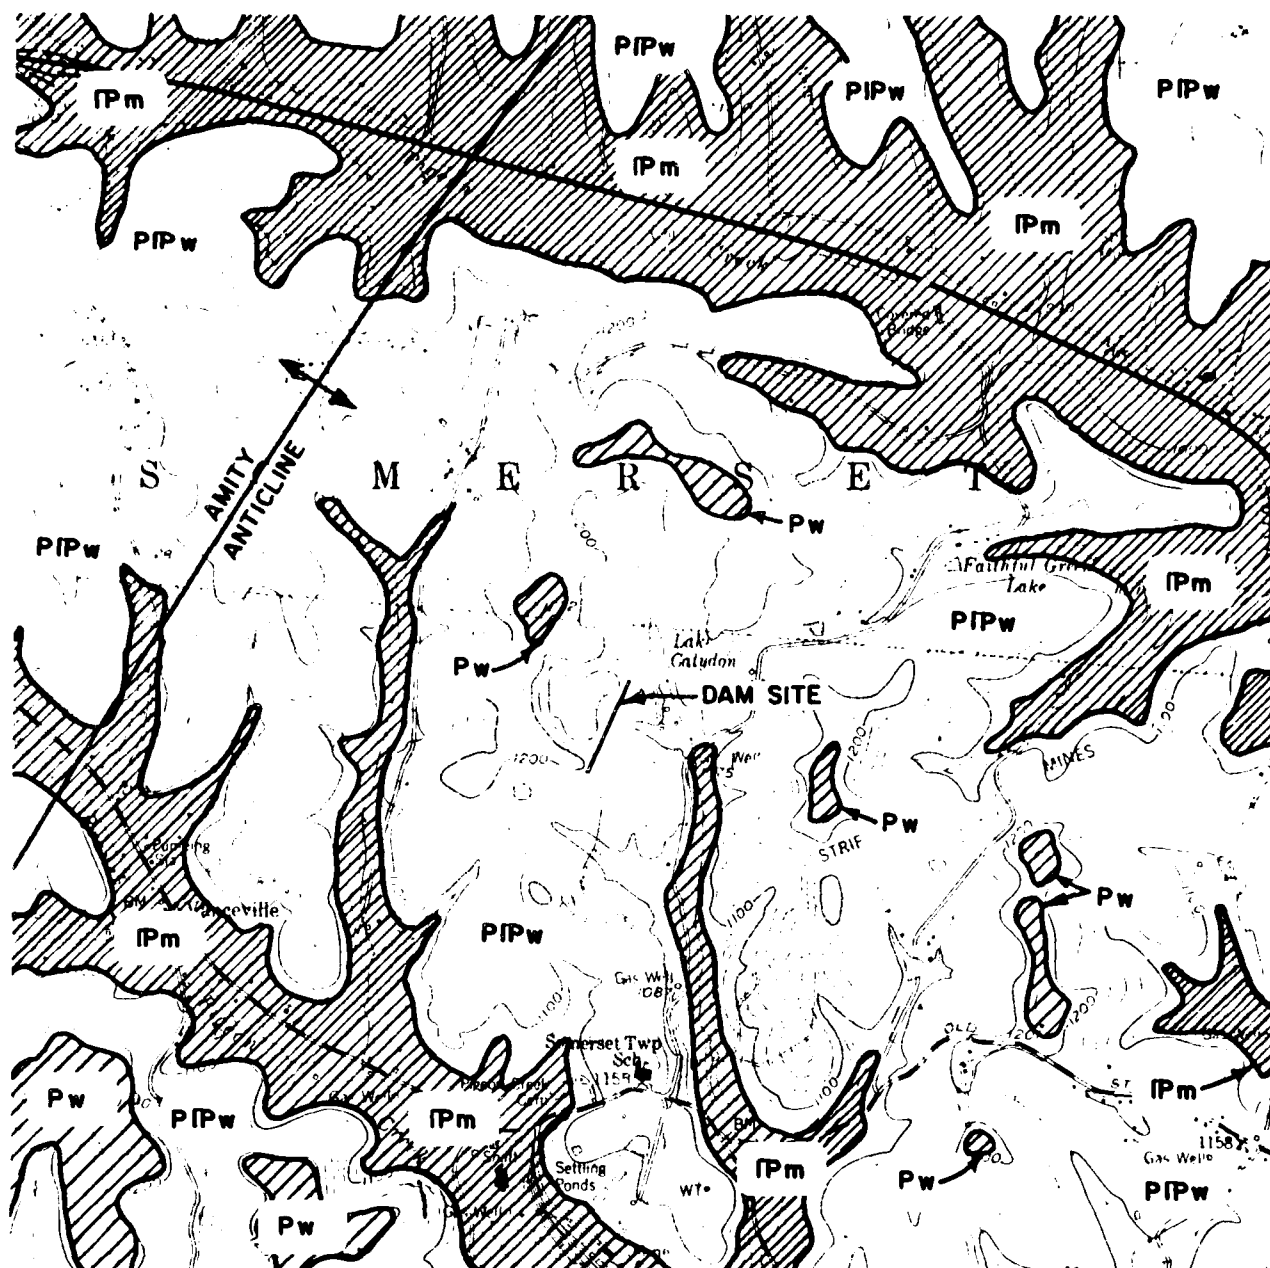

HACKETT QUADRANGLE, WASHINGTON COUNTY, PENNSYLVANIA

SCALE: 0 1/2 MILE 1:24000
 CONTOUR INTERVAL 20 FT. DATUM IS MEAN SEA LEVEL
 ——— FORMATION CONTACT

DATA OBTAINED FROM PENNSYLVANIA TOPOGRAPHIC AND GEOLOGIC SURVEY GREATER PITTSBURGH REGION GEOLOGIC MAP AND CROSS SECTIONS, 1975 and GREATER PITTSBURGH REGION STRUCTURE CONTOUR MAP, 1975

DATE: MAY 1981	MINE No. 60 - POND 5	GEOLOGIC MAP
SCALE: 1"=2000'	NATIONAL DAM INSPECTION PROGRAM	
DR: JF CK:	ACKENHEIL & ASSOCIATES CONSULTING GEO SYSTEMS, INC. ENGINEERS	
	1000 BANKSVILLE RD./PITTSBURGH PA 15216	

AGE	SYMBOL	UNIT	COLUMNAR SECTION	PROMINENT BEDS
QUATERNARY		Q1		PLEISTOCENE GLACIAL OUTWASH, RIVER TERRACE DEPOSITS AND ALLUVIUM
PERMIAN		DUNKARD (P4)		UPPER WASHINGTON LIMESTONE
		WASHINGTON GREENE (P3)		WASHINGTON COAL
		WAYNESBURG (P2)		WAYNESBURG SANDSTONE
		WAYNESBURG (P1)		WAYNESBURG COAL
		UNIONTOWN (P0)		UNIONTOWN SANDSTONE
		UNIONTOWN (P0)		UNIONTOWN COAL
		BENWOOD (P0)		BENWOOD LIMESTONE
		SEWICKLEY (P0)		SEWICKLEY COAL
		PITTSBURGH (P0)		PITTSBURGH SANDSTONE
		PITTSBURGH (P0)		PITTSBURGH COAL
PENNSYLVANIAN		CONNELLSVILLE (P0)		CONNELLSVILLE SANDSTONE
		MORGANTOWN (P0)		MORGANTOWN SANDSTONE
		AMES (P0)		AMES LIMESTONE
		PITTSBURGH (P0)		PITTSBURGH REDBEDS
		SALTSBURGH (P0)		SALTSBURGH SANDSTONE
		MAHONING (P0)		MAHONING SANDSTONE
		UPPER FREEPORT (P0)		UPPER FREEPORT COAL
		UPPER KITTANNING (P0)		UPPER KITTANNING COAL
		WORTHINGTON (P0)		WORTHINGTON SANDSTONE
		LOWER KITTANNING (P0)		LOWER KITTANNING COAL
MISSISSIPPIAN		POTTSVILLE (P0)		HOMESWOOD SANDSTONE
		MERCER (P0)		MERCER SANDSTONE, SHALE & COAL
		CONNOQUENESSING (P0)		CONNOQUENESSING SANDSTONE
		BURGON (P0)		BURGON SANDSTONE
		CUYAHOGA (P0)		CUYAHOGA SHALE
DEVELOPMENTAL		BEREA (P0)		BEREA SANDSTONE

DATE: MAY 1981

SCALE: 1" = 360'

DR: JF CK:

MINE No. 60 - POND 5

NATIONAL DAM INSPECTION PROGRAM

ACKENHEIL & ASSOCIATES CONSULTING

GEO SYSTEMS, INC. ENGINEERS

1000 BANKSVILLE RD./PITTSBURGH PA 15216

GEOLOGIC
COLUMN

