

AD-A105 274

HOSKINS-WESTERN-SONDEREGGER INC LINCOLN NE
NATIONAL DAM SAFETY PROGRAM. JUNIOR LAKE DAM, (MO 11526) MISSOU--ETC(U)
OCT 80 R S DECKER, G JAMISON, G ULMER


F/6 13/13

DACW43-80-C-0071

UNCLASSIFIED

NL

1 of 1
AD-A
105 274

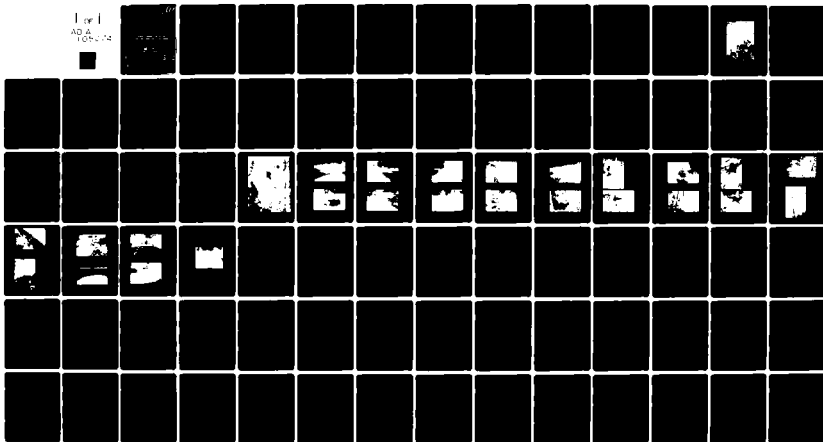

END
DATE
FILMED
10-81
DTIC

LEVEL

1

MISSOURI - KANSAS CITY BASIN

AD A105274

JUNIOR LAKE DAM
CALLAWAY COUNTY, MO.
MO 11526

**PHASE 1 INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM**



**United States Army
Corps of Engineers**
... Serving the Army
... Serving the Nation

St. Louis District

**DTIC
ELECTE
OCT 9 1981
S D**

PREPARED BY: U.S. ARMY ENGINEER DISTRICT, ST. LOUIS

FOR: STATE OF MISSOURI

OCTOBER, 1980

FILE COPY

DISTRIBUTION STATEMENT A
Approved for public release;
Distribution Unlimited

81 10 7 102

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO. AD-A205 274	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Phase I Dam Inspection Report National Dam Safety Program Junior Lake Dam (MO 11526) Callaway County, Missouri		5. TYPE OF REPORT & PERIOD COVERED Final Report
7. AUTHOR(s) Hoskins-Western-Sonderegger, Inc.		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		8. CONTRACT OR GRANT NUMBER(s) DACW43-80-C-0071 ✓
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office) <i>Phase I Dam Inspection Report</i>		12. REPORT DATE October 1980
		13. NUMBER OF PAGES Approximately 70
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
16. DISTRIBUTION STATEMENT (of this Report) <i>General Release</i> Approved for release; distribution unlimited. <i>W. L. H. V.</i>		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report) <i>National Dam Safety Program. Junior Lake Dam, (MO 11526) Missouri - Kansas City Basin, Callaway County, MO. Phase I Inspection Report.</i>		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dam Safety, Lake, Dam Inspection, Private Dams		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property.		

DD FORM 1473 1 JAN 73

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

274901

JUNIOR LAKE DAM
CALLAWAY COUNTY, MISSOURI
MISSOURI INVENTORY NO. MO 11526

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

PREPARED BY
HOSKINS-WESTERN-SONDEREGGER, INC.
CONSULTING ENGINEERS
LINCOLN, NEBRASKA

UNDER DIRECTION OF
ST. LOUIS DISTRICT, CORPS OF ENGINEERS

FOR
GOVERNOR OF MISSOURI

OCTOBER, 1980

DTIC
SELECTED
SERIALIZED
OCT 1981

D

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/	
Availability Codes	
Avail and/or	
Dist	Special
A	



DEPARTMENT OF THE ARMY
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
210 TUCKER BOULEVARD, NORTH
ST. LOUIS, MISSOURI 63101

REPLY TO
ATTENTION OF

LMSD-PD

SUBJECT: Junior Lake Dam Phase I Inspection Report

This report presents the results of field inspection and evaluation of the Junior Lake Dam MO 11526.

It was prepared under the National Program of Inspection of Non-Federal Dams.

This dam has been classified as unsafe, emergency by the St. Louis District as a result of the application of the following criteria:

a. Spillway will not pass a 10-year frequency flood without overtopping of the dam. The spillway is, therefore, considered to be unusually small and seriously inadequate.

b. Overtopping could result in dam failure.

c. Dam failure significantly increases the hazard to life and property downstream.

SIGNED

11 MAR 1981

Submitted By: _____
Chief, Engineering Division

Date

SIGNED

Approved By: _____
Colonel, CE, District Engineer

~~11 MAR 1981~~
Date

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

TABLE OF CONTENTS

<u>PARAGRAPH NO.</u>	<u>TITLE</u>	<u>PAGE NO.</u>
	Assessment Summary	
	Overview Photograph	
SECTION 1 - PROJECT INFORMATION		
1.1	General	1
1.2	Description of Project	1
1.3	Pertinent Data	2
SECTION 2 - ENGINEERING DATA		
2.1	Design	5
2.2	Construction	5
2.3	Operation	5
2.4	Evaluation	5
SECTION 3 - VISUAL INSPECTION		
3.1	Findings	6
3.2	Evaluation	8
SECTION 4 - OPERATIONAL PROCEDURES		
4.1	Procedures	9
4.2	Maintenance of Dam	9
4.3	Maintenance of Operating Facilities	9
4.4	Description of Any Warning System in Effect	9
4.5	Evaluation	9
SECTION 5 - HYDRAULIC/HYDROLOGIC		
5.1	Evaluation of Features	10
SECTION 6 - STRUCTURAL STABILITY		
6.1	Evaluation of Structural Stability	12
SECTION 7 - ASSESSMENT/REMEDIAL MEASURES		
7.1	Dam Assessment	13
7.2	Remedial Measures	14

APPENDIX A - MAPS

Plate A-1	Vicinity Topography
Plate A-2	Location Map
Plate A-3	Drainage Area Map

APPENDIX B - PHOTOGRAPHS

Plate B-1		Photo Index
Plate B-2	Photo No. 2	Upstream Face Taken from the Right Side
	Photo No. 3	Upstream Slope and Crest of the South Leg Taken from the Left Side
Plate B-3	Photo No. 4	Upstream Face of the South and East Legs Taken from the Left End of the East Leg
	Photo No. 5	Riprap on the South Leg
Plate B-4	Photo No. 6	The Upstream Slope and Crest of the East Leg Looking North
	Photo No. 7	Downstream Crest of the South Leg Looking from Left to Right
Plate B-5	Photo No. 8	Downstream Slope of the East Leg Taken from the Left End of the South Leg Looking North
	Photo No. 9	Looking Downstream from the Left End of the Spillway
Plate B-6	Photo No. 10	Crest Taken from the Right Side
	Photo No. 11	Crest of the East Leg Looking North from Just North of the End of the South Leg
Plate B-7	Photo No. 12	A Hole Eroded in the Upstream Face of Dam About 50 Feet from the Left End of the South Leg of the Dam
	Photo No. 13	Erosion of the Upstream Face of the East Leg at About Station 3+75 or 4+00
Plate B-8	Photo No. 14	Erosion of Crest of the East Leg of the Area Taken in Photo No. 15
	Photo No. 15	Erosion of the Upstream Face at Station 3+00
Plate B-9	Photo No. 16	Erosion Activity on the Upstream Face of the East Leg
	Photo No. 17	Concrete Spillway Taken from Right End
Plate B-10	Photo No. 18	Looking Downstream in the Channel Below the Spillway
	Photo No. 19	Some Cracks in the Downstream Face of the Weir Section
Plate B-11	Photo No. 20	A Bad Crack Exposing Reinforcing Steel in the Weir Section
	Photo No. 21	Crack in the Ogee Spillway Section About 40 Feet from the Right End
Plate B-12	Photo No. 22	Bedrock Outcrop in the Channel About 100 Feet Downstream from the Spillway
	Photo No. 23	Looking Upstream from the Left End of the Spillway
Plate B-13	Photo No. 24	Dwelling at Approximately 0.2 Miles Down- stream of Dam
	Photo No. 25	Dwelling at 0.3 Miles Downstream of Dam
Plate B-14	Photo No. 26	Looking West at Large Grocery Store Approxi- mately 0.25 Miles Downstream of Dam

APPENDIX C - PROJECT PLATES

Plate C-1	Phase I - Plan of Dam
Plate C-2	Phase I - Centerline Profile of Dam
Plate C-3	Phase I - Maximum Cross Section of Dam at Station 7+00 and Profile Along Centerline of Spillway

APPENDIX D - HYDRAULIC/HYDROLOGIC DATA

Plate D-1 & D-2	Hydrologic Computations
Plate D-3	Spillway Rating Curve
Plate D-4	Elevation-Area-Capacity Curves
Plates D-5 through D-34	Computer Input and Output for Ratios of the PMF

PHASE I REPORT
NATIONAL DAM SAFETY PROGRAM
ASSESSMENT SUMMARY

Name of Dam	Junior Lake Dam
State Located	Missouri
County Located	Callaway County
Stream	Smith Branch
Date of Inspection	October 6, 1980

Junior Lake Dam was inspected by an interdisciplinary team of engineers from Hoskins-Western-Sonderegger, Inc. The purpose of the inspection was to make an assessment of the general conditions of the dam with respect to safety, based upon available data and visual inspection, in order to determine if the dam poses hazards to human life or property.

The guidelines used in the assessment were furnished by the Department of the Army, Office of the Chief of Engineers and developed with the help of several Federal and State agencies, professional engineering organizations, and private engineers.

Junior Lake Dam has a height of thirteen (13) feet and a storage capacity at the minimum top elevation of the dam of seventy-two (72) acre-feet. In accordance with the guidelines, a small size dam has a height greater than or equal to twenty-five (25) feet but less than forty (40) feet and a storage capacity greater than or equal to fifty (50) acre-feet but less than one thousand (1,000) acre-feet. The size classification is determined by either the storage capacity or height, whichever gives the larger size category. Junior Lake Dam is classified as a small size dam.

In accordance with the guidelines and based on visual observation, the dam is classified as having a high hazard potential. Failure would threaten life and property. The estimated damage zone extends approximately two (2) miles downstream of the dam. Within the damage zone are a railroad embankment at 0.1 mile, a dwelling at 0.2 miles, two large commercial buildings at 0.25 miles, two dwellings at 0.3 miles, thirteen dwellings at 0.4 to 0.6 miles, a park at 0.8 miles and a building at 1.0 mile.

Our inspection and evaluation indicates that the spillway does not meet the criteria set forth in the recommended guidelines for a small dam having a high hazard potential. Considering the height of the dam, and the small volume of water impounded, 50% of the Probable Maximum Flood is the appropriate spillway design flood. The spillway will not pass the Probable Maximum Flood or the 10-year flood (10% probability flood, a flood having a 10% chance of being exceeded in any year) without overtopping the dam. The spillway will pass 10% of the Probable Maximum Flood (PMF) without overtopping the dam. The Probable Maximum Flood is defined as the flood that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible in the region.

Junior Lake Dam is in very poor condition and has a serious potential of failure due to severe erosional damage of the upstream face and the crest; rodent burrows; dense tree and brush growth on the crest and downstream slope; and a severely inadequate spillway. There apparently has been little maintenance work done on this dam.

Design data were not available for this dam. Based on the observations made during the field inspection of the dam, the following remedial measures should be performed under the guidance of a professional engineer experienced in the design and construction of dams:

a. Alternatives.

- (1) Studies should be performed to determine the amount of siltation in the reservoir, the stage-storage relationships of the reservoir, and the extent of downstream damages that could result from failure of the dam. The results of these studies should be used in implementation of the remedial measure recommended in the following paragraph.
- (2) The height of the dam should be increased in order to pass 50 percent of the probable maximum flood through the existing spillway without overtopping the dam.

b. Operation and Maintenance Procedures.

- (1) Seepage and stability analyses comparable to the requirements of the recommended guidelines should be performed by an engineer experienced in the design and construction of dams.
- (2) Trees and brush should be removed from the embankment and the spillway exit section. Tree removal should be done under the guidance of an engineer experienced in the design and construction of dams.
- (3) Rodent burrows in the embankment should be eliminated.
- (4) Cracks and spalls in the concrete spillway should be repaired.
- (5) The water level should be lowered and/or the reservoir should be drained in order to facilitate the rehabilitation of the reservoir and the modification of the dam.
- (6) A program of periodic inspection and regular maintenance should be instituted. Maintenance procedures should be focused on eliminating tree growth and rodent activity as well as making timely repairs of eroded areas and the spillway system. All records of inspections and maintenance operations should be made a part of this project file.

Rey S. Decker

Rey S. Decker
E-3703

Gordon G. Jamison

Gordon Jamison

Garold Ulmer

Garold Ulmer
E-19246

H. P. Hoskins

Harold P. Hoskins, Chairman of the Board
Hoskins-Western-Sonderegger, Inc.
E-8696



PHOTO NO. 1 - OVERVIEW

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
JUNIOR LAKE DAM - MO 11526
CALLAWAY COUNTY, MISSOURI

SECTION 1 - PROJECT INFORMATION

1.1 GENERAL

- a. Authority. The National Dam Inspection Act, Public Law 92-367, authorized the Secretary of the Army through the Corps of Engineers, to initiate a program of safety inspection of dams throughout the United States. Pursuant to the above, the St. Louis District, Corps of Engineers, District Engineer directed that a safety inspection of Junior Lake Dam be made.
- b. Purpose of Inspection. The purpose of the inspection was to make an assessment of the general condition of the dam with respect to safety, based upon available data and visual inspection, in order to determine if the dam poses hazards to human life or property.
- c. Evaluation Criteria. Criteria used to evaluate the dam were furnished by the Department of the Army, Office of the Chief of Engineers, in "Recommended Guidelines for Safety Inspection of Dams", Appendix D to "Report of the Chief of Engineers on the National Program of Inspection of Dams", dated May, 1975, and published by the Department of the Army, Office of the Chief of Engineers.

1.2 DESCRIPTION OF PROJECT

- a. Description of Dam and Appurtenances.
 - (1) Embankment. The dam is an earthfill structure approximately 13 feet in height and 717 feet in length constructed in an "L" shape with about 227 feet extending across the old channel on the south end and about 490 feet extending parallel to the railroad along the east side.
 - (2) Spillway. The spillway consists of a reinforced concrete weir and ogee chute and apron section located on the right end of the south leg of the dam. The weir section is 163 feet wide.
 - (3) Pertinent physical data are given in paragraph 1.3.
- b. Location. The dam is located on the campus of William Woods College within the corporate limits of Fulton in the central part of Callaway County, Missouri, as shown on Plate A-2. The dam is shown on Plate A-1 in the SE 1/4 of Section 8, T47N, R9W.
- c. Size Classification. Criteria for determining the size classification of dams and impoundments are presented in the guidelines

referenced in paragraph 1.1c above. Junior Lake Dam has a height of 13 feet and a storage capacity of 72 acre-feet. This dam is classified as a small size dam. A small size dam has a height greater than or equal to 25 feet but less than 40 feet and a storage capacity greater than or equal to 50 acre-feet but less than 1,000 acre-feet. The size classification is determined by either the storage or height, whichever gives the larger size category.

- d. Hazard Classification. Guidelines for determining hazard classification of dams and impoundments are presented in the guidelines as referenced in paragraph 1.1c above.

Aerial photographs of the downstream damage zone of this dam were taken in October, 1980. These photographs were used as reference in the field observations of the damage zone which were made during the inspection. Based on the field observations and on the referenced guidelines this dam is in the High Hazard Potential Classification. The estimated damage zone extends approximately two miles downstream of the dam. Within the damage zone are a railroad embankment at 0.1 mile, a dwelling at 0.2 miles, two large commercial buildings at 0.25 miles, two dwellings at 0.3 miles, thirteen dwellings at 0.4 to 0.6 miles, a park at 0.8 miles and a building at 1.0 mile.

- e. Ownership. The dam is owned by William Woods College, c/o Mr. Larry Martin, Fulton, Missouri 69251.
- f. Purpose of Dam. The dam impounds a lake which is used for recreation.
- g. Design and Construction History. No design or construction data were available for this dam. Mr. Martin reported that the dam was originally constructed in the 1940's but washed out. The old earth dam was repaired in the early 1960's, and the concrete ogee-type spillway was constructed. The concrete weir crest was added to the spillway in either the late 1960's or early 1970's.
- h. Normal Operating Procedure. There are no operating facilities for this dam. The pool level is controlled by rainfall, infiltration, evaporation, and the capacity of the uncontrolled spillway.

1.3 PERTINENT DATA

- a. Drainage Area. 1852 acres (2.89 square miles).
- b. Discharge at Damsite.
- (1) All discharges at the damsite are through a reinforced concrete ogee-type spillway with a 2-foot wide concrete weir crest.
 - (2) Estimated maximum flood at damsite -- unknown.

(3) The spillway capacity varies from 0 c.f.s. at elevation 804.0 feet to 1216 c.f.s. at the minimum top of dam (elevation 805.6 feet).

(4) Total spillway capacity at the minimum top of dam is 1216 c.f.s. \pm .

c. Elevations (feet above M.S.L.).

(1) Observed pool - 801.5 \pm .

(2) Normal pool - 804.0 \pm .

(3) Spillway crest - 804.0 \pm .

(4) Maximum experienced pool - 805.5 \pm .

(5) Top of dam (minimum) - 805.6 \pm .

(6) Streambed - 793 \pm .

(7) Maximum Tailwater - unknown.

d. Reservoir. Length (feet) of pool.

(1) At spillway crest - 1500 \pm .

(2) At top of dam (minimum) - 1600 \pm .

e. Storage (Acre-feet).

(1) Observed pool - 15 \pm .

(2) Normal pool - 42 \pm .

(3) Spillway crest - 42 \pm .

(4) Maximum experienced pool - 70 \pm (based on Mr. Martin's statement that 15 to 18-inch depths of water flow over the spillway at least once a year).

(5) Top of dam (minimum) - 72 \pm .

f. Reservoir Surface (Acres).

(1) Observed pool - 7.1 \pm .

(2) Normal pool - 14.9 \pm .

(3) Spillway crest - 14.9 \pm .

(4) Maximum experienced pool - 22.5 \pm .

- (5) Top of dam (minimum) - 23 ±.
- g. Dam.
- (1) Type - Earthfill.
 - (2) Length - 717 ft ± (227' ± south leg; 540' ± east leg).
 - (3) Height - 13 ft ± (south leg).
 - (4) Top Width - Varies: 14 ft maximum to 2 ft minimum.
 - (5) Side Slopes.
 - (a) Downstream (maximum section of south leg) - 1V on 2.6H, 1V on 4.7H, 1V on 7.7H (see plate C-3). Downstream (east leg) - 1V on 2H.
 - (b) Upstream (maximum section of south leg) - 1V on 3.6H. Upstream (east leg) - eroded to near vertical.
 - (6) Zoning - none.
 - (7) Impervious core - none.
 - (8) Cutoff - unknown.
 - (9) Grout curtain - none.
 - (10) Wave Protection - Approximately 167 feet of south leg riprapped. No protection on east 60 feet of south leg or entire east leg.
 - (11) Drains - none.
- h. Diversion Channel and Regulating Tunnel. None.
- i. Spillway.
- (1) Type - Reinforced concrete weir crest and an ogee-type reinforced concrete spillway section.
 - (2) Control Section - Concrete weir having a trapezoidal cross section with the upstream face inclined and downstream face vertical. Weir length = 163 feet; Weir width = 2 feet.
 - (3) Crest Elevation - 804.0.
 - (4) Upstream Channel - + 12.5% grade; heavy vegetative growth.
 - (5) Downstream Channel - Badly overgrown with trees and brush, bedrock exposed some 100 feet below spillway.
- j. Regulating Outlets. None.

SECTION 2 - ENGINEERING DATA

2.1 DESIGN

No design data were available for this dam.

2.2 CONSTRUCTION

No construction data were available. It was reported by Mr. Martin that the earth dam was originally constructed sometime in the 1940's. The original dam washed out. The original earth dam was repaired and a concrete ogee-type spillway was constructed in the early 1960's. The existing concrete weir section was added to the spillway in the late 1960's or very early 1970's.

2.3 OPERATION

No data were available on spillway operation. Mr. Martin reported that water 15 to 18 inches in depth will flow over the spillway at least once each year.

2.4 EVALUATION

- a. Availability. No data were available.
- b. Adequacy. The field surveys and visual observations presented herein are considered adequate to support the conclusions of this report. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions (including earthquake loads) and made a matter of record.
- c. Validity. Not applicable.

SECTION 3 - VISUAL INSPECTION

3.1 FINDINGS

- a. General. A visual inspection of the Junior Lake Dam was made on October 6, 1980. Engineers from Hoskins-Western-Sonderegger, Inc., Lincoln, Nebraska, making the inspection were:

Rey S. Decker - Geotechnical
Garold G. Ulmer - Hydraulics and Hydrology
Gordon Jamison - Hydraulics and Hydrology

The owner was represented during the inspection by Mr. Larry Martin.

b. Dam.

- (1) Geology and Soils (abutment and embankment). This dam is located in the loess-till plains of Northern Missouri. Upland soils consist of the Mexico-Putnam Association on the nearly level areas which are developed on thin loess overlying dense glacial till and the Lindley-Keswick-Hatton Association on the gently rolling slopes which have developed on thin loess of glacial till overlying bedrock.

Materials in the embankment consist of silty clay, clayey silts and sand (CL-ML-fine SM). The right abutment consists of loess overlying till. Sandstone and limestone bedrock of the Marmaton or Cherokee Group of the Pennsylvania System is exposed in the stream channel downstream from the spillway.

Groundwater movement in the bedrock is along joints and bedding planes. No evidence of solution cavities was detected. This area is not included in the locations where catastrophic collapse into sinkholes is known to occur.

The embankment is in Seismic Zone 1 indicating a minor probability of earthquakes. No quakes have been reported within a 50-mile radius of the site. The only significant structural feature within a 10-mile radius is the Auxvasse Creek Anticline.

- (2) Upstream Slope. The upstream slope is well covered with trees and brush. The extreme right end of the south leg of the dam (adjacent to the spillway) is protected with riprap. This riprap section extends from about Station 6+00 to the spillway. The riprap has provided good protection for this section of the dam. The upstream slope of the left (east) leg of the dam is badly eroded and is nearly vertical in many sections. Upstream erosion has reduced the crest width to as narrow as 2 to 3 feet in some sections. Some of the erosion on the upstream slope and into the crest appears to be the result of rodent (probably muskrat) activity. Photos 2, 3, 4, 5, and 6 show the overall slope. Photos 12, 13, 14, 15, and 16 show erosion of the upstream slope and the crest.

- (3) Crest. The crest is overgrown with trees and brush. The width of the crest of the south leg is about 14 feet except near Station 5+70 ± (Photo No. 12). Approximately 10 feet of the crest has eroded to a depth of approximately 3 feet at this location, leaving a remaining crest width of 3 to 4 feet. Tree roots are exposed in this eroded area. Photo No. 12 shows this eroded area. Crest widths of the left (east) leg vary from about 2 feet to 9 feet as shown on Plate C-1 and in Photos 13, 14, 15, and 16. In some sections of the east leg tree roots are exposed from the upstream face through the crest. Measurements indicate that the crest elevation varies from about 805.0 to 806.7 with the lowest points being located along the east leg. Some settlement has undoubtedly occurred, but the profile in general probably reflects the irregularity of the profile when construction was completed. The left (east leg) end of the dam ties into the adjacent railroad grade. Materials in sections of the east leg are very silty (ML) and/or quite sandy (fine SM). Photos 10, 11, and 14 show the crest.
- (4) Downstream Slope. The downstream slopes of both legs are overgrown with brush and trees up to 24 inches in diameter. No sliding, cracking, abnormal deformation or erosion was noted on the downstream slope of either leg. No indications of seepage were evident on the downstream slopes or along the toe of the dam. Photos 7 and 8 show the downstream slopes.
- (5) Miscellaneous. The nature of the material in most of the east leg of the dam indicates that any overtopping would probably result in breaching of the dam.

c. Appurtenant Structures.

- (1) Spillway. The spillway consists of a reinforced concrete weir with ogee-type chute. The weir section has been added to the original ogee structure, and there is some spalling of the concrete along the construction joint (see Photo 19). The weir section is badly cracked and fractured about 40 feet from the left end (see Photo 20). The ogee outlet section is in fair condition. One crack about 2 inches wide was observed in the floor section about 40 feet from the right side of the structure (see Photo 21). A number of small trees and bushes are growing in the construction joints and cracks in the outlet section. Photo 17 shows the weir crest and ogee section with tree and brush growth. The spillway discharges onto rock and concrete rubble that has been placed in the old channel bottom.
- (2) Low-Level Outlet. There is no low-level outlet facility for this dam.

- d. Reservoir Area. No significant erosion was evident around the shoreline. Mr. Martin reported that the reservoir has silted in considerably and that the present depth of the lake in the center is not over 3 to 4 feet deep. The lake is shown in Photos 1 and 23.

- e. Downstream Channel. The channel downstream from the spillway structure has a number of small trees growing along the end of the structure and in the channel. Sandstone and limestone bedrock is exposed in the channel bottom downstream from the structure. Seepage outcrops in the bedrock about 50 feet downstream from the structure. The seep was standing in small pools and there was no flow down the channel.

3.2 EVALUATION

The embankment is in very poor condition. Wave erosion has removed much of the upstream slope of the east leg and has reduced the crest width to 2 or 3 feet in some sections. Most of the embankment is covered with trees and brush, and tree roots extend from the upstream slope through sections of the crest. Rodent holes have contributed to erosion of the crest. Some of the low spots on the crest line of the east leg are only 1.6 feet \pm above the spillway elevation. No evidence of any recent overtopping was observed. However, the depths of flow over the spillway, as reported by Mr. Martin, would indicate that the low points along the east leg of the dam have been very near to overtopping. The spillway is in fair condition. However, the major cracks and spalling should be repaired to minimize future deterioration. Trees in the spillway outlet section should be removed.

SECTION 4 - OPERATIONAL PROCEDURES

4.1 PROCEDURES

There are no controlled outlet works for this dam. The pool level is controlled by rainfall, infiltration, evaporation, and the capacity of the uncontrolled spillways.

4.2 MAINTENANCE OF DAM

There doesn't appear to be any regular maintenance of this dam. Erosion on the upstream face of the east leg is uncontrolled and is severe in several places. The crest, downstream slope, and spillway channel are overgrown with brush and trees, some up to 24 inches in diameter. The concrete spillway has some bad cracks, open joints and spalls.

4.3 MAINTENANCE OF OPERATING FACILITIES

No operating facilities exist at this dam.

4.4 DESCRIPTION OF ANY WARNING SYSTEM IN EFFECT

There is no warning system in effect for this dam.

4.5 EVALUATION

No operational procedures exist for this dam. The lack of routine maintenance and repair has contributed to the poor condition of the dam and, if continued, will undoubtedly result in breaching of the dam.

SECTION 5 - HYDRAULIC/HYDROLOGIC

5.1 EVALUATION OF FEATURES

- a. Design Data. No design data were found for this dam.
- b. Experience Data. The drainage area, reservoir surface area, and elevation-storage data were developed from the USGS Fulton, Missouri and Kingdom City, Missouri 7-1/2 minute topographic quadrangle maps. The hydraulic computations for the spillway and dam overtopping discharge ratings were based on data collected in the field at the time of the field inspection. Hydrologic computations are included in this report as Appendix D.
- c. Visual Observations.
 - (1) The crest of the east leg and a portion of the south leg of the dam is severely eroded with crest widths as narrow as 2 feet. Minor overtopping would probably lead to a breach of the dam.
 - (2) The concrete weir and spillway has some bad cracks. Photo 20 shows a crack through the weir section. Spalling of the concrete at this crack has exposed the reinforcing steel. Photo 21 shows a 2-inch wide crack in the ogee spillway section downstream from the weir. The small willow tree is growing in the crack. Photo 19 shows the open construction joint between the ogee spillway section and the weir.
 - (3) The dam, as well as the spillway exit channel, is overgrown with brush and trees as shown in the photographs.
 - (4) The abutment on the north end of the east leg of the dam is lower than the minimum top of the dam. Some flow may be released and flow south between the dam embankment (east leg) and the railroad embankment. This flow was not considered in the routing procedure. The ditch section located at the north end of the east leg of the embankment and between the east leg of the dam and the railroad embankment is approximately 25 feet wide and is almost level with the top of the dam. Due to the small section and dense heavy vegetation, no significant flow would be released along the east toe of the dam embankment.
 - (5) The water level in the reservoir was 2.5 feet below the spillway weir crest at the time of inspection. The runoff from the upstream drainage area, which is almost 100% cultivated, has evidently contributed considerable amounts of silt as well as nutrients to the reservoir. The shallow water, as well as the nutrient content, has resulted in the heavy growth of algae and duck weed which is evident in the photographs. Photo 1 - Overview shows the low level of the reservoir at the time of inspection. The photograph on Plate B-1 shows the heavy weed and algae growth along the shores as well as algae blooms in

the lake. The degree of siltation of the reservoir is not known, but siltation would result in lowering the acre-feet of water impounded below the normal pool or spillway elevation and would result in a lesser volume being released in case of breaching of the dam. The analysis presented in tabular form below is based on water level at normal pool or spillway elevation at the beginning of the storm and would not be affected by siltation in the reservoir.

- d. Overtopping Potential. Based on approximate analyses, the spillway is too small to pass 50 percent of the probable maximum flood without overtopping the dam. The spillway will not pass the ten percent probability flood but will pass 10 percent of the probable maximum flood without overtopping. Overtopping is dangerous because the flow of water over the crest could erode the face of the dam and, if continued long enough, could breach the dam with sudden release of all of the impounded water into the downstream floodplain. Based on these data, the hydrologic capability of Junior Lake Dam should be considered as seriously inadequate for a high hazard potential structure.

The results of the routings through the dam are tabulated in regards to the following conditions:

<u>Frequency</u>	<u>Inflow Discharge c.f.s.</u>	<u>Outflow Discharge c.f.s.</u>	<u>Maximum Pool Elevation</u>	<u>*Maximum Depth Over Dam Feet</u>	<u>Duration Over Top Hours</u>
10%	2060	2030	806.1	0.5	2+
1%	3100	3100	806.6	1.0	3±
1/2 PMF	5900	5900	807.2	1.6	7±
PMF	11800	11800	808.2	2.6	12+
0.10 PMF	1180	1160	805.6	0	0

*Minimum top of dam elevation - 805.6.

According to the recommended guidelines from the Department of the Army, Office of the Chief of Engineers, this dam is classified as having a high hazard potential rating and a small size. Therefore, the 1/2 PMF to PMF is the test for the adequacy of the dam and its spillway.

The estimated damage zone is described in paragraph 1.2 d in this report.

SECTION 6 - STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY

- a. Visual Observation. The downstream slopes of both legs of the dam appear to be structurally stable with no sliding, cracking, abnormal deformation or erosion. The westernmost portion of the upstream face of the south leg, which is protected with riprap, is in good condition with no signs of distress. The upstream slopes of the remainder of the south leg and most of the east leg, which were not protected with riprap, are badly eroded as stated in paragraph 3.2b(2) of this report. Rodent activity (probably muskrat) on the upstream face has allowed water penetration in several locations with subsequent collapse of the upstream slope and significant portions of the crest. The materials from which the dam is constructed are not erosion resistant and continued erosion in the areas where only 2 to 3 feet of crest remains could result in fairly rapid breaching of the dam with less water level in the reservoir than would be required for overtopping.
- b. Design and Construction Data. No design or construction data were available. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.
- c. Operating Records. There are no controlled operating facilities for this dam.
- d. Post-Construction Changes. The inspection team is not aware of any post-construction changes other than the addition of the concrete weir crest to the spillway in either the late 1960's or early 1970's.
- e. Seismic Stability. This dam is located in Seismic Zone 1. An earthquake of the magnitude predicted in this area is not expected to cause structural failure of this dam.

SECTION 7 - ASSESSMENT/REMEDIAL MEASURES

7.1 DAM ASSESSMENT

- a. Safety. This dam is in very poor condition with a serious potential of failure. Failure could occur prior to the water in the reservoir overtopping the low point of the dam. The upstream slope and crest of the east leg and a portion of the south leg not protected by riprap has eroded to a depth lower than the spillway crest. Remaining crest width in several locations varies from 2 to 3 feet. Continued wave action with the water at the spillway crest elevation or above could erode through the crest in any of the several locations where most of the crest has been eroded away. The materials from which the dam is constructed offer little resistance to erosion. The lack of riprap on the upstream slope of the east leg and a portion of the south leg, rodent activity on the embankment and uncontrolled brush and tree growth have contributed heavily to the problems of this dam. Siltation has been and will continue to be a problem with the reservoir. Approximate analyses performed for this report indicate that the dam is seriously inadequate from the hydrologic standpoint. The ten percent probability flood will overtop the dam by 0.5 foot for about 2 hours. The extent of the damage that would result from overtopping and probable breaching of the dam is not known, but it should be less than normally expected due to decreased reservoir capacity caused by siltation.

Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.

- b. Adequacy of Information. No design or construction data were available. The conclusions in this report are based upon performance history and the visual inspection of the structure. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.
- c. Urgency. The items recommended in paragraphs 7.2.a. and 7.2.b. should be pursued on a high priority basis.
- d. Necessity for Further Investigations. The additional studies and analyses recommended in paragraph 7.2b should be accomplished by the owner on a high priority basis.
- e. Seismic Stability. This dam is located in Seismic Zone 1. An earthquake of this magnitude is not expected to be hazardous to this dam. It is recommended, however, that the prescribed seismic loading for Seismic Zone 1 be applied in any stability analyses performed for this dam.

7.2 REMEDIAL MEASURES

The following remedial measures and maintenance procedures are recommended. All remedial measures should be performed under the guidance of a registered professional engineer experienced in the design and construction of earth dams.



a. Alternatives.

- (1) Studies should be performed to determine the amount of siltation in the reservoir, the stage-storage relationships of the reservoir, and the extent of downstream damages that could result from failure of the dam. The results of these studies should be used in implementation of the remedial measure recommended in paragraph 7.2.a.(2).
- (2) The height of the dam should be increased in order to pass 50 percent of the probable maximum flood through the existing spillway without overtopping the dam.

b. Operation and Maintenance Procedures.

- (1) Seepage and stability analyses comparable to the requirements of the recommended guidelines should be performed by an engineer experienced in the design and construction of dams.
- (2) Trees and brush should be removed from the embankment and the spillway exit section. Tree removal should be done under the guidance of an engineer experienced in the design and construction of dams.
- (3) Rodent burrows in the embankment should be eliminated.
- (4) Cracks and spalls in the concrete spillway should be repaired.
- (5) The water level should be lowered and/or the reservoir should be drained in order to facilitate the rehabilitation of the reservoir and the modification of the dam.
- (6) A program of periodic inspection and regular maintenance should be instituted. Maintenance procedures should be focused on eliminating tree growth and rodent activity as well as making timely repairs of eroded areas and the spillway system. All records of inspections and maintenance operations should be made a part of this project file.

APPENDIX A
MAPS

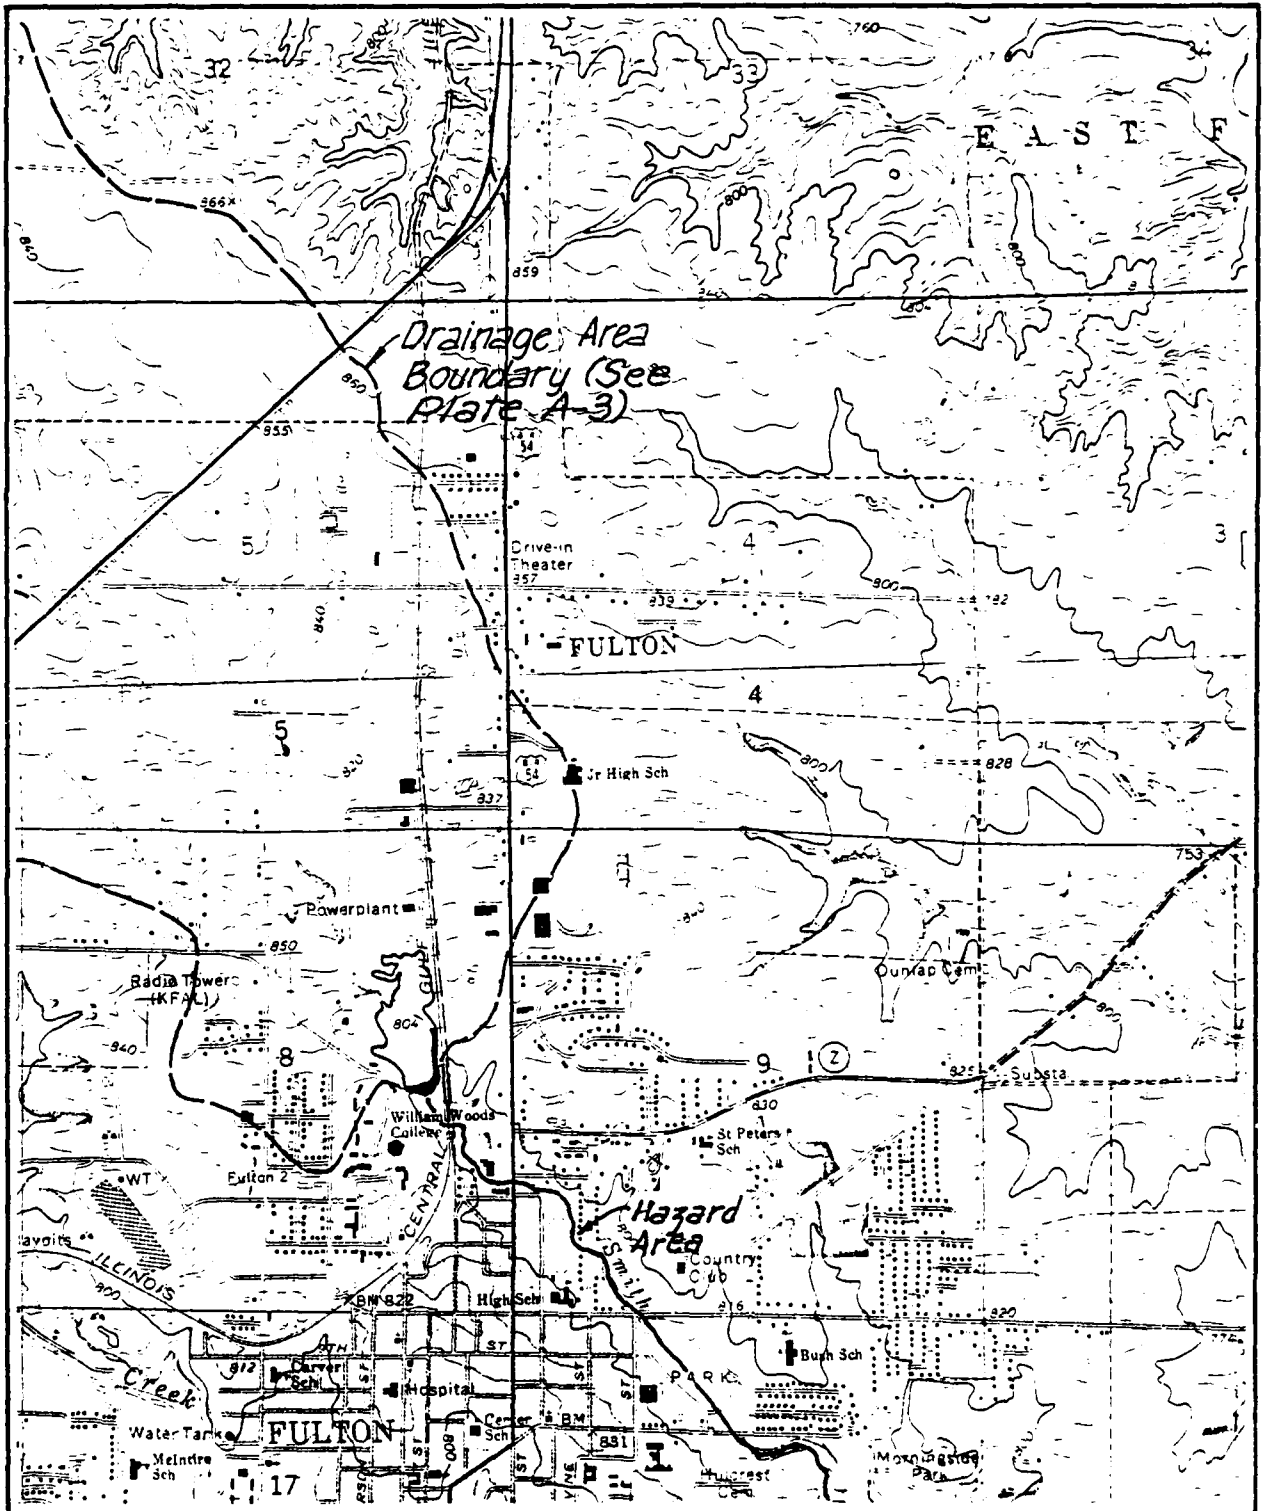

Contour Interval - 20'




VICINITY TOPOGRAPHY

JUNIOR LAKE DAM

CALLAWAY COUNTY, MO.

MO 11526


PLATE A-1

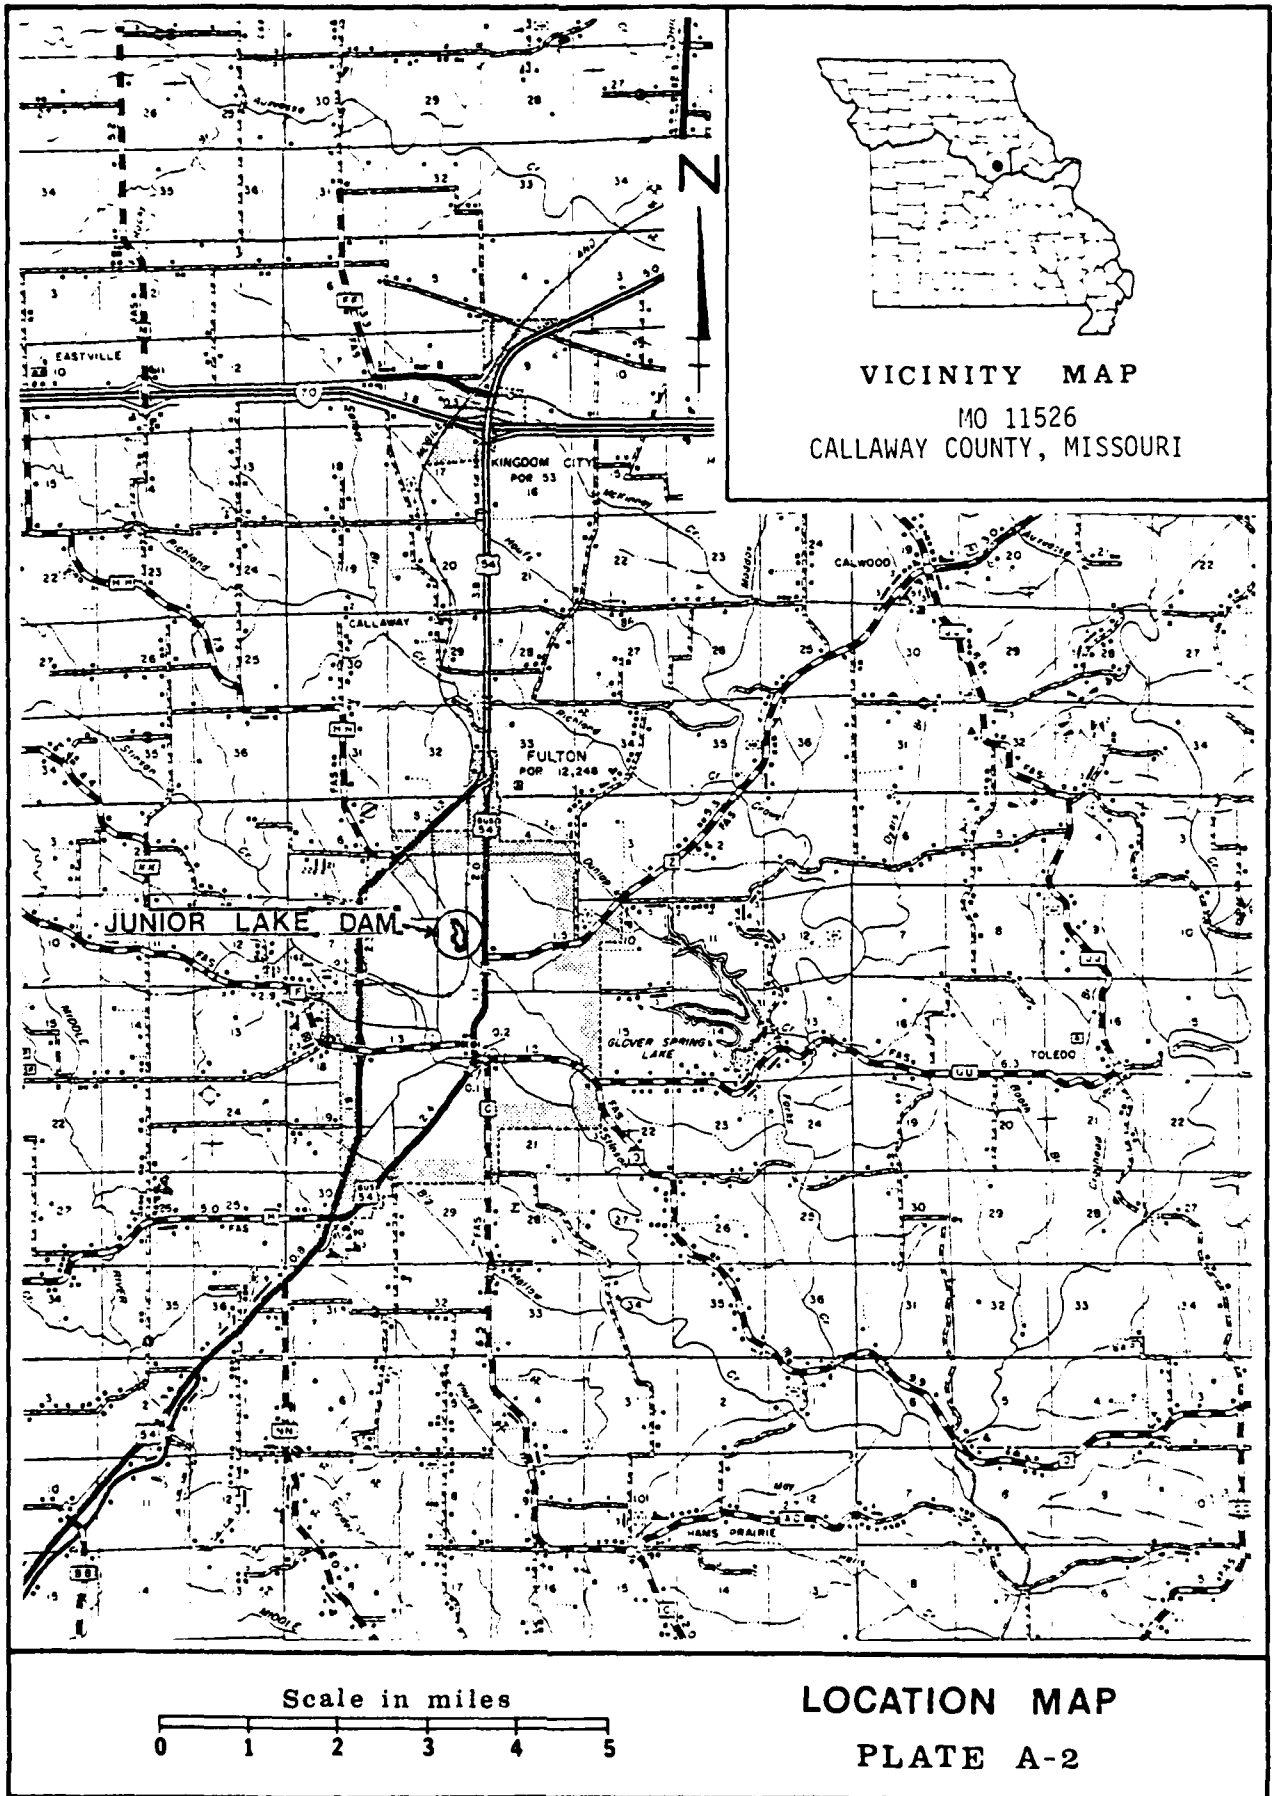

VICINITY MAP
MO 11526
CALLAWAY COUNTY, MISSOURI

Scale in miles
0 1 2 3 4 5

LOCATION MAP
PLATE A-2

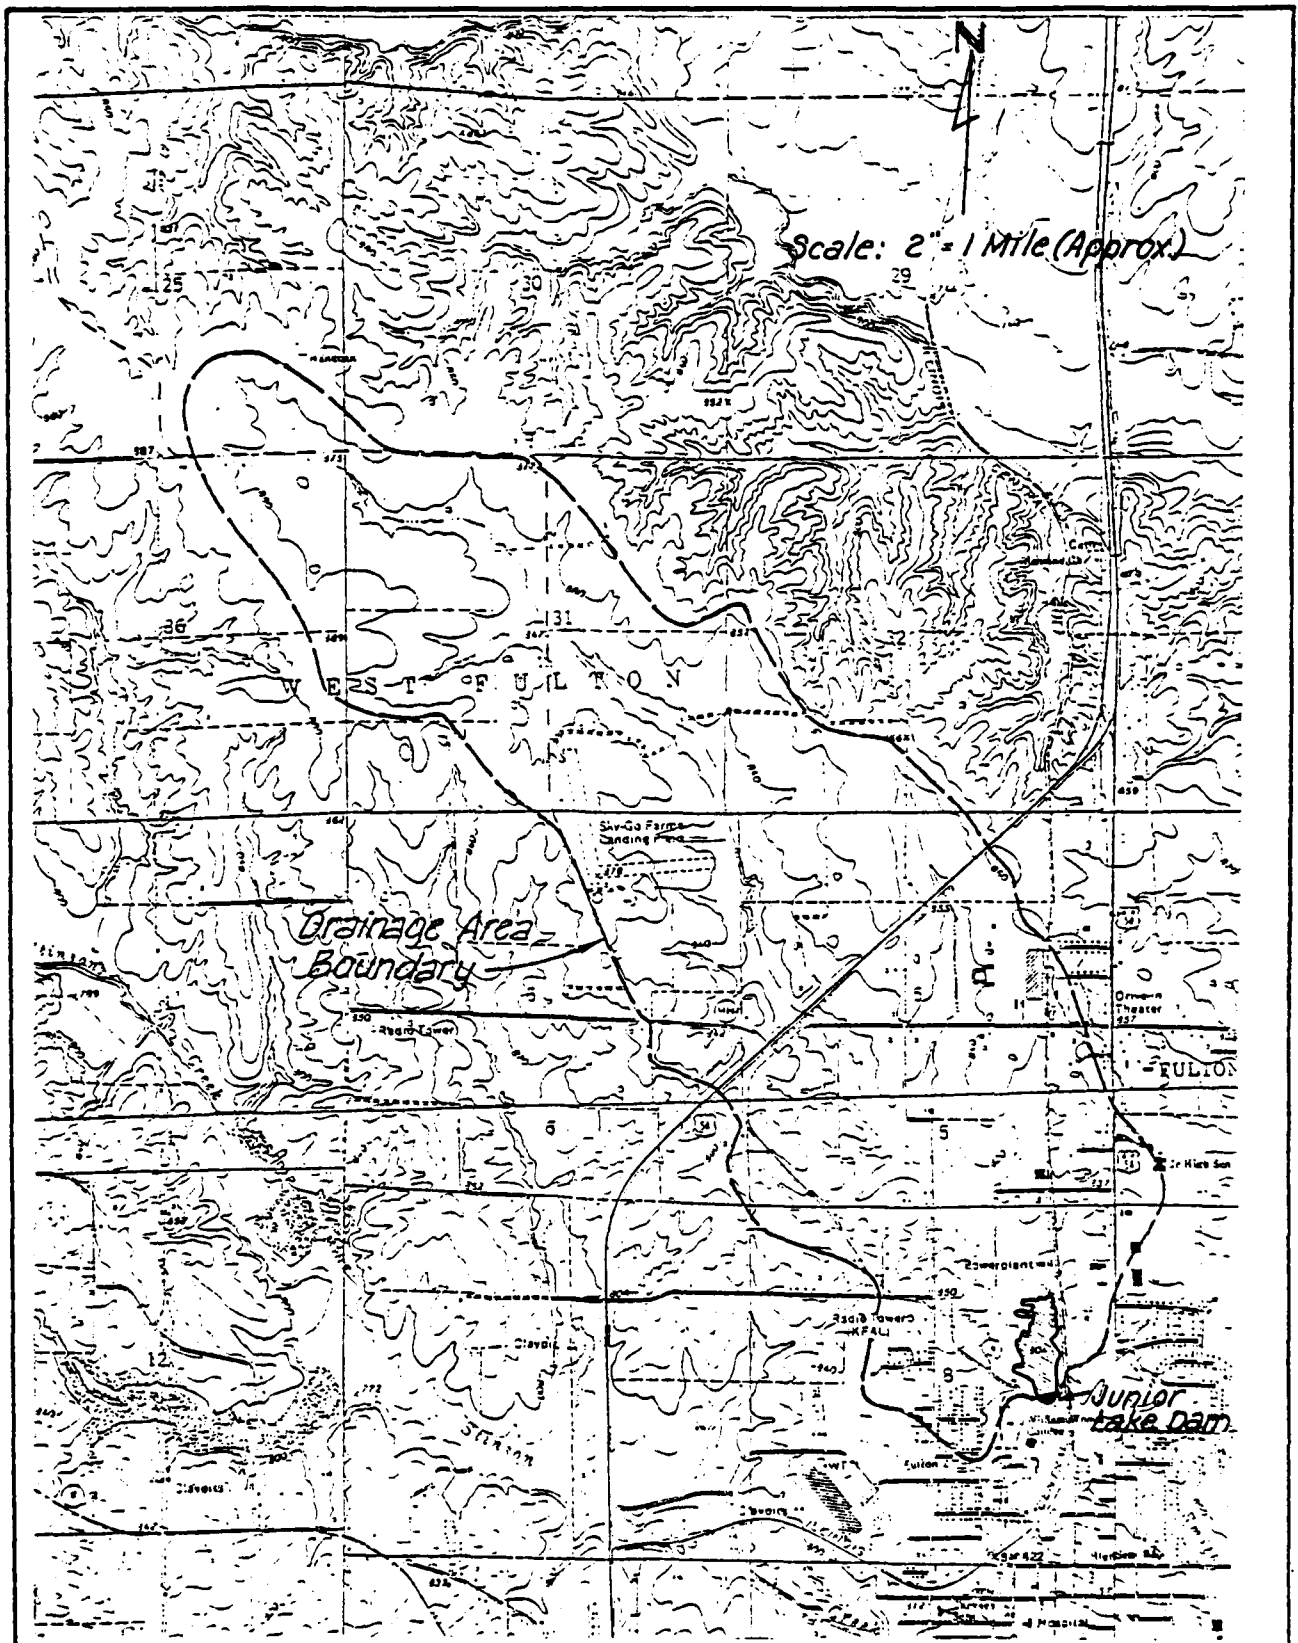

JUNIOR LAKE DAM
 CALLAWAY COUNTY, MO.
 MO 11526

DRAINAGE AREA MAP
 PLATE A-3

APPENDIX B
PHOTOGRAPHS



JUNIOR LAKE DAM
CALLAWAY COUNTY, MISSOURI
MO 11526

PHOTO INDEX

PLATE B-1



PHOTO NO. 2 - UPSTREAM FACE TAKEN FROM THE RIGHT SIDE



PHOTO NO. 3 - UPSTREAM SLOPE AND CREST OF THE SOUTH LEG
TAKEN FROM THE LEFT SIDE



PHOTO NO. 4 - UPSTREAM FACE OF THE SOUTH AND EAST LEGS
TAKEN FROM THE LEFT END OF THE EAST LEG



PHOTO NO. 5 - RIPRAP ON THE SOUTH LEG. IT EXTENDS ABOUT
150 FEET LEFT OF THE SPILLWAY

NO. 1
FORM 2



PHOTO NO. 6 - THE UPSTREAM SLOPE AND CREST OF THE EAST LEG
LOOKING NORTH. THE UPSTREAM SLOPE IS BADLY
ERODED



PHOTO NO. 7 - DOWNSTREAM CREST OF THE SOUTH LEG LOOKING
FROM LEFT TO RIGHT, OR LOOKING TOWARD
THE WEST



PHOTO NO. 8 - DOWNSTREAM SLOPE OF THE EAST LEG TAKEN FROM
THE LEFT END OF THE SOUTH LEG LOOKING
NORTH. COMPLETELY COVERED WITH BRUSH AND
TREES.



PHOTO NO. 9 - LOOKING DOWNSTREAM FROM THE LEFT END OF THE
SPILLWAY



PHOTO NO. 10 - CREST TAKEN FROM THE RIGHT SIDE



PHOTO NO. 11 - CREST OF THE EAST LEG LOOKING NORTH FROM
JUST NORTH OF THE END OF THE SOUTH LEG



PHOTO NO. 12 - A HOLE ERODED
IN THE UP-
STREAM FACE
OF DAM ABOUT
50 FEET FROM
THE LEFT END
OF THE SOUTH
LEG OF THE
DAM. IT
EXTENDS INTO
THE EMBANKMENT
ABOUT 3 FEET
AND IS APPROX.
10 FEET WIDE.

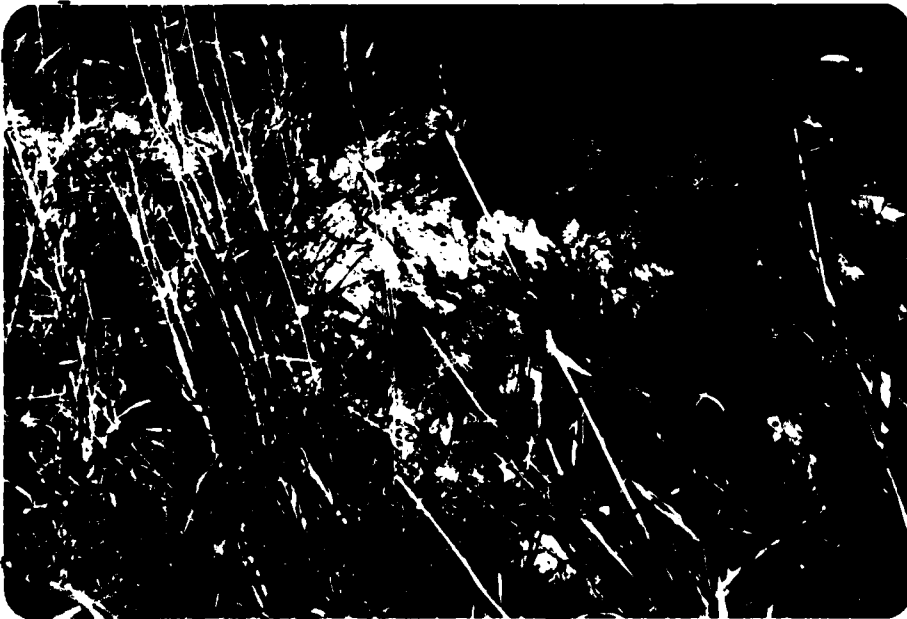


PHOTO NO. 13 - EROSION OF THE UPSTREAM FACE OF THE EAST
LEG AT ABOUT STATION 3+75 OR 4+00



PHOTO NO. 14 - EROSION OF CREST OF THE EAST LEG OF THE
AREA TAKEN IN PHOTO NO. 15. CREST
MEASURES ONLY 3 FEET IN WIDTH AT THIS
LOCATION.



PHOTO NO. 15 - EROSION OF THE UPSTREAM FACE AT STATION
3+00



PHOTO NO. 16 - EROSION ACTIVITY
ON THE UPSTREAM
FACE OF THE
EAST LEG



PHOTO NO. 17 - CONCRETE SPILLWAY TAKEN FROM RIGHT END



PHOTO NO. 18 - LOOKING DOWNSTREAM IN THE CHANNEL BELOW
THE SPILLWAY



PHOTO NO. 19 - SOME CRACKS
IN THE
DOWNSTREAM
FACE OF
THE WEIR
SECTION.
LOOKS LIKE
THE WEIR
HAS BEEN
PLACED ON
AN OLD
OGEE SPILL-
WAY SECTION.



PHOTO NO. 20 - A BAD CRACK EXPOSING REINFORCING STEEL IN THE WEIR SECTION ABOUT 40 FEET FROM THE LEFT END OF THE WEIR



PHOTO NO. 21 - CRACK IN THE Ogee SPILLWAY SECTION ABOUT 40 FEET FROM THE RIGHT END. IT IS ABOUT 2 INCHES WIDE. PHOTO TAKEN LOOKING SOUTH DOWN THE SPILLWAY.



PHOTO NO. 22 - BEDROCK OUTCROP IN THE CHANNEL ABOUT 100
FEET DOWNSTREAM FROM THE SPILLWAY



PHOTO NO. 23 - LOOKING UPSTREAM FROM THE LEFT END OF THE
SPILLWAY



PHOTO NO. 24 - DWELLING AT APPROXIMATELY 0.2 MILES DOWN-
STREAM OF DAM

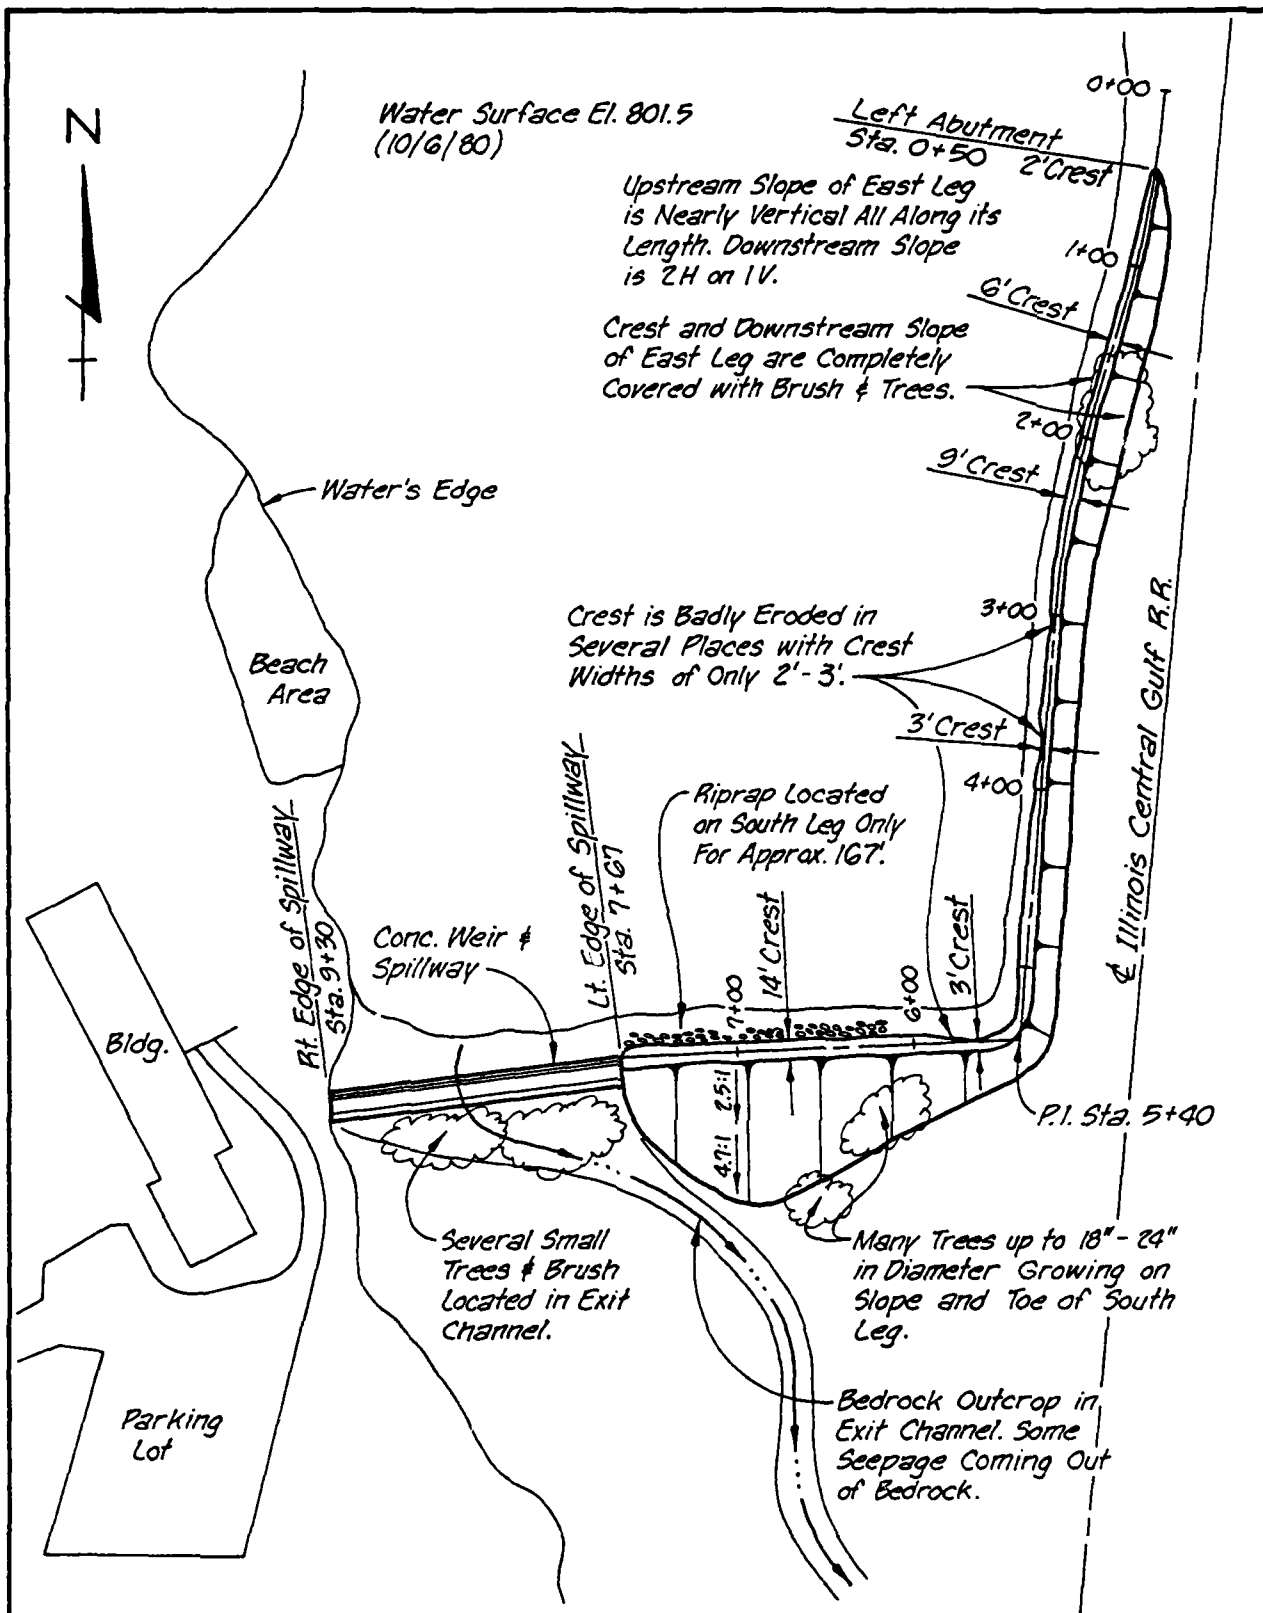


PHOTO NO. 25 - DWELLING AT 0.3 MILES DOWNSTREAM OF DAM



PHOTO NO. 26 - LOOKING WEST AT LARGE GROCERY STORE
APPROXIMATELY 0.25 MILES DOWNSTREAM
OF DAM. THE CHANNEL IS TO THE LEFT
IN THE PICTURE.



APPENDIX C
PROJECT PLATES




JUNIOR LAKE DAM
CALLAWAY COUNTY, MISSOURI
MO 11526

PLAN OF DAM


PLATE C-1

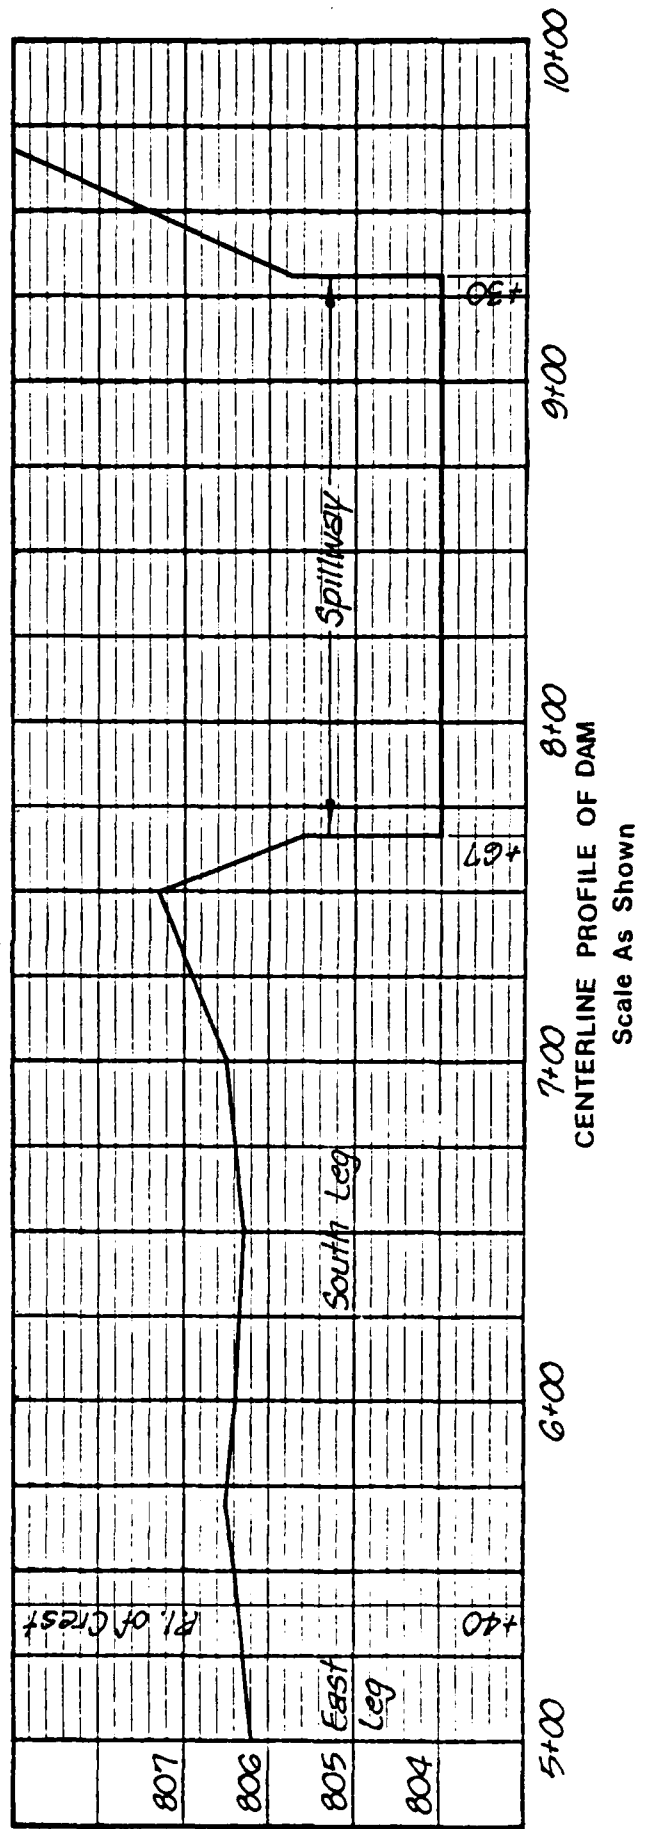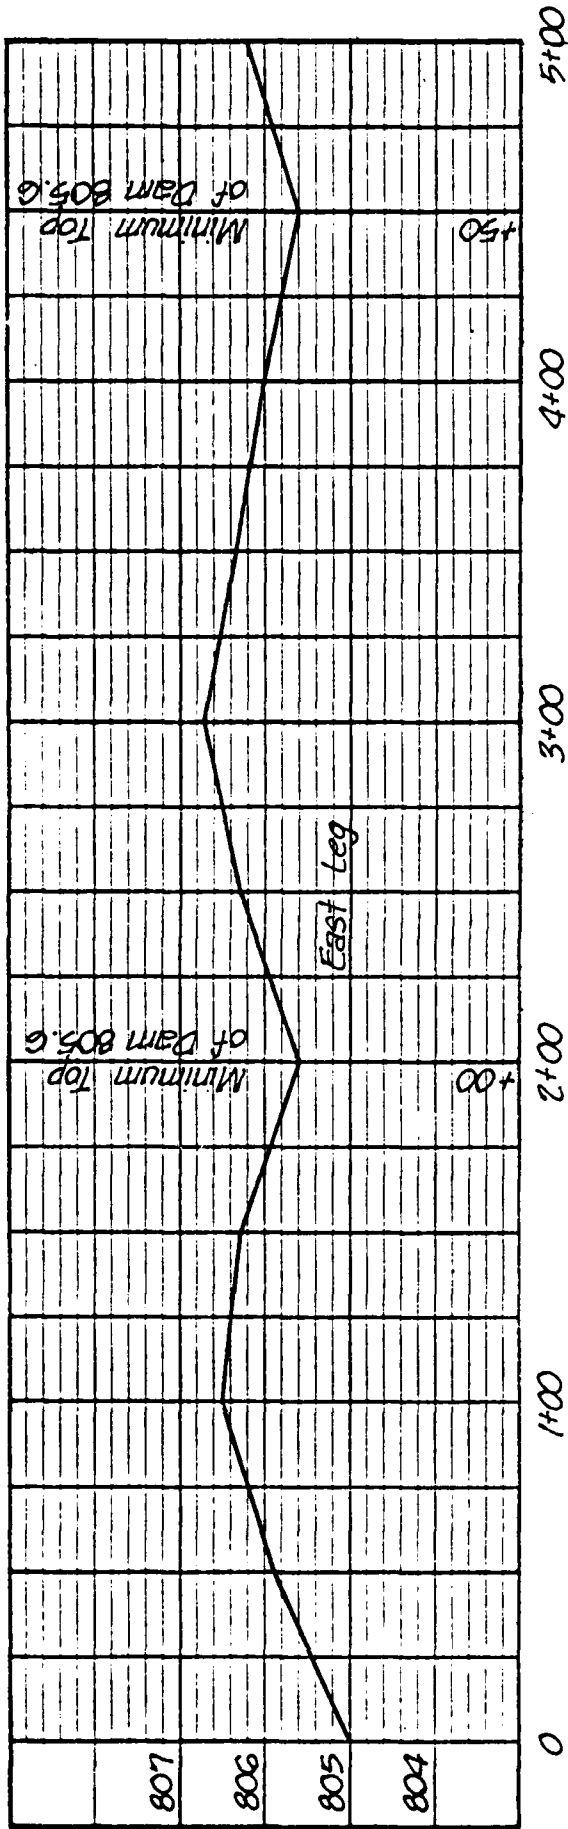

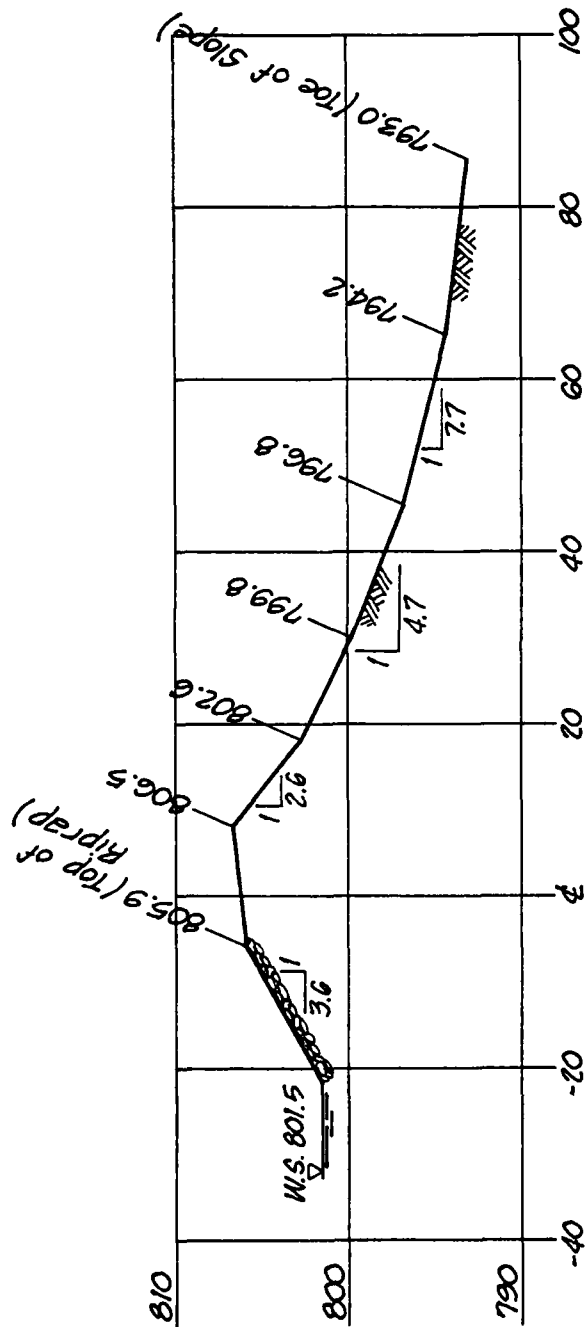

MAXIMUM CROSS-SECTION OF DAM AT STA. 7+00

Scale: 1" = 20' H.; 1" = 10' V.

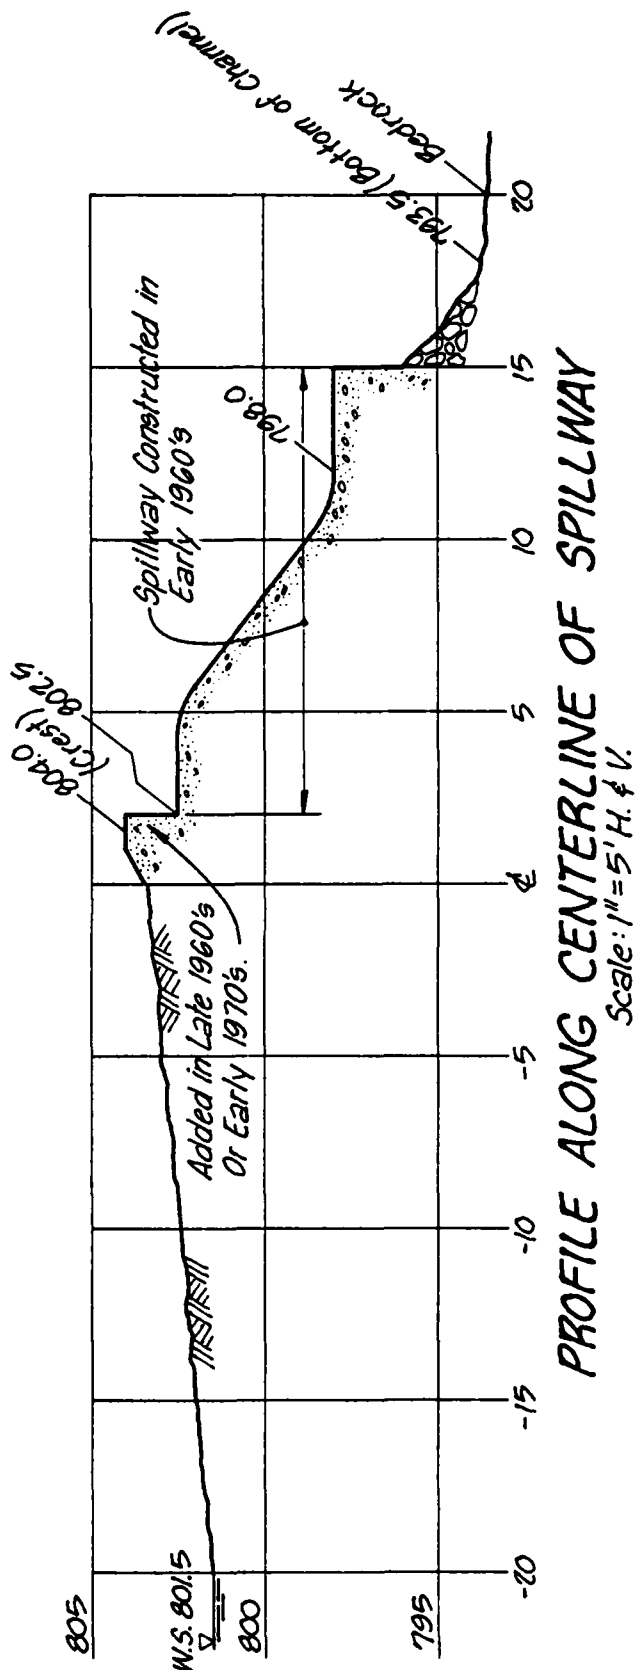

PROFILE ALONG CENTERLINE OF SPILLWAY


Scale: 1" = 5' H. & V.

APPENDIX D
HYDRAULIC AND HYDROLOGIC DATA


HYDROLOGIC COMPUTATIONS

1. The SCS dimensionless unit hydrograph and the systemized computer program HEC-1 (Dam Safety Version), July 1978, prepared by the Hydrologic Engineering Center, U.S. Corps of Engineers, Davis, California, were used to develop the inflow hydrographs (See this Appendix).
 - a. Forty-eight hour, one percent probabilistic rainfall and ten percent probabilistic rainfall for the dam location was taken from the data for the rainfall station at Moberly, MO. as supplied by the St. Louis District, Corps of Engineers per their letter dated 4 March 1980. The forty-eight hour probable maximum precipitation was taken from the curves of Hydrometeorological Report No. 33 and current Corps of Engineers and St. Louis policy and guidance for hydraulics and hydrology.
 - b. Drainage area = 2.89 square miles (1852 acres).
 - c. Time of concentration of runoff = 152 minutes (computed from the "Kirpich" formula and verified using the "California Highway Department" method).
 - d. The antecedent storm conditions for the probable maximum precipitation were heavy rainfall and low temperatures which occurred on the previous 5 days (SCS AMC III). The antecedent storm conditions for the one and ten percent probabilistic precipitations were an average of the conditions which have preceded the occurrence of the maximum annual flood on numerous watersheds (SCS AMC II). The initial pool elevation was assumed at the crest of the spillway.
 - e. The total forty-eight hour storm duration losses for the one percent and ten percent probabilistic storms were 1.44 inches and 1.36 inches respectively. The total losses for the PMF storm were 0.62 inches. These data are based on SCS runoff curve No. 95 and No. 88 for antecedent moisture conditions SCS AMC III and AMC II respectively. The watershed is composed of primarily SCS soil groups Putnam and Mexico (hydrologic soil group D). The majority of the watershed is in cultivated crops which consist of primarily row crops and small grain.
 - f. Average soil loss rates = 0.01 inch per hour approximately.
2. The combined discharge rating consisted of two components: the flow through the spillway and the flow over the top of the dam.
 - a. The spillway rating was developed using the broad crested weir equation -
$$Q = CLH^{1.5}$$
where C = weir coefficient which varied with head, values ranged from 2.9 to 3.7 (values obtained from Figure 7, "Measurement of Peak Discharge at Dams by Indirect Method", Book 3, Chap. A5, U.S.G.S.)
L = length of weir, ft. = 163
H = total head, ft. = pool elevation - 804.0

- b. The flows over the dam were developed using the dam overtopping analysis (flow over non-level dam crest) with the HEC-1 (Dam Safety Version) Program.
3. Floods were routed through the reservoir using the HEC-1 (Dam Safety Version) Program to determine the capabilities of the spillway and dam embankment crest. The input, output, and plotted hydrographs are attached in this Appendix.

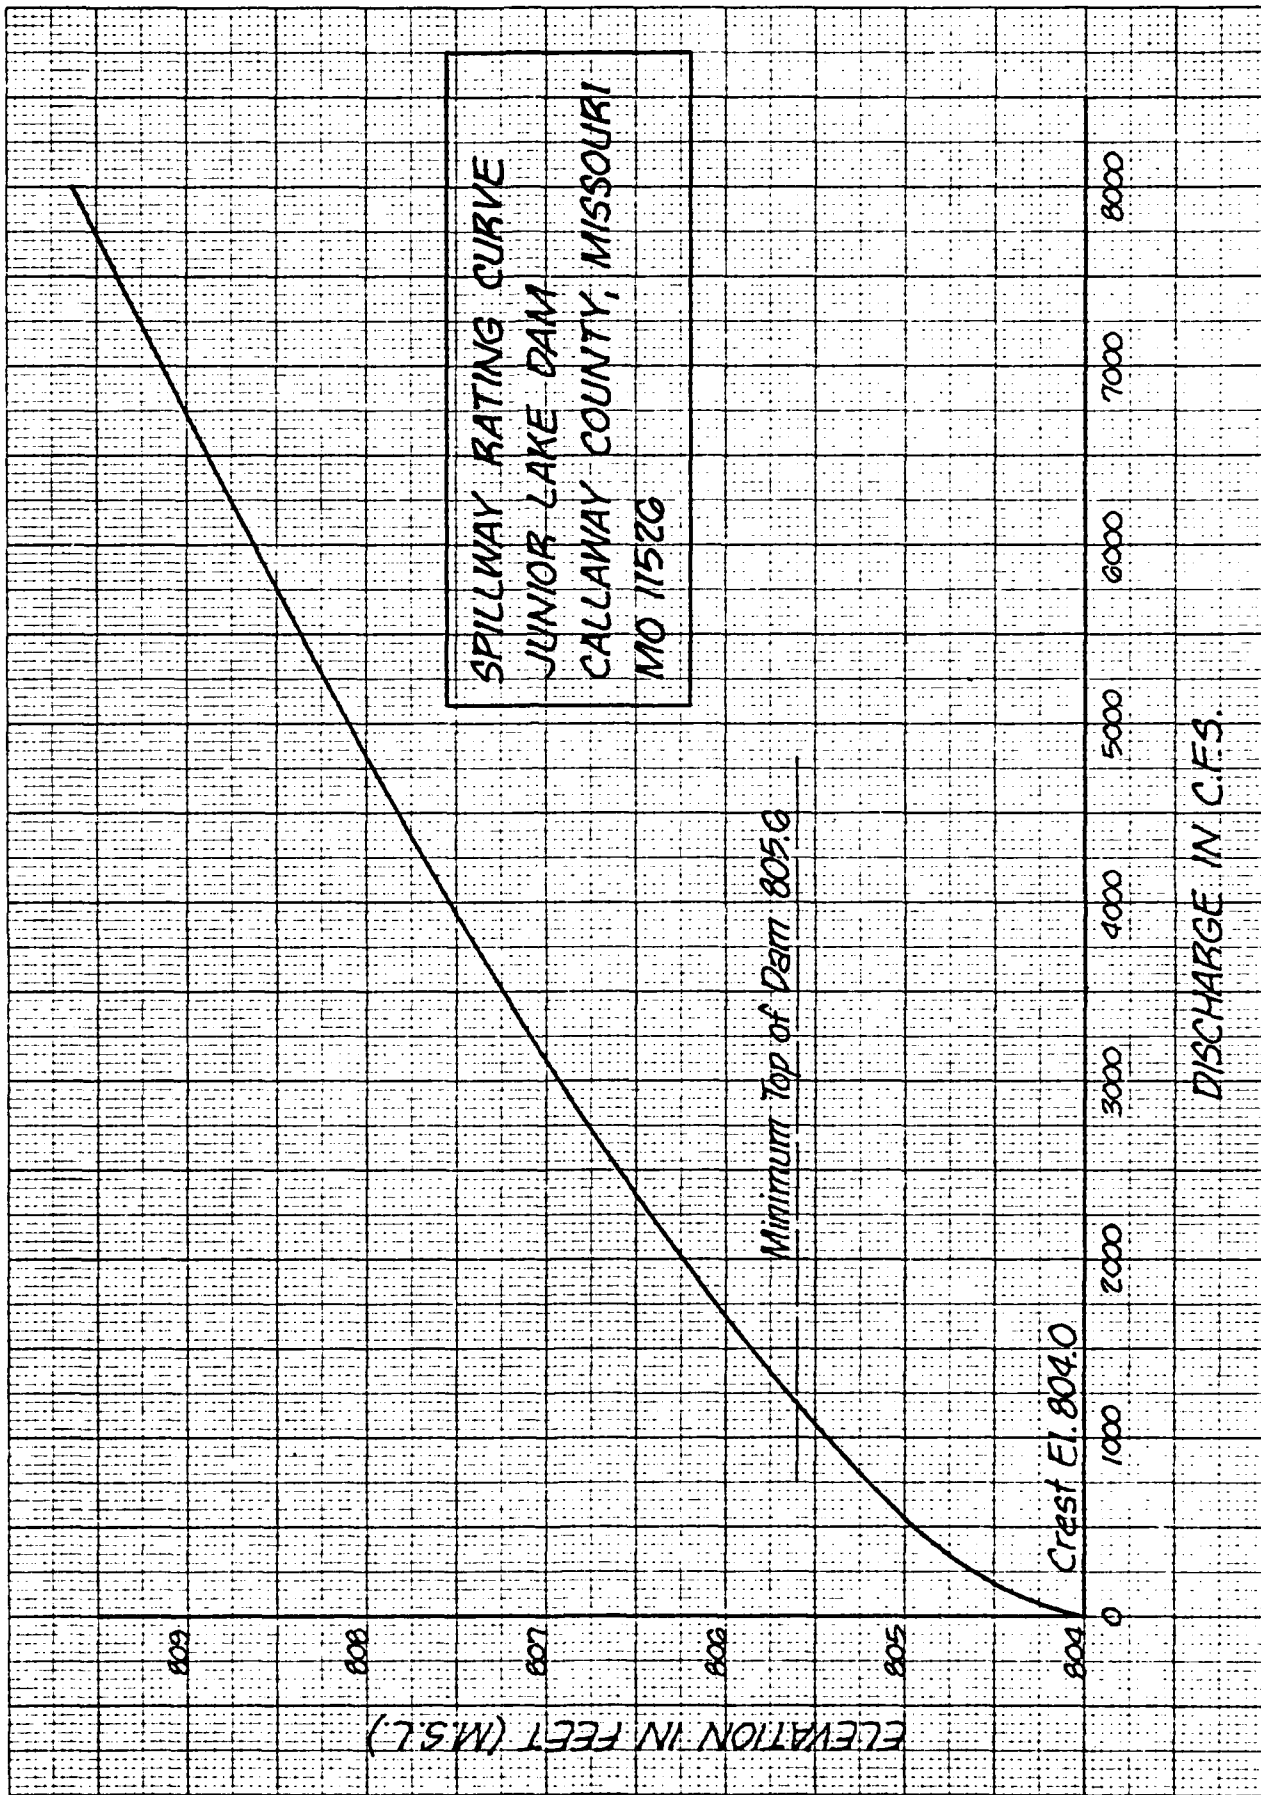

STORAGE IN ACRE-FEET

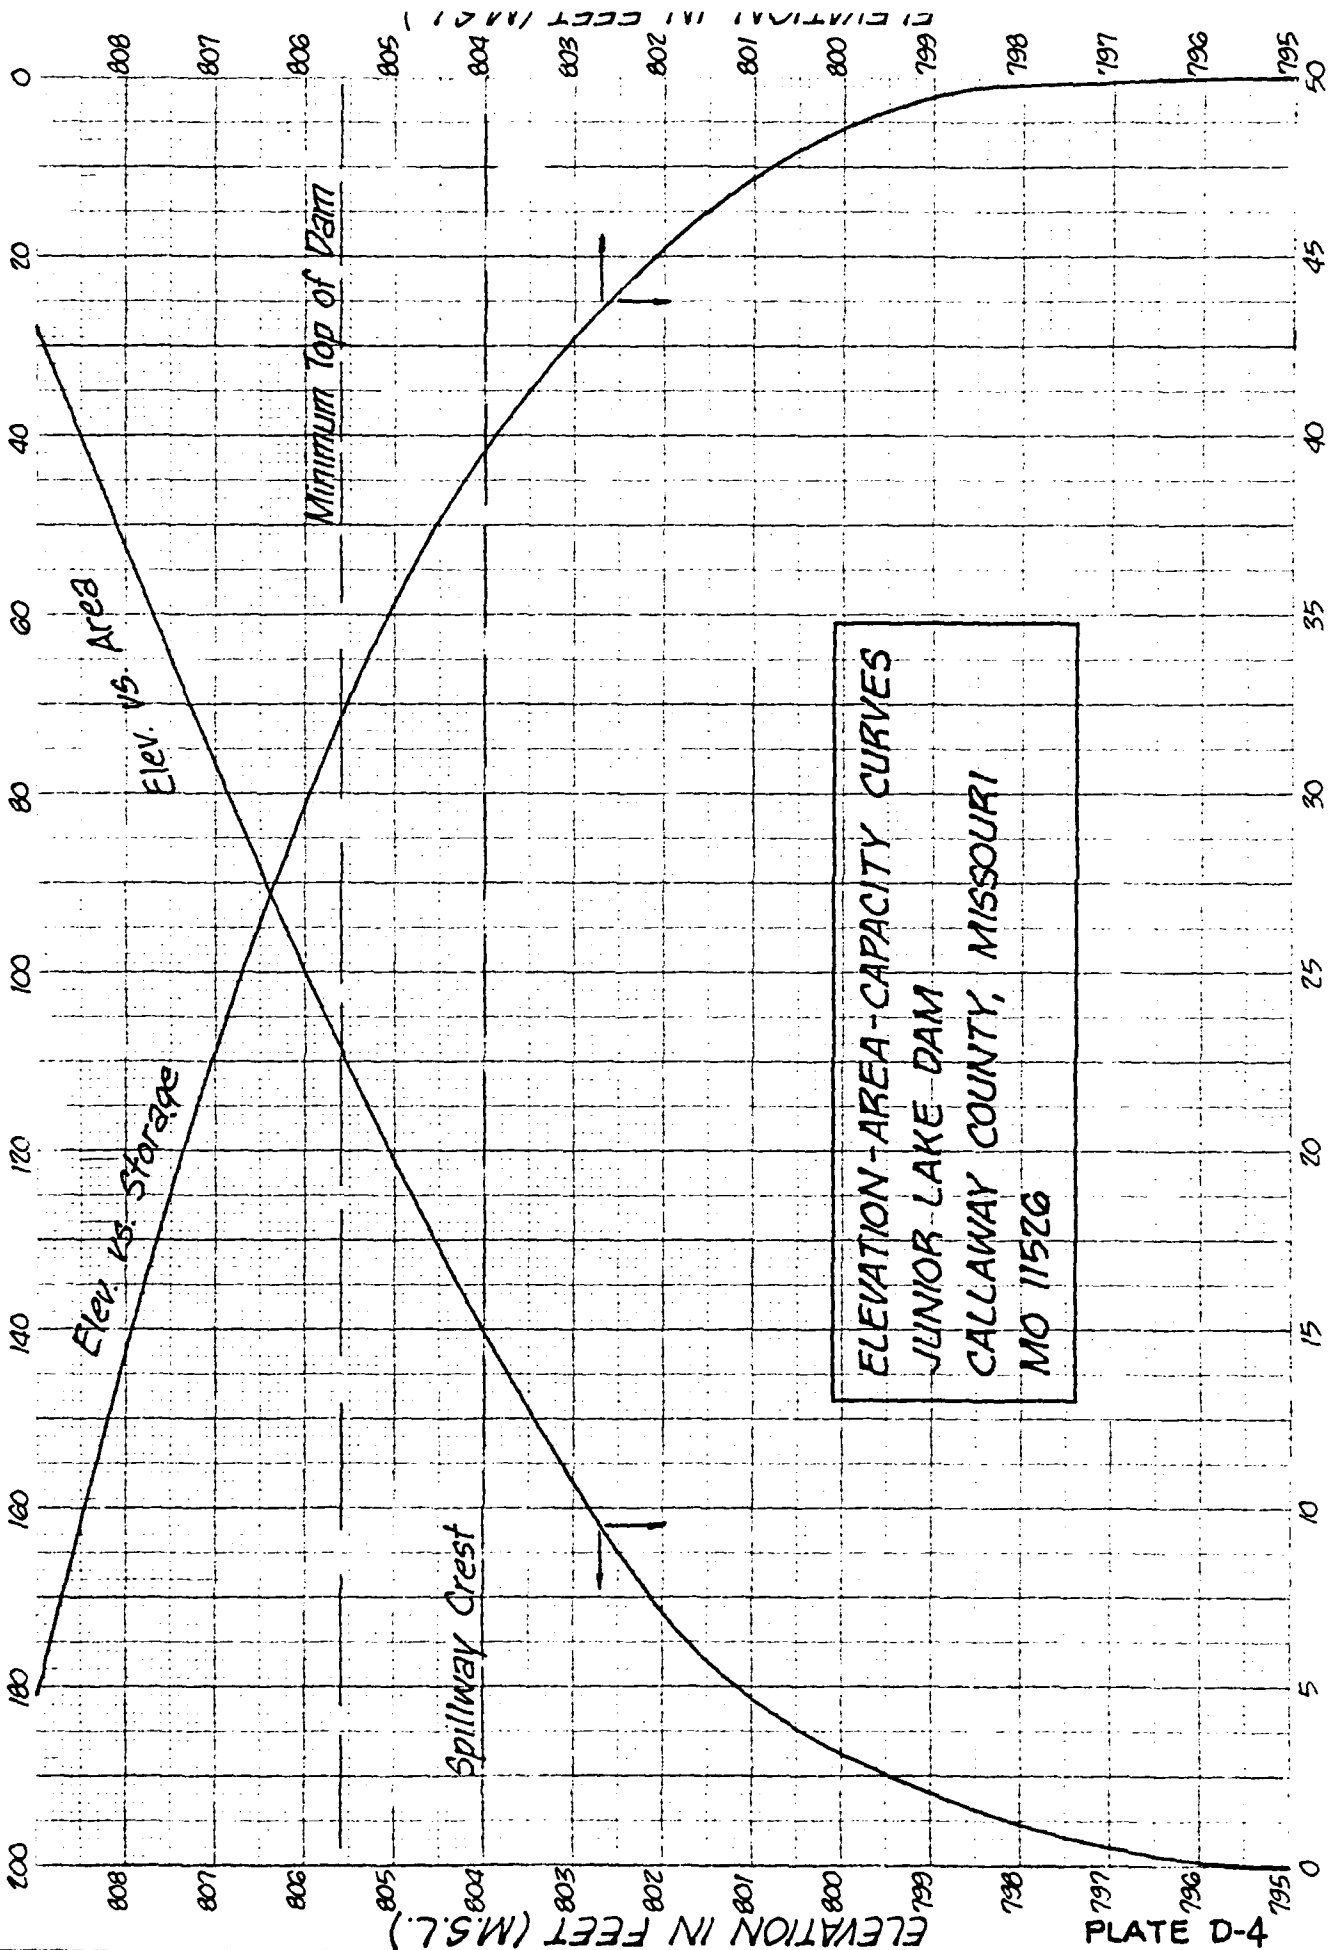

ELEVATION-AREA-CAPACITY CURVES
JUNIOR LAKE DAM
CALLAWAY COUNTY, MISSOURI
MO 11526

SURFACE AREA IN ACRES

ANALYSIS OF DAM OVERTOPPING USING RATIOS OF PMF
 (I) & H ANALYSIS OF SAFETY OF JUNIOR LAKE DAM 11526
 RATIOS OF PMF ROUTED THROUGH THE RESERVOIR
 000000000000000000000003

B1 000009
 J 0000010000000000000001
 J1 000.1000000.1100000.1200000.1300000.1400000.1500000.50000001.0
 K 0000000000000001
 K1 CALCULATION OF INFLOW HYDROGRAPH TO RESERVOIR 11526
 M 0000010000000200002.89
 P 000000000024.9000001020000012100000130000000140
 T -1.0 -95.0
 W2 00001:52
 X 000000 -0.1100000001
 K 00000100000002 Routed Flows Through Reservoir 11526
 K1
 Y1 000001
 Y4 0004.000004.500005.000006.000006.500006.500007.500008.000008.5
 Y4 0009.0
 Y5 0000000000174000054100001072000017060000230400003134000039490000482500005757
 Y5 006743
 \$A 00000000000007.1000014.9000043.0
 \$E 000795000001.5000804.0000809.0
 \$00004.0
 \$D 0005.6000002.9000001.5000000717
 \$L 000000000000320000019700000353000006600000724000007450000076700000767
 \$V 0805.6000806.0000806.3000806.5000806.7000807.0000807.5000808.0000809.0
 K-000099
 A A A A

PREVIEW OF SEQUENCE OF STREAM NETWORK CALCULATIONS

RUNOFF HYDROGRAPH AT 000001
ROUTE HYDROGRAPH TO 000002
END OF NETWORK

 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 26 FEB 79

RUN DATE# 80/11/07.
 TIME# 10.55.40.

ANALYSIS OF DAM OVERTOPPING USING RATIOS OF PMF
 IN 3-D ANALYSIS OF SAFETY OF JUNIOR LAKE DAM 11526
 RATIOS OF PMF ROUTED THROUGH THE RESERVOIR

NQ	NHR	NMIN	IDAY	JOB SPECIFICATION	IPLT	IPRI	NSTAN
289	0	12	0	IHR ININ METRC	0	3	0
			JOPER	NWT LROPT TRACE			
			5	0 0 0			

MULTI-PLAN ANALYSES TO BE PERFORMED

RTIOS= :10 :11 :12 :13 :14 :15 :90 :1:00

SUB-AREA RUNOFF COMPUTATION

CALCULATION OF INFLOW HYDROGRAPH TO RESERVOIR 11526

ISTAG	ICOMP	IECON	ITAPE	JPLT	JPRI	INAME	ISTAGE	IAUTO
000001	0	0	0	0	0	1	0	0

HYDROGRAPH DATA

IHYG	IUNG	TAREA	SNAP	TRSDA	TRSPC	RATIO	ISNOW	ISAME	LOCAL
1	2	2.89	0.00	2.89	1.00	0.000	0	0	0

PRECIP DATA

SPEE	PMS	R6	R12	R24	R48	R72	R96
0.00	24.90	102.00	121.00	130.00	140.00	0.00	0.00

LOSS DATA

LROPT	SINKR	DLTKR	RTIOL	ERAIN	STRSK	RTIOK	SIRTL	CNSTL	ALSMX	RIIMP
0	0.00	0.00	1.00	0.00	0.00	1.00	1.00	-95.00	0.00	0.00

CURVE NO = -95.00 WETNESS = -1.00 EFFECT CN = 95.00

UNIT HYDROGRAPH DATA

TC= 0:00 LAG= 1:52

RECESSION DATA

STRTQ=	0.00	GRCSN=	-0.01	RTIUR=	1.00
UNIT HYDROGRAPH NO END OF PERIOD ORIGINATES, TC=	0.00	HOURS, LAG=	1.52	VOL=	1.00
40:	236:	396:	745:	661:	847:
701:	478:	379:	252:	173:	141:
93:	63:	51:	42:	23:	19:
12:	9:	6:	5:	2:	1:

7.	00	71	71	71	04	58	00	01	01	59	48	01
11842	.00	.71	.71	.71	.04	34	.00	.01	.04	61	12	.01
111328	.00	.56	.56	.56	.04	02	.01	.03	.04	62	14	.01
10141	.00	.56	.56	.56	.04	36	.01	.03	.04	63	36	.01
9347	.00	.04	.04	.04	.04	02	.01	.04	.05	64	48	.01
86290	.00	.04	.04	.04	.04	02	.01	.04	.05	65	12	.01
7392	.00	.04	.04	.04	.04	46	.01	.04	.05	66	36	.01
6146	.00	.04	.04	.04	.04	02	.01	.04	.05	67	48	.01
5478	.00	.04	.04	.04	.04	02	.01	.05	.06	68	00	.01
4350	.00	.04	.04	.04	.04	02	.01	.05	.06	70	12	.01
3504	.00	.04	.04	.04	.04	36	.01	.05	.06	71	24	.01
3254	.00	.04	.04	.04	.04	02	.01	.05	.06	72	48	.01
2181	.00	.04	.04	.04	.04	02	.01	.07	.07	73	00	.01
1153	.00	.04	.04	.04	.04	02	.01	.12	.13	74	12	.01
1111	.00	.04	.04	.04	.04	68	.01	.11	.12	75	36	.01
1111	.00	.04	.04	.04	.04	02	.01	.05	.05	77	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.05	.05	79	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.05	.05	80	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.05	.05	81	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.05	.05	82	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.05	.05	83	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.05	.05	84	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.05	.05	85	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.04	.04	86	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.04	.04	87	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.04	.04	88	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.04	.04	89	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	90	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	91	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	92	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	93	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	94	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	95	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	96	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	97	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	98	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	99	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	100	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	101	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	102	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	103	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	104	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	105	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	106	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	107	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	108	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	109	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	110	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	111	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	112	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	113	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	114	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	115	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	116	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	117	00	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	118	12	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	119	36	.01
1111	.00	.04	.04	.04	.04	02	.00	.00	.00	120	00	.01

PEAK 6-HOUR 24-HOUR 72-HOUR TOTAL VOLUME
 11839. 7295. 2571. 1128. 324733.
 CFS 335. 207. 32. 32. 9195.
 INCHES 23.48 32.33 34.84 34.84
 MM 596.41 821.26 884.98 884.98
 AC-FT 3617. 4981. 5367. 5367.
 THOUS CU M 4462. 6144. 6621. 6621.

HYDROGRAPH ROUTING
 ROUTED FLOWS THROUGH RESERVOIR 11526

STAGE	804.00	805.00	806.50	807.00	807.50	808.00	808.50
FLOW	0.00	541.00	1072.00	1706.00	2384.00	3134.00	3949.00
SURFACE AREA	0.	7.	15.	43.			
CAPACITY	0.	15.	42.	181.			
ELEVATION	795.	802.	804.	809.			

ISIAQ	ICOMP	IECON	ITAPE	JPLI	JPRI	INAME	ISTAGE	IAUTO
00002	1	0	0	2	0	1	0	0

LOSS	CLOSS	AVG	ROUTING DATA	LOPI	IPMP	LSTR
0.0	0.00	0.00	ISAME	1	0	0

NSTPS	NSTDL	LAG	AMSKK	X	ISK	STORA	ISPHAI
1	0	0.00	0.00	0.00	0.00	-0.04	-1

CREST LENGTH AT OR BELOW ELEVATION	805.0	805.6	806.0	806.3	806.5	806.7	807.0	807.5	808.0	809.0
0.	32.	197.	353.	666.	724.	745.	767.	767.	767.	767.

TOPEL	COOR	DAM DATA	EXPD	DAMWID
805+6	2+9	1+5	7+7	

STATION 00002, PLAN 1, RATIO 1

END-OF-PERIOD-HYDROGRAPH-ORDINATES

804.0	804.1	804.2	804.3	804.4	804.5	804.6	804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0
804.1	804.2	804.3	804.4	804.5	804.6	804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1
804.2	804.3	804.4	804.5	804.6	804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2
804.3	804.4	804.5	804.6	804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3
804.4	804.5	804.6	804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3	806.4
804.5	804.6	804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3	806.4	806.5
804.6	804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3	806.4	806.5	806.6
804.7	804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3	806.4	806.5	806.6	806.7
804.8	804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3	806.4	806.5	806.6	806.7	806.8
804.9	805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3	806.4	806.5	806.6	806.7	806.8	806.9
805.0	805.1	805.2	805.3	805.4	805.5	805.6	805.7	805.8	805.9	806.0	806.1	806.2	806.3	806.4	806.5	806.6	806.7	806.8	806.9	807.0

PEAK OUTFLOW IS 1165. AT TIME 41.20 HOURS

PEAK	1165.	726.	257.	113.	32450.
CFS	726.	257.	113.	32450.	
GMS	726.	257.	113.	32450.	
INCHES	29.39	10.14	4.48	12.78	1278.
AC-FT	160.	61.4	23.6	936.	936.
THOUS-GU-M	444.	614.	661.	661.	661.
TOTAL VOLUME					32450.

STATION000002 010 PMF

DATE *

	INFLOW(1), 400.	OUTFLOW(1), 600.	AND OBSERVED FLOW(1), 1000.	1200.	0.	0.	0.	0.	0.	0.
11										
12										
13										
14										
15										
16										
17										
18										
19										
20										
21										
22										
23										
24										
25										
26										
27										
28										
29										
30										
31										
32										
33										
34										
35										
36										
37										
38										
39										
40										
41										
42										
43										
44										
45										
46										
47										
48										
49										
50										
51										
52										
53										
54										
55										
56										
57										
58										
59										
60										
61										
62										
63										
64										
65										
66										
67										
68										
69										
70										
71										
72										
73										
74										
75										
76										
77										
78										
79										
80										
81										
82										
83										
84										
85										
86										
87										
88										
89										
90										
91										
92										
93										
94										
95										
96										
97										
98										
99										
100										
101										
102										
103										
104										
105										
106										
107										
108										
109										
110										
111										
112										

11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100																					
11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100

25.401131
 0.001201
 .121211
 .241221
 .501231
 .401241
 1.001251
 1.121261
 1.2412701
 1.3612801
 1.44129.1
 2.00130.1
 2.12131.1
 2.24132.1
 2.36133.1
 2.44134.1
 3.00135.1
 3.12136.1
 3.24137.1
 3.36138.1
 3.44139.1
 4.00140.1
 4.12141.1
 4.24142.1
 4.36143.1
 4.44144.1
 5.00145.1
 5.12146.1
 5.24147.1
 5.36148.1
 5.44149.1
 6.00150.1
 6.12151.1
 6.24152.1
 6.36153.01
 6.44154.1
 7.00155.1
 7.12156.01
 7.24157.01
 7.36158.01
 7.44159.01
 8.00160.01
 8.12161.01
 8.24162.01
 8.36163.01
 8.44164.01
 9.00165.01
 9.12166.01
 9.24167.01
 9.36168.01
 9.44169.01
 10.00170.01
 10.12171.1
 10.24172.1
 10.36173.1
 10.44174.1
 11.00175.1
 11.12176.1
 11.24177.1
 11.36178.1
 11.44179.1
 12.00180.1

12.12101.	I
12.24182.	0I
12.36103.	0I
12.48164.	0I
13.00165.	0I
13.12186.	0I
13.24187.	0I
13.36100.	0I
13.48169.	0I
14.00190.	0I
14.12191.	0I
14.24192.	0I
14.36193.	0I
14.48194.	0I
15.00195.	0I
15.12196.	0I
15.24197.	0I
15.36198.	0I
15.48199.	0I
16.00200.	0I
16.12201.	0I
16.24202.	0I
16.36203.	0I
16.48204.	0I
17.00205.	0I
17.12206.	0I
17.24207.	0I
17.36208.	0I
17.48209.	0I
18.00210.	0I
18.12211.	0I
18.24212.	0I
18.36213.	0I
18.48214.	0I
19.00215.	0I
19.12216.	0I
19.24217.	0I
19.36218.	0I
19.48219.	0I
20.00220.	0I
20.12221.	0I
20.24222.	0I
20.36223.	0I
20.48224.	0I
21.00225.	0I
21.12226.	0I
21.24227.	0I
21.36228.	0I
21.48229.	0I
22.00230.	0I
22.12231.	0I
22.24232.	0I
22.36233.	0I
22.48234.	0I
23.00235.	0I
23.12236.	0I
23.24237.	0I
23.36238.	0I
23.48239.	0I
0.00240.	0I
.12241.	0I
.24242.	0I

3.6243.1
4.0244.1
1.00245.1
1.12346.1
1.20247.10
1.36248.10
1.48249.10
2.00250.1
2.12251.1
2.24252.1
2.36253.1
2.48254.1
3.00255.1
3.12256.1
3.24257.1
3.36258.1
3.48259.1
4.00260.1
4.12261.1
4.24262.1
4.36263.1
4.48264.1
5.00265.1
5.12266.1
5.24267.1
5.36268.1
5.48269.1
6.00270.1
6.12271.1
6.24272.1
6.36273.1
6.48274.1
7.00275.1
7.12276.1
7.24277.1
7.36278.1
7.48279.1
8.00280.1
8.12281.1
8.24282.1
8.36283.1
8.48284.1
9.00285.1
9.12286.1
9.24287.1
9.36288.1

OVF

STATION000002 [0.51M]

	0.	1000.	2000.	3000.	4000.	5000.	6000.	0.	0.	0.	0.	0.	0.
.12	11												
.24	21												
.36	31												
.48	41												
1.00	51												
1.12	61												
1.24	71												
1.36	81												
1.48	91												
2.00	101												
2.12	111												
2.24	121												
2.36	131												
2.48	141												
3.00	151												
3.12	161												
3.24	171												
3.36	181												
3.48	191												
4.00	201												
4.12	211												
4.24	221												
4.36	231												
4.48	241												
5.00	251												
5.12	261												
5.24	271												
5.36	281												
5.48	291												
6.00	301												
6.12	311												
6.24	321												
6.36	331												
6.48	341												
7.00	351												
7.12	361												
7.24	371												
7.36	381												
7.48	391												
8.00	401												
8.12	411												
8.24	421												
8.36	431												
8.48	441												
9.00	451												
9.12	461												
9.24	471												
9.36	481												
9.48	491												
10.00	501												
10.12	511												
10.24	521												
10.36	531												
10.48	541												
11.00	551												
11.12	561												

11.24 571
 11.36 501
 11.48 591
 12.00 601
 12.12 611
 12.24 621
 12.36 631
 12.48 641
 13.00 651
 13.12 6601
 13.24 6701
 13.36 681
 13.48 691
 14.00 701
 14.12 711
 14.24 721
 14.36 731
 14.48 741
 15.00 751
 15.12 76.01
 15.24 77.01
 15.36 78.1
 15.48 79.1
 16.00 80.01
 16.12 81.01
 16.24 82.1
 16.36 83.01
 16.48 84.1
 17.00 85.1
 17.12 86.1
 17.24 87.1
 17.36 88.1
 17.48 89.1
 18.00 90.10
 18.12 91.1
 18.24 92.1
 18.36 93.1
 18.48 94.10
 19.00 95.10
 19.12 96.1
 19.24 97.1
 19.36 98.1
 19.48 99.10
 20.00 100.10
 20.12 101.1
 20.24 102.1
 20.36 103.1
 20.48 104.1
 21.00 10510
 21.12 10610
 21.24 10710
 21.36 10810
 21.48 1091
 22.00 1101
 22.12 1111
 22.24 1121
 22.36 1131
 22.48 1141
 23.00 1151
 23.12 1161
 23.24 1171
 23.36 1181

23.481191
 0.001201.....
 .121211
 .241221
 .361231
 .481241
 .601251
 1.121261
 1.2412701
 1.3612801
 1.48129.1
 2.00130.1
 2.12131.1
 2.24132.1
 2.36133.1
 2.48134.1
 3.00135.1
 3.12136.1
 3.24137.1
 3.36138.1
 3.48139.1
 4.00140.1
 4.12141.1
 4.24142.1
 4.36143.1
 4.48144.1
 5.00145.1
 5.12146.1
 5.24147.1
 5.36148.1
 5.48149.1
 6.00150.1
 6.12151.1
 6.24152.1
 6.36153.01
 6.48154. 1
 7.00155. 1
 7.12156. 01
 7.24157. 1
 7.36158. 01
 7.48159. 1
 8.00160.....01
 8.12161. 1
 8.24162. 01
 8.36163. 01
 8.48164. 1
 9.00165. 1
 9.12166. 01
 9.24167. 01
 9.36168. 1
 9.48169. 1
 10.00170.....1
 10.12171. 1
 10.24172. 1
 10.36173. 1
 10.48174. 1
 11.00175. 1
 11.12176. 1
 11.24177. 1
 11.36178. 1
 11.48179. 1
 12.00180.....1

.36245.1
.48244.1
1.00245.1
1.12246.1
1.24247.10
1.36248.10
1.48249.1
2.00250.1
2.12251.1
2.24252.1
2.36253.1
2.48254.1
3.00255.1
3.12256.1
3.24257.1
3.36258.1
3.48259.1
4.00260.1
4.12261.1
4.24262.1
4.36263.1
4.48264.1
5.00265.1
5.12266.1
5.24267.1
5.36268.1
5.48269.1
6.00270.1
6.12271.1
6.24272.1
6.36273.1
6.48274.1
7.00275.1
7.12276.1
7.24277.1
7.36278.1
7.48279.1
8.00280.1
8.12281.1
8.24282.1
8.36283.1
8.48284.1
9.00285.1
9.12286.1
9.24287.1
9.36288.1

47. 57. 56. 55. 54. 53. 52. 52.
 51. 49. 48. 48. 48. 48. 48. 48.
 48. 48. 48. 48. 48. 48. 48. 48.
 48. 48. 48. 48. 48. 48. 48. 48.

	STAGE							
804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0
804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0
804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0
804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0	804.0
804.1	804.1	804.1	804.1	804.1	804.1	804.1	804.1	804.1
804.1	804.2	804.2	804.2	804.2	804.2	804.2	804.2	804.2
804.4	804.5	804.5	804.5	804.5	804.5	804.5	804.5	804.5
804.9	805.0	805.1	805.2	805.2	805.2	805.2	805.2	805.2
805.1	805.1	805.0	805.0	805.0	804.9	804.8	804.6	804.6
804.6	804.5	804.5	804.4	804.4	804.4	804.3	804.3	804.2
804.2	804.2	804.1	804.1	804.1	804.1	804.1	804.1	804.1
804.4	804.4	804.5	804.5	804.6	804.6	804.6	804.6	804.6
804.6	804.6	804.6	804.6	804.6	804.6	804.6	804.6	804.6
804.6	804.7	804.7	804.8	804.8	804.8	805.0	805.1	805.2
805.4	805.5	805.5	805.6	805.6	805.6	805.7	805.7	805.7
805.7	805.7	805.7	805.8	805.8	805.8	805.8	805.8	805.8
805.0	805.8	805.0	806.0	806.1	806.2	806.4	806.5	806.6
806.7	806.8	806.9	807.0	807.1	807.1	807.2	807.3	807.5
807.7	807.9	808.0	808.1	808.2	808.2	808.1	808.0	807.9
807.7	807.6	807.5	807.4	807.3	807.2	807.0	806.9	806.6
806.4	806.3	806.1	806.0	805.8	805.7	805.6	805.4	805.3
805.2	805.2	805.1	805.0	805.0	805.0	804.9	804.9	804.9
804.9	804.9	804.9	804.8	804.8	804.8	804.7	804.6	804.6
804.5	804.5	804.4	804.4	804.4	804.4	804.4	804.4	804.3
804.4	804.3	804.3	804.3	804.3	804.3	804.3	804.3	804.3
804.3	804.3	804.3	804.3	804.3	804.3	804.3	804.3	804.3
804.3	804.3	804.3	804.3	804.3	804.3	804.3	804.3	804.3

PEAK OUTFLOW IS 11793. AT TIME 41.00 HOURS

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	11793.	7294.	2510.	1126.	324405.
-CMS	334.	207.	71.	32.	9186.
INCHES		25.48	32.32	34.81	34.81
MM		596.34	820.91	884.08	884.08
AC-FI		3617.	4979.	5362.	5362.
THOUS CU M		4461.	6141.	6614.	6614.

•OVF•

STATION000002 [LO FME

	0.	2000.	4000.	6000.	8000.	10000.	12000.	0.	0.	0.	0.
.12											
.24											
.36											
.48											
1.00											
1.12											
1.24											
1.36											
1.48											
2.00											
2.12											
2.24											
2.36											
2.48											
3.00											
3.12											
3.24											
3.36											
3.48											
4.00											
4.12											
4.24											
4.36											
4.48											
5.00											
5.12											
5.24											
5.36											
5.48											
6.00											
6.12											
6.24											
6.36											
6.48											
7.00											
7.12											
7.24											
7.36											
7.48											
8.00											
8.12											
8.24											
8.36											
8.48											
9.00											
9.12											
9.24											
9.36											
9.48											
10.00											
10.12											
10.24											
10.36											
10.48											
11.00											
11.12											
11.24											
11.36											
11.48											
12.00											

11.24 571
11.36 591
11.48 591
12.00 601
12.12 611
12.24 621
12.36 631
12.48 641
13.00 651
13.12 6601
13.24 6701
13.36 68.1
13.48 69.1
14.00 70.1
14.12 71.1
14.24 72.1
14.36 73.1
14.48 74.1
15.00 75.1
15.12 76.01
15.24 77. 1
15.36 78. 1
15.48 79. 1
16.00 80.01
16.12 81. 01
16.24 82. 1
16.36 83. 01
16.48 84. 1
17.00 85. 1
17.12 86. 1
17.24 87. 1
17.36 88. 1
17.48 89. 1
18.00 90.10
18.12 91. 1
18.24 92. 1
18.36 93. 1
18.48 94. 10
19.00 95. 10
19.12 96. 1
19.24 97. 1
19.36 98. 1
19.48 99.10
20.00 100.1
20.12 101.1
20.24 102.1
20.36 103.1
20.48 104.1
21.00 10510
21.12 10610
21.24 10710
21.36 10810
21.48 1091
22.00 1101
22.12 1111
22.24 1121
22.36 1131
22.48 1141
23.00 1151
23.12 1161
23.24 1171
23.36 1181

23.481191
 0.001201
 .12121
 .24122
 .36123
 .48124
 1.00125
 1.12126
 1.24127
 1.36128
 1.48129
 2.00130
 2.12131
 2.24132
 2.36133
 2.48134
 3.00135
 3.12136
 3.24137
 3.36138
 3.48139
 4.00140
 4.12141
 4.24142
 4.36143
 4.48144
 5.00145
 5.12146
 5.24147
 5.36148
 5.48149
 6.00150
 6.12151
 6.24152
 6.36153
 6.48154
 7.00155
 7.12156
 7.24157
 7.36158
 7.48159
 8.00160
 8.12161
 8.24162
 8.36163
 8.48164
 9.00165
 9.12166
 9.24167
 9.36168
 9.48169
 10.00170
 10.12171
 10.24172
 10.36173
 10.48174
 11.00175
 11.12176
 11.24177
 11.36178
 11.48179
 12.00180

4.0294.1
 4.0304.1
 1.00295.1
 1.12246.1
 1.20297.10
 1.36246.10
 1.40249.1
 2.00250.1
 2.12251.1
 2.24252.1
 2.36253.1
 2.40254.1
 3.00255.1
 3.12256.1
 3.24257.1
 3.36258.1
 3.40259.1
 4.00260.1
 4.12261.1
 4.24262.1
 4.36263.1
 4.40264.1
 5.00265.1
 5.12266.1
 5.24267.1
 5.36268.1
 5.40269.1
 6.00270.1
 6.12271.1
 6.24272.1
 6.36273.1
 6.40274.1
 7.00275.1
 7.12276.1
 7.24277.1
 7.36278.1
 7.40279.1
 8.00280.1
 8.12281.1
 8.24282.1
 8.36283.1
 8.40284.1
 2.00285.1
 9.12286.1
 9.24287.1
 9.36288.1

PEAK FLOW AND STORAGE (END OF PERIOD). SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIOS APPLIED TO FLOWS							
				RATIO 1	RATIO 2	RATIO 3	RATIO 4	RATIO 5	RATIO 6	RATIO 7	RATIO 8
HYDROGRAPH AT	000001	2.89 (7.49)	1	1184. (33.53)	1302. (36.88)	1421. (40.23)	1539. (43.58)	1650. (46.94)	1776. (50.29)	5920. (167.63)	11839. (335.25)
	ROUTED TO	2.89 (7.49)	1	1165. (33.00)	1283. (36.33)	1401. (39.66)	1518. (43.00)	1637. (46.34)	1755. (49.70)	5896. (166.96)	11793. (333.95)

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1
 ELEVATION
 STORAGE
 OUTFLOW
 INITIAL VALUE
 804.00
 42.
 0.
 SPILLWAY CREST
 804.00
 42.
 0.
 TOP OF DAM
 805.60
 72.
 1216.

RATIO OF PMF	MAXIMUM RESERVOIR W.S.ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
.10	805.56	0.00	71.	1165.	0.00	41.20	0.00
.11	805.65	.05	73.	1283.	.80	41.20	0.00
.12	805.73	.13	75.	1401.	1.20	41.20	0.00
.13	805.82	.22	77.	1518.	1.60	41.20	0.00
.14	805.89	.29	79.	1637.	2.00	41.20	0.00
.15	805.97	.37	80.	1755.	2.20	41.20	0.00
.50	807.20	1.60	115.	5896.	7.00	41.20	0.00
1.00	808.19	2.59	148.	11793.	12.40	41.00	0.00

DATE
ILME