


AD-A136 401


CONSTRUCTION OF ALUMINUM STANDING-SEAM ROOFING AT AN
ARMY FACILITY(U) CONSTRUCTION ENGINEERING RESEARCH LAB
(ARMY) CHAMPAIGN IL M J ROSENFELD NOV 83
CERL-IR-M-336

1/1

UNCLASSIFIED

F/G 13/13 NL

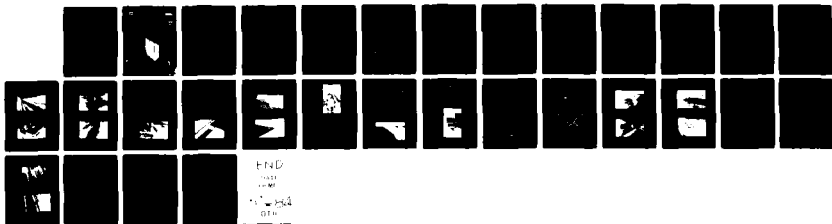

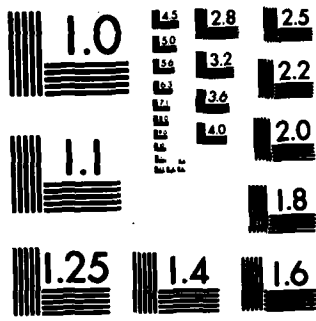

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A



**US Army Corps
of Engineers**
Construction Engineering
Research Laboratory

CEERL


INTERIM REPORT M-336
November 1983

(12)

AD-A136401

**CONSTRUCTION OF ALUMINUM STANDING-SEAM
ROOFING AT AN ARMY FACILITY**

by
Myer J. Rosenfield

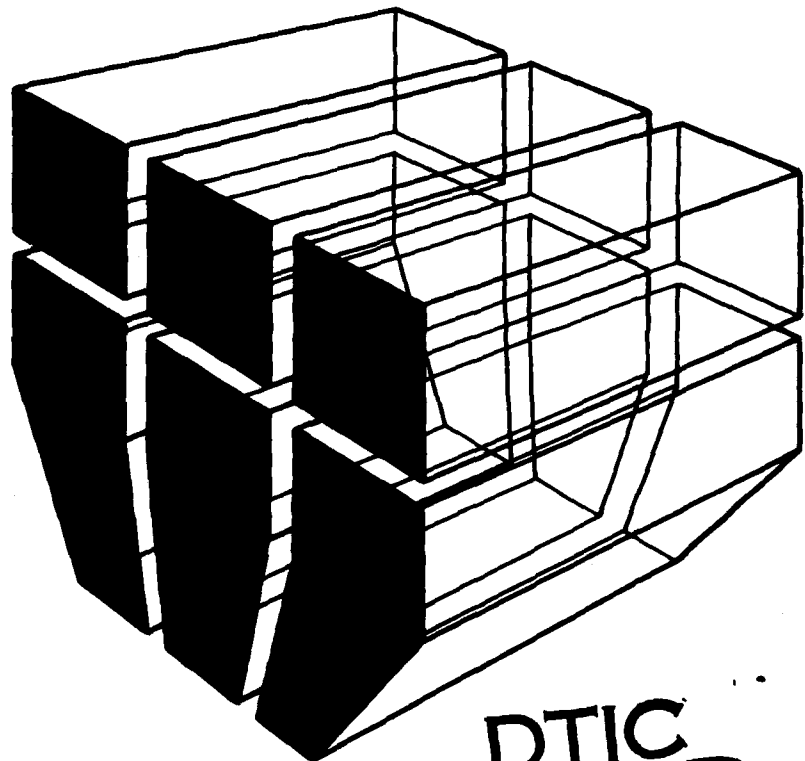

DTIC FILE COPY

DTIC
ELECTE
DEC 28 1983
S **D**
E

Approved for public release; distribution unlimited.

83 12 23 063

The contents of this report are not to be used for advertising, publication, or promotional purposes. Citation of trade names does not constitute an official indorsement or approval of the use of such commercial products. The findings of this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

**DESTROY THIS REPORT WHEN IT IS NO LONGER NEEDED
DO NOT RETURN IT TO THE ORIGINATOR**

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER CERL-IR-M-336	2. GOVT ACCESSION NO. AD-A136401	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) CONSTRUCTION OF ALUMINUM STANDING-SEAM ROOFING AT AN ARMY FACILITY	5. TYPE OF REPORT & PERIOD COVERED FINAL	
	6. PERFORMING ORG. REPORT NUMBER	
7. AUTHOR(s) Myer J. Rosenfield	8. CONTRACT OR GRANT NUMBER(s) Military Interdepartmental Purchase Request No. 81-938-16	
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Construction Engr Research Laboratory P.O. Box 4005 Champaign, IL 61820	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS	
11. CONTROLLING OFFICE NAME AND ADDRESS	12. REPORT DATE November 1983	
	13. NUMBER OF PAGES 25	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	15. SECURITY CLASS. (of this report) UNCLASSIFIED	
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE	
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Copies are obtainable from the National Technical Information Service Springfield, VA 22161		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) roofs aluminum Defense Construction Supply Center, Columbus, OH		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) —> This report documents the construction and instrumentation of an aluminum standing-seam roofing system on a Defense Logistics Agency warehouse. The condition and performance of the system are being checked and tested at periodic intervals to determine its behavior over annual cycles and to evaluate its capacity for long-term, trouble-free service. This portion of the study observed the construction of the warehouse roof, including the specifications, materials, and building procedures used. Future studies will investigate		

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

the effects of corrosion on the aluminum panels and continue evaluations of temperatures and movement related to the system. The data will then be used to evaluate the roofing system's behavior over two annual cycles.

This type of system shows promise of being a good, long-lasting reroofing system for replacing deteriorated BUR, which is commonly used at Army installations. The contractor who installed the roof used good building practices, and these procedures can serve as a model for future installations of this type of roofing.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

FOREWORD

This investigation was performed for the Defense Logistics Agency (DLA) by the Engineering and Materials Division (EM), U.S. Army Construction Engineering Research Laboratory (CERL). The work was performed under Military Interdepartmental Purchase Request No. 81-938-16 dated 17 August 81. Mr. Marvin U. DuBois was the DLA project monitor.

Appreciation is expressed to Mr. Gary Cattel of CTL Engineering, Inc., for monitoring the construction of the roof for Warehouse 8, and to Mr. Herbert Neff of the Ohio River Division, Corps of Engineers, and Mr. William Smith of the Facilities Engineer Office of the Defense Construction Supply Center, Columbus, OH, for their assistance. Mr. James Gambill and Mr. William Gordon of CERL made valuable contributions by designing and installing the instrumentation systems.

Dr. R. Quattrone is Chief of CERL-EM. COL Paul J. Theuer is Commander and Director of CERL, and Dr. L. R. Shaffer is Technical Director.

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	



CONTENTS

	Page
DD FORM 1473	1
FOREWORD	3
LIST OF FIGURES	5
1 INTRODUCTION	7
Background	
Objective	
Approach of Overall Study	
2 CONSTRUCTION	7
3 TEST PROGRAM	9
4 DISCUSSION OF OBSERVATIONS	9
5 SUMMARY	10
DISTRIBUTION	

FIGURES

Number	Page
1 Warehouse No. 8, DCSC	11
2 Roof Model	11
3 Vacuum Removal of Loose Aggregate	12
4 Installation of Wood Sleepers	12
5 Detail of Roofing Panel	13
6 Application of Sealant	13
7 Foam Rubber Rib Closure	14
8 Rib Closure in Place Prior to Forming Seam	14
9 Placing Aluminum Panel	15
10 Manual Crimper for Seam Ends	15
11 Electric Seam Lock Tool	16
12 Ridge Cap and End Closures	16
13 Panel Attachment Clips	17
14 Counterflashing at Firewall	17
15 Flashing Details at Firewall	18
16 Counterflashing Step Intersection Details	18
17 Detail of Ventilator Flashing	19
18 Detail of Ridge Cap at Ventilator Flashing	20
19 Intersection of Ridge Cap and Ventilator Flashing	21
20 Peak of Ridge Cap Close to Top of Counterflashing	21
21 Peak of Ridge Cap Above Top of Counterflashing	22
22 NBS Test Rack of Samples for Corrosion Tests	22
23 Cross Section of Warehouse 5 Showing Thermocouple Locations	23

FIGURES (cont'd)

Number		Page
24	Arrangement of Elongation and Deflection Measurement Points	24
25	Typical Thermocouple on Aluminum Panel	25
26	Typical Elongation and Deflection Measurement Point	25

CONSTRUCTION OF ALUMINUM STANDING-SEAM ROOFING AT AN ARMY FACILITY

1 INTRODUCTION

Background

Most Army facilities use conventional roofing systems, such as built-up roofing (BUR), that are sometimes expensive and complicated to construct. Such systems are often comparatively short-lived, resulting in high life-cycle roofing costs which are difficult for already over-burdened Army operation and maintenance budgets to absorb. Therefore, the Office of the Chief of Engineers asked the U.S. Army Construction Engineering Research Laboratory (CERL) to identify alternative, easy-to-install roofing systems that can improve the performance of Army roofing and reduce its life-cycle costs.

The Defense Logistics Agency (DLA) was preparing to install aluminum standing-seam roofing on three warehouses at the Defense Construction Supply Center (DCSC) at Columbus, OH. This roofing was to replace BUR which had been installed only 6 years previously. Being aware of CERL's roofing investigation program, DLA contacted CERL and the National Bureau of Standards (NBS) and requested that they monitor the construction and subsequent behavior of this roofing.

Objective

The overall objective of this project is to determine the behavior of aluminum standing-seam roofing over two annual cycles and evaluate the capacity for long-term, trouble-free performance. This report documents the construction and instrumentation of the roof system for one of the three DLA warehouses on which it was installed.

Approach of Overall Study

The following tasks were established to accomplish the work:

1. Observe and monitor the construction of the roofing on the warehouses (documented in this report).
2. Perform the following specific measurements and observations on the roofing every 6 months for 2 years:

- a. Observe condition and performance of the roofing system at periodic intervals, and conduct required testing. This work would include checking each component, such as panel, flashing, ridge cap, etc., for corrosion, deformation, and movement.

- b. Install gage points at appropriate locations to measure deformation and movement of the roof panel.

- c. Check flashings carefully to make sure they perform as intended.

- d. Measure temperatures of the metal roofing and the existing BUR with thermocouples.

- e. Analyze panel samples at 6-month intervals to determine the extent and type of corrosion, using appropriate metallographic techniques such as microphotography, scanning electron microscope, etc. This task is being performed by the National Bureau of Standards (NBS).

- f. Analyze and evaluate the results of these observations and measurements.

The results of the analysis and evaluation will be documented in a final report at the end of the study.

2 CONSTRUCTION

At a meeting in July 1981, copies of the plans and specifications were given to CERL and NBS for review. In October 1981, a preconstruction conference was held at DCSC in which comments from both agencies and all other details were discussed.

Under the contract, three warehouses were to be re-roofed: Nos. 8, 4, and 5, respectively (Figure 1). Each warehouse is 160 ft (48.8 m) wide by 1541 ft (470 m) long, and divided by firewalls into 11 approximately equal sections, each about 138 ft (42 m) long. Roofs are constructed with a slope of approximately 5/8 in. per foot (50 mm per meter). Roofing panels are 1 ft (300 mm) wide. With panels continuous from the central ridge to the eaves, each panel is 80 ft (24 m) long. Thus, there are about 3036 individual panels on each warehouse.

Because of the varied types of junctions and intersections which occur in the roofs, the contract specified that the contractor submit shop drawings for approval. In addition, the contractor submitted a model showing these various conditions full-size (Figure 2). This model was placed out-of-doors in an open location, so that it was readily available for reference.

Construction on Warehouse 8 began on 12 April 1982, and was monitored by CERL. The first operation was removing, by vacuum, all loose aggregate from the existing BUR (Figure 3). Sleepers of 4 x 4 in. (100 x 100 mm) treated lumber were installed into grooves cut into the BUR membrane and insulation on 5 ft, 8-in. (1.75-m) centers (Figure 4). Visible in the grooves shown in Figure 4 are shims which were used to ensure that the tops of the sleepers were elevated above the BUR surface to provide an air space between the BUR and the aluminum panels. The sleepers were screwed to the deck, which is a 2-in. (51 mm) tongue-and-groove wood plank.

The 80-ft (24-m) panel length is the longest standard length furnished by the manufacturer from the factory. Each panel is 1 ft (305 mm) wide, with a 2 1/2-in. (64-mm) roll-formed shape on each side. Figure 5 shows a cross section of the panel. Panels used at DCSC were .032 in. (.81 mm) thick. The sealant used was a 3/16-in. (4.75-mm-) diameter butyl strip on a release paper. When placed as shown in Figure 6, it seals the standing seam and prevents entry of wind-driven or snow-melt water into the system.

The eave end of the seam was sealed with a foam rubber plug (Figure 7), applied before the seam was formed (Figure 8). This prevents entry of wind and water into the end of the seam.

After the panels were set in place (Figure 9), the ends of the seam were crimped with a hand tool (Figure 10), and the remainder of the seam locked with a traveling electric tool (Figure 11). The ridge ends of the panels were formed into a pan end, sealed with a closure that fills the panel from seam to seam, and then covered with a ridge cap (Figure 12).

Panels are retained in place by clips screwed to the sleepers. Each clip has bulbs at the top which fit into the seam and prevent the roof panels from lifting off while permitting expansion and contraction. There are two types of clips: one is for expansion, and one serves as an anchor (Figure 13). A button punch locks the panel seams to the anchor clips. These clips were

placed at the two sleepers straddling the center of the panels, permitting expansion at both ends.

Figure 13 also shows the clip used along the firewalls to hold the edge of the first panel under the base flashing. A stepped aluminum counterflashing was installed (Figure 14) into reglets cut into the firewall parapet. Because of the high winds that can be expected in the Columbus, OH, area, a stainless steel strap was installed to provide uplift resistance to the counterflashing. Figure 15 shows flashing details. Figure 16 shows the intersection of counterflashings at the step, including the uplift resistance strap before it was bent up. The upper sheet was locked to the lower one by cutting a slit and locking the two pieces together as shown.

All this careful attention to detail, fabrication, and installation yields a roofing system which should provide many years of satisfactory service. The only deficiencies noted were related to design and installation of the ridge cap. On Warehouse 8, these occurred where the ridge cap intersected the flashings at the large central vents, and also occurs on all warehouses where the ridge caps ended at the firewall parapets.

The ventilator flashing intersection was detailed on the drawing shown in Figure 17. This shows a 5-in. (127-mm) vertical wall of the flashing, with the ridge cap low enough for the connection to be completely within this dimension. As shown in Figure 12, the vertical height of the ridge cap should be at least five times the expected roof movement. For 40 ft (12 m) of aluminum over a temperature range of -20°F (-29°C) to 120°F (49°C)—a difference of 140°F (78°C)—the expected change in length is about 7/8 in. (22 mm). Following the recommendation of Figure 12, the vertical height was set at 6 in. (152 mm). To fabricate the intersection as shown in Figure 18, the height of the vent flashing would have to be increased to more than the ridge cap. Instead, it was made equal to the ridge cap wall, and was actually fabricated to the 6-in. (152-mm) dimension. This made the intersection impossible to fabricate as detailed; the result is shown in Figure 19. A large amount of sealant was needed to waterproof these intersections.

The ends of the ridge caps at the parapets showed a similar deficiency. In one case, the peak of the ridge cap was very close to the top of the counterflashing (Figure 20). In another, the peak of the ridge cap was actually above the counterflashing (Figure 21). The picture shows the reglet into which the counterflashing

will be inserted, which has been primed with a black primer. Again, a great deal of sealant is used.

Neither of these details was addressed in the roof model. Figure 2 shows that the ridge cap was not included when the model was prepared. If it had been, these deficiencies would probably have become evident before the roofing components were fabricated.

Since these two ridge cap details depend greatly on the sealant to keep them watertight, they will have to be monitored very carefully to be sure that any deterioration of the sealant is repaired quickly and thoroughly.

3 TEST PROGRAM

One of the tests to be conducted on the roofing system is determining the effects of atmospheric corrosion on the aluminum panels; this study is being performed by NBS. A test rack containing 30 samples of the roofing material has been installed on one of the parapets of Warehouse 4 (Figure 22). These samples will be removed at 6-month intervals and analyzed to measure the rate and type of corrosion and to determine its effect on the material.

CERL has installed devices to measure temperatures and movement related to the system. Instrumentation was installed in the fifth bay from the north end of Warehouse 5, 37 ft (12 m) from the north end of the bay. Six stacks of thermocouples were installed, three each on the east and west sides of the warehouse (Figure 23). One thermocouple was attached to the lower surface of the roof deck to measure interior temperatures, one to the top of the existing BUR, and one to the top of the aluminum roof panels. Also, one thermocouple was mounted on an interior column near the switching box for all the thermocouples, and another thermocouple was mounted in an external shielded location to determine ambient temperatures. In all, 20 thermocouples were installed.

Elongation and deflection measurement points were established in the panel adjacent to the one with the thermocouples, but were placed 1 ft (305 mm) closer to the nearest firewall parapet. Figure 24 shows arrangements of these points.

Thermocouples were epoxied to the aluminum surface and covered with aluminized silicone sealant,

as shown in Figure 25. Figure 26 shows a typical elongation and deflection measurement point.

This instrumentation was installed in July 1982, and initial readings were taken. Subsequent readings are being taken at 6-month intervals for 2 years, with the final ones in July 1984. These data will allow evaluation of the roofing system's behavior over two annual cycles.

4 DISCUSSION OF OBSERVATIONS

On the basis of observations made during monitoring of the construction, several features were noted that require careful monitoring over time:

1. **Foam Seals.** Foam rubber has a tendency to shrink and harden. This could cause leakage problems at the ridge closures and at the rib closure plugs. The rib closure plugs could be particularly troublesome, since they are not adhered to the rib, and could therefore fall out if shrinkage occurs. A driving rain could then penetrate under the panels, enter the cuts in the BUR made to install the sleepers, and leak into the building.

2. **Ice Dams.** Ice dams result when water from melting snow freezes on a cold overhang. Thus, water can build up over the level of the rib and seep through the seam if it is not sealed properly. If the butyl sealing strip used to seal the seams dries up, hardens, and cracks, the seam will be susceptible to leakage.

3. **Wind Uplift.** The system was installed with special features to guard against wind uplift damage (e.g. heavy-duty clips, counterflashing straps), so this should not be a problem. However, flashings and edgings should be checked periodically to ensure that these provisions were adequate.

4. **Corrosion.** The system was designed and installed to minimize corrosion problems from contact of dissimilar metals. To eliminate any sources of galvanic corrosion, all fasteners and accessories are made of either aluminum or stainless steel. The corrosive potential of the Columbus, OH, atmosphere is being monitored by NBS.

5. **Thermal Movement.** The theoretical thermal capabilities of the roofing system are excellent, since the panels are free to expand and contract longitudinally, and their cross section shape permits transverse

movement without inducing excessive stresses. Thermal response is being monitored for 2 years following installation of the instrumentation.

Special care is necessary during roofing design to ensure dimensional compatibility of all components. Metallic roofing cannot be formed in the same manner as single-ply membranes or sprayed polyurethane foam. Sometimes the only way design errors can be corrected in the field is with excessive use of elastomeric sealant, which is not supposed to be installed in thick applications. As this sealant ages, it cracks or splits; this will cause leaks to develop and allow water to enter the system.

5 SUMMARY

This report has documented the construction and instrumentation of an aluminum standing-seam roof system on a DLA warehouse. This type of system shows promise of being a good, long-lasting reroofing system for replacing deteriorated BUR, which is commonly used at Army installations. The contractor who installed the DLA warehouse roof used good building practices (see Chapter 2), and these procedures can serve as a model for future installations of this type of roofing.



Figure 1. Warehouse No. 8, DCSC.

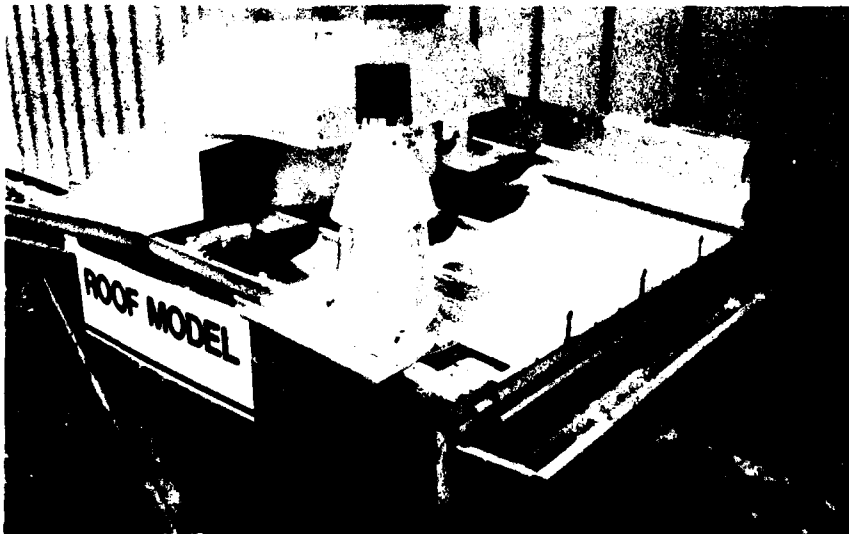


Figure 2. Roof model.

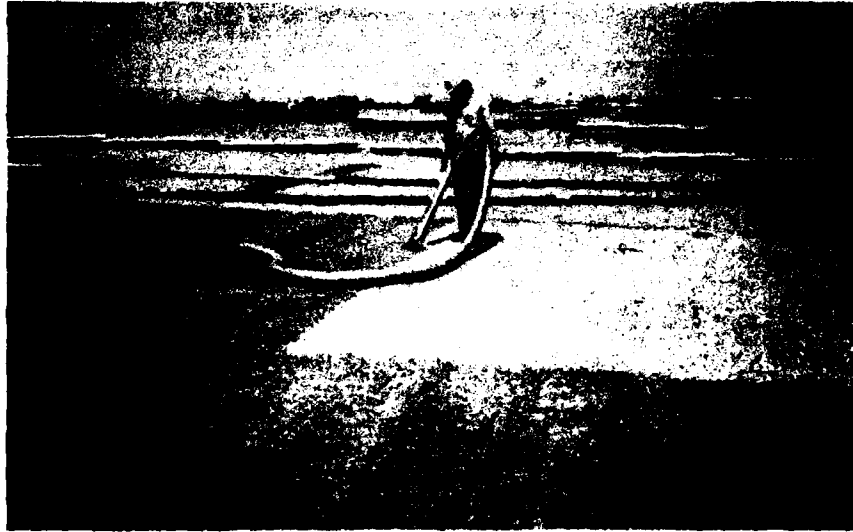


Figure 3. Vacuum removal of loose aggregate.



Figure 4. Installation of wood sleepers.

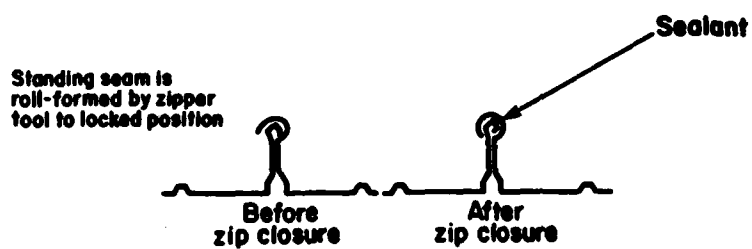
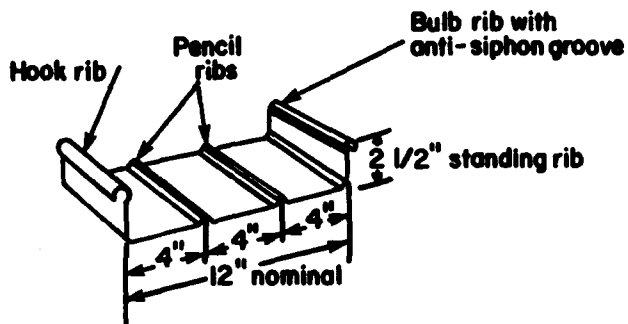


Figure 5. Detail of roofing panel.



Figure 6. Application of sealant.

Rib Closure

Cut from 1" foam rubber, this closure compresses to seal bulb rib and between legs of adjoining ribs.



Figure 7. Foam rubber rib closure.

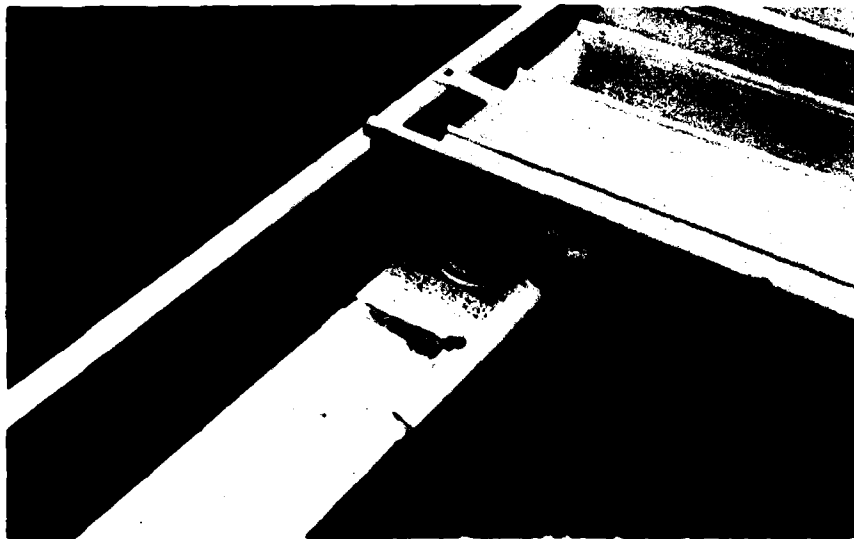


Figure 8. Rib closure in place prior to forming seam.

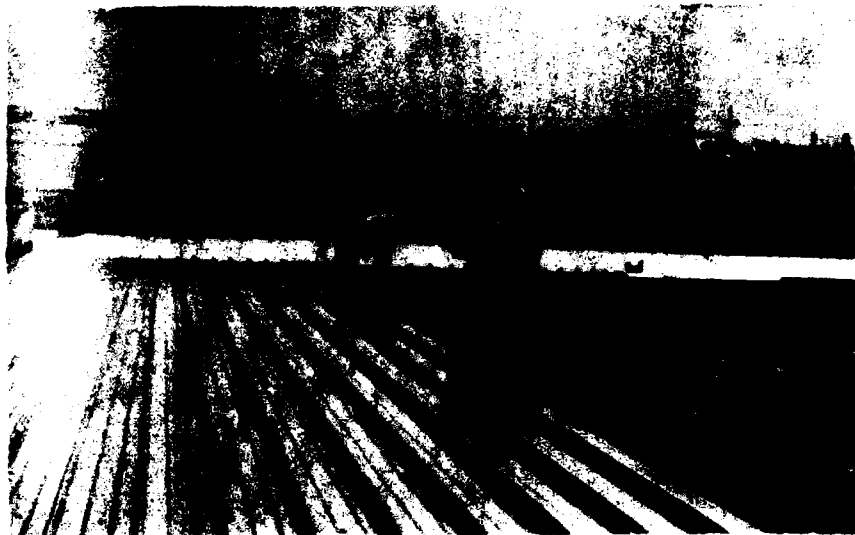


Figure 9. Placing aluminum panel.



Figure 10. Manual crimper for seam ends.

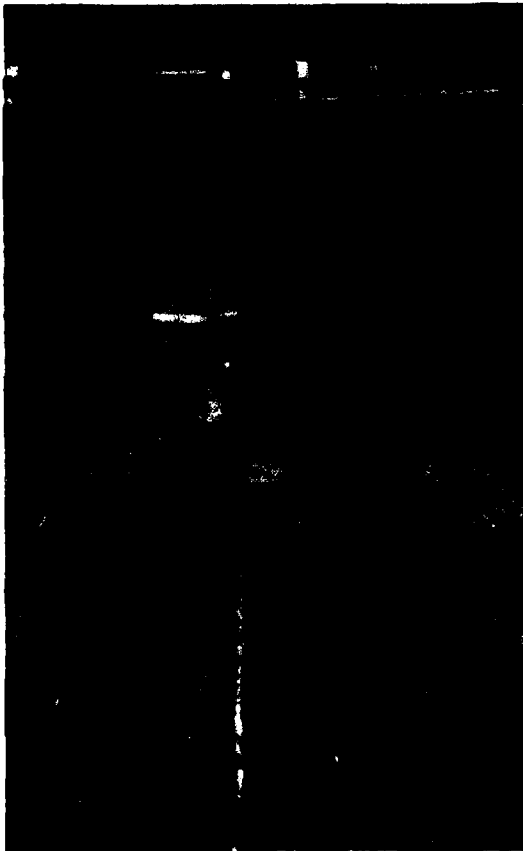


Figure 11. Electric seam lock tool.

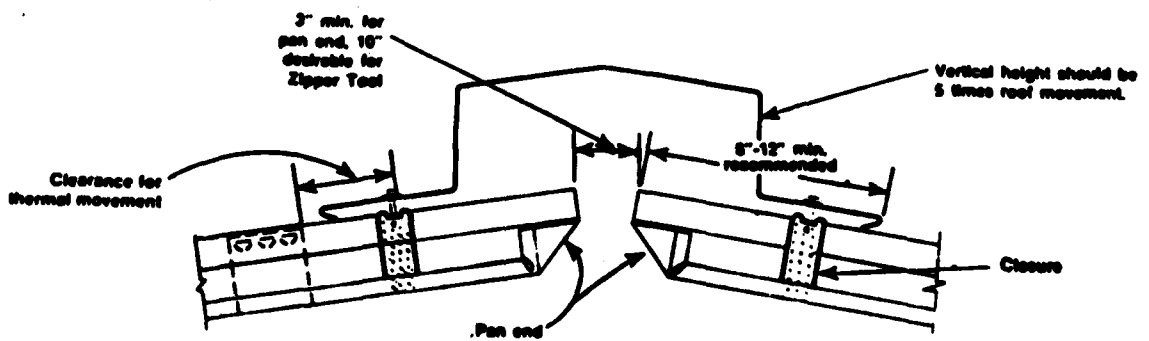


Figure 12. Ridge cap and end closures.

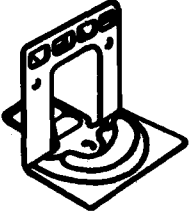
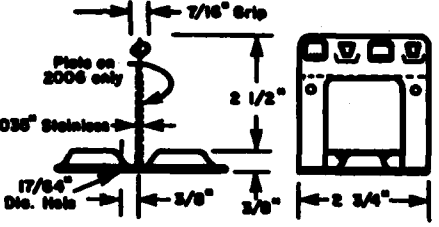

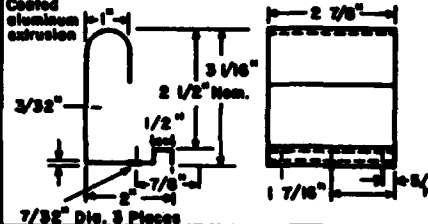
CLIP DESCRIPTION AND NUMBER	BASIC CONFIGURATION	NORMAL DIMENSIONS	PANEL CLEARANCE OVER STRUCTURE
Heavy Base Bulb Clips 2005 2006		 <p> $7/16''$ Grip Plate on 2006 only $036''$ Stainless $17/64''$ Dia. Hole $2 1/2''$ $3/8''$ $2 3/4''$ $3/8''$ </p>	$3/8''$
Gable Clip 2002		 <p> Coated aluminum extrusion $1''$ $3/32''$ $2 1/2''$ Nom. $3 1/16''$ $1/2''$ lead $2''$ $7/8''$ $2 7/8''$ $1 7/16''$ $3/16''$ $7/32''$ Dia. 3 Pieces </p>	$3/8''$

Figure 13. Panel attachment clips.

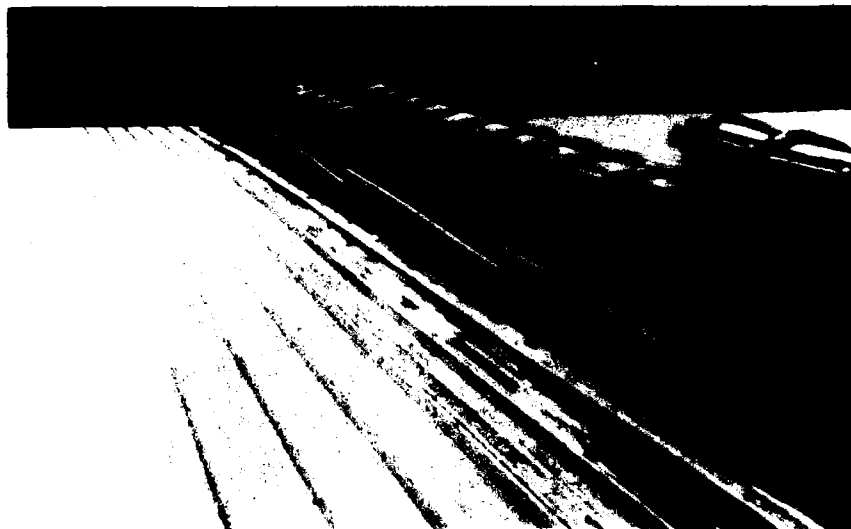


Figure 14. Counterflashing at firewall.

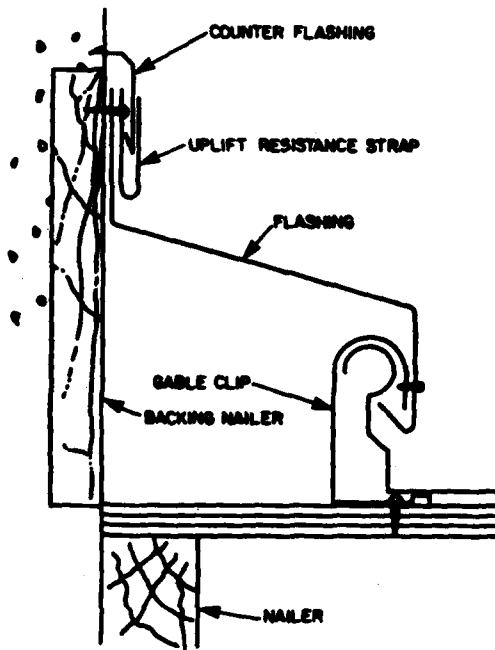


Figure 15. Flashing details at firewall.



Figure 16. Counterflashing step intersection details.

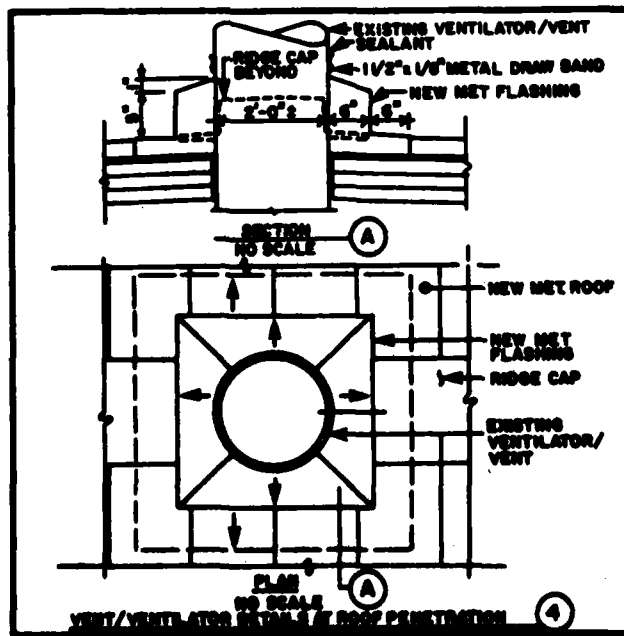


Figure 17. Detail of ventilator flashing.

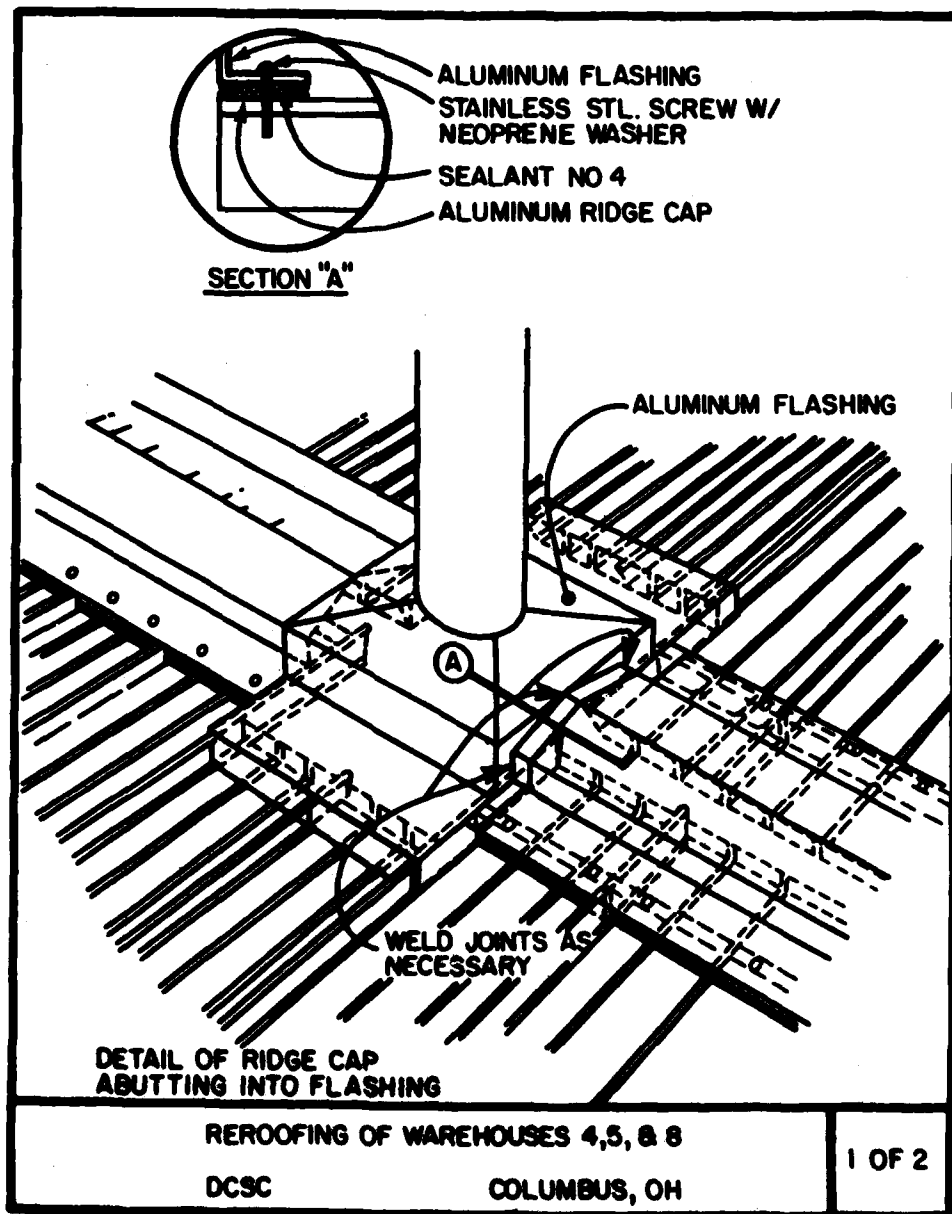


Figure 18. Detail of ridge cap at ventilator flashing.



Figure 19. Intersection of ridge cap and ventilator flashing.

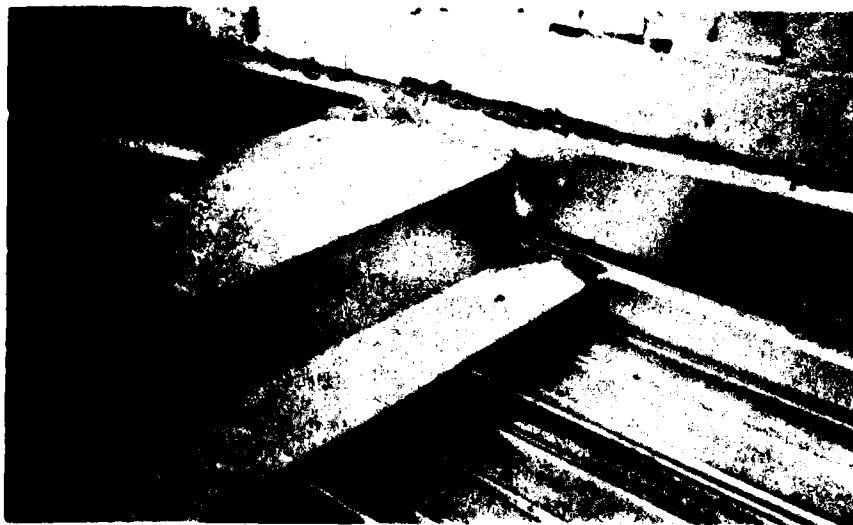


Figure 20. Peak of ridge cap close to top of counterflashing.



Figure 21. Peak of ridge cap above top of counterflashing.

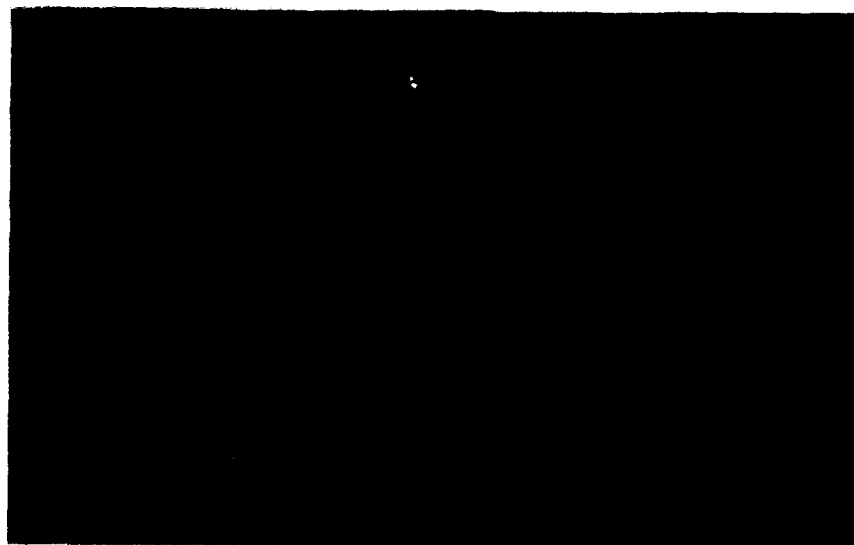


Figure 22. NBS test rack of samples for corrosion tests.

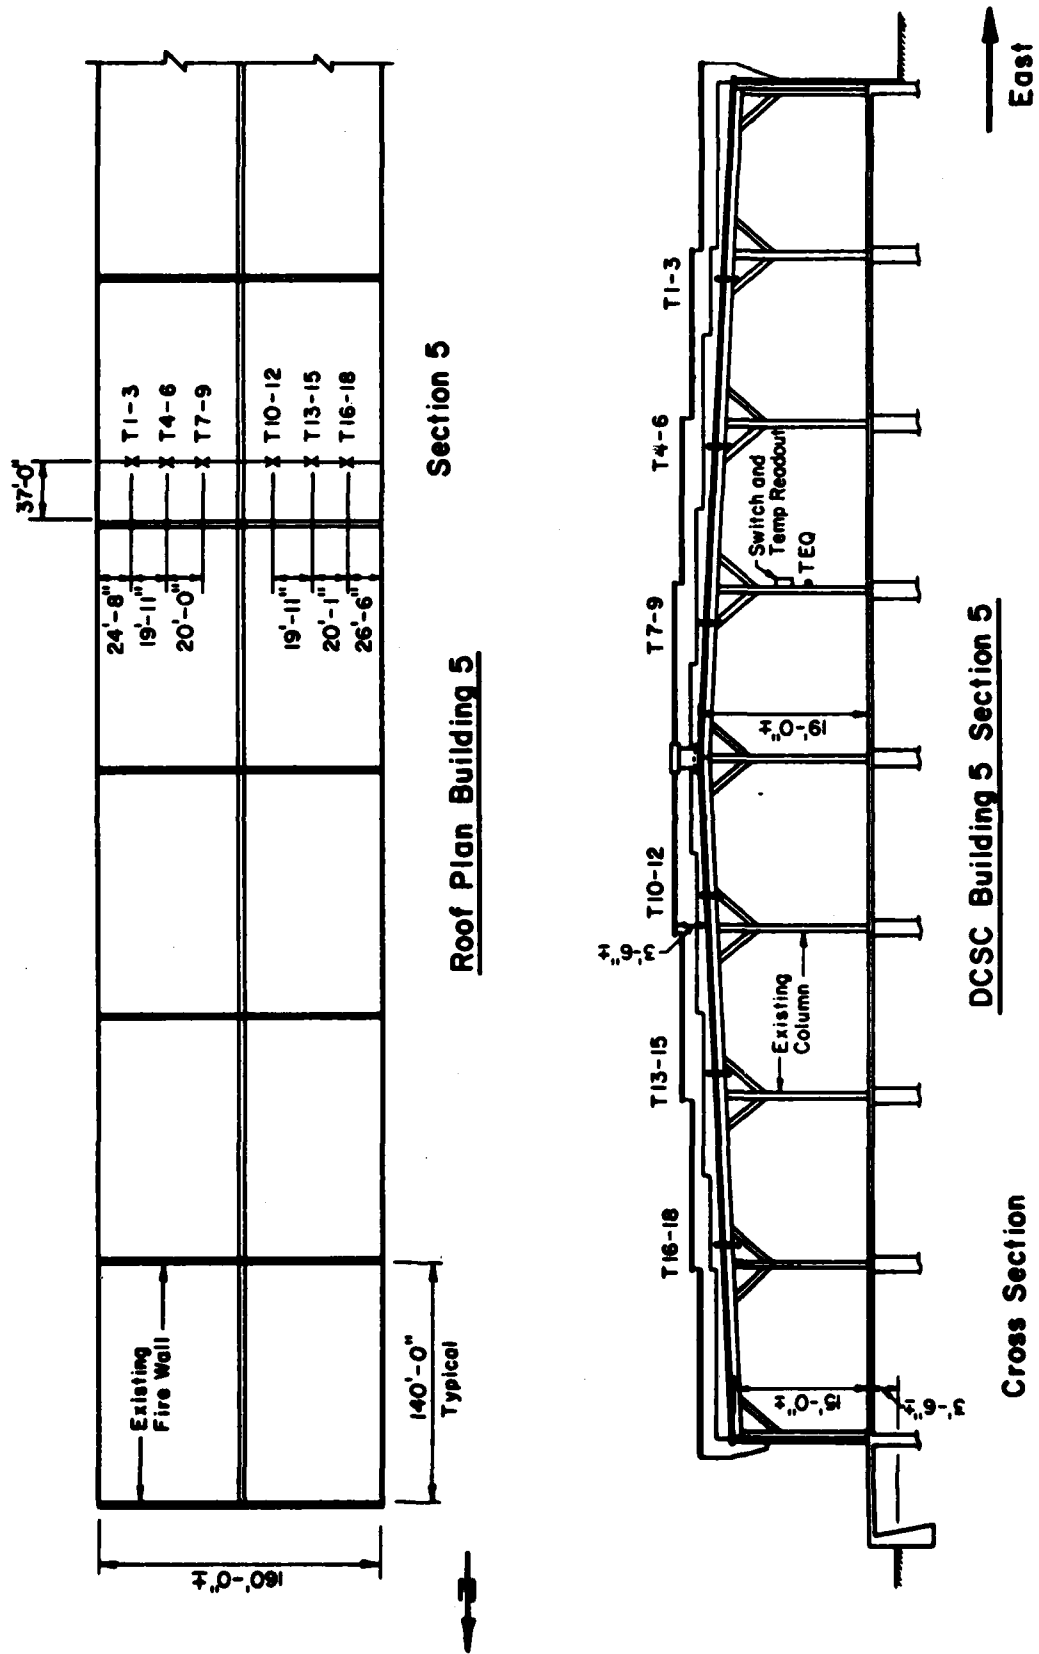


Figure 23. Cross section of Warehouse 5 showing thermocouple locations.

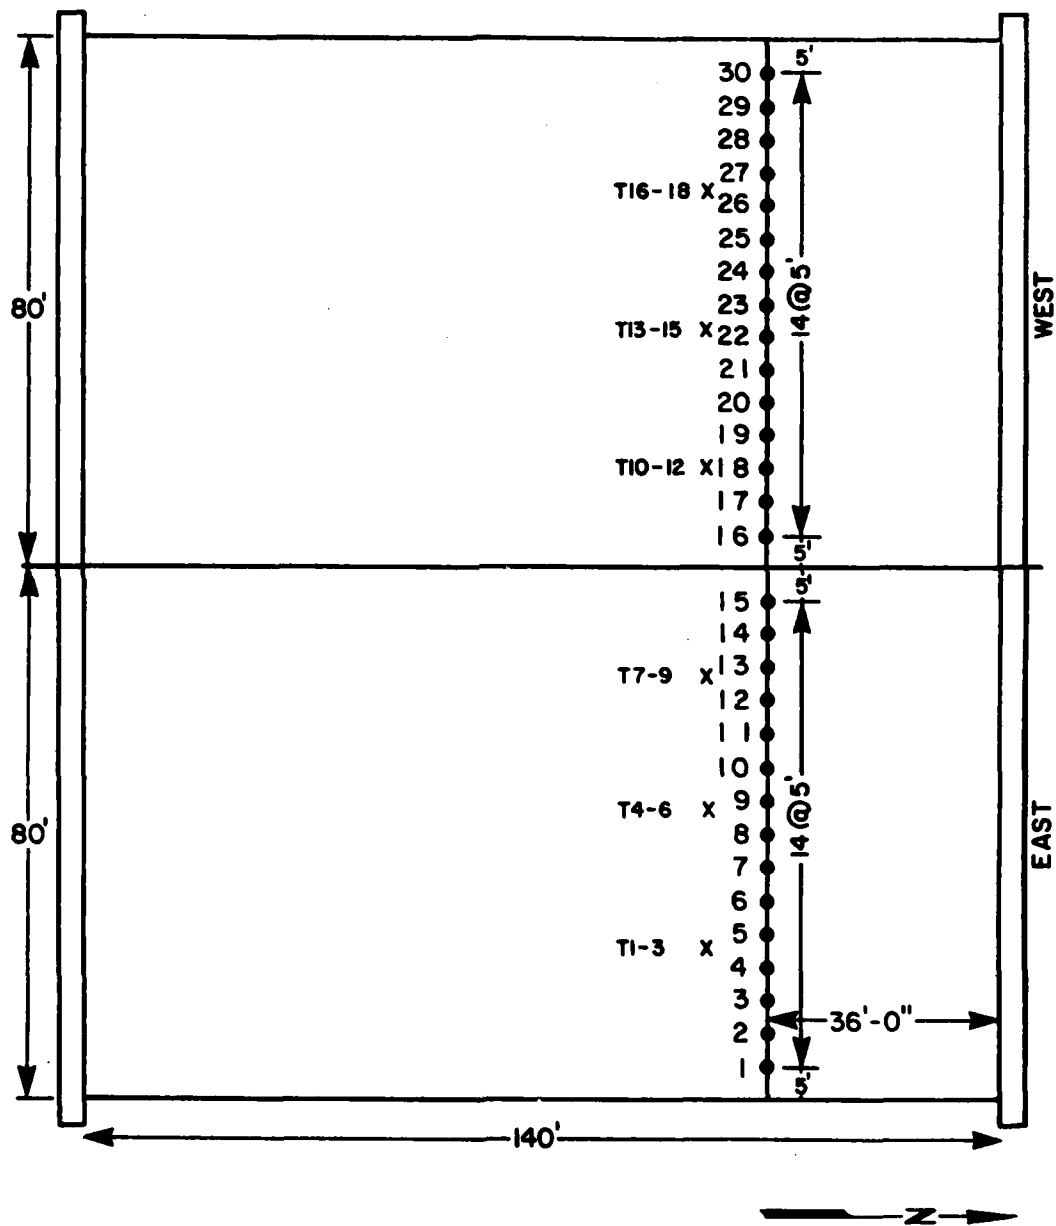


Figure 24. Arrangement of elongation and deflection measurement points.

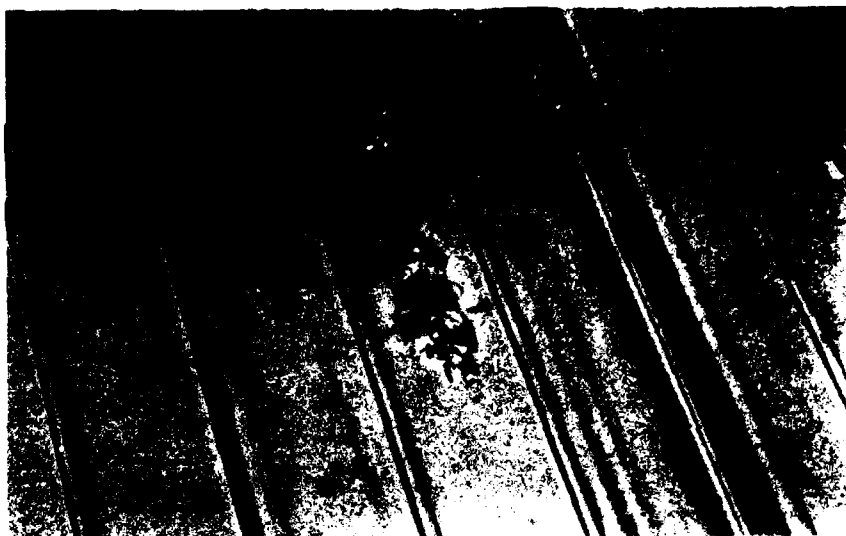


Figure 25. Typical thermocouple on aluminum panel.

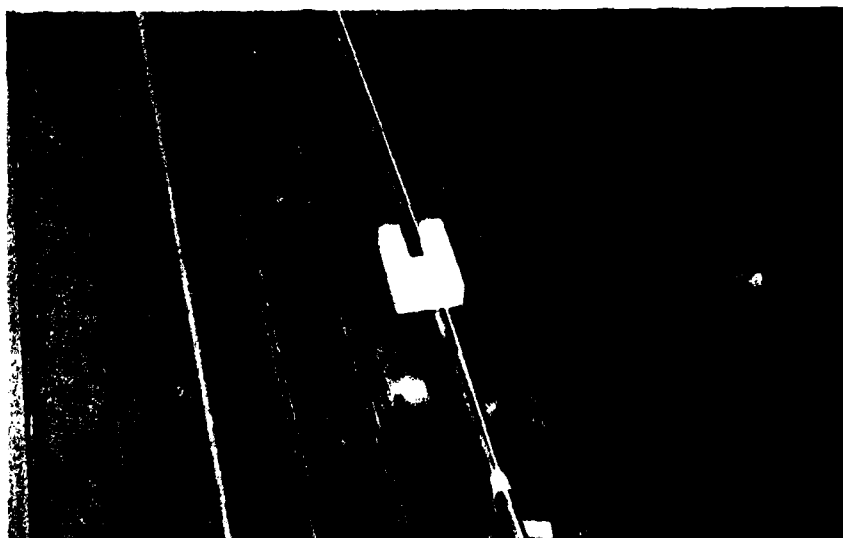


Figure 26. Typical elongation and deflection measurement point.

CERL DISTRIBUTION

Chief of Engineers
 ATTN: Tech Monitor
 ATTN: DAEN-ASI-L (2)
 ATTN: DAEN-CCP
 ATTN: DAEN-CI
 ATTN: DAEN-CME
 ATTN: DAEN-CM-R
 ATTN: DAEN-CMO
 ATTN: DAEN-CWP
 ATTN: DAEN-EC
 ATTN: DAEN-ECC
 ATTN: DAEN-ECE
 ATTN: DAEN-ZCF
 ATTN: DAEN-ECB
 ATTN: DAEN-RD
 ATTN: DAEN-ROC
 ATTN: DAEN-ROM
 ATTN: DAEN-RM
 ATTN: DAEN-ZCZ
 ATTN: DAEN-ZCE
 ATTN: DAEN-ZCI
 ATTN: DAEN-ZCM

FESA, ATTN: Library 22060
 ATTN: DET III 79906

US Army Engineer Districts
 ATTN: Library (41)

US Army Engineer Divisions
 ATTN: Library (14)

US Army Europe
 AEAEH-DCSENGR 09403
 ISAE 09081
 V Corps
 ATTN: DEH (11)
 VII Corps
 ATTN: DEH (15)
 21st Support Command
 ATTN: DEH (12)
 USA Berlin
 ATTN: DEH (15)
 USASETAF
 ATTN: DEH (6)
 Allied Command Europe (ACE)
 ATTN: DEH (3)

8th USA, Korea (14)

ROK/US Combined Forces Command 96301
 ATTN: EUSA-HC-CFC/Engr

USA Japan (USARJ)
 ATTN: AJEN-FE 96343
 ATTN: DEH-Honshu 96343
 ATTN: DEH-Okinawa 96331

Rocky Mt. Area 80903

Area Engineer, AEDC-Area Office
 Arnold Air Force Station, TN 37389

Western Area Office, CE
 Vandenberg AFB, CA 93437

416th Engineer Command 60623
 ATTN: Facilities Engineer

US Military Academy 10966
 ATTN: Facilities Engineer
 ATTN: Dept of Geography &
 Computer Science
 ATTN: DSCPER/MAEN-A

AMORC, ATTN: DRDMR-WE 02172

USA AMRDCOM 61299
 ATTN: DRGIS-RI-I
 ATTN: DRGAR-IS

DARCOM - Dir., Inst., & Svcs.
 ATTN: DEH (23)

DLA ATTN: DLA-WI 22314

FORSCOM
 FORSCOM Engineer, ATTN: AFEN-FE
 ATTN: DEH (23)

HSC
 ATTN: HSLQ-F 78234
 ATTN: Facilities Engineer
 Fitzsimons AMC 80240
 Walter Reed AMC 20012

INSCOM - Ch. Instl. Div.
 ATTN: Facilities Engineer (3)

MDW
 ATTN: DEH (3)

MTMC
 ATTN: MTMC-SA 20315
 ATTN: Facilities Engineer (3)

NARADCOM, ATTN: DRDMA-F 071160

TARCOM, Fac. Div. 48090

TRADOC
 HQ, TRADOC, ATTN: ATEN-FE
 ATTN: DEH (19)

TSARCOM, ATTN: STSAS-F 63120

USACC
 ATTN: Facilities Engineer (2)

WESTCOM
 ATTN: DEH
 Fort Shafter 96858
 ATTN: APEN-IM

SHAPE 09055
 ATTN: Survivability Section, OCB-OPS
 Infrastructure Branch, LAMDA

HQ USEUCOM 09128
 ATTN: ECJ 4/7-LOE

U.S. Army, Fort Belvoir 22060
 ATTN: Canadian Liaison Officer
 ATTN: Water Resources Support Center
 ATTN: Engr Studies Center
 ATTN: Engr Topographic Lab
 ATTN: ATZA-DTE-SU
 ATTN: ATZA-DTE-EM

CRNEL, ATTN: Library 03755

ETL, ATTN: Library 22060

WES, ATTN: Library 39180

HQ, XVIII Airborne Corps and
 Ft. Bragg 28307
 ATTN: AFZA-FE-EE

Chanute AFB, IL 61868
 3345 CES/DE, Stop 27

Horton AFB CA 92409
 ATTN: AFRC-MQ/DEE

Tyndall AFB, FL 32403
 AFESC/Engineering & Service Lab

NAFEC
 ATTN: ROT&E Liaison Office (6)
 ATTN: Sr. Tech. FAC-03T 22332
 ATTN: Asst. CDR R&D, FAC-03 22332

NCEL 93041
 ATTN: Library (Code LOBA)

Defense Technical Info. Center 22314
 ATTN: ODA (12)

Engineering Societies Library
 New York, NY 10017

National Guard Bureau 20310
 Installation Division

US Government Printing Office 22304
 Receiving Section/Depository Copies (2)

US Army Env. Hygiene Agency
 ATTN: HSHB-E 21010

National Bureau of Standards 20760

EMC Team Distribution

Chief of Engineers 20314
 ATTN: DAEN-ZCF-B
 ATTN: DAEN-ECZ-A
 ATTN: DAEN-ECB (2)
 ATTN: DAEN-ZCP

US Army Engineer District
 New York 10007
 ATTN: Chief, Design Br
 Pittsburgh 15222
 ATTN: Chief, ORPCD
 ATTN: Chief, Engr Div
 Philadelphia 19106
 ATTN: Chief, NAFEN-D
 Baltimore 21203
 ATTN: Chief, Engr Div
 Norfolk 23510
 ATTN: Chief, NAOEN-M
 ATTN: Chief, NAOEN-D
 Huntington 25721
 ATTN: Chief, ORMED-F
 Wilmington 28401
 ATTN: Chief, SAMCO-C
 ATTN: Chief, SAMEN-D
 Charleston 29402
 ATTN: Chief, Engr Div
 Savannah 31402
 ATTN: Chief, SASAS-L
 Jacksonville 32232
 ATTN: Const Div
 Mobile 36628
 ATTN: Chief, SAMEN-D
 ATTN: Chief, SAMEN-F
 ATTN: Chief, SAMEN
 Nashville 37202
 ATTN: Chief, ORMED-F
 Memphis 38103
 ATTN: Chief, Const Div
 ATTN: Chief, LMED-D
 Vicksburg 39180
 ATTN: Chief, Engr Div
 Louisville 40201
 ATTN: Chief, Engr Div
 Detroit 48231
 ATTN: Chief, NCEED-T
 St. Paul 55101
 ATTN: Chief, ED-D
 ATTN: Chief, ED-F
 Chicago 60604
 ATTN: Chief, NCCCO-C
 ATTN: Chief, NCCED-F
 Rock Island 61201
 ATTN: Chief, Engr Div
 ATTN: Chief, NCRED-F
 St. Louis 63101
 ATTN: Chief, ED-D
 Kansas City 64106
 ATTN: Chief, Engr Div
 Omaha 68102
 ATTN: Chief, Engr Div
 New Orleans 70160
 ATTN: Chief, LMED-DG
 Little Rock 42203
 ATTN: Chief, Engr Div
 Tulsa 74102
 ATTN: Chief, Engr Div
 Ft. Worth 76102
 ATTN: Chief, SMFED-D
 ATTN: Chief, SMFED-F
 Galveston 77550
 ATTN: Chief, SMGAS-L
 ATTN: Chief, SMGCO-C
 ATTN: Chief, SMGED-DC
 Albuquerque 87103
 ATTN: Chief, Engr Div
 Los Angeles 90053
 ATTN: Chief, SPLED-F
 San Francisco 94105
 ATTN: Chief, Engr Div
 Sacramento 95814
 ATTN: Chief, SPKED-D
 ATTN: Chief, SPKCO-C
 Far East 96301
 ATTN: Chief, Engr Div

US Army Engineer District
 Portland 97208
 ATTN: Chief, DB-6
 ATTN: Chief, FM-1
 ATTN: Chief, FM-2
 Seattle 98124
 ATTN: Chief, NPSCO
 ATTN: Chief, NPSEM-FM
 ATTN: Chief, EN-DB-ST
 Walla Walla 99362
 ATTN: Chief, Engr Div
 Alaska 99501
 ATTN: Chief, NPASA-R

US Army Engineer Division
 New England 02154
 ATTN: Chief, MEDED-T
 ATTN: Laboratory
 ATTN: Chief, NEDCD
 Middle East (Rear) 22601
 ATTN: Chief, MEDED-T
 North Atlantic 10007
 ATTN: Chief, NADEN
 South Atlantic 30303
 ATTN: Laboratory
 ATTN: Chief, SADEEN-TC
 ATTN: Chief, SADEEN-TS
 Huntsville 35807
 ATTN: Chief, MNDED-CS
 ATTN: Chief, MNDED-M
 ATTN: Chief, MNDED-SR
 Lower Mississippi 39180
 ATTN: Chief, LMVED-G
 Ohio River 45201
 ATTN: Laboratory
 ATTN: Chief, Engr Div
 Missouri River 68101
 ATTN: Chief, MNDED-G
 ATTN: Laboratory
 Southwestern 75202
 ATTN: Laboratory
 ATTN: Chief, SMDED-MA
 ATTN: Chief, SMDED-TG
 South Pacific 94111
 ATTN: Laboratory
 Pacific Ocean 96858
 ATTN: Chief, Engr Div
 ATTN: FMAS Branch
 ATTN: Chief, PODED-D
 North Pacific 97208
 ATTN: Laboratory
 ATTN: Chief, Engr Div

6th US Army 94129
 ATTN: AFKC-EN

7th US Army 09407
 ATTN: AETM-WRD-END

HQ, Combined Field Army (ROK/US) 96358
 ATTN: CFAR-EN

HQDA SGRD-EDE 20314

US Army Foreign Science and
 Tech Center
 ATTN: Charlottesville, VA 22901
 ATTN: Far East Office 96328

USA ARRADCOM 07801
 ATTN: DRDAR-LCA-OK

HQ, USAMRDC
 ATTN: SGRD-PLC
 Fort Detrick, MD 21701

West Point, NY 10996
 ATTN: Dept of Mechanics
 ATTN: Library

Ft. Belvoir, VA 22060
 ATTN: ATSE-TD-TL (2)
 ATTN: Learning Resource Center
 ATTN: British Liaison Officer (5)

Ft. Benning, GA 31905
 ATTN: ATZB-FE-EP
 ATTN: ATZB-FE-BG

Ft. Clayton Canal Zone 34004
 ATTN: DFAE

Ft. Leavenworth, KS 66027
 ATTN: ATZLCA-SA

Ft. Lee, VA 23801
 ATTN: DRXMC-D (2)

Ft. McPherson, GA 30330
 ATTN: AFEN-CD

Ft. Monroe, VA 23651
 ATTN: ATEN-AD (3)
 ATTN: ATEN-FE-ME
 ATTN: ATEN-FE-EN (2)

Ft. Richardson, AK 99505
 ATTN: AFZT-FE-E

Rocky Mountain Arsenal 80022
 ATTN: SARRM-CD-FEP

USA-WES 39180
 ATTN: C/Structures
 ATTN: Soils & Pavements Lab

Naval Facilities Engr Command 22332
 ATTN: Code 04
 ATTN: Code 2013 C

Port Hueneme, CA 93043
 ATTN: Morell Library

Commander (Code 2636) 93555
 Naval Weapons Center

Bolling AFB, DC 20332
 AF/LEEUU

Little Rock AFB
 ATTN: 314/DEEE

Patrick AFB, FL 32925
 ATTN: XRQ

Tinker AFB, OK 73145
 2854 ABG/DEEE

Tyndall AFB, FL 32403
 AFESC/TST

Airports and Const Services Dir
 Technical Info Reference Center
 Ottawa, Ontario, Canada K1A 0N8

Bldg Research Advisory Board 20418
 Federal Aviation Administration 20540
 Dept of Transportation Library 20590
 Transportation Research Board 20418

Division of Building Research
 National Research Council
 Ottawa, Ontario, Canada K1A 0N8

National Defense Headquarters
 Director General of Construction
 Ottawa, Ontario, Canada K1A 0K2

Rosenfield, Myer J.
Construction of aluminum standing seam roofing at an Army facility. -
Champaign, IL : Construction Engineering Research Laboratory ; available
from NTIS, 1983.
25 p. (Interim report / Construction Engineering Research Laboratory ;
M-336)

1. Roofing, aluminum. 2. Defense Construction Supply Center,
Columbus, Ohio. I. Title. II. Series : Interim report (Construction
Engineering Research Laboratory) ; M-336.