# AD-A250 806



# Field Assessment Techniques for Bank Erosion Modeling

Final Report

Prepared for

US Army
European Research Office
USARDSG-UK
EDISON HOUSE
223 Old Marylebone Road
London, NW1 5TH
England

 $\mathbf{B} \mathbf{y}$ 

Colin R. Thorne
Department of Geography,
University of Nottingham,
Nottingham NG7 2RD, UK
Tel. (0602) 484848

Under

Research Contract R&D 6560-EN-09

This document has been approved for public release and sale; its distribution is unlimited.

February 1992



# **CONTENTS**

COVER SHEET		2
BACKGROUNI		3
TECHNICAL RI	EPORT	5
1	OBJECTIVES	5
2	APPROACHES UNDERTAKEN	6
	2.1 Bank Erosion Assessment Sheet Evaluation	6
	2.2 Bank Erosion Assessment Sheet Testing	6
	2.3 Bank Erosion Assessment Sheet	
	Guideline Evaluation	7
	3.4 Bank Erosion Assessment	
	Sheet Guideline Testing	7
	3.5 Bank Erosion Assessment Sheet	
	and Guideline Development	7
3	FINAL PRODUCTS	7
4	REFERENCE	8
APPENDIX A	Stream Reconnaissance Record Sheets &	
	Guidelines for the use of Stream Reconnaissance	
	Sheets in the Field	
APPENDIX B	Recommended Contents for a Stream Reconnaissance	
	Backpack	

#### BACKGROUND

Bank erosion, particularly when associated with vertical channel instability and/or active meander migration, poses serious problems to river channel users and flood plain dwellers. The rationale for this project was the realization that the causes of instability and erosion are often difficult to identify in the field. Even experienced river engineers and fluvial geomorphologists find it hard to accurately determine the dominant processes and mechanisms of erosion without recourse to expensive and time consuming measurements and observations. For non-specialist personnel the problem is much greater. As completely different processes may produce similar bank morphologies, it is easy to attribute bank retreat to totally the wrong cause. This can lead to the selection of inappropriate stabilization measures.

Also, the distribution of bank erosion varies within the channel as a function of time, and along the channel depending on than geometry and upstream conditions. This makes it very difficult to predict future distributions of bank erosion, rapid widening and bend migration. This capability is beyond the scope of even the most advanced bend flow and sediment process models currently available, but reliable qualitative and semi-quantitative predictions can be made on the basis of a sound geomorphic evaluation of the fluvial system, provided that the state of bank stability can be correctly established and the causes of bank retreat accurately identified.

90

Finally, the bank retreat may be due to lateral shifting of a channel in dynamic equilibrium, or it may be caused by local, reach scale or system wide channel instability. Again, correct identification of the cause of bank retreat has an important bearing on the optimum treatment to resolve the erosion problem.

Bank erosion is, therefore, a problem that is not easily diagnosed in the field, predicted into the future, or attributed to a specific cause. Yet, its analysis is vital to evaluating and predicting channel stability and the evolution of a dis-equilibrium channel from an unstable to a stable state. What is needed is a means of establishing how the flow in the channel acts on the bank and the bed close to the bank to produce erosion, how this erosion impacts the bank stability with respect to mass failure under gravity, where retreat will be located in the future and how local erosion processes are related to reach dynamics or to instability in the fluvial system.

Initially it was proposed to further develop the sheets produced in a previous project on bank erosion for the US Army WES (Thorne and Abt, 1989). Although at an early stage of development, this approach has the potential to become a standard method for the identification, delineation and characterisation of bank erosion in the field. The sheets supply the basic input of information for the bank stability model. They are supported by detailed guidelines for use by non-expert personnel.


However, during the project it became clear that developing an assessment system restricted to characterizing only the channel banks was too restrictive. Mr Thomas at WES and

the PI agreed that the scope of the field method should be expanded to cover not only the banks, but also the rest of the channel. This increased the scope of work and length of the reconnaissance sheets, but with the benefit of making the appraoch far more useful.

To generalize the method for practical use required field testing and validation of the sheets that was both intensive and extensive. This involved application of the sheets to a wide variety of cases in different river environments. The development of clear guidlines for users of the method who are not necessarily experts on channel processes demanded that the sheets be applied by engineers and scientists other than sedimentation experts, who might reasonably be expected to undertake channel surveys in the course of their assigned duties in channel evaluation, maintenance and improvement. The advanced development of these guidelines was a major task, but was vital to production of a braodly applicable and successful stream reconnaissance method.

The approach which has resulted is flexible and general, but sufficiently detailed to be useful for a variety of applications. Some prior knowledge is assumed: it is not feasible to write a set of guidelines that will allow an individual with no training in river mechanics and sedimentation to undertake a stream reconnaissance. However, every attempt has been made to keep things clear and understandable without the need for advanced specialist knowledge.

It is recommended that thought be given to training in Stream Reconnaissance based on this or some other systemmatic approach. This could be in the form of a short course or a video, or both.

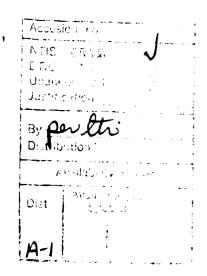

#### TECHNICAL REPORT

## 1 OBJECTIVES

The stated objectives of the proposed work were as follows:

- 1. To evaluate potential for practical application of existing bank erosion assessment sheets as an aid to field identification of:
  - a) the state of vertical and lateral channel stability;
  - b) the relation of local bank retreat to channel instability;
  - c) the engineering and morphological characteristics of the banks;
  - d) the dominant erosive forces and processes;
  - e) the state of bank stability and the major failure mechanisms;
  - f) the severity and extent of bank erosion in the reach; and
  - g) the input parameters necessary for modeling bank retreat.
- 2. To undertake field testing of the existing bank erosion assessment sheets in a wide variety of river environments to identify areas of weakness or processes/mechanisms and bank erosion scenarios not covered by them. Particular attention was to be paid to maintaining the comprensive nature of the sheets while minimising their length and complexity of completion.
- 3. To evaluate the existing guidelines on completion of the sheets, regarding their effectiveness in supporting field assessment of bank erosion by non-specialist personnel.
- 4. To undertake field testing of the existing bank erosion assessment sheet guidelines in a wide variety of river environments to identify areas of weakness or processes/mechanisms and bank erosion scenarios not covered by them. Particular attention was to be paid to ease of comprehension and clarity of statement in the guidelines in the light of comments from locally based specialist and non-specialist engineers and scientists.
- 5. To further develop the sheets and guidelines to produce an assessment system suitable for routine use nationwide by non-expert personnel.

With the exception that the scope of the bank erosion assessment sheets was increased to include the whole channel, these objectives were retained. However, to reflect the increased scope of the sheets they were renamed "Stream Reconnaissance Record Sheets".

## 2. APPROACHES UNDERTAKEN

#### 2.1 Bank Erosion Assessment Sheet Evaluation

The preliminary assessment sheets developed by Thorne and Abt (1989) were evaluated in the light of critical comment from project reviewers at the University of Louisville and post-project input from engineers and scientists at the US Army Engineer Waterways Experiment Station. Improvements to the existing sheets were made based on these independent reviews in Phase 1 of the project, in the summer and fall of 1990, and reported in detail in the first interim report in November 1990.

# 2.2 Bank Erosion Assessment Sheet Testing

The updated versions of the stream reconnaissance sheets were field tested in Phase 2, by the Principal Investigator together with appropriate personnel from US Army Engineer Waterways Experiment Station, using field sites on a variety of rivers within the contiguous United States. It was planned to visit between 3 and 6 separate locations and this was overachieved in that 7 sites were studied. The locations were selected to include a wide range of river environments, in terms of the physiographic regions drained by the rivers, the size and morphology of the channels, the nature of the bed and bank materials, and, most particularly, the range of causes, processes and mechanisms involved in bank retreat. Non-specialist engineers and scientists from local District Offices of the Corps of Engineers accompanied the PI's and WES personnel into the field to assist in the on-site testing of the assessment sheets. The local knowledge so gained was vital to in-depth testing of the sheets. The precise details of the dates, locations and participants are listed below:

<u>Date</u>	<u>Location</u>	<u>Participants</u>
October 1990	Clear Creek, Mississippi	Sedimentation Course Students
May 1991	White Water River, Indiana	Section 14 Short Course Students
July 1991	Seneca Creek, Maryland	<b>Baltimore District Personnel</b>
	Nonconnah Creek, Tennessee	Memphis District Personnel
	Ten Mile River, Texas	Ft Worth District Personnel
	Sacramento River, California	Scaramento District Personnel
	Snake River, Wyoming	Walla Walla District Personnel

Field testing of the sheets proved invaluable. The comments and suggestions from the District personnel produced major changes and additions to the sections that transformed them from academically sound but practically obscure documents, to really useful aides to operational staff in the field.

#### 2.3 Bank Erosion Assessment Sheet Guideline Evaluation

The preliminary guidelines for application of the assessment sheets developed by Thorne and Abt (1989) were evaluated in the light of critical comment from project reviewers at the University of Louisville and post-project input from engineers and scientists at the US Army Engineer Waterways Experiment Station. Significant improvements to the existing guidelines were made based on these independent reviews in Phase 1 of the project, in the summer and fall of 1990, and reported in detail in the first interim report in November 1990.

# 2.4 Bank Erosion Assessment Sheet Guideline Testing

The updated version of the bank erosion assessment sheet guidelines (as contained in the Interim Report) was also field tested in Phase 2, by the Principal Investigator together with appropriate personnel from US Army Engineer Waterways Experiment Station, using the field sites listed in 2.2. Non-specialist engineers and scientists from local District Offices of the Corps of Engineers did accompany the PI's and WES personnel into the field to assist in the on-site testing of the guidelines. They then briefed the PI regarding the strengths and weaknesses of the guidelines as they perceived them, and suggested numerous changes and improvements as necessary. This allowed the original objective of producing a set of guidelines which is genuinely usable by non-specialist personnel to be achieved.

## 2.5 Bank Erosion Assessment Sheet and Guideline Development

In the final phase, Phase 3, the comments and input from District personnel were used to further develop the sheets and guidelines in the light of the direct field experience gained in Phase 2. This part of the project involved incorporating improvements, deleting extraneous sections, and optimizing the gathering of information, so that the resulting sheets and guidelines are now much more comprehensive and accurate, while being managable and unambiguous.

## 3. FINAL PRODUCTS

The original proposal listed the following, anticipated products:

- 1. Tested and verified Bank Erosion Assessment Sheets to be used as an aid to field identification of:
  - a) the state of vertical and lateral channel stability;
  - b) the relation of local bank retreat to channel instability;
  - c) the engineering and morphological characteristics of the banks;

- d) the dominant erosive forces and processes;
- e) the state of bank stability and the major failure mechanisms;
- f) the severity and extent of bank erosion in the reach; and
- g) the input parameters necessary for modeling bank retreat.
- 2. Documentation providing clear and detailed guidance on the use of the bank erosion assessment sheets for use by personnel who are not experts on bank erosion.

The final products (Appendices A and B) meet all these criteria, but also go beyond the original expectation.

The sheets and guidelines present a system for the orderly and disciplined collection and recording of comprehensive qualitative and semi-quantitative data on streams. While still developmental, since they are the product of a relatively small project, they are based on real world application by practising engineers concerned with actual problems. As such they should be of some immediate use to the US Army Corps of Engineers in fulfilling its mission.

The devlopment of a "Stream Reconnaissance Backpack" of useful equipment for field reconnaissance is a valuable spin-off from this work. Six such field packs are now kept at WES and they are proving to be very popular with field personnel.

#### 4. REFERENCE

Thorne, C.R. and Abt, S.R. "Bank Erosion Modeling and Assessment Techniques" Colorado State University, Department of Civil Engineering, Report to the US Army Engineer Waterways Experiment Station, Vicksburg, Mississippi under contract number DACW3987D0031, November 1989.

APPENDIX A Stream Reconnaissance Record Sheets & Guidelines for the use of Stream Reconnaissance Sheets in the Field

# STREAM RECONNAISSANCE RECORD SHEETS

and

# GUIDELINES FOR THE USE OF STREAM RECONNAISSANCE RECORD SHEETS IN THE FIELD

Prepared for

US Army Engineer Waterways Experiment Station, PO Box 631 CEWES-HS, Vicksburg, Mississippi 39181

By

Colin R. Thorne

Department of Geography, University of Nottingham, Nottingham NG7 2RD, UK

February 1992

# CONTENTS

ST	REAM RECONNAISSANCE RECORD SHEETS	3
	JIDELINES FOR THE USE OF STREAM RECONNAISSANCE	
RE	CORD SHEETS IN THE FIELD	10
1	BACKGROUND	10
	1.1 Introduction	10
	1.2 Overall Structure of the Sheets	11
	1.3 Applications of the Reconnaissance Sheets	12
2	GUIDELINES FOR COMPLETING THE SHEETS	14
	2.1 Introduction	1 4
	2.2 Section 1 - Scope and Purpose	16
	2.3 Section 2 - Region and Valley Description	18
	Part 1 Area around River Valley	18
	Part 2 River Valley and Valley Sides	21
	Part 3 Flood Plain (Valley Floor)	24
	Part 4 Vertical Relation of Channel to Valley	26
	Part 5 Lateral relation of Channel to Valley	31
	2.4 Section 3 - Channel Survey	38
	Part 6 Channel Description	38
	Part 7 Bed Sediment Description	4 1
	2.5 Section 4 - Left Bank Survey	52
	Part 8 Left Bank Characteristics	52
	Part 9 Left Bank Vegetation	60
	Part 10 Left Bank Erosion	67
	Part 11 Left Bank Geotech Failures	74
	Part 12 Left Bank Toe Sediment Balance	83
	2.6 Section 5 - Right Bank Survey	90
3	CONCLUSIONS	90
4	ACKNOWLEDGEMENTS	90
5	REFERENCES	91

# STREAM RECONNAISSANCE RECORD SHEET

Developed by Colin R. Thorne for the US Army Engineer Waterways Experiment Station, Vicksburg, Mississippi

	SEC*	TION I - SCO	PE AND PURPOS	E	
Brief Problem Stat	ement:-				
Purpose of Stream	Reconnaissance:-				
<u></u>					
Logistics of Recont	aissance Trip:-		· — —		
RIVER		LOCATION			DATE
				From	То
PROJECT			STUDY REACH		
SHEET COMPLET	ED BY				
1					
RIVER STAGE			TIME: START		TIME: FINISH
General Notes and	Comments on Reconnais	ssance Trip:-			
		•			
}					

		2 - REGION AND			
PART 1: AREA AROU!	ND RIVER VALLEY	Surface Geology	Rock Type	Land Use	Vegetation
Terrain	Drainage Pattern	Bed rock	Sedimentary	Natural	Tropical forest
Mountains	Dendritic Dendritic	Weathered Soils	Metamorphic	Managed	Temperate forest
Uplands	Parallel	Glacial Moraine	Igneous	Cultivated	Boreal forest
Hills	Trellis	Glacio/Fluvial	None	Urban	Woodland
Plains	Rectangular	Fluvial		Suburban	Savanna
Lowlands	Radial	Lake Deposits			mperate grassland
	Annular		Specific Rock Types (if i		Desent scrub
1	Multi-Basin	(,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	77-1-1		Extreme Desert
1	Contorted	<b>+</b>			Tundra or Alpine
ļ	CO1101162	}-			Agricultural land
1		L			Agricondial late
Notes and Comments:					
.votes and Comments.					
L	<del></del>		·····		
DARTS DIVERNALL	EY AND VALLEY SIDES		<del></del>	Interpretative Ob	
1			V-11 Clas	Interpretative Of	
Location of River	Height	Side	Valley Side	Material Type	Severity
In Valley	< 20 feet	Slope Angle	Failures	Bedrock	of Problems
On Alluvial Fan	20-50 feet	< 5degrees	None	Soils	Insignificant
On Alluviai Plain	50-100 feet	5-10 degrees	Occasional	Unconsolidated debris	Mild
ln a Delta	100-200 feet	10-20 degrees	Frequent	Failure Type	Significant
In Old Lake Bed	200-500 feet	20-50 degrees	Failure Locations	(see Sketches in Manual)	Serious
Valley Shape	>500 feet	>50 degrees	None		Catastrophic
Symmetrical	- Luciani	~	Away from river		• •
Asymmetrical		Ale	ong river (Undercut)	Level of Confidence in answe	rs (Circle one)
-,				0 10 20 30 40 50 60 70 8	
Notes and Comments:					
			<u> </u>		
PART 3: FLOOD PLAIS	MALIEV FLOOD	Surface Geology	Land Use	Vegetation	Riparian Buffer Strip
•					• —
Valley Floor Type	Valley Floor Data	Bed rock	Natural	None	None
None	None	Glacial Moraine	Managed	Unimproved Grass	Indefinite
Indefinite	< 1 river width	Glacio/Fluvial	Cultivated	Improved Pasture	Fragmentary
irragmentary	1 - 5 river widths	Fluvial: Alluvium	Urban	Orchards	Continuous
Continuous	5-10 river widths	Fluvial: Backswamp	Suburban	Arable Crops	Strip Width
	>10 river widths	Lake Deposits	Industrial	Shrubs	None
1	Flow Resistance*	Wind Blown (Loess)		Deciduous Forest	< 1 river width
Left Overb	ank Manning n value	• —		Coniferous Forest	1 - 5 river widths
	-				<b>4</b>
Right Overh	ank Manning n value (*	note: n value for channel i	s recorded in Part 6)	Mixed Forest	> 5 river widths
Right Overh	eank Manning n value(*	note: n value for channel i	s recorded in Part 6)	Mixed Forest	> 5 river widths
	vank Manning n value(*	note: n value for channel i	s recorded in Part 6)	Mixed Forest	> 5 river widths
Right Overh Notes and Comments:-	eank Manning n value(*	note: n value for channel i	s recorded in Part 6)	Mixed Forest	> 5 river widths
	ank Manning n value(*	note: n value for channel i	s recorded in Part 6)	Mixed Forest	> 5 nver widths
	aank Manning n value (*	note: n value for channel i	s recorded in Part 6)	Mixed Forest	> 5 river widths
	aank Manning n value (*	note: n value for channel i	s recorded in Part 6)	Mixed Forest	> 5 river widths
Notes and Comments:			s recorded in Part 6)		
Notes and Comments:  PART 4: VERTICAL R	ELATION OF CHANNEL	TO VALLEY		Interpretative Ol	pservations
Notes and Comments:- PART 4: VERTICAL R Terraces	ELATION OF CHANNEL	TO VALLEY Levees	Levee Data	Interpretative Ol Present Status	bservations Problem Severity
Notes and Comments:- PART 4: VERTICAL R Terraces None	ELATION OF CHANNEL Overbank Deposits None	TO VALLEY  Levees  None	Levee Data Height (f)	Interpretative Ol Present Status Adjusted	bservations Problem Severity Insignificant
PART 4: VERTICAL R Terraces None indefinate	ELATION OF CHANNEL Overbank Deposits None	TO VALLEY  Levees  None  Natural	Levee Data	Interpretative Ol Present Status Adjusted Incised	pservations Problem Severity Insignificant Moderate
PART 4: VERTICAL R Terraces None indefinate I-raginentary	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand	TO VALLEY  Levees  None  Natural  Man-made	Levee Data Height (f) Side Slope (o)	Interpretative Ol Present Status Adjusted	Problem Severity Insignificant Moderate Serious
PART 4: VERTICAL R Terraces None indefinate Fragmentary Continuous	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand	TO VALLEY  Levees  None  Natural  Man-made  Levee Description	Levee Data Height (f) Side Slope (o) Levee Condition	Interpretative Ol Present Status Adjusted Incised Aggraded M	pservations Problem Severity Insignificant Moderate Serious Problem Extent
PART 4: VERTICAL R Terraces None indefinate Pragmentary Continuous Nature of Terraces	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None	Levee Data Height (f) Side Slope (o) Levee Condition None	Interpretative Ol Present Status Adjusted Incised Aggraded Instability Status	Problem Severity Insignificant Moderate Serious Problem Extent None
PART 4: VERTICAL R Terraces None indefinate fragmentary Continuous Namber of Terraces Trash Lines	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact	Interpretative Ol Present Status Adjusted Incised Aggraded Aggraded Instability Status	Problem Severity Insignificant Moderate Serious Problem Extent None Local
PART 4: VERTICAL R Terraces None indefinate Pragmentary Continuous Nature of Terraces	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading	bservations Problem Severity Insignificant Moderate Serious Problem Extent None Local General
PART 4: VERTICAL R Terraces None indefinate Fragmentary Continuous Namber of Terraces Trash Lines	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact	Interpretative Ol Present Status Adjusted Incised Aggraded Aggraded Instability Status	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale
PART 4: VERTICAL R Terraces None indefinate irragmentary Continuous Natifier of Terraces Trash Lines Absent	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading	bservations Problem Severity Insignificant Moderate Serious Problem Extent None Local General
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Nariber of Terraces Trash Lines Absent Present	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional
PART 4: VERTICAL R Terraces None indefinate Fragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional
PART 4: VERTICAL R Terraces None indefinate Fragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank  Right Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one)
PART 4: VERTICAL R Terraces None indefinate Fragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank  Right Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Incised Incis	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one)
PART 4: VERTICAL R  Terraces None Indefinate Irragmentary Continuous Natifier of Terraces Trash Lines Absent Present Ht above flood plain (ft)	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank  Right Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Incised Incis	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one)
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Natifier of Terraces Trash Lines Absent Present Ht above flood plain (ft)	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank  Right Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Incised Incis	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one)
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Natifier of Terraces Trash Lines Absent Present Ht above flood plain (ft)	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank  Right Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Incised Incis	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one)
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Nature of Terraces Trash Lines Absent Present Ht above flood plain (ft)	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel	TO VALLEY  Levees  None  Natural  Man-made  Levee Description  None  Indefinite  Fragmentary  Continuous  Left Bank  Right Bank	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Incised Incis	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one)
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Nature of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders	Levees None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Level of Confidence in answe	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one)
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:	ELATION OF CHANNEL  Overbank Deposits  None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL	Levees None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Level of Confidence in answer of 10 20 30 40 50 60 70 1	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one) So 90 100 %
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Number of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:-	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  Both Banks  TO VALLEY Lateral Activity	Levee Data Height (f) Side Slope (o)  Levee Condition Nonc Intact Local Failures Frequent failures	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Level of Confidence in answer of 10 20 30 40 50 60 70 1	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one) 80 90 100 %
PART 4: VERTICAL R Terraces None indefinate Fragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:-	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures  Frodoplain Features None	Interpretative Of Present Status Adjusted   Incised   Aggraded   Instability Status Stable   Degrading   Aggrading   Instability Status   Instability Status   Instability Status   Instability Status   Instability Status   Instability Status   Interpretative Of Present Status   Adjusted   Interpretative Of Interpretat	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional Its (Circle one) So 90 100 %
PART 4: VERTICAL R Terraces None indefinate irragmentary Continuous Natifier of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravet Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width	Levees None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures  Plood plain Features None Meander scars	Interpretative Of Present Status  Adjusted Incised Aggraded Instability Status  Stable Degrading Aggrading Instability Status  Level of Confidence in answere 0 10 20 30 40 50 60 70 Interpretative Of Present Status  Adjusted Over wide	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one) 80 90 100 %  Deservations Problem Severity Insignificant Moderate
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Natifier of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:-	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength	Levees None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Increasing amplitude	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures  Flood plain Features None Meander scars Scroll bars+sloughs	Interpretative Of Present Status Adjusted   Incised   Aggraded   Instability Status Stable   Degrading   Aggrading   Instability Status   Instability Status   Instability Status   Instability Status   Instability Status   Instability Status   Interpretative Of Present Status   Adjusted   Interpretative Of Interpretat	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one) 80 90 100 %  Discriptions Problem Severity Insignificant Moderate Serious
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravet Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width	Levees None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Larcasing amplitude Progression+cut-offs	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures  Frought Frequent failures  Meander scars Scroll bars+sloughs Oxbow lakes	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Level of Confidence in answer of 10 20 30 40 50 60 70 Interpretative Of Present Status Adjusted Over wide Too narrow	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one) 0 90 100 %  Diservations Problem Severity Insignificant Moderate Serious Problem Extent
PART 4: VERTICAL R Terraces None Indefinate Irragmentary Continuous Natifier of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:-  PART 5: LATERAL RE Planform Straight Sinuous Irregular	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength	Levees None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Increasing amplitude	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures  Frought Failures  Meander scars Scroll bars+sloughs Oxbow lakes Irregular terrain	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Level of Confidence in answer of 10 20 30 40 50 60 70 10 10 20 30 40 50 60 70 10 10 10 10 10 10 10 10 10 10 10 10 10	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional IS (Circle one) 80 90 100 %  Deservations Problem Severity Insignificant Moderate Serious Problem Extent None
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Linguage amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures  Frought Frequent failures  Meander scars Scroll bars+sloughs Oxbow lakes	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Instability Status  Level of Confidence in answere 0 10 20 30 40 50 60 70 Interpretative Of Present Status Adjusted Over wide Too narrow Instability Status Stable	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional ITS (Circle one) 80 90 100 %  Deservations Problem Severity Insignificant Moderate Serious Problem Extent None Local
PART 4: VERTICAL R Terraces None Indefinate Fragmentary Continuous Number of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:-  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders Irregular regular regular meanders Irregular meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity	Levees None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Increasing amplitude Progression+cut-offs Irregular erosion	Levee Data Height (f) Side Slope (o)  Levee Condition None Intact Local Failures Frequent failures  Frought Failures  Meander scars Scroll bars+sloughs Oxbow lakes Irregular terrain	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Level of Confidence in answer of 10 20 30 40 50 60 70 10 10 20 30 40 50 60 70 10 10 10 10 10 10 10 10 10 10 10 10 10	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional IS (Circle one) 80 90 100 %  Deservations Problem Severity Insignificant Moderate Serious Problem Extent None
PART 4: VERTICAL R Terraces None indefinate Irragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders Irregular meanders Irotuous meanders Tortuous meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity Location in Valley	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Linguage amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o) Levee Condition None Local Failures Frequent failures Frequent failures Scroll bars+sloughs Oxbow lakes Irregular terrain Abandoned channel	Interpretative Of Present Status Adjusted Incised Aggraded Instability Status Stable Degrading Aggrading Instability Status  Level of Confidence in answere 0 10 20 30 40 50 60 70 Interpretative Of Present Status Adjusted Over wide Too narrow Instability Status Stable	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional ITS (Circle one) 80 90 100 %  Deservations Problem Severity Insignificant Moderate Serious Problem Extent None Local
PART 4: VERTICAL R Terraces None indefinate Irragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders Irregular meanders Irotuous meanders Tortuous meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity Location in Valley Left Middle	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Linguage amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o) Levee Condition None Local Failures Frequent failures Frequent failures Scroll bars+sloughs Oxbow lakes Irregular terrain Abandoned channel	Interpretative Of Present Status  Adjusted Incised Aggraded Incised Aggraded Instability Status  Stable Degrading Aggrading Instability Status  Level of Confidence in answered 10 20 30 40 50 60 70 Interpretative Of Present Status  Adjusted Over wide Too narrow Instability Status  Stable Widening	Problem Severity Insignificani Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one) 80 90 100 %  Descriptions Problem Severity Insignificant Moderate Serious Problem Extent None Local General General
PART 4: VERTICAL R Terraces None indefinate Irragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders Irregular meanders Irotuous meanders Tortuous meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity Location in Valley Left	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Linguage amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o) Levee Condition None Local Failures Frequent failures Frequent failures Scroll bars+sloughs Oxbow lakes Irregular terrain Abandoned channel	Interpretative Of Present Status  Adjusted Incised Aggraded Incised Aggraded Instability Status  Stable Degrading Aggrading Instability Status  Level of Confidence in answered 10 20 30 40 50 60 70 Interpretative Of Present Status  Adjusted Over wide Too narrow Instability Status  Stable Widening	Problem Severity Insignificani Moderate Serious Problem Extent None Local General Reach scale System wide Regional rs (Circle one) 80 90 100 %  Deservations Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale
PART 4: VERTICAL R Terraces None indefinate Irragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders Irregular meanders Irotuous meanders Tortuous meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity Location in Valley Left Middle	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Linguage amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o) Levee Condition None Local Failures Frequent failures Frequent failures Scroll bars+sloughs Oxbow lakes Irregular terrain Abandoned channel	Interpretative Of Present Status Adjusted   Incised   Aggraded   Instability Status   Stable   Degrading   Aggrading   Level of Confidence in answer   O 10 20 30 40 50 60 70    Interpretative Of Present Status   Adjusted   Ower wide   Too narrow   Instability Status   Stable   Widening   Narrowing   Our wing   Our win	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional Is (Circle one) 80 90 100 %  Deservations Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional
PART 4: VERTICAL R Terraces None indefinate Irragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders Irregular meanders Irotuous meanders Tortuous meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity Location in Valley Left Middle	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Increasing amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o) Levee Condition None Local Failures Frequent failures Frequent failures Scroll bars+sloughs Oxbow lakes Irregular terrain Abandoned channel	Interpretative Of Present Status  Adjusted Incised Aggraded Incised Aggraded Instability Status Stable Degrading Aggrading Instability Status Stable Degrading Aggrading Interpretative Of On 20 30 40 50 60 70 Instability Status Stable Widening Narrowing Instability Status Status Stable Widening Narrowing Instability Status Status Stable Widening Narrowing Instability Status Stabl	Problem Severity Insignificani Moderate Serious Problem Extent None Local General Reach scale System wide Regional ITS (Circle one) Problem Extent None Local General Resch scale System wide Regional ITS (Circle one) Regional General Reach scale System wide Regional ITS (Circle one)
PART 4: VERTICAL R Terraces None Indefinate Irragmentary Continuous Natifier of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Simuous Irregular Regular meanders Irregular meanders Irregular meanders Irregular meanders Braided	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity Location in Valley Left Middle	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Increasing amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o) Levee Condition None Local Failures Frequent failures Frequent failures Scroll bars+sloughs Oxbow lakes Irregular terrain Abandoned channel	Interpretative Of Present Status Adjusted   Incised   Aggraded   Instability Status   Stable   Degrading   Aggrading   Level of Confidence in answer   O 10 20 30 40 50 60 70    Interpretative Of Present Status   Adjusted   Ower wide   Too narrow   Instability Status   Stable   Widening   Narrowing   Our wing   Our win	Problem Severity Insignificani Moderate Serious Problem Extent None Local General Reach scale System wide Regional ITS (Circle one) Problem Extent None Local General Resch scale System wide Regional ITS (Circle one) Regional General Reach scale System wide Regional ITS (Circle one)
PART 4: VERTICAL R Terraces None indefinate Irragmentary Continuous Namber of Terraces Trash Lines Absent Present Ht above flood plain (ft)  Notes and Comments:  PART 5: LATERAL RE Planform Straight Sinuous Irregular Regular meanders Irregular meanders Irotuous meanders Tortuous meanders	ELATION OF CHANNEL Overbank Deposits None Silt Fine sand Medium sand Coarse sand Gravel Boulders  ELATION OF CHANNEL Planform Data Bend Radius Meander belt width Wavelength Meander Sinuosity Location in Valley Left Middle	TO VALLEY  Levees  None Natural Man-made Levee Description None Indefinite Fragmentary Continuous Left Bank Right Bank Both Banks  TO VALLEY Lateral Activity None Meander progression Increasing amplitude Progression+cut-offs Irregular erosion Avulsion	Levee Data Height (f) Side Slope (o) Levee Condition None Local Failures Frequent failures Frequent failures Scroll bars+sloughs Oxbow lakes Irregular terrain Abandoned channel	Interpretative Of Present Status  Adjusted Incised Aggraded Incised Aggraded Instability Status Stable Degrading Aggrading Instability Status Stable Degrading Aggrading Interpretative Of On 20 30 40 50 60 70 Instability Status Stable Widening Narrowing Instability Status Status Stable Widening Narrowing Instability Status Status Stable Widening Narrowing Instability Status Stabl	Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional ITS (Circle one) Problem Extent Moderate Serious Problem Severity Insignificant Moderate Serious Problem Extent None Local General Reach scale System wide Regional ITS (Circle one)

	S	ECTION 4 - LEFT BA	NK SURVEY		
PART 8: LEFT BANK Type Noncohesive Cohesive Composite Layered		Layer Thickness Ave Material 1 (ft) Av Material 2 (ft) Material 3 (ft) A	. Bank Height	Bank Profile Shape se sketches in manual)	Tension Cracks None Occasional Frequent Crack Depth
Even Layers Thick+thin layers Number of layers Protection Status	Sand/gravel Gravel Gravel/cobbles Cobbles Cobbles/coulders	Distribution and Descript		in Bank Profile  Material Type 3  Toe	Proportion of bank height  Material Type 4  Toe
Unprotected Hard points Toe protection Revetments Dyke Fields	Boulders/bedrock	Mid-Bank Upper Bank Whole Bank D50 (mm)	Mid-Bank Upper Bank Whole Bank D50 (mm) orting coefficient	Mid-Bank Upper Bank Whole Bank D50 (mm) sorting coefficient	Mid-Bank Upper Bank Whole Bank D50 (mm) sorting coef.
Notes and Comments:					-
PART 9: LEFT BANK Vegetation None/fallow Artificially cleared Grass and flora	-FACE VEGETATION  Tree Types  None  Deciduous  Coniferous	Density + Spacing None Sparse/clumps dense/clumps	Location Whole bank Upper bank Mid-bank	Health Healthy Fair Poor	Height Short Medium Tall
Reeds and sedges Shrubs Saplings Trees Orientation	Mixed Tree species (if known)	Sparce/continuous Dense/continuous Roots Normal Exposed	Lower bank  Diversity  Mono-stand  Mixed stand	DeadAgeMature	Height (ft)  Lateral Extent  Wide belt  Narrow belt
Angle of leaning (o)  Notes and Comments:-		Adventitious C	limax-vegetation.	Old	Single row
Bank Profile Sketc	hes	-			
Bank Top Edge		Profile Symb	ois	Engineered Structure	1000 E
Bank Toe	- <b>E</b>	Attached bar		Significant vegetation	Ç. Ç.
Water's Edge		Undercutting		Vegetation Limit	**************************************

PART 10: LEFT BANK			Interpretative O		
Erosion Location	Present Status	Severity of Erosion	Processes	Distribution of Each Pro-	ess on Bank
General	Intact	Insignificant 🔃	Parallel flow	Process 1	Process 2
Outside Meander	Eroding:dormant	Mild [	Impinging flow	Toe (undercut)	Toe (undercut)
Inside Meander	Eroding:active	Significant	Piping	Lower bank	Lower bank
Opposite a bar	Advancing:dormant	Serious 🗍	Freeze/thaw	Upper bank	Upper bank
Behind a bar	Advancing:active	Catastrophic	Sheet erosion	Whole bank	Whole bank
Opposite a structure			Rilling + gullying	Process 3	Process 4
Adjacent to structure	Rate of Retreat	Extent of Erosion	Wind waves	Toe (undercut)	Toe (undercut)
Dstream of structure	ft/yr (if applicable	None	Vessel Forces	Lower bank	Lower bank
Ustream of structure	and known)	Local	Ice rafting	Upper bank	Upper bank
Other (write in)	Rate of Advance	General	Other (write in)	Whole bank	Whole bank
	ft/yr (if applicable	Reach Scale	• • •		
~ <del>~~~~~</del>	and known)	System Wide		Level of Confidence in answer	(Circle one)
		· · · · · · · · · · · · · · · · · · ·	ليــــــــــــــــــــــــــــــــــــ	0 10 20 30 40 50 60 70 8	
Notes and Comments:-					
	GEOTECH FAILURES		Interpretative O		
Failure Location	Present Status	Instability:Severity	Failure Mode	Distribution of Each Mo	
General	Stable	Insignificant	Soil/rock fall	Mode 1	Mode 2
Outside Meander	Unreliable	Mild []	Shallow slide 🔲	Toe	Toe
Inside Meander	Unstable:dormant	Significant	Rotational slip	Lower bank	Lower bank
Opposite a bar	Unstable:active	Serious	Slab-type block	Upper bank	Upper bank
Behind a bar		Catastrophic	Cantilever failure	Whole bank	Whole bank
Opposite a structure	Failure Scars+Blocks		Pop-out failure	Mode 3	Mode 4
Adjacent to structure	None	Instability: Extent	Piping failure	Toe [	Toe
Dstream of structure	Old	None [	Dry granular flow	Lower bank	Lower bank
Ustream of structure	Recent	Local	Wet earth flow	Upper bank	Upper bank
Other (write in)	Fresh	General	Other (write in)	Whole bank	Whole bank
	Contemporary	Reach Scale			
		System Wide	<del></del>	Level of Confidence in answer	s (Circle one)
	1	5)516.11	1	0 10 20 30 40 50 60 70 8	
Notes and Copmments:-				0 10 20 30 40 30 00 70 0	70 70 700 10
•					
PART 12: LEFT BANK	TOE SEDIMENT ACCU	MULATION		Interpretative Ob	servations
Stored Bank Debris	Vegetation	Age	Health		diment Balance
None	None/fallow	Immature	Healthy	Planar	Accumulating
Individual grains	Antificially cleared	Mature	Unhealthy	Concave upward	Steady State
Aggregates+crumbs	Grass and flora	Old	Dead	Convex upward	Undercutting
Root-bound clumps	Reeds and sedges	Age in Years		Present Debris Storage	Unknown
Small soil blocks	Shrubs	/ige in reals	Roots	No bank debris	
Medium soil blocks	Saplings	Tree species	Normal	Little bank debris	
Large soil blocks	Trees	(if known)	Adventitious	Some bank debris	
Cobbles/houlders	ļ		Exposed	Lots of bank debris	- (C)1- · · ·
Boulders	l.			Level of Confidence in answer 0 10 20 30 40 50 60 70 8	
otes and Comments:				0 10 20 30 40 30 60 70 8	00 70 100 76
and Comments.					

\*

ſ	SI	ECTION 5 - RIGHT	BANK SURVEY		
PART 13: RIGHT BAN	K CHARACTERISTICS				
Type Noncohesive	Bank Materials Silt/clay	Layer Thickness  Material 1 (ft)	Ave. Bank Height Average height (ft) (f)	Bank Profile Shape see sketches in manual)	Tension Cracks None
Cohesive	Sand/silt/clay	Material 2 (ft)	WACIARC HEIRUR (II)	see skeedies in manual)	Occasional
Composite	Sand/silt	Material 3 (ft)	Ave. Bank Slope		Frequent .
Layered	Sand	Material 4 (ft)	Average angle (o)		Crack Depth
Even Layers	Sand/gravel	` '—	• • • • •		Proportion of
Thick+thin layers	Gravel				bank height
Number of layers	Gravel/cobbles		cription of Bank Material		
Protection Status	Cobbles Cobbles Cobbles/boulders	Material Type 1	Material Type 2	Material Type 3	Material Type 4
Unprotected	Boulders/bedrock	Toe Mid-Bank	Toe Mid-Bank	Toe Mid-Bank	Toe Mid-Bank
Hard points	Boulders/Desilock	Upper Bank	Upper Bank	Upper Bank	Upper Bank
Toe protection		Whole Bank	Whole Bank	Whole Bank	Whole Bank
Revetments		D50 (mm)	D50 (mm)	D50 (mm)	D50 (mm)
Dyke Fields		sorting coefficient	sorting coefficient	sorting coefficient	sorting coef.
Notes and Comments:-					
[					
	K-FACE VEGETATION				
Vegetation	Tree Types	Density + Spacing	Location	Health	Height
None/fallow	None	None	Whole bank	Healthy	Short
Artificially cleared	Deciduous	Sparse/clumps	Upper bank	Fair	Medium
Grass and flora	Coniferous	dense/clumps	Mid-bank	Poor	Tall Uniche (6)
Reeds and sedges Shrubs	Mixed Tree species	Sparce/continuous Dense/continuous	Lower bank	Dead	Height (ft)
Saplings	(if known)	Roots	Diversity	Age	Lateral Extent
Trees	(II ALIVAII)	Normal	Mono-stand	Imature	Wide belt
Orientation		Exposed	Mixed stand	Mature	Narrow belt
Angle of leaning (o)		Adventitious	Climax-vegetation	Old	Single row
Notes and Comments:					
Bank Profile Sketch	es				
		Profile Sy	Ziodan		
Bank Top Edge		Faried debns		Enginœrea Suricaire	<u> </u>
Bank Toe	_	Auached bar		e:	
340.00	=	Audied bar		gistuticant sederation	
Water's Edge	`	Undercutting	-	Vegetation Limit	3
	=				*
ł					
j	•				

PART 15: RIGHT BANK E			Interpretative O	bzervations	
Erosion Location	Present Status	Severity of Erosion	Processes	Distribution of Each Process on Ba	nk
General	Intact	Insignificant	Parallel flow		cess 2
Outside Meander	Eroding:dormant	Mild	Impinging flow	Toe (undercut) Toe (und	ercui)
Inside Meander	Eroding:active	Significant	Piping	Lower bank Lower	bank
Opposite a bar A	dvancing:dormant	Serious	Freeze/thaw	Upper bank Upper	bank
Behind a bar	Advancing:active	Catastrophic	Sheet erosion	Whole bank Whole	
Opposite a structure	· ·	. —	Rilling + gullying	. —	cess 4
Adjacent to structure	Rate of Retreat	Extent of Erosion	Wind waves	Toe (undercut) Toe (und	
	ft/yr (if applicable	None [	Vessel Forces	Lower bank Lower	
Ustream of structure	and known)	Local	Ice rafting	Upper bank Upper	
	Rate of Advance	General	Other (write in)		bank
	ft/yr (if applicable	Reach Scale	O (	" more dame " more	
<del></del>	and known)	System Wide		Level of Confidence in answers (Circle of	\
	## XIN WIII)	System with		0 10 20 30 40 50 60 70 80 90 100	
Notes and Comments:-					*
PART 16: RIGHT BANK G	WAYN WAYN WATER HOLKS		Interpretative O	the second secon	
Failure Location	Present Status	Instability:Severity	Failure Mode	Distribution of Each Mode on Ban	
General	Stable	Insignificant	Soil/rock fall		ode 2
Outside Meander	Unreliable	Mild	Shallow slide	Toe	Toe -
· —	Unstable:dormant	Significant	Rotational slip		bank H
Opposite a bar	Unstable:active	Serious	Slab-type block		bank
Behind a bar	Ulbunoic.active	Catastrophic	Cantilever failure		bank
	lure Scars+Blocks	Catastrophic	Pop-out failure	4	ode 4
	None	Instabilitus Eutone	· · · · · · · · · · · · · · · · · · ·		
Adjacent to structure  Distream of structure	Old	Instability: Extent	Piping failure	Lower bank Lower	Toe
Ustream of structure		None Local	Dry granular flow		bank
. —	Recent Fresh	General -	Wet earth flow		bank
Other (write in)	Contemporary	Reach Scale	Other (write in)	Whole bank Whole	e bank 🔝
	Contemporary	System Wide	<del></del>	1 and of Confidence is answer (Circle o	
1		System witte		Level of Confidence in answers (Circle of 0.10 20 30 40 50 60 70 80 90 100	
Notes and Copmments:				1 0 10 20 30 40 30 80 70 80 90 100	196
·					·
PART 17: RIGHT BANK TO	OE SEDIMENT ACC	CMULATION		Interpretative Observations	
Stored Bank Debris	Vegetation	Age	Health	Toe Bank Profile Sediment Ba	
None	None/fallow	[mmature]	Healthy	Planar Accumu	
Individual grains A	Artificially cleared	Mature	Unhealthy	Concave upward Stead	, <u> </u>
Aggregates+crumbs	Grass and flora	Old	Dead	Convex upward Under	
	Reeds and sedges	Age in Years			brown
Small soil blocks	Shrubs	• • • • • • • •	Roots	No bank debris	
Medium soil blocks	Saplings	Tree species	Normal	Little bank debris	
Large soil blocks	Trees	(if known)	Adventitious	Some bank debris	
Cobbles/boulders			Exposed	Lots of bank debris	
Boulders	<b> </b>		24,000	Level of Confidence in answers (Circle of	ne)
				0 10 20 30 40 50 60 70 80 90 100	
Notes and Comments:					
}					
ļ					
1					

# GUIDELINES FOR THE USE OF STREAM RECONNAISSANCE RECORD SHEETS IN THE FIELD

## 1. BACKGROUND

## 1.1 INTRODUCTION

The nature and causes of channel instability and sedimentation problems are often difficult to identify in the field. Even quite experienced river engineers and fluvial geomorphologists find it hard to describe the dominant forms and features of the valley, the channel and its sediments accurately. This is the case because channel stability problems may result from a wide variety of dynamic geomorphic processes, some operating at local scales, others at reach scales, and still others associated with instability of the entire fluvial system throughout the drainage basin.

In other cases, the channel is known to be stable, but channel improvements are essential for flood control or navigation purposes. It is then necessary to anticipate the geomorphic and sedimentary reaction of the channel to engineering works. This usually requires a thorough characterisation of the present, unmodified status of the system, based on field reconnaissance, measurement and observation.

The processes of sediment erosion, transport and deposition responsible for channel changes usually operate primarily during high flows and it is not usually possible to observe their operation directly. Any opportunity to observe the river at high flow should be taken, as invaluable insights into fluvial and sedimentary processes can be gained. However, often this simply is not possible.

Consequently, during a site visit, the appearance of the channel, its geomorpholgical setting and the sedimentary forms and features must be used to *infer* the types of processes operating during channel forming flows, and to judge the nature and severity of any related problems of channel instability. The state of the channel on any particular visit depends to some extent on the sequence of flow events responsible for significant erosion, sediment transport and deposition in the days, weeks, months and, sometimes, years prior to the visit. Also, the cyclical nature of some fluvial processes can produce a deceptive appearance of stability in a dynamically changing

channel. For example, continued bank erosion may occur by a cycle of flow under-cutting, geotechnical failure and basal clean-out. This can produce parallel retreat, with little apparent change in the appearance of the bank over time. Consequently, a channel bank may appear unchanged on consecutive visits to a site, even though it has retreated substantially between the two visits. This is the case if it is at about the same stage of toe clean-out when the visits are made, there having been one or more mass failures in between. At first it appears that the bank has not moved since the previous visit, the actual retreat only becoming apparent when the position of the bank relative to fixed points or baselines is re-established. If such reference marks are not available it is easy to under-estimate the severity of erosion and hence over-estimate the stability of the channel.

In conclusion, the form and features of the channel and its surroundings must be examined carefully if they are to yield reliable pointers to the true nature of the dominant flow and sediment processes, the impact of sediment related problems and the resulting state of channel stability or instability. Usually, the information necessary to make reliable estimates and interpretations is there, but the observer must know how and where to look for it.

### 1.2 OVERALL STRUCTURE OF THE SHEETS

The sheets are set out in five major sections, each starting on a new page. Each Section is divided into a number of Parts dealing with different aspects of the section. Each Part is subdivided into a number of specific Topics. The main Sections are:

SECTION 1 - SCOPE AND PURPOSE puts the stream reconnaissance into the context of the problem being addressed and the purpose of the survey and it records the basic logistical information on when and by whom the survey was performed and notes the limits to the study reach covered in the survey.

SECTION 2 - REGION AND VALLEY DESCRIPTION deals with the regional scale. The aims are:

1. To define the geologic, geomorphic, landscape and human environment around the stream, particularly by establishing the nature of the river basin and the relationship between the river channel and its valley;

2. To identify any instability in the fluvial system in terms of its direction, severity and spatial extent. Reference is made here to vertical and lateral channel instability separately because it is vital at this early stage to identify whether the direction of channel instability is in the vertical plane, the horizontal plane, or both.

SECTION 3 - CHANNEL DESCRIPTION focuses on the stream channel itself with the aim of establishing a clear picture of the channel in terms of its characteristic dimensions, flow type, geologic or man-made controls on its vertical and lateral activity, the nature of the bed sediments, and the presence of sedimentary features such as islands and bars. These qualitative and semi-quantitative observations flesh-out the factual information provided by surveyed cross-sections and plan maps.

SECTION 4 - LEFT BANK SURVEY deals in greater detail with all aspects of bank assessment for the left bank. The aim is to establish a clear picture of the bank in terms of its characteristic geometry and materials, vegetation, erosion processes, geotechnical failure mechanisms, and state of toe sediment balance.

SECTION 5 - Right Bank Survey repeats the bank survey for the opposite bank and completes the reconnaissance record for a particular study reach.

#### 1.3 APPLICATIONS OF THE RECONNAISSANCE SHEETS

The stream reconnaissance record sheets presented here are an attempt to provide some assistance in examining alluvial streams in the field. The sheets may serve different purposes for different individuals and applications. Six uses have been identified in preliminary testing and application of the sheets to date:

1. Conducting Geomorphic Analyses of Streams - In the context of a data collection and analysis project the sheets form part of the "Level 1 Geomorphic Analysis" described by Simons, Li and Associates (1982) or the "Reconnaissance Level Analysis" of Schumm et al. (1984). The record sheets are not intended as a substitute for conventional hydrographic, hydraulic and geotechnical surveys of the site. Rather they are a fore-runner of such surveys which are termed Engineering-

Geomorphic or Semi-Quantitative Surveys. Being made over a wider area, the reconnaissance level survey should allow any subsequent quantitative work to be better targeted on critical areas to increase efficiency.

2. Supplying Input to Stable Channel Design Methodologies - The sheets can be applied to gathering the descriptive data necessary to characterize existing channels, identifying the flow and sediment processes and mechanisms, and estimating the severity of any flow or sediment related problems. This is an important first step in the design of engineering works to improve channel stability and/or flood capacity. Only after these steps have been taken is it possible to determine the cause of the problems with any confidence and make sound recommendations concerning remedial measures.

New and innovative approaches to stable channel design such as the SAM modular method require input data of this type (Thomas, 1990). In this respect, the framework established here for characterizing the channel, its morphology and its sediments should be very useful in determining the applicability of the different equations for flow resistance, sediment transport and one-dimensional modeling. On this basis, the most appropriate quantitative equations to be used can be selected.

- 3. In the Assessment, Modelling and Control of Bank Retreat The explanation, prediction and stabilization of bank retreat are all aided by the application of new approaches to the analysis of flow erosion processes and geotechnical failure (Thorne and Osman, 1988; Thorne and Abt, 1990; Hagerty, 1989). The input data and qualitative information necessary to apply such methods are collected in the course of using the stream reconnaissance sheets.
- 4. As a Training Aide the sheets can be used in the training of staff who are inexperienced in field methods and techniques, but who are required to undertake stream reconnaissance (WES, 1990). The sheets are structured in a way which encourages a systematic and disciplined approach to the collection, recording and interpretation of both archive and field data. Use of the sheets helps the user to develop good practices which will benefit both the individual and the project. The sheets also help the user to decide where to look and what to look for when characterising channel forms and features.

- 5. As an Aide Memoir Even experienced field personnel who do not need to use the sheets as a guide to conducting a reconnaissance survey may find them useful in structuring their time and effort and ensuring that no important aspects of the survey are accidentally omitted.
- 6. To Establish a Historical Record of Stream Condition A reconnaissance trip is made at considerable cost in time, manpower and resources, but the observations, data and information gathered are not always permanently recorded and stored in any systematic fashion. Once the individuals actually undertaking the survey leave the office, it is extremely difficult for other staff to use the results of the survey effectively in subsequent work or projects. The record sheets provide a medium for the permanent record of the results of a stream reconnaissance trip, which may be filed for future reference. The sheets are also designed for ease of storage as a computerised database.

The sheets also have the potential to form the input data for a computerized expert system on the analysis of sediment related problems in river channels. To develop such a system is beyond the scope of the present project, but experience gained in the development and use of the reconnaissance sheets should be very useful should such systems be developed in the future.

## 2. GUIDELINES FOR COMPLETING THE SHEETS

## 2.1 INTRODUCTION

In this section detailed guidance is given on how to fill-out the Stream Reconnaissance Record Sheets in the field. References to particular sections, parts and topics that appear on the sheets are put in italics.

The sheets have been designed:

- 1. To produce a comprehensive record of the form, features and processes of the stream and;
- 2. To be applicable to a very wide range of types and sizes of river in diverse geographical, geological, geomorphic and land-use settings.

As a result they can appear detailed and overly long on first inspection. It should be remembered that in the great

majority of cases the answers to preliminary questions will mean that subsequent topics are inapplicable and this will simplify filling the sheets out considerably.

# 2.1.1 Expediency versus Completeness

Many engineers will be tempted to omit filling out some topics or whole sections because they feel that they are not justified by the scope of work of the project, or because, based their level of experience with the river concerned, they are confident that the material is irrelevant. This temptation should in most cases be resisted. In fact, although there may be applications where it is expedient to omit sections and where there really is no need to look at the broader watershed features covered in Section 2, or at the detailed streambank descriptions of Sections 4 and 5, this is the exception not the rule. Also, omission of material seriously degrades the value of the stream reconnaissance as a historical archive record. Therefore, while provision is made in Section 1 to note that certain sections or topics have not been completed, some justification of the reason for omitting the material must be provided in the Notes and Comments.

Conversely, there will usually be justification for customising the sheets to a particular river, watershed or geographical region. This involves the removal of extraneous material rather than the omission of whole sections or topics. For example, if the study area lies entirely in a lowland sedimentary plain then references to mountains, bedrock, valley sides, coarse sediments such as boulders, and processes such as armouring have no bearing at all and may be edited out. The resulting slimmed-down sheets will still be comprehensive, but will also be simpler and more streamlined.

## 2.1.2 Filling-in the Sheets

When filling-in the sheets, there are two main types of response which may be recorded:

- 1. Topics where a box is ticked or ranked;
- 2. Topics where a numerical measurement is written in.

On the sheets, places where a tick or rank is required have boxes, while places where a numerical value is required have an under-lined space for the number to be written. When ranking attributes (for example, the various types of vegetation present in the catchment (Part 1, Topic 6), or the different materials making up the bed of the stream (Part 7, Topic 1), it is suggested that the Braun-Blanquet Scale be used.

Table 1. Braun-Blanquet Scale of Ranking

Number of individual examples present and percentage cover of Reference Area	Recorded Rank
Any number and more than 75% cover	5
Any number and 50 to 75% cover	4
Any number and 25 to 50% cover	3
Any number and 5 to 25%	2
Numerous but less than 5% cover, or scattered	
with cover up to 5%	1
A few individuals covering a small area	+
A solitary individual covering a small area	r

The strength of this ranking system is that as well as recording the main types of cover making up most of the area, it also allows the observer to record the presence of rare or even individual examples that are seen to be significant, even though they cover only a small percentage of the area being described.

## 2.2 SECTION 1 - SCOPE AND PURPOSE

This section sets the context for the reconnaissance trip, records the details of when, where and by whom the surveys were carried out and provides space for notes and comments on general aspects of the trip.

Experience shows that a reconnaissance trip is usually more successful and the results are more worthwhile when it addresses a particular problem and has a clearly defined purpose. These should be agreed at the outset and entered on the sheet for future reference. It is also important to record the logistical details of the reconnaissance trip as these have a bearing on the results obtained. If any sections or topics are omitted this must be recorded and justified. All this information is entered on the front cover of the reconnaissance record sheets under section 1.

Finally, the level of detail required for the survey must be determined. This is deliberately left open so that the reconnaissance team can decide on how best to apply the sheets for their particular river, project and purpose.

The broad descriptions of the catchment and valley in Sections 1 and 2 may cover quite large areas and, possibly, describe the whole of a small catchment in one sheet.

However, the length of the reach of channel covered in Sections 3, 4 and 5 must be tailored to the situation, and the time and resources available.

At the most detailed level, the shortest meaningful reach would be of the order of 5 to 10 times the channel width in length. This would cover a single geomorphic unit of the river, such as an individual bendway or a pool-riffle pair in a single-thread channel, or a major bar-chute-complex unit in a braided channel. While the resolution of such a detailed survey would be excellent, many reaches would have to be surveyed to cover a significant length of channel. At the other extreme, a long stretch of river, within which the character of the channel did not change significantly, might be covered as a single reach if a lower level of detail was required. The length of the overall and sub-reaches should be recorded in Sections 1 and 3.

A useful compromise was found in surveying a 220 kilometer stretch of the right bank of the Brahmaputra River, Bangladesh. In the survey, which was made by boat, a continuous log was kept of the basic nature of the channel and bank, with notes being made of major changes of character. Typically, major changes occurred 15 to 20 kilometers apart, but with some closely more spaced variation around towns and bank protection structures. Between the points of change, short study reaches 0.5 to 2 kilometers in length were selected for detailed survey and a set of reconnaissance sheets was completed to represent that reach. Since the reach was entirely contained within the Ganges-Brahmaputra Delta, all references to uplands, valley sides, bedrock and coarse sediments were edited out to produce customised sheets for the particular application. In this way, overall coverage with local detail was achieved within the time and resources available.

# 2.3 SECTION 2 - REGION AND VALLEY DESCRIPTION

This section deals with the geologic setting, geomorphic features and sedimentary characteristics of the river channel and its valley. It is essential to establish these in order that sedimentation problems can be assessed in the context of the general river basin and sedimentary environment.

More particularly, it is important to establish any causal links between large-scale fluvial processes and local sediment impacts at the outset, and to identify the severity and extent of any underlying instability in the fluvial system. Often the particular problem to be addressed in an analysis, such as bank erosion or bed aggradation, is just a symptom of wider system instability and it should not then be treated in isolation if it is to be properly understood and dealt with.

Much of this section may be completed in the office by reference to topographic, geologic and land-use maps. However, it is still important to obtain an overview of the catchment and observe its physiography, vegetation and land-use directly. In large catchments, or where ground access is difficult, an over flight may be the best and most cost-effective way to achieve this.

The section is divided into 6 parts. Each is now dealt with in turn.

## Part 1: Area around River Valley

This part has six topics. The aim is to characterize the surrounding land in terms of terrain, drainage pattern, geology, rock type, land-use, and vegetation.

Terrain defines the type of landscape within which the river valley is located. Generally, the greater the topography the more energy is available to do geomorphic work and the more rapid and pronounced will be terrain response to natural instability, or human-induced destabilisation.

Drainage Pattern defines the plan shape of the channel network. Eight common types of pattern have been identified (Howard, 1967) as indicative of the underlying terrain. These are shown in Fig. 1. and are described overleaf.

# Drainage Patterns and Geologic Interpretations

Dendritic - homogeneous terrain, no strong geologic control

Parallel - A steep regional dip to the terrain

Trellis - Dipping or folded sedimentary rock

Rectangular - right-angled faulting and jointing


Radial - eroded structural domes or volcanoes

Annular - eroded domes or basins in layered rock

Multi-basinal - hummocky surficial deposits or limestone solution

Contorted - complex metamorphic structures

Figure 1. Basic Drainage Patterns (Adapted from Howard, 1967)

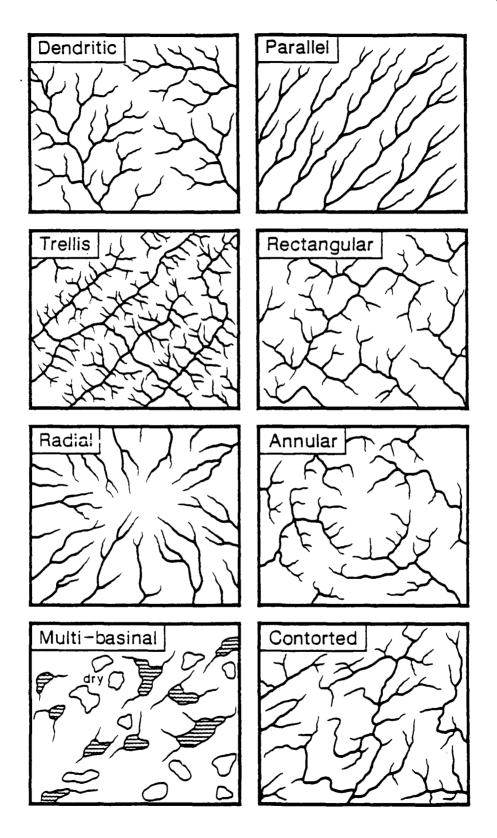

Surface Geology deals with the origin of the surficial materials making up the landscape. Erosion resistance is directly related to surficial geology and this will strongly affect the susceptibility of the area to geomorphic processes and related sediment impacts.

Rock Type defines the composition of the sub-surface materials. Erosion resistance and sediment yield (both volume and calibre) are also affected by the rock type.

Land-use addresses the type of human activity taking place in the area around the valley. Generally, cultivated areas have higher run-off potential and sediment yields than natural catchments. Urban and suburban catchments produce flashy run-off hydrographs and altered sediment yields.

Vegetation plays an important role in catchment hydrology, generating run-off and sediment yield. It is useful to know the vegetation community (or biome) in the catchment around the valley in order to gauge its influence on present catchment hydrology and sediment processes, and the potential for instability induced by changing vegetation or land-use.

# Part 2: River Valley and Valley Sides

Has 9 topics. The aim is to define the form, scale, geometry, stability and mode of failure (if any) of the valley side slopes and the severity of any sediment related problems.

Location of River defines whether the river is in a valley or is located in some other physiographic setting such as on a fan, plain, delta or lake bed. If there are no valley sides then it is not necessary to complete the remainder of this section.

Valley Shape records whether the valley is symmetrical or asymmetrical. Asymmetrical valleys may have contrasting valley side characteristics and failures and these should then be noted separately.

Height and Side Slope Angle define the scale and geometry of the valley sides. The higher and/or steeper the valley sides, the greater the potential for them to be destabilized and to trigger system wide instability to the fluvial system.

Valley Side Failures records whether the slopes are stable, or prone to occasional or frequent failures. Valley wall failures indicate lateral geomorphic activity, and possibly valley widening.

Failure Locations indicates whether failures are adjacent to, or remote from, the river channel. This critically important because it determines the relationship between the river and the failures, and indicates how sediments derived from valley side failures are delivered to the river. Failures occurring away

from the river are not a direct result of river erosion. Sediments generated by such failures are stored at the base of the slope for long periods (these deposits are called colluvium by geomorphologists).

They then either make their way to the river by very slow processes, such as soil creep, or are eroded during catastrophic floods - which occur only rarely. These failures are uncoupled from the fluvial system. Conversely, failures adjacent to the river are coupled directly to river erosion. They are triggered by flow undercutting and deliver large volumes of debris directly into the channel. Such failures may be considered to be bank erosion at the largest scale and may pose serious problems in terms of system stability, land loss and wash load sediment yield.


The last three sub-sections are in italics on the sheet to indicate that they are interpretative rather than being simple observations. Some degree of subjectivity is unavoidable in completing these sub-sections. To help to indicate how sure or unsure the user feels concerning the interpretations made here, the user can circle a level of confidence from 0 to 100% at the bottom of the section.

Material Type records the nature of the valley side materials as being either bed-rock, soil or unconsolidated debris. Debris is a superficial collection of broken rock.

Failure Type defines the mechanism of valley side failure. The type of failure determines the shape of the valley side after failure, controls the volume of material involved in each failure and may help to identify the cause of the instability. Sketches of typical failure modes are shown in Fig. 2.

Severity of Problems indicates the level of impact of valley side failures on the valley environment. Unstable valley sides pose serious hazards and can also be a major supplier of both coarse sediment and wash load to the fluvial system, causing serious local and downstream sedimentation.

Figure 2. Typical Valley Side Failure Modes (Developed from Varnes, 1958).

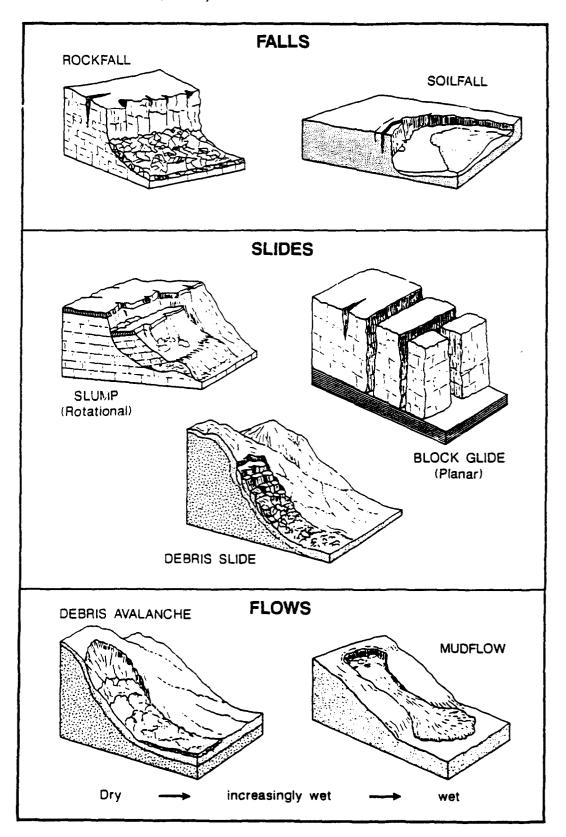

## Part 3: Flood Plain (Valley Floor)

Has 8 topics. The aims are to characterise the presence, size and nature of the low-lying area between the valley sides and around the stream channel.

Valley Floor Type and Valley Floor Data note the presence or absence of a flat valley floor and its width in relation to the width of the channel. Rivers with fragmentary or narrow valley floors are closely coupled to hillslope run-off and erosion processes operating on the valley sides and are also liable to destabilization by valley side slope failures and sediment inputs. This is not true of rivers with broad flood plains. (Fig. 3 a and b).

Flow Resistance records the Manning's 'n' flow resistance coefficients for the left and right overbank areas. The 'n' values are used when calculating discharge capacity during out-of-bank floods.

Surface Geology deals with the origin of the surficial materials making up the flood plain. Erosion resistance is directly related to surficial geology and this will strongly affect the susceptibility of the area to fluvial erosion, channel shifting and related sediment impacts.

Land-use addresses the type of human activity taking place in the flood plain. Generally, cultivated areas require less engineering protection than urban or industrially developed flood plains. Urban and suburban catchments produce flashy, concentrated run-off, altered sediment yields and trash and debris which may impact channel stability.

Vegetation plays an important role in flood plain hydrology, hydraulics and sediment production. It is useful to know the type of vegetation assemblage in the flood plain in order to gauge its influence on present hydrologic, hydraulic and sediment processes, and the potential for instability induced by changing vegetation or land-use.

Riparian Buffer Strip and Strip Width note the presence and extent of a buffer of natural vegetation along the course of the river. The riparian corridor has long been known provide important ecological habitat, but more recently it has been recognised that the riparian vegetation has other effects. First, it intercepts surface run-off and detains it, thereby reducing the potential for erosion by drainage over the bank edge. Second, it acts as a sink for pollutants in the surface and sub-surface run-off (thereby improving stream water quality). Third, it reduces near bank velocities, reinforces the bank material and limits access to the bank by grazing animals, all of which are

Figure 3. a) Upland river with a narrow flood plain and frequent coupling of channel and active erosion of valley side. b) Lowland river with broad flood plain and uncoupled channel and hillslope processes.





b)

beneficial to bank and channel stability. Experience shows that bank instability often occurs when the buffering effect of riparian vegetation is lost and cultivation extends right up to the bank top.

## Part 4 Vertical Relation of Channel to Valley


This part has 11 topics. The aim is to establish the present relationship between the channel and its valley in terms of the vertical dimension, the dynamic nature of that relationship, and the existence of any features and landforms indicative of vertical instability.

Terraces are fluvial landforms produced by past vertical instability in the fluvial system. A terrace is a remnant of a former flood plain which is no longer subject to inundation (Fig. 4). It may be identified in the field as a strip of almost level ground higher than the present flood plain, and separated from it by a steeper slope. Terraces give the valley cross-profile a stepped appearance. They indicate that the river has had degradational instability in the past.


Number of Terraces records how many terraces may be identified. The theory of complex response shows how several terraces may be produced by a single destabilization of the system, as the river hunts for a new graded profile (Schumm et al., 1984). The number of terraces indicates the nature and magnitude of past vertical instability and demonstrates the potential of the system for dynamic vertical activity.

Trash Lines are found on the flood plain and in trees and bushes growing there. They are composed of floating trash and vegetation left after a flood and indicate the high water mark left by a flood event (Fig. 5a). The trash degrades quite quickly once it is lodged and so its condition acts as a guide to the time elapsed since the flood. If a fresh trash line is found above the elevation of the valley floor, and it is known that there has not been a catastrophic flood of long return period recently, this indicates that out-of-bank events occur fairly frequently, suggesting that the river is not incised significantly below its flood plain. Abundant trash lines left by floods of relatively short return period suggest that the river may be aggraded.

Overbank Deposits notes the presence and calibre of material deposited directly onto the valley floor by out-of-bank flow (Fig. 5b). The calibre of the sediment indicates the sediment transport competence of overbank flow. Deep, fast over bank flows are indicative of active flood plain processes, which are usually associated with an aggrading river.

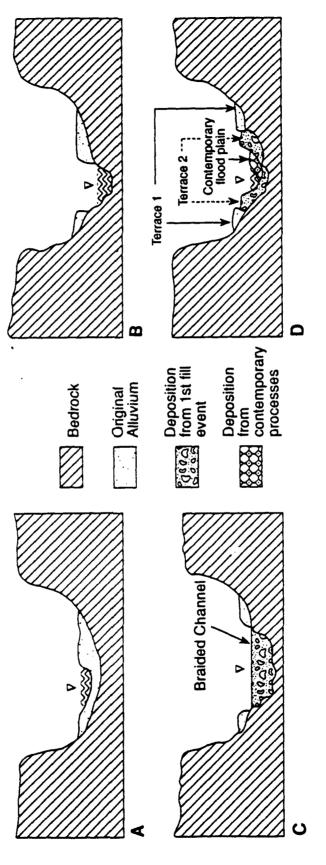

Terraces formed by past channel degradation and aggradation. A. Valley and alluvium with Channel degradation through alluvium and into bedrock leaves Aggradation generates inset alluvial fill as sediment supply increases due to bank D. Second, lower terrace is formed when channel degrades slightly in response to reduced sediment supply due to bank stabilisation and establishment of graded former flood plain as a terrace. Bank instability due to degradation leads to destruction of part of Lateral migration destroys part of lower terrace and forms new contemporary flood plain. single-thread channel and flood plain. B. instability and upstream degradation. ong-profile. Figure 4. terrace.

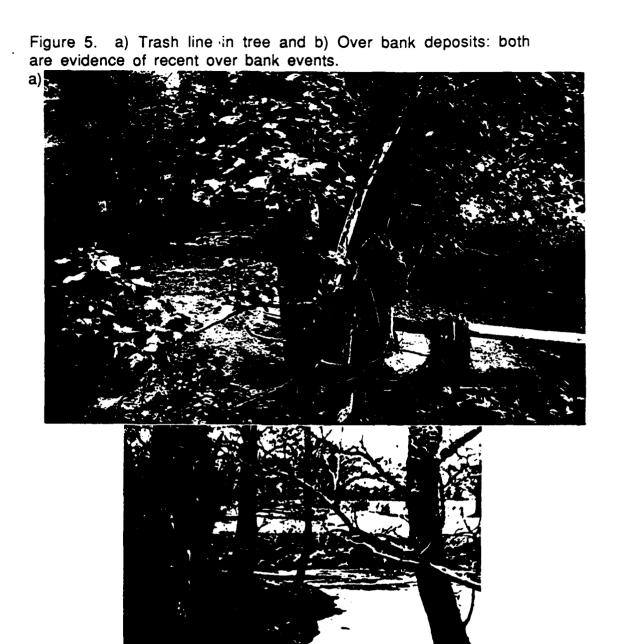

b)

Levees and Levee Description deal with elevated banks above flood plain height and parallel to the course of the river. Natural levees are produced by overbank sedimentation during flood flows because the greatest amount of sediment tends to fall out of transport close to the river. Well developed natural levees indicate a river with a heavy load of sediment and frequent overbank flooding. Man-made levees are constructed to contain flood flows and protect the area behind them from inundation. They may be set back some distance behind the bank top. The presence of man-made levees indicates that the river is prone to frequent flooding in its natural state.

Levee Data and Levee Condition record the height, side slope angle and stability of any levees present.

The remaining 4 topics are interpretative and subject to a confidence level.

Present Status defines whether the channel in the study reach is presently adjusted to the valley floor elevation (graded) or whether it is either incised (entrenched), or aggraded (Fig. 6a and b). Incised rivers rarely flood, flow being concentrated in-channel except at extremely high discharges of long return period. They tend to have low width to depth (aspect) ratios and erode their banks through undercutting and mass failure. Aggrading rivers often flood, depositing sediment onto their flood plains and building levees. They have high aspect ratios, numerous bars and islands with a poorly defined channel, and widen through bank erosion by direct entrainment of bank material by the flow.

Instability Status defines whether vertical instability in the system is on-going or has ceased. Although the present status of the channel is important, to make predictions of future channel behaviour it is necessary to interpret the current trend of channel change as being either stable (no change), degrading (continued incision) or aggrading (continued siltation).

Problem Severity defines the severity of any current vertical instability. This helps to put any sediment impacts associated with aggradation or degradation into perspective and is a first step towards prioritising channel instability problems in terms of urgency of stabilization.

Problem Extent defines the scale of vertical instability in the river. Usually, this is an essential step in identifying the underlying cause of a channel instability problem. If a problem is common to the whole fluvial system then a local solution may be ineffective. For success, it usually necessary to match the scale of the solution to the scale of the problem.

Figure 6. Examples of: a) an incised river b) an aggraded river

a) an aggraved river



# Part 5: Lateral Relation of Channel to Valley

This part has 9 topics. The aim is to establish the present relationship between the channel and its valley in terms of the lateral dimension, the dynamic nature of that relationship, and the existence of landforms indicative of lateral instability and/or activity. Landforms include the planform geometry, type of planform evolution and the flood plain features.

describes the geometry of the channel when viewed from above. It uses the generally accepted classification of rivers as being straight, meandering or braided (Fig. 7). For single thread channels, sinuous channels are in the transition between straight and meandering. They have alternate bars and cut-banks opposite leading to curved flow, but have not yet attained a truly meandering course. meanders lack the symmetry of regular, or classical, meanders and usually indicate that the planform is being influenced by outcrops of erosion resistant materials in the banks. meanders are highly convoluted and experience neck cut-offs. Braided rivers are very wide and shallow with multiple subchannels (anabranches) due to divided flow around braid bars.

Planform Data records the characteristic dimensions of any meanders (Fig. 8). Bend radius measures the tightness of the bend in terms of the radius of a circle approximately following the channel centerline. Meander belt width is the width of the strip of flood plain regularly swept by the channel as bends migrate downstream. Wavelength is twice the long valley distance between crossings (meander inflection points). Meander sinuosity is the channel length divided by the straight line valley length between crossings.

Lateral Activity records the type of channel planform evolution currently taking place (Fig. 9). Meander progression (down valley movement of the bend) occurs when bank erosion in meander bends is concentrated at the outer bank between the bend apex and the downstream crossing. Increasing amplitude occurs when the meander grows laterally as well as progressing downstream. In mature, meandering rivers progression leads to some bends being destroyed by neck and chute cut-offs. Irregular erosion occurs where variability (for example, due to local contrasts in flood plain sediment erodibility) disrupts the regular pattern of lateral activity. An avulsion is the rapid abandonment of the river's historic course in favor of a new Avulsions usually occur during floods. Braiding occurs by apparently random shifting of sub-channels (anabranches), to produce impinging flow, intense local bank erosion and a dynamic, unpredictable plan shape to the bank lines.


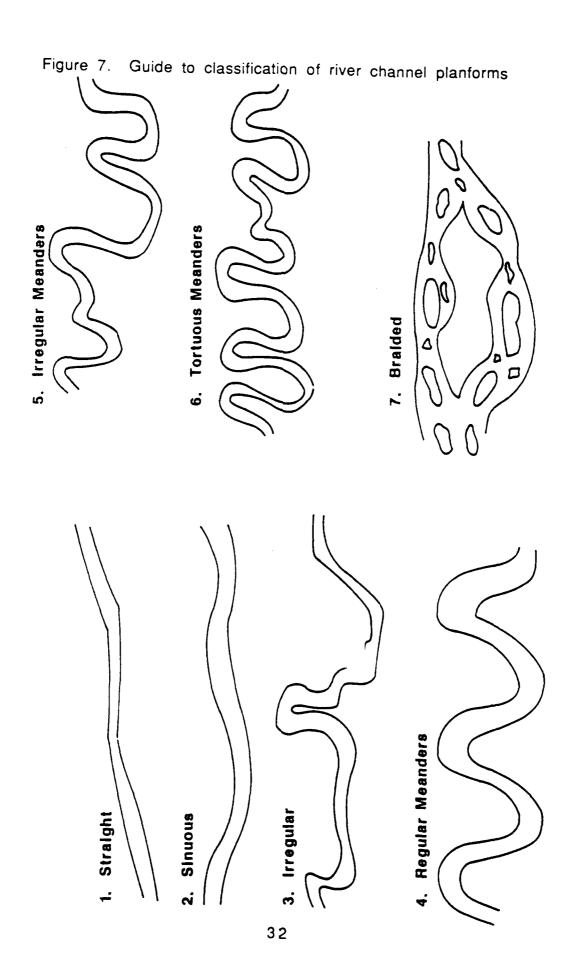


Figure 8. Definition of meander planform parameters

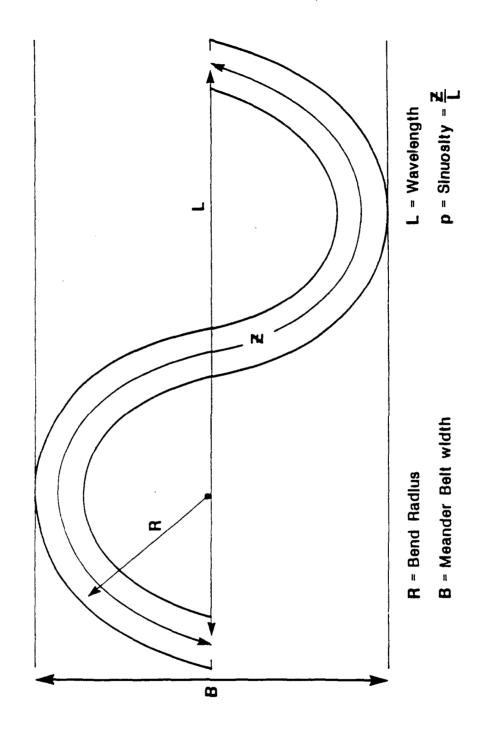

Flood Plain Features are associated with different types of lateral activity (Fig. 9). Meander scars are steep scarp slopes left in the flood plain by meander progression. Scroll bars are low, curved ridges in the flood plain which are found inside and parallel with meander loops. Swales or sloughs are low troughs running between the scrous. Bars and swales are produced by point bar migration on the advancing, convex bank, during meander growth through increased amplitude. Oxbow lakes are crescent-shaped lakes which were once part of a meander but which were cut-off and abandoned due to meander progression. Abandoned channels are unsilted reaches of the channel left behind after an avulsion. Braided deposits give the flood plain an uneven, hummocky topography, with frequent abandoned channels, vegetated braid bars and sloughs.

The remaining 4 topics are interpretative and subject to a confidence level.

Present Status defines whether or not the channel width is adjusted to the present flow regime. Adjusted channels have stable widths over time, although they may still be laterally active if they erode one bank and deposit sediment at the other (Fig. 10a). This is termed 'dynamic equilibrium'. Over-wide rivers are broad and shallow with shifting bars. They have stable banks and accumulated sediment shelves at the toes of both banks, producing a composite, "two-stage channel" type of cross-sectional shape (Fig. 10b). Narrow rivers have low aspect ratios, active erosion of both banks, no sediment stored at either bank toe and more trapezoidal cross-sections (Fig. 10c).

Instability Status defines whether lateral instability in the system is on-going or has ceased. Although the present status of the channel is important, to make predictions of future channel behaviour it is necessary to interpret the current trend of channel change as being either stable (no change), widening (continued erosion of both banks) or narrowing (continued deposition at both banks).

Problem Severity defines the severity of any lateral instability. This helps to put any sediment impacts associated with bank line movement and lateral shifting into perspective and is a first step towards prioritising channel instability problems in terms of urgency of stabilization.

Problem Extent defines the scale of lateral instability in the river. Usually, this is an essential step in identifying the underlying cause of an instability problem. If a problem is common to the whole fluvial system then a local solution may be ineffective. For success, it usually necessary to match the scale of the solution to the scale of the problem.

Figure 9. Types of lateral activity and typical associated flood plain features

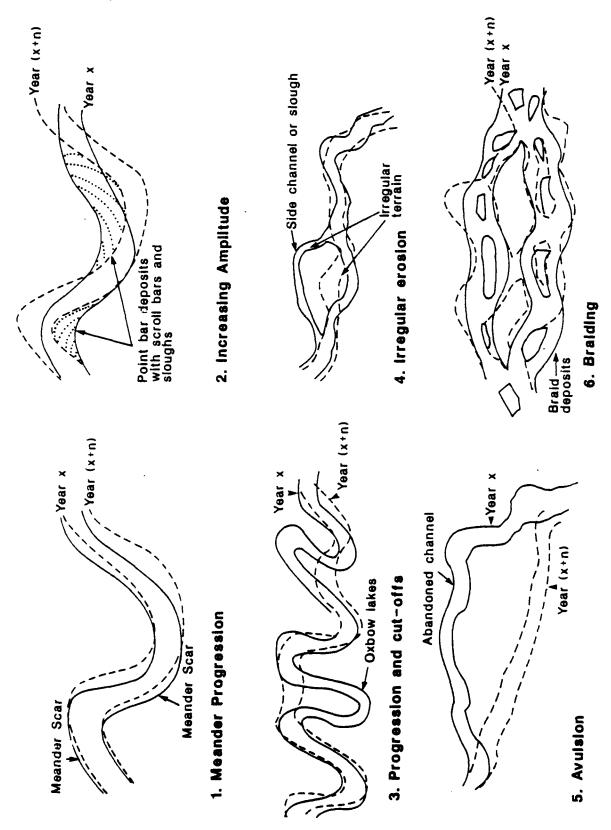


Figure 10. Examples of: a) a shifting river in dynamic equilibrium; b) an over-wide channel, and; c) a channel which is too narrow

a)







#### 2.4 SECTION 3 - CHANNEL DESCRIPTION

This section deals with the geomorphic features and sedimentary characteristics of the river channel. It is essential to establish these in order that the channel can be characterised and classified correctly.

There are causal links between the erosion and deposition processes operating on the bed and banks. It is artificial to view either the bed or banks in isolation. The related features of the bed and banks may be used to help identify the nature, severity and extent of any underlying instability in the fluvial system. Also, they can help indicate the sensitivity of the channel to destabilization through unsympathetic engineering.

The section is divided into 2 parts. Each is now dealt with in turn.

#### Part 6: Channel Description

This part has 6 topics. The aims are to characterize the channel in terms of its dimensions, flow regime and geologic, sedimentary or man-made controls on bed scour and bank retreat. This supplies the basic information needed by an engineer or geomorphologist to represent the river and its channel in terms of basic hydraulics and potential instability.

Dimensions gives an approximate guide to the size and shape of the channel in terms of the standard hydraulic geometry parameters of average top bank width, average water surface width on the day of observation, average channel and water depths, reach slope, estimated mean velocity, and the Manning's 'n' coefficient for in-bank flows. Overbank 'n' values were covered in Part 3 "Flood plain (Valley Floor)".

Flow Type defines the regime of flow in the channel according to the principles of free surface flow (Fig. 11). Uniform/Tranquil flow lacks major changes in flow velocity with distance along the channel and is sub-critical. Uniform/Shooting flow lacks major changes in flow velocity along the channel and is super-critical. Pools and riffles are alternating bed features producing non-uniform flow. Pools are areas of deep, slow flow with a gentle water surface slope. Riffles are areas of shallow, fast flow with a steep water surface slope. Steep + Tumbling flow occurs in high gradient streams with coarse bed material which disrupts the water surface and produces local super-critical flow between and over Steep + Step/pool flow is found in very steep channels with boulders arranged in periodic steps across the channel and plunge pools in between.

Figure 11. Types of flow in natural rivers. a) Uniform tranquil; b) Pool and Riffle; c) Tumbling/Step-Pool

a)





b)



Bed Controls set limits on the degree of vertical instability allowed by the local geology, materials and/or human intervention. A control is a feature which is not easily eroded by the river, thereby preventing continued instability.

Control Types defines the nature of the bed controls (Fig. 12). Natural examples are bed rock outcrops, coarse sediments which form an immobile armor layer, and fine sediments which are strongly cohesive. Where natural controls like these are absent, weirs or cut-off walls may be constructed to prevent bed degradation. Such grade control structures are vital where severe degradation is occuring and natural controls are either absent or unreliable. Foundations and protection constructed at bridges and culvert crossings may also act as bed controls.

Width Controls set limits on the degree of widening and/or lateral migration allowed by the local geology, materials and human intervention. A control is a feature which is not easily eroded by the river, thereby preventing continued bank line retreat.

Control Types define the nature of the width controls (Fig. 13). Natural examples are bed rock outcrops, coarse sediments which form an immobile armour on the bank, and fine sediments which are strongly cohesive. Controls due to fine sediments are often associated with clay plugs and back swamp deposits in the flood plain left by earlier depositional activity. Where natural controls like these are inadequate, dyke fields and/or revetments may be used to control river width and bank line movement. Such training structures are a vital part of bank protection schemes in systems where width is unstable and natural controls are either absent or unreliable.


# Part 7: Bed Sediment Description

This part has 10 topics. The aims are to characterize the sediments in the bed and bars of the channel in terms of their types, stratigraphy, depth, size distributions, bed forms and bar types. This supplies the basic sediment information needed by an engineer or geomorphologist when calculating sediment transport and potential bed instability.

Bed Material describes the bed sediment of the river. This is important because there are fundamental differences in the flow and sedimentary regimes and types of sediment related problems of rivers with clay, silt, sand, gravel or boulder beds.

Figure 12. Types of bed control in rivers. a) Bedrock; b) Boulders; c) Gravel armour; d) Cohesive materials; e) Bridge protection; f) Grade control structure

a)

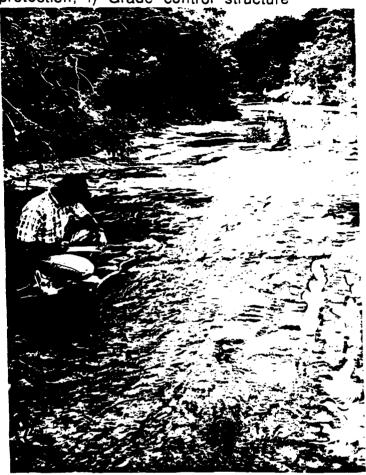









e)

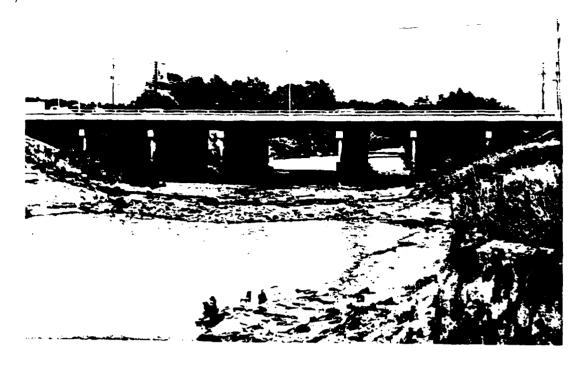

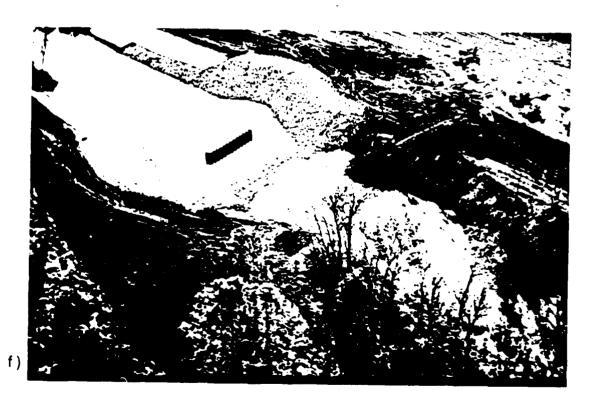


44

Figure 13. Types of width control in rivers. a) Bedrock;
b) Revetment; c) Cohesive materials d) Bridge
abutments. For boulders, gravel armour and
dykes/groynes see Figs. 12b, 12c and 19d,
respectively







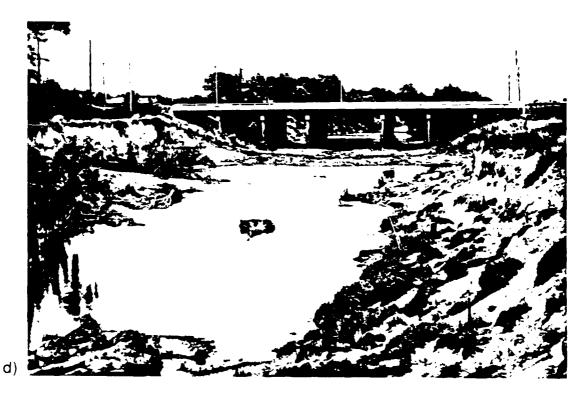

Bed Armor identifies whether a coarse surface layer is present (Fig. 14). An armor layer limits the availability of bed sediments for transport and the potential for bed scour. Two types of armor have been identified: static armor is much coarser than the underlying sediment and is immobile under all but catastrophic flood flows; mobile armor is a little coarser than the underlying sediment and is moved by moderate events below bankfull flow.

Sediment Depth records the depth of loose sediment in the bed of the channel. This gives a guide to the size of the reservoir of sediment stored in the channel and available for transport by the flow. Degrading channels have thin bed sediment thicknesses, aggrading channels have thick layers.

Surface and Substrate Size Data are quantitative data based on sieve or size-by-number analyses of bed material samples taken at a representative point in the bed. This should be at about mid-channel in a crossing, away from obvious bar and island features. A separate substrate sample is only necessary if an armor layer is present. Techniques for sampling and analysing bed sediments are described in most rivers texts. Note: It may not always be necessary to measure bed material sizes quantitatively:qualitative description (in 'Bed Material') may be sufficient, depending on the purpose of the survey.


Bed Forms (Sand) notes the presence and type of bed forms in sand-bed channels. Bed forms are very important in producing form roughness which increases the Manning's 'n' for the channel and play a dominant role in the movement of bed load. Bedforms on this scale are not usually present in gravel-bed rivers.

Islands or bars accounts for macro-scale bed features and the presence of divided reaches in the flow. Islands and bars can have important impacts on flow resistance, channel capacity and in-channel sediment storage. Divided flows are generally less hydraulically efficient than single channel flows.

Bar Types describes the shape (morphology) of any bars (Fig. 15). Bars represent major topographic features in the channel bed and are intimately related to flow patterns and sediment transport distributions. They may be responsible for diversion of the flow so that it attacks one or both banks, promoting bank erosion, toe scour and bank line retreat.

Bar Surface and Substrate Data are quantitative data based on sieve or size-by-number analyses of bar material samples taken at a representative point in the bar. This should be at about mid-bar, away from obvious bar-head and bar-tail materials. A separate substrate sample is only necessary if an armor layer is present. Bars are often the primary source of sediment for transport by the river, especially in rivers with

Figure 14. Armor layer in a gravel-bed river

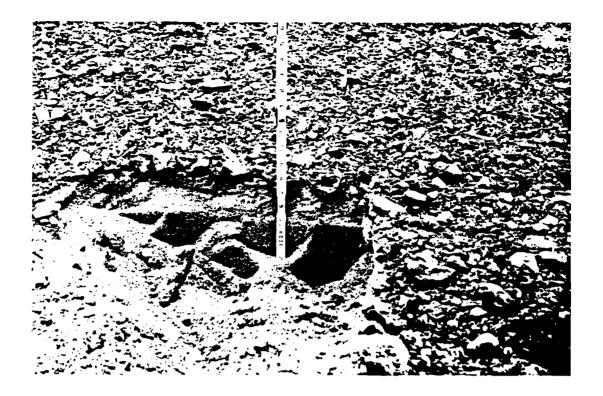

armored beds. Bar samples may be taken to indicate the approximate size distribution of the high flow sediment load.

Channel Sketch Map and Representative Cross-section are spaces provided for a visual representation of the channel in the study reach. An example for a reach of the Snake River, Wyoming is shown in Fig. 16. The aims are to show the shape and features of the channel and record the sampling points for bed and bar sediment samples. Also, photographs showing: i) views upstream and downstream along the study reach ii) right and left banks, and iii) special features of the channel should be taken and photo points and orientations marked on the map so that they can be relocated and repeated precisely in any future re-surveys. This greatly enhances their value as a guide to bed scour, bank erosion, channel changes and system instability. Fig. 17 shows examples of site photographs from the study reach on the Snake River.

Figure 15. Bar type classification

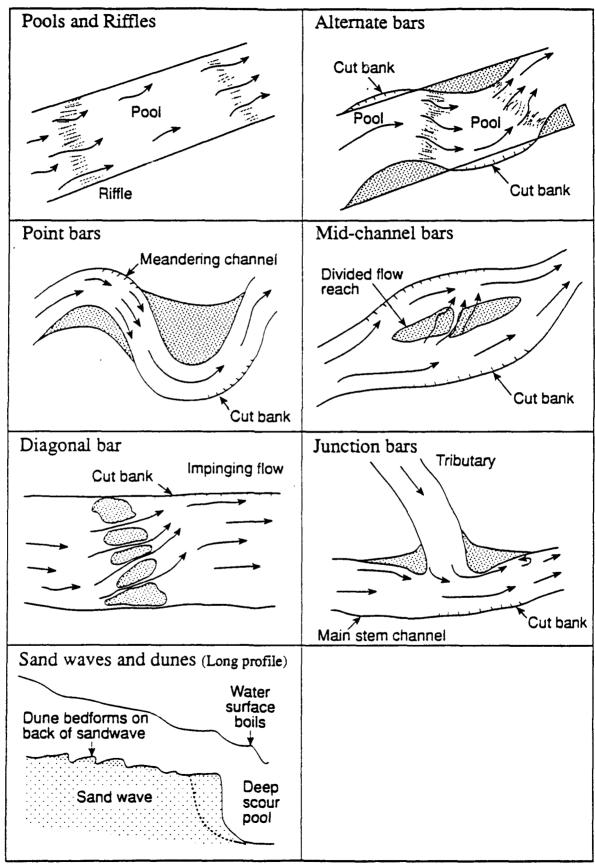


Figure 16. Example sketch map and representative cross-section: Snake River near Jackson Hole, Wyoming


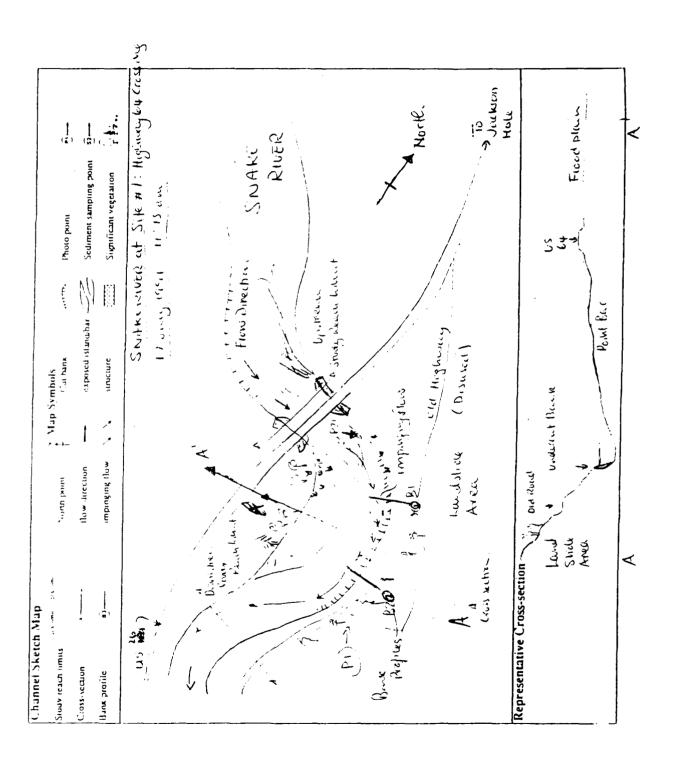


Figure 17. Example site photographs: Snake River near Jackson Hole, Wyoming. a) P1, view upstream over site, b) P2, view of under-cutting and sliding of valley side



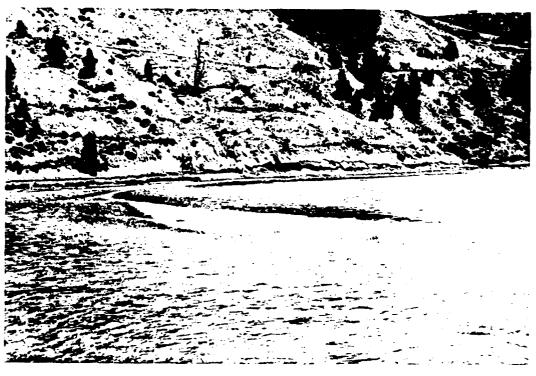

### 2.5 SECTION 4 - LEFT BANK SURVEY

This section describes in detail the character, vegetation, erosion processes, geotechnical failure mechanics and toe-sediment balance for the left bank. It is divided into 5 parts, dealing with each of these aspects in turn. A complete and thorough evaluation of the bank and its dynamics lies at the heart of the field inspection and forms the basis for the explanation of bank line retreat and the selection of appropriate approaches to modeling channel processes and designating stabilization strategies.

It is important that the user complete each part independently of the information gathered in other parts. For example, the status of bank stability with regard to mass failure is not addressed until Part 11. Users should not allow the presence or absence of failures influence their selections in Parts 8 to 10 which do not deal with bank failures, but with other bank characteristics and bank erosion processes.

The accumulation of bank failure debris and sediment at the toe of the bank is a very significant and important morphological feature of alluvial channels. Consequently, it is dealt with in Part 12, separately from the intact bank.

#### Part 8: Left Bank Characteristics


This part contains 13 topics. The aim is is characterize the left bank in terms of its type, materials, protection status, approximate dimensions, shape and degree of cracking. All of these characteristics are of fundamental importance to bank erosion, failure and stabilization.

Type establishes the overall classification of the bank as being noncohesive, cohesive, composite or layered (Fig. 18). There are basic differences between banks formed in different materials, or combinations of materials. Noncohesive banks are formed in sands, gravels, cobbles and boulders that lack intrinsic cohesion. Cohesive banks are formed in silts and clavs which are cohesive. Composite banks consist of a single cohesive layer underlain by a single noncohesive layer. banks are common in rivers with noncohesive bed material (sand or gravel) which are flowing through alluvial flood plain deposits consisting of bed material overlain by overbank fines. Layered banks consist of layers of noncohesive and cohesive materials laid down during a past aggradational phase. Often the layers are of uneven thickness and this can be very significant to bank erosion and hydrology.

Figure 18. Bank Types: a) Noncohesive; b) Cohesive; c) Composite; and d) Layered a)



c)

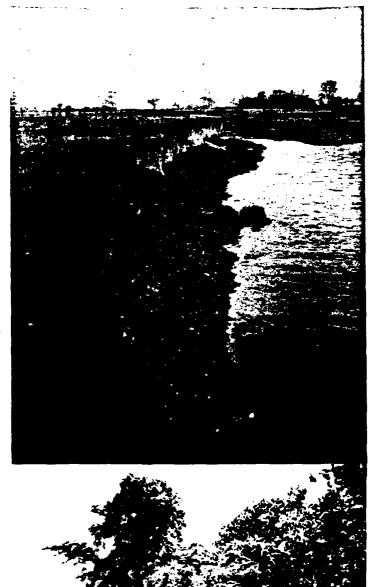

d)



Protection Status establishes whether the bank is unprotected or has been subject to engineering stabilization (Fig. 19). Where a bank has been protected the condition and effectiveness of the structure should be described in the Notes and Comments space.

Bank Materials details the composition of the bank in terms of the characteristic types of sediment for up to four materials making up the bank. This supplies information on the nature of the bank materials for interpreting bank erosion and failure processes and the type of material input to the fluvial system.

Layer Thickness records the thickness of each stratigraphic unit making up the bank.

Mean Bank Height and Mean Bank Slope record the approximate overall height and steepness of the bank. Both are important in determining the geotechnical stability.

Bank Profile Shape augments the height and slope data by specifying the form of the bank profile. This can be a good indicator of the dynamic nature of current bank retreat, stability or advance. Typical bank profiles and their interpretations are shown in Fig. 20.

Tension Cracks notes whether there are tension cracks behind the bank (Fig. 21). Tension cracks develop vertically down from the ground surface behind steep banks and greatly reduce the stability of the bank with respect to mass failure. Their presence indicates that the bank is prone to geotechnical instability and potential mass failure due to gravity.

Crack Depth records the depth of tension cracking as a proportion of the total bank height. As a general rule, cracks rarely exceed a depth of half the total bank height.

Distribution of Bank Materials in Bank Profile (Material Types 1 - 4) defines the distribution of up to 4 bank materials through the bank. This can be of crucial importance to bank stability. For example, the occurrence of a weak, noncohesive layer close to top of a layered bank is of little consequence, but the same layer at the toe could allow rapid undercutting and/or piping, leading to a mass failure of the overlying layers.

Figure 19. Types of bank protection: a) Hard points; b) Toe protection; c) revetment; and d) dyke fields

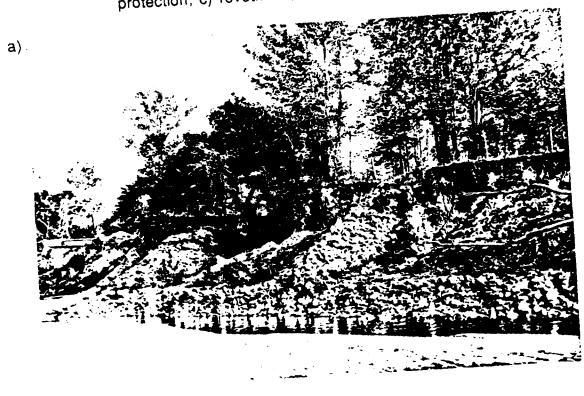








Figure 20. Typical bank profiles


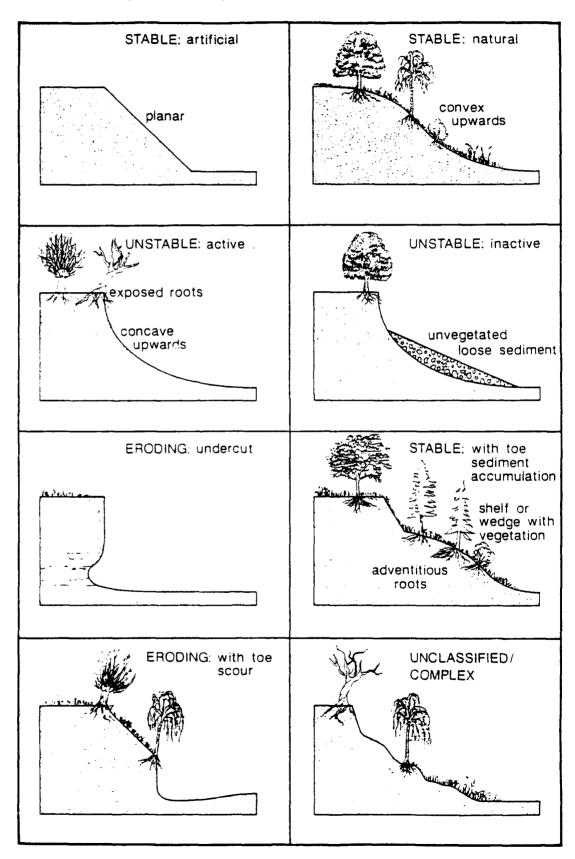


Figure 21. Tension cracking behind a steep, eroding river bank
a) Crack behind active failure block; b) New crack
forming at flood plain surface behind bankline



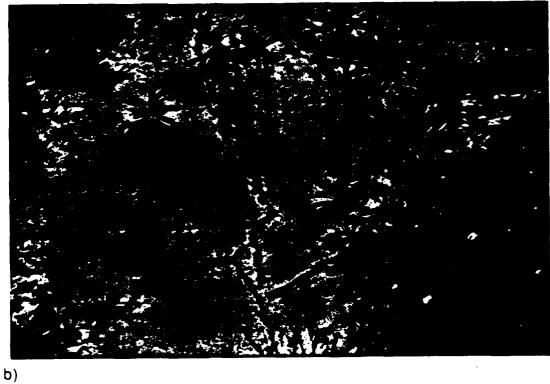

# Part 9: Left Bank Vegetation

This part has 12 topics. The important role of bank vegetation in affecting bank processes and stability is now recognized by both engineers and geomorphologists. Vegetation effects may be either beneficial or detrimental to bank stability depending on the nature of the vegetation and the geomorphic environment. Also, vegetation can be a useful indicator of the condition of the bank. Therefore, vegetation is covered in some detail in the reconnaissance.

Vegetation broadly classifies the types of flora found on the bank face itself.

Orientation records the angle at which bank vegetation is leaning over. Vertical vegetation generally indicates stability while leaning vegetation, especially trees, is a sure sign of wind-throw and/or bank instability.


Tree Types recognizes that deciduous and coniferous trees have different effects on bank stability. Compared to deciduous trees, conifers are shallow rooted and lack a vegetative understorey. Usually, deciduous trees are more effective in helping to stabilize a bank through root reinforcement than are conifers.

Tree Species allows the user to record in detail the actual trees present if they can be identified. Different species have different degrees of root reinforcement of the soil, vulnerability to wind-throw and flood tolerance which can be useful in interpreting their significance to channel stability.

Density and Spacing describe the degree of vegetative cover over the bank face. Density refers to the closeness of packing together of plant stems. The higher the density, the better the erosion protection, but also the greater the flow resistance of the vegetation. Spacing describes how the vegetation is spread over the bank. Particularly, it refers to whether there are clumps of vegetation with gaps in between which the flow can attack, whether there are closely spaced clumps of plants, or whether there is a continuous cover of plants. It differs from density. For example, it is common for dense vegetation to be growing in widely spaced clumps, with bare soil in between which the flow is able to attack and erode.

Roots defines the relationship between the vegetation roots and the bank surface (Fig. 22). If the bank face has not moved substantially, then the roots are normally found just below the soil surface. If sediment is accumulating on the bank, vegetation produces adventitious roots into the new sediment as the ground surface moves up relative to the plant. If the bank is eroding, plant roots are exposed as the ground surface moves back relative to the plant. If erosion is rapid then roots poke

Figure 22. Plant roots growing in banks subject to : a) slow erosion; and b) rapid erosion

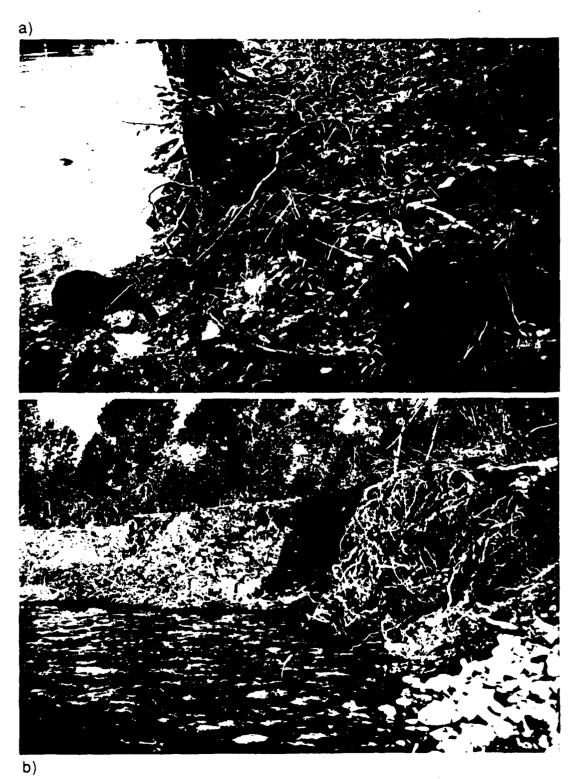

straight out of the bank face. But if erosion is slow, the exposed roots will tend turn back and grow back into the bank face. Hence the state of the roots can be used to infer the present trend in bank deposition or erosion.

Location defines the position of the vegetation on the bank profile. Generally, vegetation (especially trees) at the bank top is less effective in helping to stabilize the bank than that lower on the bank. This is the case because: i) the surcharge weight of woody vegetation at the bank top acts to promote failure, while that low on the bank may load the bank against failure; ii) trees low on the bank are less exposed and are less vulnerable to wind-throw; iii) closely spaced trees low on the banks may have a buttressing effect; iv) vegetation low on the bank reduces near bank velocities and attack on the bank toe. While vegetation low on the banks does induce more flow resistance than that higher on the bank, recent research shows that this will only result in a significant lowering of in-channel conveyance in channels of very low width to depth ratio (less than about 10) (Masterman and Thorne, In Press).

Diversity deals with the mixture of vegetative types present. Diversity is positively correlated with age. Generally a mature ecosystem with a wide variety of species and types is more beneficial than a monostand of one plant type. Climax-vegetation is a mature ecosystem in which there is no longer any succession of plant species with time. Ecologically bank erosion plays a beneficial role in the renewal of the channel environment through destroying overly mature climax-vegetation.

Health notes the state of the vegetation. Dead or dying vegetation is a serious liability to bank stability. It is vulnerable to wind-throw, drags down the bank and, if it falls into the channel, dead wood may divert the flow and cause bed scour and bank erosion. However, woody debris can also create flow retarding log-jams that have beneficial hydraulic, sediment storage and habitat effects so long as potential flooding is not an issue. Within the bank the cavities left by rotted-out roots of dead trees weaken the bank and provide ready pathways for seepage and piping processes (see Parts 10 and 11).

Age can be a useful guide to the history of the bank. Mature vegetation can only develop on a stable bank, while a predominance of young, immature vegetation hints at recent instability. Vegetation age can be estimated eye by field workers with experience of the local species, but more accurate ages must be based on coring of trees to count the annual rings. This requires the right tree coring tools and expertise.

Fallen trees which are not dead produce new stems which grow vertically from the downed trunk (Fig. 23). Breaking off such a stem and counting the annual rings is a good way to gauge the time elapsed since the failure.

Height is a factor in determining the possible effect of vegetation in dragging down the bank and in impeding near-bank flow in the channel. Tall trees (particularly on the upper bank or top bank) may drag down a section of bank by toppling into the channel through either their surcharge weight, or due to wind-throw. Tall vegetation has a higher effective roughness height and produces significant flow resistance in low width/depth ratio channels. The height may be noted qualitatively, but space is also provided for a numerical value, if this is required.

Lateral Extent describes the width of the band of bank vegetation along the channel. It refers to how extensive the band is in relation to the riparian corridor (Fig. 24). A wide, extensive band of vegetation along the bank isolates it from the flood plain, protecting it from grazing and trampling by animals and damage by people. A wide band has many advantages to the bank's environment, habitat value and aesthetic appearance as well as its stability. A narrow band or single line of trees is grazed on the bankward side, producing asymmetrical trees and bushes which lean over into the channel and are vulnerable to Encroachment of farming, recreational and wind-throw. commercial activities to the bank top and beyond should be avoided, to create a buffer strip, except where access to the stream is essential. At these locations special provision should be made to protect the bank from damage while allowing free access for stock, people, machinery and maintenance crews.

Bank Profile Sketches are spaces provided for a visual representation of the left bank in the study reach (Fig. 25). The aims are to show the slope profile break points, the geotechnical/sedimentary features and any engineered structures on the bank, and to record any sediment sampling points in different bank layers. Also, photographs showing important bank features should be taken and photo points and orientations marked on the sketch so that they can be relocated and repeated precisely in any future re-surveys. This greatly enhances their value as a guide to bank condition, erosion, bank-line changes and system instability.

Figure 23. New stems shooting upwards from a downed tree.

Counting rings in the stems gauges the time elapsed since failure



Figure 24. Bank vegetation in bands of different widths.

a) Narrow band vulnerable to destabilisation by erosion and wind-throw; b) Deep band resistant to destabilisation


a)





b)

Figure 25. Example bank profile sketch

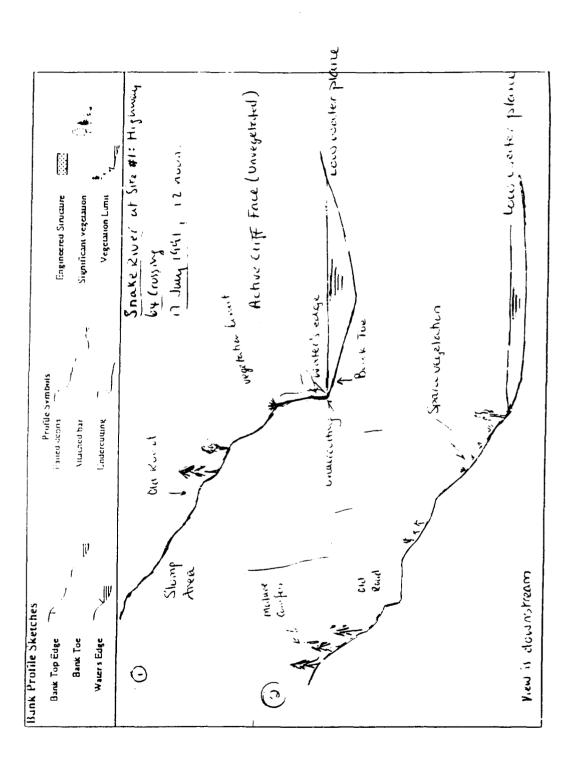

# Part 10: Left Bank Erosion

This part has 10 topics. The aim is to develop a good understanding of the process responsible for erosion and their distribution over the bank, both along the channel and up and down the bank profile. A large proportion of this part is interpretative and the field worker must have some background knowledge of bank erosion to complete this part of the survey.

Erosion Location establishes the position of the eroding area of bank in relation to major channel features. These may, or may not, be the cause of the problem, but it is important to record the relative position of bank erosion in relation to channel planform, bed features and engineering structures.

Present Status establishes the condition of the bank at the time of observation. It may be intact, that is not affected by erosion. If the survey is made at low flow, it may well be that the bank is affected by erosion, but not actually at the time of observation. Such a bank is eroding but dormant. If, however, erosion is actually occurring then the bank is eroding and active. Similarly, a bank advancing through deposition may be either dormant or active at the time of observation.

Rate of Retreat and Rate of Advance allow the individual to record the speed of bank-line migration, if it is known. This may be determined in the office from historical maps and aerial photographs, in the field from repeated surveys along set ranges, or from local land-owners and other interested parties. However, although potentially valuable, hearsay and other anecdotal evidence must be treated with extreme caution and not accepted as accurate without independent corroboration.

The remaining 7 topics are interpretative and subject to a confidence level.

Severity of Erosion puts any erosion into perspective. Nearly all rivers have some bank erosion and this may be quite acceptable: by no means all cases merit analysis or treatment.

Extent of Erosion defines the scale of bank erosion in the river. Usually, this is an essential step in identifying the underlying cause of a bank erosion problem. For example, if a problem is common to the whole fluvial system then a local cause may be unlikely. In terms of bank stabilization, it usually necessary to match the scale of the solution to the scale of the problem. A local solution will not cure a reach or system wide problem and may well be ineffective in the medium to long-term.


Processes attempts to identify the processes responsible for bank erosion (Fig. 26). This is not an easy task and often

Figure 26. Bank erosion processes observed in the field.

- a) Parallel flow; b) impinging flow; c) piping;
- d) freeze/thaw; e) sheet erosion+rilling/gullying; f) wind waves; g) vessel forces and resulting erosion





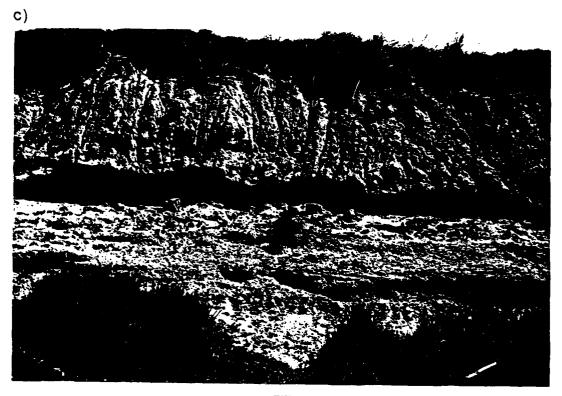



d)





g)





requires some training. It is assumed here that the individuals undertaking the survey are somewhat familiar with erosion processes and field recognition of the effects of different processes on the bank surface. Some guidance is given here to augment the individual's knowledge

Parallel Flow erosion is the detachment and removal of intact grains or aggregates of grains from the bank face by flow along the bank. Evidence includes: observation of high flow velocities close to the bank; near-bank scouring of the bed; under-cutting of the toe/lower bank relative to the bank top; a fresh, ragged appearance to the bank face; absence of surficial bank vegetation.

Impinging Flow erosion is detachment and removal of grains or aggregates of grains by flow attacking the bank at a steep angle to the long-stream direction. Impinging flow occurs in braided channels where braid-bars direct the flow strongly against the bank, in tight meander bends where the radius of curvature of the outer bank is less than that of the channel centerline, and at other locations where an in-stream obstruction deflects and disrupts the orderly flow of water. Evidence includes: observation of high flow velocities approaching the bank at an acute angle to the bank; braid or other bars directing the flow towards the bank; tight meander bends; strong eddying adjacent to the bank; near-bank scouring of the bed; under-cutting of the toe/lower bank relative to the bank top; a fresh, ragged appearance to the bank face; absence of surficial bank vegetation.

Piping is the caused by groundwater seeping out of the bank face. Grains are detached and entrained by the seepage flow (also termed sapping) and may be transported away from the bank face by surface run-off generated by the seepage, if there is sufficient volume of flow. Piping is especially likely in high banks or banks backed by the valley side, a terrace, or some other high ground. In these locations the high head of water can cause large seepage pressures to occur. Evidence includes: pronounced seep lines, especially along sand layers or lenses in the bank: pipe shaped cavities in the bank; notches in the bank associated with seepage zones and layers; run-out deposits of eroded material on the lower bank. Note that the effects of piping erosion can easily be mistaken for those of wave and vessel force erosion. (see papers by Hagerty and Hagerty, 1989 and by May, 1982).

Freeze/thaw is caused by sub-zero temperatures which promote freezing of the bank material. Ice wedging cleaves apart blocks of soil. Needle-ice formation loosens and detaches grains and crumbs at the bank face. Freeze/thaw activity

seriously weakens the bank and increases its erodibility. Evidence includes: periods of below freezing temperatures in the river valley; a loose, crumbling surface layer of soil on the bank; loosened crumbs accumulated at the foot of the bank after a frost event; jumbled blocks of loosened bank material.

Sheet erosion is the removal of a surface layer of soil by non-channelised surface run-off. It results from surface water draining over the bank edge, especially where the riparian and bank vegetation has been destroyed by encroachment of human activities. Evidence includes: surface water drainage down the bank; lack of vegetation cover, fresh appearance to the soil surface; eroded debris accumulated on the lower bank/toe area.

Rilling + gullying occurs when there is sufficient uncontrolled surface run-off over the bank to initialise channelised erosion. This especially likely where flood plain drainage has been concentrated (often unintentionally) by human activity. Typical locations might be near buildings and parking lots, stock access points and along stream-side paths. Evidence includes: a corrugated appearance to the bank surface due to closely spaced rills; larger gullied channels incised into the bank face, headward erosion of small tributary gullies into the flood plain surface, eroded material accumulated on the lower bank/toe in the form of alluvial cones and fans.

Wind waves cause velocity and shear stresses to increase and generate rapid water level fluctuations at the bank. They cause measurable erosion only on large rivers with long fetches which allow the build up of significant waves. Evidence includes: large channel width or long, straight channel and an acute angle between eroding bank and longstream direction; a wave-cut notch just above normal low water plane; a wave-cut platform or run-up beach around normal low-water plane. Note that it is easy to mistake the notch and platform produced by piping and sapping for one cut by wave action (see papers by Hagerty and Hagerty, 1989 and May, 1982).

Vessel Forces can generate bank erosion in a number of ways. The most obvious way is through the generation of surface waves at the bow and stern which run up against the bank in a similar fashion to wind waves. In the case of large vessels and/or high speeds these waves may be very damaging. If the size of the vessel is large compared to the dimensions of the channel hydrodynamic effects produce surges and drawdown in the flow. These rapid changes in water level too can loosen and erode material on the banks through generating rapid pore water pressure fluctuations. If the vessels are relatively close to the bank propeller wash can erode material and re-suspend sediments on the bank below the water surface. Finally,

mooring vessels along the bank may involve mechanical damage by the hull. Evidence includes: use of river for navigation; large vessels moving close to the bank; high speeds and observation of significant vessel-induced waves and surges; a wave-cut notch just above the normal low-water plane; a wave-cut platform or "spending" beach around normal low-water plane. Note that it is easy to mistake the notch and platform produced by piping and sapping for one cut by vessel forces (see papers by Hagerty and Hagerty, 1989 and May, 1982).

Ice rafting erodes the banks through mechanical damage to the banks due to the impact of ice-masses floating in the river and due to surcharging by ice cantilevers during spring thaw. Evidence includes: severe winters with river prone to icing over; gouges and disruption to the bank line; toppling and cantilever failures of bank+attached ice masses during spring break-up.

Other erosion processes (trampling by stock, damage by fishermen etc.) could be significant but it is impossible to list them all. If some other erosive process is identified tick this box and write it in below.

Distribution of Each Process on the Bank recognizes that more than one erosion process may operate on a bank. Different processes may be responsible for eroding different parts of the bank. The distribution of up to four different processes over the bank may be delineated here. This is significant because the distribution of different erosion processes has geomorphic implications and may require special consideration when stabilizing the bank.

#### Part 11: Left Bank Geotech Failures

This part has 10 topics. Serious bank retreat often involves geotechnical bank failures as well as direct erosion by the flow. Such failures are often referred to as "bank sloughing" or "caving", but these terms are poorly defined and their use is to be discouraged. The potential for bank failure can have implications for plans to stabilize a bank. The aim of this part is to identify any geotechnical instability, classify the modes of failure and note their distribution over the bank.

Failure Location establishes the position of the failing area of bank in relation to major channel features. These may, or may not, be the cause of the problem but it is important to record the relative position of bank failure in relation to channel planform, bed features and engineering structures. Failures will usually coincide with the location of bank erosion, but this may not always be the case. Where instability and

retreat are the result of weakness or processes operating within the bank, it may not be in an area of active erosion (see for example papers by Hagerty and Hagerty, 1989).

Present Status establishes the condition of the bank at the time of observation. It may be stable, that is not affected by geotechnical instability and showing no evidence of past If the bank appears to be stable, but does show evidence of recent, past failures, it may be classified as unreliable. This indicates that failures have occurred on the bank and, therefore, that they might recur in the future. instability is associated with saturated conditions in the bank and failures tend to occur during, or soon after, high flow stages in the channel. If the survey is made at low flow and there has not been heavy rain or snowmelt for some time, it may be that although the bank is potentially unstable, it is stable at the time of observation. Such a bank is unstable but dormant because should saturated and/or rapid drawdown conditions occur, it would be likely to fail. If failures are actually observed then the bank is unstable and active.

Failure Scars + Blocks notes the presence and appearance of two prominent features produced by bank instability. Scars are the failure surfaces left in the bank when a block of material falls, slumps or slides away. Blocks are the more or less intact pieces of the failure mass which come to rest at the bank toe, or on the lower bank. Immediately after failure scars and blocks are fresh, with sharp edges, but weathering softens their appearance as time passes.

The remaining 7 topics are interpretative and subject to a confidence level.

Instability: Severity puts any instability into perspective. Nearly all rivers have some bank instability and this may be quite acceptable: not all cases merit analysis or treatment.

Instability: Extent defines the scale of bank collapse in the river. Usually, this is an essential step in identifying the underlying cause of a bank instability problem. For example, if a problem is common to the whole fluvial system then a local cause may be unlikely. In terms of bank stabilization, it usually necessary to match the scale of the solution to the scale of the problem. A local solution will not cure reach or system wide problems and may be ineffective in the medium to long-term.


Failure Mode attempts to identify the type of failures resulting from bank instability (Fig. 27). This is not an easy task and often requires some training. It is assumed here that the individuals undertaking the survey are somewhat familiar with slope failure mechanics and bank collapse.

Figure 27. Examples of different modes of geotechnical stream bank failure. a) Soil fall; b) rotational slip; c) slab failure; d) cantilever failure; e) pop-out failure; f) piping; g) dry granular flow; h) wet earth flow;

i) example 'other' failure mode - cattle trampling

a)



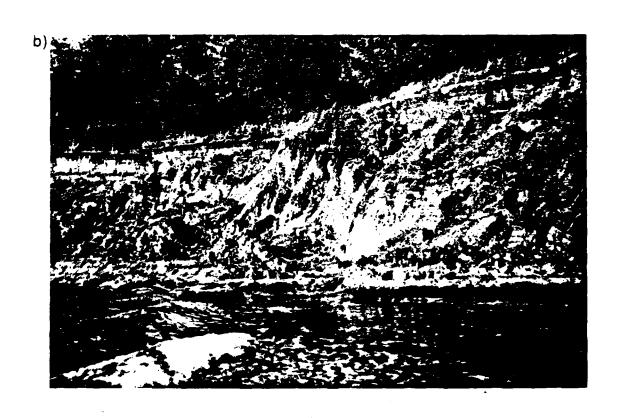





c)

d)



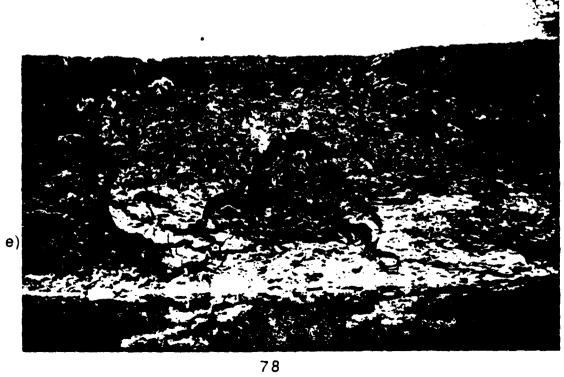

f)

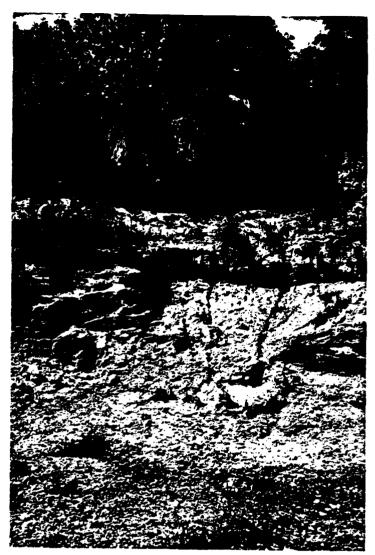







Interpretation rests on recognition of the geometry of the bank which results from different mechanisms. Some guidance is given here.

Soil/rock fall occurs only on a steep bank, where grains, grain assemblages or blocks fall into the channel. Such failures are found on steep, eroding banks of low operational cohesion. Soil and rock falls often occur when a stream undercuts the toe of a sand, gravel or deeply weathered rock bank. Evidence includes: very steep bank; debris falling into the channel; failure masses broken into small blocks; no rotation or sliding failures.

Shallow slide is a shallow seated failure along a plane somewhat parallel to the ground surface. Such failures are common on banks of low cohesion. Shallow slides often occur as secondary failures following rotational slips and/or slab failures. Evidence includes: weakly cohesive bank materials; thin slide layers relative to their area; planar failure surface; no rotation or toppling of failure mass.

Rotational slip is the most widely recognised type of mass failure mode. A deep seated failure along a curved surface results in back-tilting of the failed mass toward the bank. Such failures are common in high, strongly cohesive banks with slope angles below about 60°. Evidence includes: banks formed in cohesive soils; high, but not especially steep, banks; deep seated, curved failure scars; back-tilting of top of failure blocks towards intact bank; arcuate shape to intact bank line behind failure mass.

Slab-type block failure is sliding and forward toppling of a deep seated mass into the channel. Often there are deep tension cracks in the bank behind the failure block. Slab failures occur in cohesive banks with steep bank angles, greater than about 60°. Such banks are often the result of toe scour and under-cutting of the bank by parallel and impinging flow erosion. Evidence includes: cohesive bank materials; steep bank angles; deep seated failure surface with a planar lower slope and nearly vertical upper slope; deep tension cracks behind the bank-line; forward tilting of failure mass into channel; planar shape to intact bank-line behind failure mass.

Cantilever failure is the collapse of an overhanging block into the channel. Such failures occur in composite and layered banks where a strongly cohesive layer is underlain by a less resistant one. Under-mining by flow erosion, piping, wave action and/or pop-out failure leaves an overhang which collapses by a beam, shear or tensile failure. Often the upper layer is held together by plant roots. Evidence includes: composite or layered bank stratigraphy; cohesive layer

underlain by less resistant layer; under-mining; overhanging bank blocks; failed blocks on the lower bank and at the bank toe.

Pop-out failure results from saturation and strong seepage in the lower half of a steep, cohesive bank. A slab of material in the lower half of the steep bank face falls out, leaving an alcove-shaped cavity. The over-hanging roof of the alcove subsequently collapses as a cantilever failure. Evidence includes: cohesive bank materials; steep bank face with seepage area low in the bank; alcove shaped cavities in bank face.

Piping failure is the collapse of part of the bank due to high groundwater seepage pressures and rates of flow. Such failures are an extension of the piping erosion process described in Part 9, to the point that there is complete loss of strength in the seepage layer. Sections of bank disintegrate and are entrained by the seepage flow (termed sapping). They may be transported away from the bank face by surface run-off generated by the seepage, if there is sufficient volume of flow. Evidence includes: pronounced seep lines, especially along sand layers or lenses in the bank; pipe shaped cavities in the bank, notches in the bank associated with seepage zones, run-out deposits of eroded material on the lower bank or beach. Note that the effects of piping failure can easily be mistaken for those of wave and vessel force erosion.

Dry granular flow describes the flow-type failure of a dry, granular bank material. Other terms for the same mode are ravelling and soil avalanche. Such failures occur when a noncohesive bank at close to the angle of repose is undercut, increasing the local bank angle above the friction angle. A carpet of grains rolls, slides and bounces down the bank in a layer up to a few grains thick. Evidence includes: noncohesive bank materials; bank angle close to the angle of repose; undercutting, toe accumulation of loose grains in cones & fans.

Wet earth flow failure is the loss of strength of a section of bank due to saturation. Such failures occur when water-logging of the bank increases its weight and decreases its strength to the point that the soil flows as a highly viscous liquid. This may occur following heavy and prolonged precipitation, snow-melt or rapid drawdown in the channel. Evidence includes: sections of bank which have failed at very low angles; areas of formerly flowing soil that have been preserved when the soil dried out; basal accumulations of soil showing delta-like patterns and structures.

Other failure modes could be significant but it is impossible to list them all. If some other type of failure is identified tick this box and write it in below.

Distribution of Each Mode on the Bank recognizes that different failure modes may be involved in the collapse of different parts of the bank. The distribution of up to four different modes may be delineated here. This is significant because the distribution of different failure modes has geomorphic implications and may require special consideration when stabilizing the bank.

### Part 12: Left Bank Toe Sediment Accumulation

The part has 9 topics. The aims are to characterize the balance between sediment supply and removal at the bank toe and to establish the degree of toe scour or sediment accumulation there. The sediment balance defines the state of basal endpoint control of the bank.

Banks which have net toe erosion (under-cutting) are certain to become less stable and to retreat more rapidly in the future unless a more resistant bank material is encountered or steps are taken to stabilize the bank (Fig. 28a). When stabilizing such banks, special steps must be taken in the design to either eliminate or allow for serious toe scour.


Banks which have neither net toe erosion or deposition will continue to retreat at about a constant rate because, on average, failed material is removed by basal clean-out about as quickly as it is generated by bank erosion and failure (Fig. 28b). Only the usual degree of toe scour protection is needed on such banks.

Banks with net toe deposition should show increased stability and a reduced rate of retreat, all else being equal (Fig. 28c). This is achieved through bank shelf building - the accumulation of a low angle sediment wedge at the bank toe. Hence the degree of bank shelf development is a good indicator of the tendency of the bank towards stability. Given the opportunity, vegetation invades the stable toe area and shelf quite quickly. Therefore, toe vegetation can be used as a guide to the age and permanence of a bank shelf. Banks with developing, permanent shelves should not normally require structural bank protection.

Stored Bank Debris notes the presence and type of material found in storage at the bank toe. Note that a bank shelf is made up mostly of debris derived from bank erosion and failure which has not been removed by the flow. Bed and bar sediment should not be the primary material, as this indicates that the feature is an attached bar rather than a bank shelf. Bars are hydraulic roughness elements and bed sediment stores which play different roles in channel process to the bank sediment storage and buttressing roles of a bank shelf.

Figure 28. Typical bank toe profiles: a) Concave upwards (active erosion); b) Planar (temporary storage) and; c) convex upwards (net accumulation)

a)

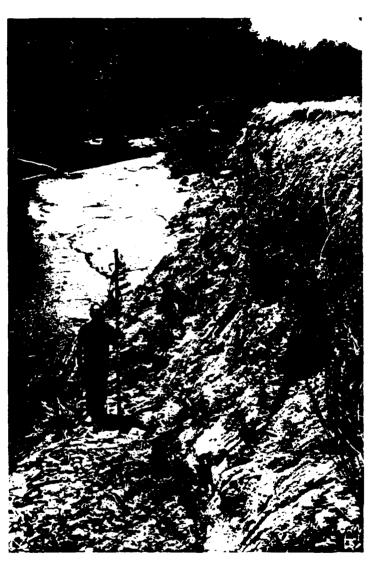





Vegetation at the broad scale classifies the types of flora found on the bank shelf at the toe.

Age can be a useful guide to the recent history of undercutting or sediment accumulation (Fig 29). Old and mature vegetation clearly can only develop on a stable bank shelf. A lack of vegetation or a predominance of young, immature plants hints at a recently deposited shelf that may be a temporary feature, being destroyed at high flow.

Tree Species allows the user to record in detail the actual trees present if they can be identified. Different species have different degrees of root reinforcement of the soil, vulnerability to wind-throw and flood tolerance which can be useful in interpreting their significance to channel stability.

Health identifies the state of the shelf vegetation. Dead or dying vegetation can quickly become a serious liability to the shelf, bank and channel stability unless it is dense enough to form a natural crib wall, protecting the toe and lower bank.

Roots defines the relationship between the vegetation roots and the bank shelf surface. If the elevation of the shelf surface has not changed substantially, then the roots are normally found just below the surface. If the shelf is accumulating, vegetation produces adventitious roots into the new sediment as this moves the ground surface up relative to the plant. If the shelf is eroding, plant roots are exposed as the ground surface moves down relative to the plant. Hence, the roots can be used to infer the present trend in shelf growth or erosion.


The remaining 3 topics are interpretative and subject to a confidence level.

Toe Bank Profile classifies the shape of the bank toe area. A planar slope is either artificial or is formed in totally disaggragated, effectively non-cohesive debris from bank erosion and failure. This material is most likely being stored at the toe as a basal wedge, prior to removal by a high flow event in the channel. A concave upward profile is usually associated with toe erosion and little sediment storage at the toe. A convex upward profile indicates a considerable and accumulating storage of material as a bank shelf.

Present Debris Storage estimates the amount of bank debris currently stored at the bank toe.

Sediment Balance identifies on the basis of the evidence observed whether the amount of bank debris in the toe area is increasing (accumulating), staying about constant (steady state) or decreasing (under-cutting). If it is not possible to judge this then the "unknown" box may be ticked.

Figure 29. Bank Shelf vegetation of different ages. a) Immature vegetation on a shelf in front of mature flood plain forest; b) mature vegetation on bench on left bank; c) old trees on shelves on both banks

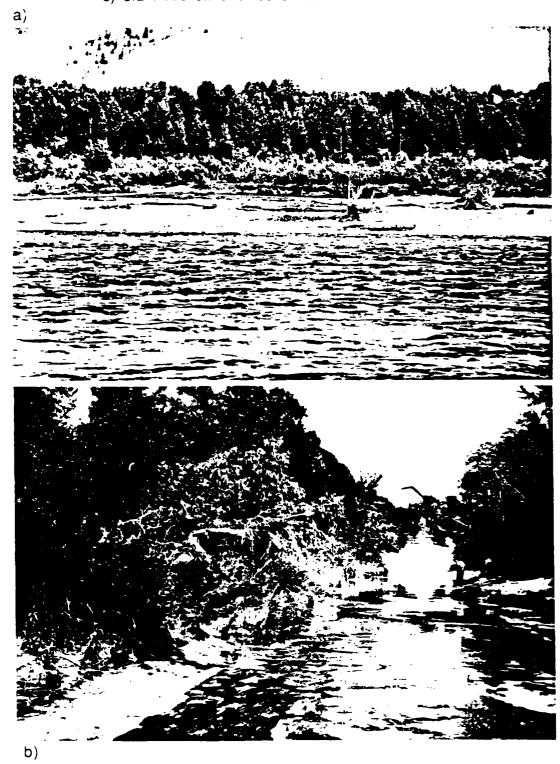

c)



# 2.6 SECTION 5 - RIGHT BANK SURVEY

Section 5 repeats the bank survey for the other river bank. The section consists of parts 13 to 17 which are indentical to parts 7 to 12 in Section 4.

### 3. CONCLUSIONS

The Stream Reconnaissance sheets presented here are an attempt to develop a system to observe and record information pertaining to channel form, fluvial processes, sediment impacts and stability problems on natural water courses. They have been tested and modified in the light of comments made by professional engineers working in District Offices in five However, their development and improvement American States. is on-going and will benefit from further experience. individual who uses the sheets should bear their nature in mind. Any experience in using the sheets would be of interest to the developers, who would be grateful for feedback and comments. Please address any correspondence to either of the Principal Investigator named on the front cover of this document or the relevant staff at the Hydraulics Laboratory, WES.

# 4 ACKNOWLEDGEMENTS

The original idea for the sheets comes from a paper by Kellerhals, Church and Bray (1976) and their inspiration is fully acknowledged. The work undertaken in this project benefitted enormously from the involvement of Brad Comes and Mike Trawle at WES. Brad was originally in charge of the work unit under which the project was performed and he was instrumental in making the early phases of the work a success. Mike Trawle took over the work unit after Mr Comes left the Laboratory, and played an important role in the later phases and particularly the field testing and evaluation of the technique. The support of Mr Tony Thomas at WES is also gratefully acknowledged.

Field testing could not have been undertaken without the positive involvement of Meg Burns (Baltimore District), Dave Berretta (Memphis District), Steve Collingsworth (Ft Worth District), Ed Sing (Sacramento District) and Lester Cunningham (Walla Walla District). Each gave of their time and energy in making the sheets better.

The idea of adding a "confidence level" to the interpretative sections came to me after seeing an "expert system" for channel evolution produced by the staff of Water Engineering and Technology, Ft Collins, Colorado for the Vicksburg Division, US Army Corps of Engineers.

In the field, my research associate Richard Masterman was tireless in his role as route finder, secretary, note keeper, camera operator and helpful adviser.

# **5 REFERENCES**

Howard, A.D. (1967) "Drainage analysis in geological interpretation: a summation" *Bulletin of the Anierican Association of Petroleum Geologists*, Vol. 51, 2246-59.

Hagerty, D.J (1989) "Geotechnical aspects of river bank erosion" in, *Hydraulic Engineering*, M.A. Ports (Ed.), Proceedings of the National Conference on Hydraulic Engineering, ASCE, New Orleans, August 1989, 118-123

Hagerty, D.J. and Hagerty, M.J. (1989) "Ohio River Bank Erosion - Traffic Effects" Journal of the Waterways, Port, Coastal and Ocean Engineering Division, ASCE, Vol. 115(3), 404-408.

Kellerhals, R., Church, M. and Bray, D.I. (1976) "Classification and analysis of river processes" *Journal of the Hydraulics Division*, Proc. ASCE, 102 (HY7), 813-829

Masterman, R. and Thorne, C.R. (In Press) "Analytical approach to flow resistance in channels with vegetated banks" Technical Note, *Journal of Hydraulic Engineering*, ASCE.

May, J.R. (1982) "Engineering geology and geomorphology of stream bank erosion. Report 3: The applications of water-borne geophysical techniques in fluvial experiments." *Technical Report GL-79-7 and Supplemental Update*, Geotechnical Laboratory, US Army Engineers, Waterways Experiment Station, PO Box 631, Vicksburg, Ms 39181, USA.

Schumm, S.A., Harvey, M.D. and Watson, C.C. (1984) *Incised Channels, Morphology, Dynamics and Control* Water Resources Publications, P.O. Box 2841, Littleton, Co 80161, USA, 200p.

Simons, D.B., Li, R-M. and Associates (1982) *Engineering Analysis of Fluvial Systems* Simons, Li and Associates, P.O Box 1816, Fort Collins, Co 80522, USA.

Thomas. W.A. (1990) Example of the Stable Channel Design Approach in Hydraulic Engineering (H.H. Chang and J.C. Hill, eds.), Proceedings of the 1990 National Conference, San Diego, Ca, ASCE, pp 175-180.

Thorne, C.R. and Abt, S.R. (1989) "Bank Erosion Modeling and Assessment Techniques" *Final Report to the US Army Engineers Waterways Experiment Station*, under contract number DACW39-87-D-0031, Colorado State University, Ft Collins, Co., November 1989, 4 Parts.

Thorne, C.R. & Osman, A.M. (1988) "Riverbank Stability Analysis: II Applications" *Journal of Hydraulic Engineering*, ASCE, Vol 114, No 2, pp 151-172

Varnes, D.J. (1958) "Landslide types and processes" in, Landslides and Engineering Practice, E.B. Eckel (ed.), Highway Research Board, Washington, Special Report 29, NAS-NRC Publication 544, 20-47.

WES (1990) Sedimentation Investigations of Rivers and Reservoirs, USAEWES, Prospect Course Notes 148/CECW-EH-Y, No. P1MSAIWR.

# APPENDIX B

Recommended Contents for a Stream Reconnaissance Backpack

# Field Equipment Backpack

Equipment	Primary Usage	Cost (\$)
Backpack	Transporting equipment and protecting it from the weather and accidental damage	27.50
Sunto Compass (metal)	Finding direction, orientating maps and aerial photographs, taking bearings, establishing baselines	
Sunto Clinometer	Measuring valley side and bank slopes. Measuring bank and tree heights	187.75
Range-finder	Measuring distances such as channel width and longstream reach length, where access is difficult.	66.,5
Lietz Open Reel Tape	Measuring distances such as channel width and longstream reach length, where access is easy.	24.50
Lietz 5x Mag. Hand Level	Leveling cross-sections, bank profiles and long-stream bed and water slopes.	99.00
Lietz Level Rod	Leveling cross-sections, bank profiles and long-stream bed and water slopes.	122.50
Chaining Pins	Marking sections and points of interest.	33.70
Sunglo Vinyl Flagging	Flagging features of interest.	3.00
Stop Watch	Timing transit time of floats for velocity measurement.	not known
Hammer/Hatchet	Clearing brush, hammering pegs.	31.50
Army Trenching Shovel	Digging sample pits and trenches.	5.00
Soil sample Bags (100)	Holding bed, bar and bank material samples.	11.95
Marker Pen	Labeling sediment samples.	1.00
Sieve Screen Set (6 sieves)	On-site sieve analysis of sediment samples	54.50

# TOTAL COST OF FIELD BACKPACK (EXCLUDING STOPWATCH) \$729.65

NOTE. All field groups should also be equipped with a first aid kit, insect repellent, sun screen and clothing and footwear appropriate to the field area and weather.

Suggestions for changes made by Corps' personnel:

Replace survey rod with builder's rule or pocket rod Replace inch ruler with one marked in tenths Add a poleroid camera for instant pictures Add a gravelometer for size analysis of coarse bed material Add tree and plant identification literature Add a magnifying lens Add a painted scale for photographs Add a hip chain for distance measurement Add a copy of Barnes' USGS book on Manning's 'n' estimation Add an unbrella Add a dictaphone

These suggestions are put forward to the WES personnel responsible for maintenance and development of the field packs.