

TALLIL MILITARY BASE  
CAMP UR  
NASIRIYAH, IRAQ

SUSTAINMENT ASSESSMENT

**SIGIR PA-06-087**  
**SIGIR PA-06-088**  
**APRIL 25, 2007**

Report Documentation Page				Form Approved OMB No. 0704-0188	
Public reporting burden for the collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to a penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.					
1. REPORT DATE <b>25 APR 2007</b>		2. REPORT TYPE		3. DATES COVERED <b>00-00-2007 to 00-00-2007</b>	
4. TITLE AND SUBTITLE <b>Tallil Military Base Camp Ur. Nasiriyah, Iraq. Sustainment Assessment</b>				5a. CONTRACT NUMBER	
				5b. GRANT NUMBER	
				5c. PROGRAM ELEMENT NUMBER	
6. AUTHOR(S)				5d. PROJECT NUMBER	
				5e. TASK NUMBER	
				5f. WORK UNIT NUMBER	
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) <b>Office of the Special Inspector General for Iraq Reconstruction, 400 Army Navy Drive, Arlington, VA, 22202</b>				8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)				10. SPONSOR/MONITOR'S ACRONYM(S)	
				11. SPONSOR/MONITOR'S REPORT NUMBER(S)	
12. DISTRIBUTION/AVAILABILITY STATEMENT <b>Approved for public release; distribution unlimited</b>					
13. SUPPLEMENTARY NOTES					
14. ABSTRACT					
15. SUBJECT TERMS					
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT <b>Same as Report (SAR)</b>	18. NUMBER OF PAGES <b>24</b>	19a. NAME OF RESPONSIBLE PERSON
a. REPORT <b>unclassified</b>	b. ABSTRACT <b>unclassified</b>	c. THIS PAGE <b>unclassified</b>			



## **SPECIAL INSPECTOR GENERAL FOR IRAQ RECONSTRUCTION**

April 25, 2007

MEMORANDUM FOR DIRECTOR, IRAQ RECONSTRUCTION MANAGEMENT  
OFFICE  
COMMANDING GENERAL, MULTI-NATIONAL  
SECURITY TRANSITION COMMAND-IRAQ  
COMMANDING GENERAL, GULF REGION DIVISION,  
U.S. ARMY CORPS OF ENGINEERS


SUBJECT: Report on Tallil Military Base (Camp Ur) Sustainment, Nasiriyah, Iraq  
(Report Numbers SIGIR PA-06-087 and PA-06-088)

The Office of the Special Inspector General for Iraq Reconstruction is conducting a series of assessments to assess the current condition of completed projects subsequent to their transition to the Government of Iraq to determine whether the projects are likely to remain operational.

We are providing this report for your information and use. It addresses construction work performed on the Tallil Military Base (Camp Ur) near Nasiriyah, Iraq, to determine if the project is likely to remain operational after its transition to the Government of Iraq. These assessments were made to provide you and other interested parties with real-time information on relief and reconstruction projects to enable appropriate action to be taken, if warranted.

The coordinated comments received from the Commanding General, Multi-National Security Transition Command-Iraq in response to a draft of this report addressed the recommendations, and the actions taken and planned should address the issues we identified. As a result, comments to this final report are not required.

We appreciate the courtesies extended to our staff. If you have any questions please contact Mr. Brian Flynn at [brian.flynn@sigir.mil](mailto:brian.flynn@sigir.mil) or at 914-360-0607. For public or congressional queries concerning this report, please contact SIGIR Congressional and Public Affairs at [publicaffairs@sigir.mil](mailto:publicaffairs@sigir.mil) or at 703-428-1100.

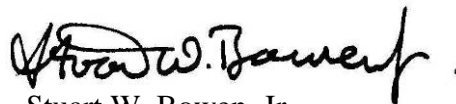

Stuart W. Bowen, Jr.  
Inspector General

# **Special Inspector General for Iraq Reconstruction**

**SIGIR PA-06-087 and 088**

**April 25, 2007**

## **Tallil Military Base (Camp Ur) Sustainment Assessment Nasiriyah, Iraq**

### **Synopsis**

**Introduction.** The Inspections Directorate of the Office of the Special Inspector General for Iraq Reconstruction is assessing transitioned projects to determine if they are likely to remain operational after transition from the United States Government to the Government of Iraq.

This report addresses our assessment of the Tallil Military Base (Camp Ur) near Nasiriyah, Iraq that was occupied by the Iraqi Armed Forces in June 2006. Camp Ur was constructed to garrison approximately 3,000 personnel, including one brigade. We conducted this project assessment in accordance with the Quality Standards for Inspections issued by the President's Council on Integrity and Efficiency. The assessment team included a professional engineer/inspector and an auditor/inspector.

**Project Assessment Objectives.** This report is being made to provide project information to interested parties to enable timely and appropriate action, when warranted. Our assessment objectives were to determine whether the facility is operating at the designated capacity, if the construction quality was adequate, and if it remains in good operating repair. To address these objectives, we reviewed contract documentation, met with responsible project officials, and visited the site on 31 January 2007. Construction started 23 April 2004 and concluded in November 2005. The contractor delivered Camp Ur to the United States Government on 29 January 2006. Warranty work commenced in January 2006 and was completed in June 2006. The United States Government transferred the base to the Government of Iraq on 24 June 2006. We did not determine if the base was accepted and recorded on the Minister of Finance's books.

The facility has been occupied and used for its intended purposes to garrison one brigade, a brigade headquarters company, brigade support troops, and a regional training center to support basic training for approximately 750 troops.

### **Conclusions.**

1. In general, the base is meeting its objectives to support the brigade and regional training center. Maintenance of the facilities is generally adequate with exceptions noted regarding the barracks and sidewalks.
2. The number of sinks and toilets installed in some bathrooms was not sufficient to handle the volume of activity for which the buildings were designed. This shortage, combined with workmanship deficiencies, inferior materials, insufficient maintenance, and abusive use caused significant deterioration to the enlisted and transient barracks that the Special Inspector General for Iraq Reconstruction inspected. Also, a large percentage of the window air conditioning units installed in the barracks were not operational.

3. The base's current power demands are adequately supplied by the primary power plant, eight backup generators, and three generators dedicated to powering perimeter security requirements. The generators appear to be adequately maintained by the Garrison Support Unit with the exception of one generator in the primary power plant. This inoperable generator has not been repaired in a timely manner and could impact the plant's ability to meet base power requirements this summer. The generator may also be covered by the manufacturer's warranty since it failed within one year.
4. Although the contractor made a number of repairs to sidewalks and storm drains that were poorly constructed or damaged by vehicle traffic, similar problems were evident during the Special Inspector General for Iraq Reconstruction's site visit.
5. The Garrison Support Unit appears to be providing adequate maintenance to the water treatment plants, the generators, the dining facilities, the laundry, the medical center, and the vehicle maintenance facility. Maintenance in the barracks bathrooms is inadequate, and few, if any repairs were made to broken items in the enlisted barracks that was inspected. Also, damage to sidewalks and storm drains has not been repaired.
6. Construction on four buildings was 85% complete when they were dismantled. At the time of this report, neither Multi-National Security Transition Command-Iraq nor Air Force Center for Environmental Excellence could account for why the buildings were dismantled and their ultimate disposition.

### **Recommendations.**

1. Although Multi-National Security Transition Command-Iraq should insure the barracks' bathrooms have the required compliment of commercial grade sinks, toilets, and showers, undertaking significant corrective action without insuring the facilities will be properly maintained would not be cost effective. Therefore, Multi-National Security Transition Command-Iraq should consider delaying corrective action until operations and maintenance demands are met. Multi-National Security Transition Command-Iraq should also determine if the broken air conditioners are warranty issues that should be repaired by the contractor.
2. Multi-National Security Transition Command-Iraq should review the sidewalk and storm drain condition and determine if it is still covered by the warranty. If the sidewalk damage is covered under the warranty, the contractor should be required to make the necessary repairs. If the warranty is void due to vehicle damage, Multi-National Security Transition Command-Iraq should either fund the repair or notify the Garrison Support Unit that they are responsible for repairing the damage.
3. Multi-National Security Transition Command-Iraq should notify the Government of Iraq and Iraqi Joint Headquarters that Garrison Support Unit maintenance on the barracks is inadequate and will significantly shorten the useful life unless immediate repairs are made and the occupants are trained on the proper use of the facilities and adequate oversight is maintained..
4. Multi-National Security Transition Command-Iraq, Air Force Center for Environmental Excellence, and the contractor, Weston, should assist the Garrison Support Unit to expedite delivery and installation of the turbocharger on the fourth generator in the base power plant.

5. Multi-National Security Transition Command-Iraq should account for the dismantled buildings and demonstrate that they were used on a higher priority project. Multi-National Security Transition Command-Iraq should also demonstrate that the building material costs were not charged to the United States government twice; first on the Tallil contract and second to an unadjusted subcontract at the receiving facility.

**Management Comments.** Multi-National Security Transition Command-Iraq coordinated the management comments for the affected agencies. Following are replies to each recommendation:

**Recommendation #1 Bathroom Facilities and Air Conditioners:** Multi-National Security Transition Command-Iraq and Air Force Center for Environmental Excellence note that the project design conformed to the United States Central Command's Contingency and Long Term Base Camp Facilities Standards and obtained required approvals. The facilities were constructed as planned, and provided to the Iraqis in satisfactory condition. However, the present condition of the bathroom facilities and air conditioners appear to be the result of inadequate user-level maintenance.

Multi-National Security Transition Command-Iraq continues to review the general requirements for bathroom and related plumbing fixtures, as well as air conditioning equipment, in the region to determine the optimal quality and design for future projects.

**Recommendation #2 Sidewalks and Storm Drains:** Even though the contractor replaced approximately 150 meters of damaged sidewalk, Multi-National Security Transition Command-Iraq acknowledges that many more meters of damaged sidewalk remain. This condition appears to be the result of inappropriate Iraqi vehicular traffic.

**Recommendation #3 Maintenance Responsibilities:** Multi-National Security Transition Command-Iraq is engaged in discussions with the Government of Iraq to establish clear lines of responsibility for maintaining and protecting facilities and equipment provided by Coalition Forces.

**Recommendation #4 Generator Turbocharger:** Multi-National Security Transition Command-Iraq is engaged in discussions with the Government of Iraq to establish clear lines of responsibility for maintaining and protecting facilities and equipment provided by Coalition Forces.

**Recommendation #5 Relocated Buildings:** The maintenance facility and warehouses were moved to the Iraqi Special Operation Forces compound near Baghdad International Airport as part of Task Order 208. Multi-National Security Transition Command-Iraq reallocated these resources to better conform to changes in mission and conditions at both Tallil and the Iraqi Special Operation Forces compound.

**Evaluation of Management Comments.** We reviewed the management comments and after further clarification with Multi-National Security Transition Command-Iraq officials we found them to be responsive to our recommendations. Following are the Special Inspector General for Iraq Reconstruction's evaluations of each comment:

**Recommendation #1 Bathroom Facilities and Air Conditioners:** During a follow-up meeting to clarify its response, Multi-National Security Transition Command-Iraq officials indicated that they will advise Air Force Center for Environmental Excellence to modify the Tallil contract to bring the requirements into compliance with the United States Central Command's Contingency and Long Term Base Camp Facilities Standards. With respect to the remaining recommendation, to delay corrective action until an

appropriate maintenance program is evident at Camp Ur, Multi-National Security Transition Command-Iraq's comments are responsive.

**Recommendation #2 Sidewalks:** Based on Multi-National Security Transition Command-Iraq's representation that the sidewalks were damaged by vehicle traffic, the Special Inspector General for Iraq Reconstruction suggests that Multi-National Security Transition Command-Iraq inform the Garrison Support Unit that they are responsible for all additional repairs.

**Recommendation #3 Maintenance Responsibilities:** During a follow-up meeting to clarify its response, Multi-National Security Transition Command-Iraq officials said they will notify the appropriate Government of Iraq organizations that the bathroom problems exist and require corrective action.

**Recommendation #4 Generator Turbocharger:** During a follow-up meeting to clarify its response, Multi-National Security Transition Command-Iraq officials noted that they will contact the Base Support Unit at Tallil and offer assistance to expedite the delivery of the turbocharger.

**Recommendation #5 Regarding Relocated Buildings:** Multi-National Security Transition Command-Iraq's reply is responsive to the Special Inspector General for Iraq Reconstruction's recommendation regarding the disposition of the building. During a follow-up meeting to clarify its response, Multi-National Security Transition Command-Iraq officials noted that Air Force Center for Environmental Excellence informed them that the contractor represented to them that the materials were not double charged to the United States Government.

# Table of Contents

---

<b>Synopsis</b>	i
<b>Introduction</b>	
Objective of the Project Assessments	1
Background	1
Site Assessment	2
<b>Conclusions</b>	9
<b>Recommendations</b>	10
<b>Management Comments</b>	11
<b>Evaluation of Management Comments</b>	11
<b>Appendixes</b>	
A. Scope and Methodology	13
B. Acronyms	14
C. Report Distribution	15
D. Assessment Team Members	17

# **Introduction**

---

## **Objective of the Project Assessments**

These project assessments are intended to provide information to interested parties in order to enable timely and appropriate action, when warranted. The Special Inspector General for Iraq Reconstruction (SIGIR) assessment objectives were to determine whether the facility was operating at the designated capacity, if the construction quality was adequate, and if it remained in good operating repair.

## **Background**

The Tallil Military Base, subsequently renamed by the Government of Iraq (GoI) as Camp Ur, was built over an existing facility that was neglected for over ten years and severely damaged from looting during and after the war.

Camp Ur was designed to garrison approximately 3,000 personnel, including one brigade. Construction included twenty-two barracks, thirty-two headquarters buildings, three dining facilities, seven warehouses, seven maintenance facilities and twenty-nine other support buildings such as a fire house, jail, mosque and other buildings. Utility construction included a waste water treatment plant, a water treatment plant, an electrical generation plant, a fire protection system, and perimeter security. The base grounds included four athletic fields, a parade ground, sidewalks, paved roads and street lighting. A regional training center and a firing range were located adjacent to the base to provide basic training for approximately 750 troops.

Base construction started on 23 April 2004 and completed on 29 January 2006. Camp Ur was officially transferred to the IA on 24 June 2006. Multi National Security Transition Command-Iraq (MNSTC-I) was the funding agency responsible for defining the general requirements for Camp Ur. Camp Ur was designed and built under Indefinite Delivery/Indefinite Quantity (IDIQ) contract# FA8903-04-D-8681 issued by AFCEE to Weston Solutions, Inc (Weston). AFCEE issued three task orders under the contract:

- Task Order # 24 dated 14 April 2004 to renovate, replace, and construct facilities for the new Iraqi Army. Requirements included civil site work, architectural work and special construction. The task order was initially valued at \$49.8 million and modified five times adding \$46.1 million, bringing the total value to \$95.9 million.
- Task Order # 126 dated 9 September 2004 added the consolidation of the generator facilities, construction of a perimeter fence, a vehicle search area, a guard area including guard houses and towers, a preventative maintenance plan and training manuals. The task order was initially valued at \$4.9 million and modified once adding \$7.5 million, bringing the total value to \$12.4 million.
- Task Order # 193 dated 30 September 2005 added facilities to the firing range, an electrical generating plant, a water treatment plant, a maintenance facility, a dining facility, a helipad, fuel for the generating plant and additional security and life support. The task order was initially valued at \$8.1 million and modified once adding \$3.1 million bringing the total value to \$11.2 million.

The total value of the combined task orders was \$119.5 distributed as follows:

Task Order	Total Contract Cost	Subcontract Costs	Prime Contractor	
			Estimated Cost	Fee
24	\$ 87,097,972	\$ 72,668,367	\$ 14,429,605	\$ 8,772,343
126	10,980,023	9,551,441	1,428,582	1,419,355
193	10,511,802	8,686,908	1,824,894	729,058
	<u>\$ 108,589,797</u>	<u>\$ 90,906,716</u>	<u>\$ 17,683,081</u>	<u>\$10,920,756</u>

Weston transferred the project to the U.S. Government (USG) with a Transfer and Acceptance of Military Real Property (DD Form 1325) signed on 29 January 2006. Camp Ur was officially transferred to the GoI local representative on 24 June 2006. Quality assurance was provided by Title II under contract to AFCEE. An onsite quality assurance representative performed daily inspections and submitted daily reports during the construction period.

## Site Assessment

The SIGIR team consisting of a professional engineer and an auditor visited Camp Ur on 31 January 2007.

SIGIR's inspection of the following facilities found them to be operational and in adequate repair:

• <b>HQ buildings</b>	• <b>Water treatment plant</b>
• <b>Dining facilities</b>	• <b>Medical center</b>
• <b>Laundry</b>	• <b>Jail</b>
• <b>Fire house</b>	• <b>Telecom center</b>
• <b>Vehicle maintenance center</b>	• <b>Mosque</b>

The SIGIR inspectors noted deficiencies at the following facilities:

### 1. Enlisted Barracks

Eighteen enlisted/transient barracks were built on the base. Each has a maximum capacity of 156 soldiers, 72 on the ground floor and 84 upstairs. The inspection found that leaks from the upstairs floor caused damage to floor tiles and ceiling damage to the ground floors. Also, fixtures, toilets, showers and sinks were damaged. The design provided for fewer sinks than required for the upstairs bathrooms. The inadequate design, combined with low quality fixtures and poor quality workmanship made the facilities too fragile for the volume of use they experienced. The problem was compounded by poor maintenance and abuse by the tenants.

The contract required one shower, sink and toilet for every ten soldiers. The ground floor design met the contract requirements; however, the contractor installed only five of the eight sinks required by the building design for the two barracks SIGIR inspected. The upstairs design provided for enough showers; however its provision for eight sinks and seven toilets to accommodate eighty-four soldiers was short by one sink and two toilets. Furthermore, the contractor installed only five sinks, which increased the shortage to four sinks. Although time limitations prevented the review of all barracks, their similarity in design and construction would indicate similar shortages exist in all enlisted and transient barracks.

The shortage problem was compounded by using plumbing and fixtures that are closer to household grade than commercial grade. The fixtures, supply lines and valves were flimsy and easily broken after being exposed to the volume of use. Floor tile was installed over a sand base and not adequately sealed. Water seeped through the joints causing tile breakage and damage to the ceiling on the ground level. These problems were also identified during the warranty period where seven of thirty-two work requests involved repairs to bathrooms. Also, during a February 2006 site inspection an AFCEE representative noted eighteen warranty items associated with bathroom floors and fixtures.

Inadequate maintenance and apparent abuse by the occupants further compounded the problem. Un-repaired water leaks damaged floors and ground floor ceilings. Broken fixtures left sinks, showers and toilets unusable. Abusive use such as standing on western toilet seats, slamming shower doors, and stuffing water bottles down toilet drains damaged plumbing and fixtures. These abuses were also noted in an AFCEE representative's site visit report dated 2 February 2006 which cited eighteen examples of soldier abuse to the bathrooms including drains filled with debris, discarded drain covers and cracked toilets. The report commented that the abuse started when the Iraqi soldiers occupied the facility. Site Photos 1 through 7 show the damage to the facilities SIGIR inspected.



**Site Photo 1. Example of bathroom sinks immediately after construction  
(From Weston photo log)**



**Site Photo 2. Bathroom floor and sinks at inspection**



**Site Photo 3. Example of a finished shower immediately after construction  
(From Weston photo log)**




**Site Photo 4. Dislodged shower floor pan at inspection**



**Site Photo 5. Ground floor ceiling water damage caused by leak and excess water from the bathroom above. The bed frame was apparently used to protect the person below in case the ceiling collapsed.**



**Site Photo 6. Closed toilet door frame with missing center panel**

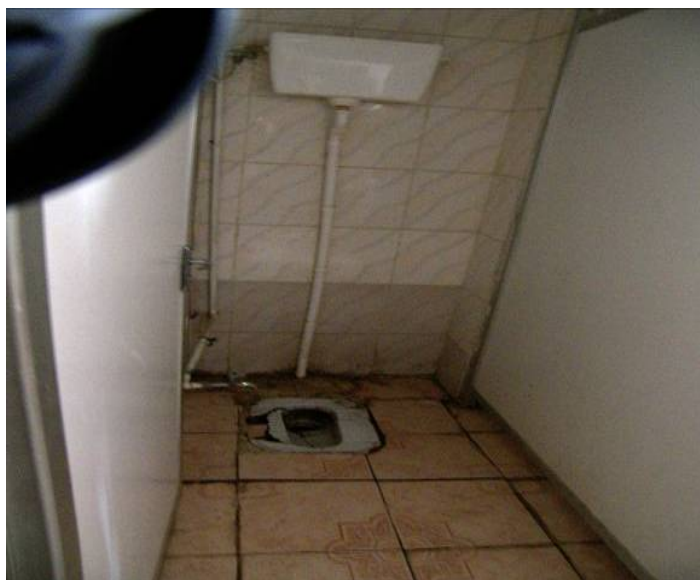

**Site Photo 7. Broken eastern toilet**

Although we noted minor damage to doors and some broken or missing door handles, the bedrooms, utility rooms, staircases, and hallways in the billeting areas were in reasonably adequate condition. Electrical wiring, panels, and lighting were intact and not tampered with. We could not test the electricity because the power was off. However, the billeting manager confirmed that the lights and electrical outlets were working.

The billeting manager said that eight of sixteen air conditioning units in building #670 were not operational. We could not determine if the units were not operating because of poor maintenance or warranty problems.

## **2. Electrical Power Generation**

The base's primary electrical generating plant was designed to house nine 1.5 Mega Watt (MW) generators to power base facilities. Although nine generators were originally installed, five were subsequently removed and taken to the Iraqi Special Operation Forces (ISOF) facility in Baghdad. MNSTC-I and AFCEE representatives informed SIGIR that Camp Ur's power requirements were reduced when a decision was made to locate the Regional Support Unit (RSU) at Basra rather than Camp Ur. Also, plans to provide supplemental power to Nasiriyah and an adjacent Iraqi Army (IA) camp were eliminated. The reduced power requirement at Camp Ur made the generators excess equipment and available to meet the power shortage at the ISOF facility. MNSTC-I and AFCEE provided pictures, site reports, and Statements of Work, supporting the movement of the five generators to ISOF. SIGIR did not physically observe the generators at ISOF due to scope limitations however our review of the supporting documentation provided reasonable support for the MNSTC-I and AFCEE representations.

Three of the four remaining generators were operational. The fourth had been waiting for a replacement turbocharger that was ordered in July 2006. The plant manager said that the three generators are sufficient to supply power to the base in the winter but higher demand for air conditioning will pose a problem during the summer. The fourth generator will be needed to supplement power during routine maintenance. The generators were not operating at the time of our inspection due to fuel shortages at the base. The plant manager said the generators operate from ten to

twelve hours per day beginning in late afternoon. Site Photo 8 shows the condition of the generators at the time of our inspection.



**Site Photo 8. Remaining base plant generators.**

### 3. Sidewalks and Ground Drainage

SIGIR's inspection disclosed a number of sidewalks and drain cleanout holes with un-repaired damage from inadequate workmanship and vehicle traffic. The sidewalks and cleanout holes were designed for pedestrian traffic. Quality issues existed at the time the base was delivered to the USG. An AFCEE warranty inspector visited the site on February 2 and 3, 2006 and noted that approximately 70% of the concrete work done on sidewalks was of poor quality and would need to be replaced.

Warranty requests provided by AFCEE show that repairs were made to sidewalks in the 100, 200, 600, 700 and 800 complex areas from May 25, 2006 to June 3, 2006. Our inspection showed that quality and damage issues still existed at the facility. Site photos # 9 and #10 show the sidewalks and drain cleanout holes at the time of our inspection.



**Site Photo 9. Broken drain cleanout hole**




**Site Photo 10. Drainage cleanout holes and standing water that should drain into the system**

#### 4. Operation and Maintenance

##### a. Base Support Units (BSU)

Since 2005, MNSTC-I has been working with the GoI Joint Headquarters (JHQ) to implement a base support maintenance program. The objectives of the program are to develop effective facility management organizations at all installations and to ensure all types of infrastructure are sustained by early 2008. The BSU organization structure includes five Regional Support Units (RSUs) and seventy-eight Garrison Support Units (GSU) for a total of eighty-three bases throughout Iraq. RSUs will accomplish GSU functions at their respective installation, support GSUs for work outside the GSU scope, and work with JHQ to establish service contracts. GSUs respond to local work requests, oversee service contracts and quality assurance programs, and provide labor to support unscheduled repairs and maintenance. The following chart illustrates the base support organization structure.

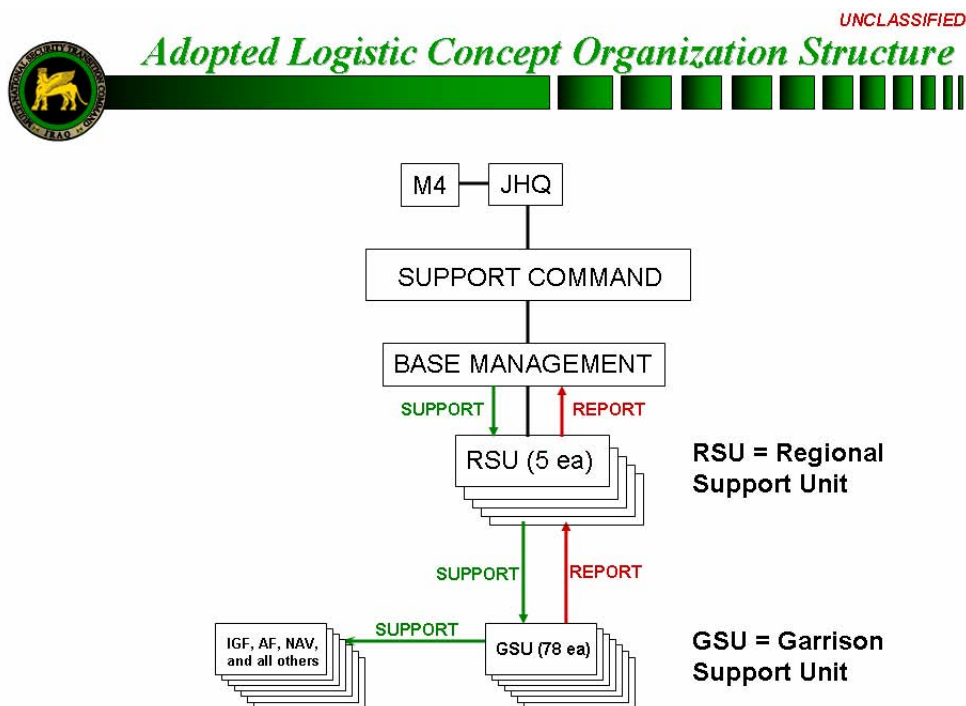

The third phase of the BSU plan is expected to end in early 2008 and will provide support for over nineteen maintenance categories shown below:

Base Support Unit Implement Phasing Plan				
		Implementation Phase		
		I	II	III
1	Electrical power generation			
2	Building or infrastructure			
3	Electrical distribution (exterior)			
4	Electrical distribution (Interior)			
6	Finishes (paint, flooring, tile, carpet, etc)			
7	HVAC			

8	Fire protection and detection			
9	Ice making			
10	Pavements, roads and surface areas			
11	POL			
12	Refrigeration			
13	Roof			
14	Sewage			
15	Signage			
16	Storm water			
17	Water distribution			
18	Water distribution (interior and plumbing)			
19	Waste water treatment			
20	Water treatment			

Most maintenance categories in phase I were funded by the GoI which used service contracts to meet requirements. Phase I started in April 2006 and ended December 2006. Phase II started in January 2007 and is expected to be completed by June 2007. Phase II will continue to use predominately GoI funded service contracts to meet requirements. Phase III will begin in June 2007 to add the remaining maintenance categories and to institutionalize the BSU structure by eliminating service contracts and replacing them with Iraqi civil servants or military personnel. The BSU program is expected to be fully operational by early 2008.

b. Maintenance is performed on three levels:

- Level 1 is recurring maintenance such as minor plumbing repairs, janitorial service, street cleaning, etc. This maintenance is performed by personnel assigned to the GSU.
- Level 2 is unforeseen repairs such as failures to sewer lines, water supply lines, electrical power, etc. Replacement parts are funded by the RSU and the labor to perform the work comes from the local GSU labor pool.
- Level 3 is urgent maintenance that affects the life and health of soldiers such as generator failure, fuel supply, etc. Replacement parts are funded by the RSU and the labor to perform the work comes from the local GSU labor pool.

The GoI, in conjunction with the JHQ, funded maintenance with an annual budget of \$480 million, plus approximately \$104 million in replacement parts and supplies to accomplish level 2 and 3 maintenance.

c. Operation and Maintenance Assessment

Representatives from the Australian Army Training Team (AATT) assigned to provide support to the IA Regional Training Center informed us that a GSU has been set up at Camp Ur. It provides Level 1 O&M on base facilities, including the buildings and facilities for dining, power generation, laundry, water treatment, and waste water treatment.

The GSU appears to be adequately maintaining the buildings with the exception of the barracks bathrooms. The water treatment plant, waste water treatment plant, generator plant, and vehicle maintenance facility are maintained under service contracts. These facilities were operational and adequately maintained.

## 5. Turnover Process

Weston delivered the completed buildings and facilities to the USG from 1 May 2005 to 29 January 2006. Deliveries were made at the completion of each task order. Warranty work commenced in January 2006 and was completed in June 2006. The USG transferred the base to the GoI local representative on 24 June 2006. SIGIR did not determine if the base was accepted and recorded on the Minister of Finance's books.

## 6. Dismantled Modular Buildings

The project required constructing three modular steel frame warehouses and a 20-bay modular steel frame maintenance facility. The construction work started in September 2005 and was stopped in November 2005 with approximately 85% of the effort completed. At the time of this report neither MNSTC-I nor AFCEE could provide the reason for dismantling the buildings nor could they identify their ultimate disposition. Based on the contractor's cost to complete reports, the total cost of the building construction and dismantling charged to the contract is summarized below:

Item	% Complete	Subcontract Price <sup>1</sup>	Total Paid to the Subcontractor <sup>1</sup>	Price Reduction
20 Bay Maintenance Bldg	85%	\$ 885,000	\$ 52,250	\$132,750
3 Warehouses	84%	\$921,000	\$773,640	\$147,360
Total Construction costs	85%	\$1,806,000	\$1,525,890	\$ 280,110
Dismantle Buildings	100%	\$4,800	\$4,800	\$0
Total	85%	\$1,810,800	\$1,530,690	\$280,110

<sup>1</sup> A cost element breakdown by labor, materials, etc. by the subcontractor was not available

Critical requirements elsewhere could justify disassembling buildings that were virtually complete; however, it is important that MNSTC-I provide the basis for the decision and demonstrate that they were reassembled at another location. It is also important to insure that the government did not pay for the building materials twice; first when purchased for the Tallil base and second, as a fixed price deliverable on a firm fixed price subcontract that was not adjusted for the materials furnished by the government.

## Conclusions

1. In general, the base is meeting its objectives to support the brigade and regional training center. Maintenance of the facilities is generally adequate with the exceptions noted regarding the barracks and sidewalks.
2. The number of sinks and toilets installed in some bathrooms was not sufficient to handle the volume of activity the buildings were designed for. This shortage, combined with workmanship deficiencies, inferior materials, insufficient maintenance, and abusive use caused significant deterioration to the enlisted and transient barracks that SIGIR inspected. Also, a large percentage of the window air conditioning units installed in the barracks were not operational.
3. The base's current power demands are adequately supplied by the primary power plant, eight backup generators, and three generators dedicated to powering perimeter

security requirements. Except for one generator in the primary power plant, the generators appear to be adequately maintained by the Garrison Support Unit with the exception of one generator in the primary power plant. The inoperable generator has not been repaired in a timely manner and could impact the plant's ability to meet base power requirements this summer. The generator may also be covered by the manufacturer's warranty since it failed within one year.

4. Although the contractor made a number of repairs to sidewalks and storm drains that were poorly constructed or damaged by vehicle traffic, similar problems were evident during SIGIR's site visit.
5. The GSU appears to be providing adequate maintenance to the water treatment plants, the generators, the dining facilities, the laundry, the medical center, and the vehicle maintenance facility. Maintenance in the barracks bathrooms is inadequate and few if any repairs were made to broken items in the enlisted barracks that were inspected. Also, damage to sidewalks and storm drains has not been repaired.
6. Construction on each of four buildings was 85% complete when they were dismantled. At the time of this report neither MNSTC-I nor AFCEE could account for why the buildings were dismantled and their ultimate disposition.

## **Recommendations**

1. Although MNSTC-I should insure the barracks' bathrooms have the required compliment of commercial grade sinks, toilets, and showers, undertaking significant corrective action without insuring the facilities will be properly maintained would not be cost effective. Therefore, MNSTC-I should consider delaying corrective action until Operations and Maintenance (O&M) demands are met. MNSTC-I should also determine if the broken air conditioners are warranty issues that should be repaired by the contractor.
2. MNSTC-I should review the sidewalk and storm drain conditions and determine if they are still covered by the warranty. If the sidewalk damage is covered under the warranty, the contractor should be required to make the necessary repairs. If the warranty is void due to vehicle damage, MNSTC-I should either fund the repair or notify the GSU that they are responsible for repairing the damage.
3. MNSTC-I should notify the GoI and JHQ that GSU maintenance on the barracks is inadequate and will significantly shorten the useful life unless immediate repairs are made and the occupants are trained on the proper use of the facilities and adequate oversight is maintained..
4. MNSTC-I, AFCEE, and Weston should assist the GSU to expedite delivery and installation of the turbocharger on the fourth generator in the base power plant.
5. MNSTC-I should account for the dismantled buildings and demonstrate that they were used on a higher priority project. MNSTC-I should also demonstrate that the building material costs were not charged to the U.S. Government twice, first on the Tallil contact and second to an unadjusted subcontract at the receiving facility.

## **Management Comments**

MNSTC-I coordinated the management comments for the affected agencies. Following are replies to each recommendation:

**Recommendation #1 Bathroom Facilities and Air Conditioners:** MNSTC-I and AFCEE note that the project design conformed to the USCENTCOM's Contingency and Long Term Base Camp Facilities Standards and obtained required approvals. The facilities were constructed as planned, and provided to the Iraqis in satisfactory condition. However, the present condition of the bathroom facilities and air conditioners appear to be the result of inadequate user-level maintenance.

MNSTC-I continues to review the general requirements for bathroom and related plumbing fixtures, as well as air conditioning equipment, in the region to determine the optimal quality and design for future projects.

**Recommendation #2 Sidewalks:** Even though the contractor replaced approximately 150 meters of damaged sidewalk, MNSTC-I acknowledges that many more meters of damaged sidewalk remain. This condition appears to be the result of inappropriate Iraqi vehicular traffic.

**Recommendation #3 Maintenance Responsibilities:** MNSTC-I is engaged in discussion with the Government of Iraq (GoI) to establish clear lines of responsibility for maintaining and protecting facilities and equipment provided by Coalition Forces.

**Recommendation #4 Generator Turbocharger: Regarding Maintenance Responsibilities (Turbocharger):** MNSTC-I is engaged in discussions with the GoI to establish clear lines of responsibility for maintaining and protecting facilities and equipment provided by Coalition Forces.

**Recommendation #5 Relocated Buildings:** The maintenance facility and warehouses were moved to the ISOF compound near BIAP as part of Task Order 208. MNSTC-I reallocated these resources to better conform with changes in mission and conditions at both Tallil and the ISOF compound.

## **Evaluation of Management Comments**

We reviewed the management comments and found them to be responsive to our recommendations. The following are SIGIR's evaluations of each comment:

**Recommendation #1 Bathroom Facilities and Air Conditioners:** During a follow-up meeting to clarify its response, MNSTC-I officials indicated that they will advise AFCEE to modify the Tallil contract to bring the requirements into compliance with the USCENTCOM's Contingency and Long Term Base Camp Facilities Standards. With respect to the remaining recommendation, to delay corrective action until an appropriate maintenance program is evident at Camp Ur, MNSTC-I's comments are responsive.

**Recommendation #2 Sidewalks:** Based on MNSTC-I's representation that the sidewalks were damaged by vehicle traffic, SIGIR suggests that MNSTC-I inform the Garrison Support Unit (GSU) that they are responsible for all additional repairs.

Recommendation #3 Maintenance Responsibilities: During a follow-up meeting to clarify its response, MNSTC-I officials said they will notify the appropriate GoI organizations that the bathroom problems exist and require corrective action.

Recommendation #4 Generator Turbocharger: During a follow-up meeting to clarify its response, MNSTC-I officials noted that they will contact the Base Support Unit at Tallil and offer assistance to expedite the delivery and installation of the turbocharger.

Recommendation #5 Regarding Relocated Buildings: MNSTC-I's reply is responsive to SIGIR's recommendation regarding the disposition of the building. During a follow-up meeting to clarify its response, MNSTC-I officials noted that AFCEE informed them that the contractor represented to them that the materials were not double charged to the U. S. Government.

## **Appendix A. Scope and Methodology**

---

SIGIR performed this project sustainment inspection in accordance with the Quality Standards for Inspections issued by the President's Council on Integrity and Efficiency. The assessment team included a professional engineer/inspector and an auditor/inspector.

In performing this Project Sustainment Inspection we:

- Reviewed contract documentation including the Contract, Contract Modifications, Contract documentation, and Statement of Work;
- Reviewed available turnover documents (e.g., Contractor transmittal documents, Spare Part List, etc.);
- Interviewed representatives from the Multi National Security Transition Command-Iraq (MNSTC-I), Air Force Center for Environmental Excellence (AFCEE), Australian Advisory Transition Team (AATT), and facilities managers at the Tallil Military Base (Camp Ur); and
- Conducted an on-site inspection at the Tallil Military Base (Camp Ur) on 31 January 2007.

## Appendix B. Acronyms

---

AATT	Australian Advisory Training Team
AFCEE	Air Force Center for Environmental Excellence
BSU	Base Support Unit
DFAC	Dining Facility
GoI	Government of Iraq
GSU	Garrison Support Unit
IA	Iraqi Army
IDIQ	Indefinite Delivery Indefinite Quantity
IRRF	Iraq Relief and Reconstruction Fund
ISOF	Iraqi Special Operation Forces
JHQ	Iraqi Joint Headquarters
MNSTC-I	Multi National Security Transition Command-Iraq
MoD	Iraqi Ministry of Defense
MW	Mega Watt
O&M	Operation and Maintenance
RSU	Regional Support Unit
PCO	Project and Contracting Office
SIGIR	Special Inspector General for Iraq Reconstruction
SOW	Statement of Work
TO	Task Order
USACE	United States Army Corps of Engineers
USG	United States Government

## **Appendix C. Report Distribution**

---

### **Department of State**

Secretary of State

Senior Advisor to the Secretary and Coordinator for Iraq

Director of U.S. Foreign Assistance/Administrator, U.S. Agency for  
International Development

Director, Office of Iraq Reconstruction

Assistant Secretary for Resource Management/Chief Financial Officer,  
Bureau of Resource Management

U.S. Ambassador to Iraq

Director, Iraq Reconstruction Management Office

Mission Director-Iraq, U.S. Agency for International Development

Inspector General, Department of State

### **Department of Defense**

Secretary of Defense

Deputy Secretary of Defense

Under Secretary of Defense (Comptroller)/Chief Financial Officer

Deputy Chief Financial Officer

Deputy Comptroller (Program/Budget)

Deputy Assistant Secretary of Defense-Middle East, Office of Policy/International  
Security Affairs

Inspector General, Department of Defense

Director, Defense Contract Audit Agency

Director, Defense Finance and Accounting Service

Director, Defense Contract Management Agency

### **Department of the Army**

Assistant Secretary of the Army for Acquisition, Logistics, and Technology

Principal Deputy to the Assistant Secretary of the Army for Acquisition,  
Logistics, and Technology

Deputy Assistant Secretary of the Army (Policy and Procurement)

Director, Project and Contracting Office

Commanding General, Joint Contracting Command-Iraq/Afghanistan

Assistant Secretary of the Army for Financial Management and Comptroller

Chief of Engineers and Commander, U.S. Army Corps of Engineers

Commanding General, Gulf Region Division

Chief Financial Officer, U.S. Army Corps of Engineers

Auditor General of the Army

### **U.S. Central Command**

Commanding General, Multi-National Force-Iraq

Commanding General, Multi-National Corps-Iraq

Commanding General, Multi-National Security Transition Command-Iraq

Commander, Joint Area Support Group-Central

## **Other Federal Government Organizations**

Director, Office of Management and Budget  
Comptroller General of the United States  
Inspector General, Department of the Treasury  
Inspector General, Department of Commerce  
Inspector General, Department of Health and Human Services  
Inspector General, U.S. Agency for International Development  
President, Overseas Private Investment Corporation  
President, U.S. Institute for Peace

## **Congressional Committees and Subcommittees, Chairman and Ranking Minority Member**

### **U.S. Senate**

Senate Committee on Appropriations  
    Subcommittee on Defense  
    Subcommittee on State, Foreign Operations and Related Programs  
Senate Committee on Armed Services  
Senate Committee on Foreign Relations  
    Subcommittee on International Operations and Organizations, Democracy and Human Rights  
    Subcommittee on International Development and Foreign Assistance, Economic Affairs and International Environmental Protection  
    Subcommittee on Near East and South and Central Asian Affairs  
Senate Committee on Homeland Security and Governmental Affairs  
    Subcommittee on Federal Financial Management, Government Information, Federal Services and International Security  
    Permanent Subcommittee on Investigations  
    Subcommittee on Oversight of Government Management, the Federal Workforce, and the District of Columbia

### **U.S. House of Representatives**

House Committee on Appropriations  
    Subcommittee on Defense  
    Subcommittee on State, Foreign Operations, and Related Programs  
House Committee on Armed Services  
House Committee on Oversight and Government Reform  
    Subcommittee on Government Management, Organization, and Procurement  
    Subcommittee on National Security and Foreign Affairs  
House Committee on Foreign Affairs  
    Subcommittee on Middle East and South Asia  
    Subcommittee on International Organizations, Human Rights, and Oversight

## **Appendix D. Project Assessment Team Members**

The Office of the Assistant Inspector General for Inspections, Office of the Special Inspector General for Iraq Reconstruction, prepared this report. The principal staff members who contributed to the report were:

Timothy Baum

Wesley Snowden. P.E.