



.

.

1

CROCOPY RESOLUTION TEST CHART NATIONAL BUREAU OF STANDARDS-1963-A

a ser avante est

DOT/FAA/CT-86/5

30

AD-A171

Halon Extinguisher Agent Behavior in a Ventilated Small Aircraft

Gerald R. Slusher Joseph Wright James Demaree

ï



June 1986

Final Report

This document is available to the U.S. public through the National Technical Information Service, Springfield, Virginia 22161.

86

8

22

151

one file copy



US Department of Transportation Federal Aviation Administration Technical Center Atlantic City Airport, N.J. 08405

DISTRIBUTION STATEMENT A Approved for public releases Distribution Unlimited

NOTICE

٢

This document is disseminated under the sponsorship of the Department of Transportation in the interest of information exchange. The United States Government assumes no liability for the contents or use thereof.

The United States Government does not endorse products or manufacturers. Trade or manufacturer's names appear herein solely because they are considered essential to the object of this report.

1. Report No.	2. Government Accession No.	3. Recipient's Catalog No.
	AD-A171 361	
DOT/FAA/CT-86/5 4. Title and Subtitle	17 9-11 11 28	5. Report Date
		June 1986
HALON EXTINGUISHER AGENT	BEHAVIOR IN A	6. Performing Organization Code
VENTILATED SMALL AIRCRAFT		
7. Author's)		8. Performing Organization Report No.
G. R. Slusher, J. Wright,	and J. E. Demaree	DOT/FAA/CT-86/5
9. Performing Organization Name and A	idress	10. Work Unit No (TRAIS)
Federal Aviation Administ	ration	
Technical Center		11. Contract or Grant No.
Atlantic City Airport, New	ø Jersey U84U5	
12. Sponsoring Agency Name and Addres	s	13. Type of Report and Period Covered
U.S. Department of Transp		Final
Federal Aviation Administ		March - July 1984
Technical Center		14. Sponsoring Agency Code
Atlantic City Airport, Net 15. Supplementary Notes	w Jersey 08405	
16. Abstract		
passenger Cessna Model 21 nical Center airflow faci discharged without fires Halon extinguishing agent dose calculations demonst	OC aircraft. The aircraft lity under simulated flight to determine the dissipatio s. Agent concentrations di rated that 2.5 pound Halon	301) were evaluated in a four was operated in the FAA's Ter- conditions. Extinguishers of n rate and toxicity levels of ssipated rapidly. Analysis 1211 and 3.0 pound Halon 130
passenger Cessna Model 21 nical Center airflow faci discharged without fires Halon extinguishing agent dose calculations demonst extinguishers were safe i pilot were a maximum of 6 31 percent of the limit f cabin ventilation result Distribution of extinguis When the extinguishers we four percent concentration	OC aircraft. The aircraft lity under simulated flight to determine the dissipatio s. Agent concentrations di rated that 2.5 pound Halon n the four-pasenger test ai O percent of the limit for or Halon 1301. Stratificat ed in safe conditions for t hing agents under the instr re discharged on either the n was measured on the side her gas stratification was	was operated in the FAA's Te conditions. Extinguishers of n rate and toxicity levels of ssipated rapidly. Analysis 1211 and 3.0 pound Halon 130 rcraft. Dose calculations fo Halon 1211, and maximum dose ion of the Halons together w
passenger Cessna Model 21 nical Center airflow faci discharged without fires Halon extinguishing agent dose calculations demonst extinguishers were safe i pilot were a maximum of 6 31 percent of the limit f cabin ventilation result Distribution of extinguis When the extinguishers we four percent concentration extinguishers. Extinguis	OC aircraft. The aircraft lity under simulated flight to determine the dissipatio s. Agent concentrations di rated that 2.5 pound Halon n the four-pasenger test ai O percent of the limit for or Halon 1301. Stratificat ed in safe conditions for t hing agents under the instr re discharged on either the n was measured on the side her gas stratification was 'r	was operated in the FAA's Ter conditions. Extinguishers on rate and toxicity levels of ssipated rapidly. Analysis 1211 and 3.0 pound Halon 130 rcraft. Dose calculations for Halon 1211, and maximum dose ion of the Halons together w he pilot. ument panel was investigated pilot's or the copilot's si opposite of the discharge of determined by measuring agen
passenger Cessna Model 21 nical Center airflow faci discharged without fires Halon extinguishing agent dose calculations demonst extinguishers were safe i pilot were a maximum of 6 31 percent of the limit f cabin ventilation result Distribution of extinguisa When the extinguishers we four percent concentration extinguishers. Extinguis levels on the cabin floor 17. Key Words General Aviation Extinguishers Halons Aircraft Fire	OC aircraft. The aircraft lity under simulated flight to determine the dissipatio s. Agent concentrations di rated that 2.5 pound Halon n the four-pasenger test ai O percent of the limit for or Halon 1301. Stratificat ed in safe conditions for t hing agents under the instr re discharged on either the n was measured on the side her gas stratification was 'r	was operated in the FAA's Ter- conditions. Extinguishers on rate and toxicity levels of ssipated rapidly. Analysis 1211 and 3.0 pound Halon 130 rcraft. Dose calculations for Halon 1211, and maximum dose ion of the Halons together whe pilot. ument panel was investigated pilot's or the copilot's si opposite of the discharge of determined by measuring agen
passenger Cessna Model 21 nical Center airflow faci discharged without fires Halon extinguishing agent dose calculations demonst extinguishers were safe i pilot were a maximum of 6 31 percent of the limit f cabin ventilation result Distribution of extinguisa When the extinguishers we four percent concentration extinguishers. Extinguis levels on the cabin floor 17. Key Words General Aviation Extinguishers Halons Aircraft	OC aircraft. The aircraft lity under simulated flight to determine the dissipatio s. Agent concentrations di rated that 2.5 pound Halon n the four-pasenger test ai O percent of the limit for or Halon 1301. Stratificat ed in safe conditions for t hing agents under the instr re discharged on either the n was measured on the side her gas stratification was 'r	was operated in the FAA's Ter- conditions. Extinguishers on rate and toxicity levels of ssipated rapidly. Analysis 1211 and 3.0 pound Halon 130 rcraft. Dose calculations for Halon 1211, and maximum dose ion of the Halons together w he pilot. ument panel was investigated pilot's or the copilot's si opposite of the discharge of determined by measuring agen Stolement is available to the U.S publ he National Technical Inform

• •

TABLE OF CONTENTS

EXECUTIVE SUMMARY	vii
INTRODUCTION	1
Purpose Background	1 1
DISCUSSION	1
Description of Facility Description of Aircraft Measurement of Extinguishing Agents Documented Fire Locations	1 2 2 2
TEST RESULTS	4
Discharge Under Instrument Panel Discharge to Fuel and Hydraulic Selector Valves Discharge to Copilot's Door Discharge to Rear Seat Back Discharge to Baggage Compartment Results Extinguisher Agent Distribution Under Instrument Panel Extinguisher Agent Stratification in Cabin	4 7 7 7 7 9 9
SUMMARY OF RESULTS	10
CONCLUSIONS	11
REFERENCES	11

APPENDIX

	Accesio	on For
	DTIC	
	Justific	Dunced 🔲
)	By Dist ib	ution /
• •	•	vailability Codes
	Dist	Avail and/or Special
	1 1	

Page

COPY

LIST OF ILLUSTRATIONS

1

1

1

٤

Figure		Page
1	General Aviation Airflow Facility Test Section - Cross Section	12
2	General Aviation Airflow Facility Test Section - Profile	12
3	Cessna 210C Airplane With Aviation Flow Facility Test Section	13
4	Instrument Panel - Cessna Model 210C Airplane	14
5	Halon 1301 Concentrations - 3-Pound Extinguisher Directed Under Instrument Panel - Copilot's Side - Overhead Vents Open	15
6	Halon 1301 Concentrations - 3-Pound Extinguisher Directed Under Instrument Panel - Copilot's Side - Overhead Vents Closed	16
7	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed Under Instrument Panel - Copilot's Side - Overhead Vents Open	17
8	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed Under Instrument Panel - Copilot's Side - Overhead Vents Closed	18
9	Halon 1301 Concentrations - 3-Pound Extinguisher Directed Under Instrument Panel - Pilot's Side - Overhead Vents Open	19
10	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Copilot's Door - Overhead Vents Closed	20
11	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed Under Instrument Panel - Pilot's Side - Overhead Vents Open	21
12	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed Under Instrument Panel - Pilot's Side - Overhead Vents Closed	22
13	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Fuel and Hydraulic Selector Valves - Overhead Vents Open	23
14	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Fuel and Hydraulic Selector Valves - Overhead Vents Closed	24

LIST OF ILLUSTRATIONS (Continued)

Figure		Page
15	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Fuel and Hydraulic Selector Valves - Overhead Vents Open	25
16	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Fuel and Hydraulic Selector Valves - Overhead Vents Closed	26
17	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Copilot's Door - Overhead Vents Open	27
18	Halon 1301 Concentrations - 3-Pound Extinguisher Directed Under Instrument Panel - Pilot's Side - Overhead Vents Closed	28
19	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Copilot's Door - Overhead Vents Open	29
20	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Copilot's Door - Overhead Vents Closed	30
21	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Rear Seat - Overhead Vents Open	31
22	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Rear Seat - Overhead Vents Closed	32
23	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Rear Seat - Overhead Vents Open	33
24	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Rear Seat - Overhead Vents Closed	34
25	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Baggage Compartment - Overhead Vents Open	35
26	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Baggage Compartment - Overhead Vents Closed	36
27	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Baggage Compartment - Overhead Vents Open	37
28	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Baggage Compartment - Overhead Vents Closed	38
29	Halon 1301 Concentrations - 3-Pound Extinguisher Directed Under the Instrument Panel - Copilot's Side - All Sample Lines Under Instrument Panel	39

ľ

LIST OF ILLUSTRATIONS (Continued)

Figure		Page
30	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed Under the Instrument Panel - Copilot's Side - All Sample Lines Under Instrument Panel	40
31	Halon 1301 Concentrations - 3-Pound Extinguisher Directed Under the Instrument Panel ~ Pilot's Side ~ All Sample Lines Under the Instrument Panel	41
32	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed Under the Instrument Panel - Pilot's Side - All Sample Lines Under the Instrument Panel	42
33	Halon 1301 Concentrations - 3-Pound Extinguisher Directed to the Fuel and Hydraulic Selector Valves - All Sample Lines Located on the Floor	43
34	Halon 1211 Concentrations - 2.5-Pound Extinguisher Directed to the Fuel and Hydraulic Selector Valves - All Sample Lines Located on the Floor	44
35	Stratification of Halon Extinguishing Agents	45

•

LIST OF TABLES

Table		Page
1	Cabin Fire Statistics	3
2	Data Summary	5
3	Ventilation Results	8
4	Extinguisher Gas Distribution	9
5	Extinguisher Gas Stratification	10

....

EXECUTIVE SUMMARY

Testing of Halon 1211 and Halon 1301 hand fire extinguishers was conducted in a Cessna Model 210C airplane mounted in an airflow facility. The facility was operated at an airspeed of 120 miles per hour for evaluation of extinguisher performance.

Extinguishers were discharged to determine the dissipation rate and toxicity levels of Halon extinguishing agents. These tests were conducted without fire, and involved the continuous sampling of neat Halon 1211 and Halon 1301 agents from three locations. Agent concentration was measured at the pilot's nose height, at pilotcopilot belt level, and at locations in proximity to discharge of the extinguisher. Discharge and associated testing were conducted remotely and observed and recorded by video systems.

Available general aviation fire related accidents statistics show that 87 percent of cabin fires are electric in origin. This problem is, for the most part, located under the instrument panel and was addressed by conducting eight extinguisher discharge tests in this area. A total of 28 tests was completed with the primary variables being agent discharge location and ventilation conditions. Extinguishers were discharged under the instrument panel, and at the fuel and hydraulic selector valves, copilot's seat, rear passenger's seat, and baggage compartment. Ventilation was varied by adjusting the overhead ports.

Ventilation airflow into the cabin was higher than previously thought possible. Time for a cabin air change at an airspeed of 120 miles per hour was 1.2 minutes, and at 140 miles per hour was 1 minute (reference 1.)

The significant result from this investigation was that 2.5-pound Halon 1211 and 3pound Halon 1301 extinguishers were safe for use in aircraft comparable to Cessna Model 210C. Dose calculation for the pilot's nose height was only 60 percent of the recommended maximum for Halon 1211 and 31 percent of the limit dose for Halon 1301. Cabin ventilation airflow, together with agent stratification, produced safe conditions throughout the cabin study.

Distribution and stratification of extinguishing agents were investigated. When extinguishers were discharged under the instrument panel, pilot or copilot's side, 4 percent agent was measured on the opposite side. Extinguisher gases were measured on the cabin floor and the measured concentrations were in excess of 11 percent.

vii

INTRODUCTION

PURPOSE.

The purpose of this report was to investigate Halon 1211 and Halon 1301 hand fire extinguishers for use in nonpressurized general aviation aircraft.

BACKGROUND.

This effort was undertaken to evaluate and compare hand fire extinguishers of Halon 1211 (reference 1) with Halon 1301 in a Cessna Model 210C aircraft. Further testing was designed to be more realistic by the utilization of four mannequins or test dummies for the passenger seating arrangement, and baggage was placed in the baggage compartment. Hand fire extinguishers for general aviation aircraft are not required by the Federal Aviation Administration (FAA). As noted in reference 1, aircraft owners are requesting installation of fire extinguishers by the manufacturers or are installing extinguishers of their selection. The Underwriters Laboratory specifies that a 2.5-pound Halon 1211 fire extinguisher should not be used in enclosure volumes less than 312 cubic feet. It was further demonstrated in reference 1 that only large twin engine aircraft have cabin volumes equal to or exceeding this limit. However, the test results of reference 1 showed that cabin ventilation was greater than previously thought and together with stratification of the Halon 1211 agents resulted in safe conditions at the pilot's nose. The molecular weight of air is 28.97, the molecular weight of Halon 1211 is 165.38, and that of Halon 1301 is 148.93. The molecular weight of Halon divided by the molecular weight of air shows Halon 1211 and Halon 1301 to be 5.7 and 5.1 times heavier than air, respectively. As defined by reference 2, the two Halon extinguisher agents evaluated are:

- 1. Halon 1211, Bromochlorodifluoromethane.
- 2. Halon 1301, Bromotrifluoromethane.

Extinguisher size selection should consider the volume and ventilation air change time of the compartment in which the extinguisher is to be used as advised in reference 3. Maximum recommended dose was also defined as extinguisher discharge that will not produce Halon 1211 concentrations greater than 4 percent for 1 minute, 2 percent for 2 minutes, or 1 percent for 4 minutes. For Halon 1301, maximum recommended dose was defined as exposure to concentrations up to 10 percent for 1 minute, 5 percent for 2 minutes, or 2.5 percent for 4 minutes.

DISCUSSION

DESCRIPTION OF FACILITY.

A 10-foot diameter by 24-foot-long airflow facility was designed and constructed from flat 4-foot by 8-foot sheets of low carbon steel. The cross section, figure 1, is octagonal in shape. The entrance is a bellmouth design with a 5-foot radius. This extension is attached to an existing 5-foot diameter airflow facility, figures 2 and 3. Performance of the 5-foot facility is near Mach 1 airspeed. Two J57 turbo jet engines provide power to drive the facility by ejector action. The 10-foot diameter extension was designed for a minimum airspeed of 100 knots. Measurements with a Cessna 210C aircraft installed has indicated that airspeeds of 140 to 150 miles per hour (120 to 130 knots) are achievable. The increase over design performance is attributed to the propeller supercharging action, the increased local airspeeds resulting from decrease in tunnel cross-section area from the installed Cessna 210 aircraft, and improved contour development of the wind tunnel walls.

DESCRIPTION OF AIRCRAFT.

The test article is a 1963 model Cessna 210C with retractable landing gear (figures 2 and 3). The airplane is a four-place high-wing monoplane, powered by a single six-cylinder, horizontally-opposed fuel injection Continental IO470 engine. For installation in the facility, mounts were designed, fabricated, and installed at the wing spar attachment points and at the wing strut attachment points. The fuselage was installed in the tunnel with 3/4-inch high carbon steel rods connected to the mounts and to the tunnel walls. The wings were cut at the 32-inch section and then were installed on the fuselage in the tunnel. The sections were installed to provide the cabin ventilation air inlet ports located in the wings. It was necessary to move the ports inboard for inclusion in the 32-inch wing root sections.

MEASUREMENT OF EXTINGUISHING AGENTS.

An environmentally controlled trailer was utilized for measurement of fire extinguishing agents of primary interest. Halon 1211 or Halon 1301 was measured at three cabin locations with three Beckman model 865 gas analyzers. The analyzer detector, purchased from Beckman Instruments Company, was changed to detect the agent being tested. In addition, an optical filter was added to eliminate sensitivity to water vapor. Calibration gases of Halon 1211 and 1301 concentrations were used at 3.0, 6.0, and 8.0 percent. Calibrations were checked before and after each test. Ancillary components utilized were sample pumps, sample transport tubing, and sample flow controls. The signals were recorded by a computer. The measurements were plotted against time in seconds.

DOCUMENTED FIRE LOCATIONS.

Table 1 was excerpted from reference 1. The information is from the FAA Service Difficulty Reports. The table shows that 86.7 percent of cabin fires in general aviation aircraft are electric or electronic in origin.

Year	Incidents No.	Smoking Materials No. (%)	Electrical Origin No. (%)	Hand-Held-Use No. (%)
1976	15		14 (93.3)	
1977	10	1 (10.0)	9 (90.0)	
1978	8	1 (12.5)	7 (87.5)	
1979	23	3 (13.0)	21 (91.3)	
1980	19		16 (78.9)	
1981	8		7 (87.5)	
TOTAL	83	5 (6.0)	72 (86.7)	NONE RECORDED

TABLE 1. CABIN FIRE STATISTICS

(Involving Smoking Materials, Electrical Origin, Hand Held Extinguishers)

The electrical and electronic components are primarily located in and under the instrument panel. The instrument panel for the test aircraft (Cessna 210) is shown in figure 4. Identification of the equipment is also listed. Electrical power for the aircraft is supplied by a 12-volt direct current, negative ground electrical system. A single 12-volt battery supplies power for starting and provides reserve power in the event of a generator or alternator failure. On the extreme left side of the instrument panel, one item that could be involved in a fire is the master switch. Operation of the switch connects the battery solenoid coil and the generator field coil to ground, thereby, activating the power system.

The ignition start switch is utilized to check the magnetos and is also used to engage the starter solenoid. The auxiliary fuel pump switch operates two electric fuel pumps connected in series and located in the nose-gear well. Additional electric units located in the left-hand side of the instrument panel include a number of circuit breakers, a pitot heater switch, navigation light rheostats, oil dilution switch, rotating beacon swith, landing light switch, gear down indicator light, instrument and radio light rheostats. Electronic components are installed in the center panel between the pilot's and copilot's location.

A stack of three radios and/or radio direction finder equipment is located in this area. Under the radio is a nav-o-matic control auto pilot.

Electrical units on the right or copilot's side of the instrument panel are (1) a transponder control located on extreme right; (2) and ammeter; and (3) additional electrical units including cylinder head temperature gauge, oil temperature gauge, and cigar/cigarette lighter. In combination with these potential electric ignition sources are the fuel, oil, and hydraulic selector and sensor lines brought to the instrument panel for indication of flow and pressure. Additionally fuel flows through the cabin from the overhead wing tanks to the tank selector valves located between the pilot and copilot.

TEST RESULTS

Testing of hand fire extinguishers was conducted remotely and observed and recorded by video systems. All testing was conducted at an airspeed of 120 miles per hour (mph), as this condition was obtained with the tunnel drive engines and the Cessna 210 piston engine operating at cruise power. Testing was accomplished under two conditions of cabin ventilation. The overhead vents were opened to give ventilation air of 122 cubic feet per minute. This results in cabin air change time of appproximately 1 minute, as described in reference 1. The second condition was with the overhead vents closed. Copious ventilation is still present with the vents closed because of air leakage.

DISCHARGE UNDER THE INSTRUMENT PANEL.

Table 1 shows that 86.7 percent of cabin fires in general aviation aircraft are electrical in origin. This fire problem is for the most part located under the instrument panel. This area was addressed by eight extinguisher tests under the instrument panel. Two Halon 1301 and two Halon 1211 extinguishers were discharged under the instrument panel on the copilot's side and identical extinguishers were discharged uder the instrument panel on the pilot's side. One test with each agent was with air ventilation resulting from open overhead vents, and one test with each extinguisher was with the overhead vents closed.

The gas measurements for the tests conducted with extinguishers discharged under the instrument panel were plotted against time in seconds and are presented in figures 5 through 12, and certain selected values were tabulated in table 2.

Points from continuous data were selected by the computer and plotted at intervals of 1 second. Peak Halon 1301 concentrations behind the instrument panel ranged from 9.1 percent to 10.8 percent, and Halon 1211 concentrations varied from 8.1 percent to 11.0 percent. Halon 1301 concentrations at the pilot's nose height ranged from 1.5 percent to 5.2 percent, and Halon 1211 varied from 3.0 percent to 4.4 percent. Halon gas measurements were also recorded between the pilot and copilot at belt level. These data were obtained to answer the question as to what problems would occur if the pilot should bend over to check or adjust aircraft controls or check for fire extinguishment. Dose was calculated in accordance with references 3 and 4. The perfect stirrer theory predicts an expotential decay of extinguisher gases as time proceeds. From the maximum concentration at the starting point, the concentration will decay to 37 percent of the maximum after one air change, and to 5 percent of the maximum after three air changes. Examination of the Halon concentrations versus time measurements in this report demonstrate that the discrete data decayed in an exponential relationship. In addition, there was an initial rise time and in many instances after the rise, concentrations remained relatively constant for up to 10 seconds prior to exponential decay. This was due to the 10- to 14-second time internal for complete discharge of bottle content. These excursions were calculated separately and then added to the dose calculations.

Dose limits for the pilot was 4 percent extinguisher agent concentration over only 1 minute for the Halon 1211, and 10 percent for 1-minute Halon 1301 (reference 4).

TABLE 1. CABIN FIRE STATIS	STICS
----------------------------	-------

(Involving Smoking Materials, Electrical Origin, Hand Held Extinguishers)

Year	Incidents No.	Smoking Materials No. (%)	Electrical Origin No. (%)	Hand-Held-Use No. (%)
1976	15		14 (93.3)	
1977	10	1 (10.0)	9 (90.0)	
1978	8	1 (12.5)	7 (87.5)	
1979	23	3 (13.0)	21 (91.3)	
1980	19		16 (78.9)	
1981	8		7 (87.5)	
TOTAL	83	5 (6.0)	72 (86.7)	NONE RECORDED

The electrical and electronic components are primarily located in and under the instrument panel. The instrument panel for the test aircraft (Cessna 210) is shown in figure 4. Identification of the equipment is also listed. Electrical power for the aircraft is supplied by a 12-volt direct current, negative ground electrical system. A single 12-volt battery supplies power for starting and provides reserve power in the event of a generator or alternator failure. On the extreme left side of the instrument panel, one item that could be involved in a fire is the master switch. Operation of the switch connects the battery solenoid coil and the generator field coil to ground, thereby, activating the power system.

The ignition start switch is utilized to check the magnetos and is also used to engage the starter solenoid. The auxiliary fuel pump switch operates two electric fuel pumps connected in series and located in the nose-gear well. Additional electric units located in the left-hand side of the instrument panel include a number of circuit breakers, a pitot heater switch, navigation light rheostats, oil dilution switch, rotating beacon swith, landing light switch, gear down indicator light, instrument and radio light rheostats. Electronic components are installed in the center panel between the pilot's and copilot's location.

A stack of three radios and/or radio direction finder equipment is located in this area. Under the radio is a nav-o-matic control auto pilot.

Electrical units on the right or copilot's side of the instrument panel are (1) a transponder control located on extreme right; (2) and ammeter; and (3) additional electrical units including cylinder head temperature gauge, oil temperature gauge, and cigar/cigarette lighter. In combination with these potential electric ignition sources are the fuel, oil, and hydraulic selector and sensor lines brought to the instrument panel for indication of flow and pressure. Additionally fuel flows through the cabin from the overhead wing tanks to the tank selector valves located between the pilot and copilot.

TEST RESULTS

Testing of hand fire extinguishers was conducted remotely and observed and recorded by video systems. All testing was conducted at an airspeed of 120 miles per hour (mph), as this condition was obtained with the tunnel drive engines and the Cessna 210 piston engine operating at cruise power. Testing was accomplished under two conditions of cabin ventilation. The overhead vents were opened to give ventilation air of 122 cubic feet per minute. This results in cabin air change time of appproximately 1 minute, as described in reference 1. The second condition was with the overhead vents closed. Copieus ventilation is still present with the vents closed because of air leakage.

DISCHARGE UNDER THE INSTRUMENT PANEL.

Table 1 shows that 86.7 percent of cabin fires in general aviation aircraft are electrical in origin. This fire problem is for the most part located under the instrument panel. This area was addressed by eight extinguisher tests under the instrument panel. Two Halon 1301 and two Halon 1211 extinguishers were discharged under the instrument panel on the copilot's side and identical extinguishers were discharged uder the instrument panel on the pilot's side. One test with each agent was with air ventilation resulting from open overhead vents, and one test with each extinguisher was with the overhead vents closed.

The gas measurements for the tests conducted with extinguishers discharged under the instrument panel were plotted against time in seconds and are presented in figures 5 through 12, and certain selected values were tabulated in table 2.

Points from continuous data were selected by the computer and plotted at intervals of 1 second. Peak Halon 1301 concentrations behind the instrument panel ranged from 9.1 percent to 10.8 percent, and Halon 1211 concentrations varied from 8.1 percent to 11.0 percent. Halon 1301 concentrations at the pilot's nose height ranged from 1.5 percent to 5.2 percent, and Halon 1211 varied from 3.0 percent to 4.4 percent. Halon gas measurements were also recorded between the pilot and copilot at belt level. These data were obtained to answer the question as to what problems would occur if the pilot should bend over to check or adjust aircraft controls or check for fire extinguishment. Dose was calculated in accordance with references 3 and 4. The perfect stirrer theory predicts an expotential decay of extinguisher gases as time proceeds. From the maximum concentration at the starting point, the concentration will decay to 37 percent of the maximum after one air change, and to 5 percent of the maximum after three air changes. Examination of the Halon concentrations versus time measurements in this report demonstrate that the discrete data decayed in an exponential relationship. In addition, there was an initial rise time and in many instances after the rise, concentrations remained relatively constant for up to 10 seconds prior to exponential decay. This was due to the 10- to 14-second time internal for complete discharge of bottle content. These excursions were calculated separately and then added to the dose calculations.

Dose limits for the pilot was 4 percent extinguisher agent concentration over only 1 minute for the Halon 1211, and 10 percent for 1-minute Halon 1301 (reference 4).

TABLE 2. DATA SUMMARY

Figure No.	Test Location	Agent Type	Agent Disch W Lbs	Agent Disch Time Sec	Ventil Vents Open	ation Vents Closed	Max Conc Test Location	Max Conc Pilot's Belt Level
5	Under Instru Panel Copilot	1301	3.1	11	x		9.4	
6	Under Instru Panel Copilot	1301	3.0	-		X	10.8	4.5
7	Under Instru Panel Copilot	1211	2.5	11	x		11.0+	8.9
8	Under Instru Panel Copilot	1211	2.3	-		X	11.0+	10.5
9	Under Instru Panel Pilot	1301	3.2	14	x		9.1	9.1
10	Under Instru Panel Pilot	1301	3.1	13		X	9.3	9.7
11	Under Instru Panel Pilot	1211	2.9	12	X		8.1	8.0
12	Under Instru Panel Pilot	1211	2.8	11		X	10.5	8.0
13	Fuel & Hyd Selec Valv	1301	3.2	13	X		8.8	10.8
14	Fuel & Hyd Selec Valv	1301	3.2	13		X	11+	9.9
15	Fuel & Hyd Selec Valv	1211	2.9	12	X		9.2	6.6
16	Fuel & Hyd Selec Valv	1211	3.3	-		X	7.9	6.8
17	Copilot Dr Undr Arm Rest	1301	3.2	-	X		10.8	7.0
18	Copilot Door Undr Arm Rest	1301	3.2	-		X .	9.0	9.1
19	Copilot Door Undr Arm Rest	1211	2.7	11	X		7.7	7.1
20	Copilot Door Undr Arm Rest	1211	3.0	13		х	7.6	5.2
21	Rear Seat Back Center	1301	3.2	15	X		11+	4.7
22	Rear Seat Back Center	1301	3.2	15		X	10.8	7.4
23	Rear Seat Rear Center	1211	2.7	10	X	-	6.4	2.6
24 25	Rear Seat Back Center	1211	2.8	11	17	X	6.9	-
	Bagg Compr	1301	3.2	15	X		11+	3.6
26	Bagg Compr	1301	3.1	16		X	10.50	5.5
27	Bagg Compr	1211	2.8	-	X		9.3	2.0
28	Bagg Compr	1211	2.9	-		X	9.8	4.2

-

Figure <u>No.</u>	Max Conc Pilot <u>Nose</u>	Dose Pilot Belt	Dose Pilot Nose	Air Temp F	Max Delta <u>[°]F</u>	Rel Humíty X	Test No.
5	3.4	-	1.60	70.9	5	10	1
6	1.5	5.65	1.41	92.1	8		45
7	4.4	3.54	1.63	77.4	66.8	~	48
8	3.0	5.95	1.79	84.5	76.0	-	47
9	5.2	3.08	2.32	63.7	14.9	70	11
10	4.1	6.68	2.53	78.1	8.9	70	12
11	3.4	5.00	2.0	79.9	45.4	70	15
12	3.3	5.53	2.02	80.3	63.0	70	14
13	5.4	5.82	2.69	68.5	41.2	18	8
14	5.9	6.53	3.10	86.0	75.7	25	9
15	3.2	4.88	1.72	69.2	26.3	15	6
16	4.0	5.78	2.56	75.9	54.5	15	7
17	3.4	3.27	1.65	84.5	28.4	-	19
18	2.4	6.44	1.72	84.4	8.0	-	18
19	1.8	2.62	0.77	73.6	5.5	-	16
20	1.5	3.70	0.66	80.3	79.0	-	17
21	3.5	1.68	1.35	99.8	84.2	-	20
22	4.3	4.60	2.26	85.6	83.2	-	21
23	2.0	0.88	0.62	91.3	13.0	-	23
24	2.7	-	1.33	101.1	29.0	-	22
25	3.3	1.65	1.54	73.1	25.0	25	27
26	2.5	4.93	1.48	68.0	12.3	30	26
27	1.1	0.76	0.34	66.8	15.7	-	24
28	1.6	2.20	0.64	75.9	23.1	26	25

TABLE 2. DATA SUMMARY (Continued)

The maximum dose calculated from the test results for Halon 1211 was only 50 percent of the limit, and the maximum dose for Halon 1301 was 25 percent of the limit at the pilot's nose. The pilot could bend over the 11 seconds without exceeding the limit dose when discharging Halon 1211 extinguishers of 2.5-pound capacity, and may bend over for an unlimited time period for discharge of Halon 1301 of 3-pound capacity.

DISCHARGE TO FUEL AND HYDRAULIC SELECTOR VALUES.

The extinguishers were directed to the fuel and hydraulic selector valves located on a console raised approximately 6 inches from floor between the pilot and copilot. Two 2.5-pound Halon 1211 extinguishers and two 3.0-pound Halon 1301 extinguishers were tested with identical ventilation conditions as previously described. The gas measurements are plotted in figures 13 through 16 and selected data are tabulated in table 2. Dose calculated for the pilot's nose was 1.72 and 2.56 percent minutes and is up to 64 percent of the limit for Halon 1211 and 2.69 and 3.10 for Halon 1301 which is 31 percent of the limit dose. Maximum dose at the pilot's and copilot's belt level was 4.88 and 5.78 percent minutes for Halon 1211 and 5.82 and 6.53 of Halon 1301. The pilot could bend over the 10 seconds without exceeding the limit dose when discharging Halon 1211 and could bend over indefinitely after discharging Halon 1301.

DISCHARGE TO COPILOT'S DOOR.

Two Halon 1211 and two Halon 1301 extinguishers were discharged to the copilot's door at a point below the arm rest. Figures 17 through 20 show the agent concentrations plotted against time. As the discharge location was moved in relation to the pilot, dose calculations are less. The dose for the pilot was only 19 percent of the limit for Halon 1211, and 17 percent of the limit for Halon 1301.

DISCHARGE TO REAR SEAT BACK.

Two Halon 1211 and two Halon 1301 bottles were discharged to the center of the rear seat back. The measurements plotted versus time are in figures 21 through 24 and values are tabulated in table 2. Dose calculations for the pilot's nose was only up to 33 percent of the limit for Halon 1211 and up to 23 percent of the limit for Halon 1301. Dose for the pilot's belt level was also low and was below the limit dose for both agents.

DISCHARGE TO BAGGAGE COMPARTMENT.

Extinguishers were directed to the center section of the baggage compartment. Tests of both Halon 1211 and Halon 1301 extinguishers were completed. The measurements are plotted in figures 25 through 28 and selected values are tabulated in table 2. The dose calculations for the pilot's nose was only 16 percent of the limit for Halon 1211, and only up to 15 percent of the limit for Halon 1301. Dose for the pilot's belt level was also low and was below the limit dose for both agents.

RESULTS.

Summaries of neat Halon extinguisher tests are contained in table 2. Relevant information includes the figure number and test location and type of Halon extinguisher. Agent discharge time were determined was possible from video records. Ventilation conditions during the tests of overhead vents open or closed are described.

The maximum concentrations of neat extinguisher gases are listed for the three sample locations; pilot's nose, pilot-copilot belt level, and in proximity to extinguisher discharge. Dose calculations are tabulated for the pilot's belt level and for the pilot's nose. The cabin air temperature and the maximum reduction in air temperature in proximity to extinguisher discharge are listed. Finally, the relative humidity and the test number are included. The weight of agent discharged averaged 2.8 pounds for Halon 1211 and weight of Halon 1301 agent discharged averaged 3.16 pounds. Discharge time was 11.38 seconds and 13.89 seconds for Halon 1211 and Halon 1301 extinguishers, respectively.

The effect of cabin ventilation conditions with overhead vents open and vents closed are listed for dose calculations for both extinguishers in table 3. Dose was increased significantly with the vents closed. At the pilot-copilot belt level location, dose increased 57 to 87 percent with the vents closed compared with the vents opened. While at the pilots nose, dose increased 12 to 27 percent under similar conditions. When maximum concentrations were compared, only minimal increases were measured with the vents closed. Since the dose calculations are based on the area under the concentration curves, it was concluded that dissipation or decay occured over longer time periods when the vents were closed. The concentrations of Halon 1301 were increased somewhat over Halon 1211, and reflected the increased agent charge weight of 3 pounds as compared to 2.5 pounds.

TABLE 3. VENTILATION RESULTS

Sample Location	Ventilation Open Closed	Sample Size	Mean Dose Percent Increase
Pilot-Copilot Belt Level			
Halon 1211	x	6	-
Halon 1211	x	6	57
Halon 1301	x	5	-
Halon 1301	x	6	87
Pilot's Nose Height			
Halon 1211	x	6	-
Halon 1211	x	6	27
Halon 1301	x	6	-
Halon 1301	x	6	12

EXTINGUISHER AGENT DISTRIBUTION UNDER INSTRUMENT PANEL.

An investigation was conducted to determine the distribution of extinguisher agents under the instrument panel. The gas sample lines were arranged to sample near the top of the instrument panel (pilot's side), near the top of the instrument panel (copilot's side), and at the very low center section under the stack of radios and direction finding electronics. The measurements are plotted versus time, figures 29 through 32, and selected values are listed in table 4. One Halon 1211 extinguisher and one 1301 extinguisher were discharged under the instrument panel on the copilot's side and identical testing was completed by discharging the extinguishers under the instrument panel pilot's side. High levels of agent (10 to 11 percent) were measured under the instrument panel on the side where the extinguishers were discharged. On the opposite side of the instrument panel, extinguisher gas concentrations ranged from 3.8 percent to 4.5 percent. Under the stack of radios located in the center section, concentrations ranged from high levels to low levels of 3.8 percent. Thus, both agents exhibited good distribution throughout the sampled area beneath the instrument panel.

EXTINGUISHER AGENT STRATIFICATION IN CABIN.

Testing was designed to measure extinguisher agent stratification within the cabin. The three sample lines were placed on the cabin floor. Single sample lines were placed on the floor both near the pilot and the copilot and on the floor by the rear passenger behind the pilot. The measurements are in figures 33 and 34 and selected values are listed in table 5. The highest Halon extinguisher gas concentrations are located on the floor. In all cases, the gas measurement capability was overwhelmed and exceeded the maximum measurement level of 11 percent. Stratification of the Halon agents are presented in figure 35. Average gas measurements were plotted for the pilot-copilot belt level and for the pilot's nose location. As noted, only one test with each Halon was conducted for measurement of the agents for the floor. Stratification of the Halons is significant as they vary from over 11 percent on the floor to 2.65 percent and 4.03 percent at the pilot's nose and it appears that this relationship is near linear, figure 35.

TABLE 4. EXTINGUISHER GAS DISTRIBUTION

Figure No.	Discharge Location	Agent Type	Agent Disch W Lbs	Agent Disch Time Sec	Max Conc Pilot's Side <u>%</u>	Max Conc Copilot's Side %	Max Conc Center Radios X
29	Under Instr Pan Copilot's Side	1301	2.7		4.3	11+	10.8
30	Under Instr Pan Copilot's Side	1211	2.4	11	4.5	7.9	9.9
31	Under Instr Pan Pilot's Side	1 30 1	-	12	10.5	0.9	3.8
32	Under Instr Pan Pilot's Side	1211	2.3	13	11.0	0.5	4.3

Figure No.	Sample Location	Agent Type	Agent Disch W Lbs	Agent Disch Time Sec	Max Conc On Floor By Pilot	Max Conc On Floor By Copilot	Max Conc On Floor By Rear Seat
33	Sample Lines On Floor	1301	2.5	12	11+	11+	11+
34	Sample Lines On Floor	1211	2.4	11	11+	11+	-

TABLE 5. EXTINGUISHER GAS STRATIFICATION

SUMMARY OF RESULTS

Hand fire extinguishers charged with Halon 1211 and Halon 1301 of 2.5 pound and 3pound capacity, respectively, were tested and evaluated in a Cessna 210C airplane. Four mannequins were used for pilot and passengers and baggage was placed in the baggage compartment. These tests were conducted in an airflow facility without fires and involved the continous sampling and measurement of neat Halon gases from three locations. The agent concentrations were measured in proximity to discharge of the extinguishers at the pilot and copilot belt level, and at the pilot's nose. Air temperature was measured near discharge of the extinguishers and at the pilot's nose. Testing was completed for ventilation conditions of overhead vents open and overhead vents closed. Two Halon 1211 and two Halon 1301 extinguishers were discharged at each test location. Agent discharge was mainly under the instrument panel because cabin fire statistics show that 87 percent of cabin fires in general aviation aircraft are electronic or electrical in origin. Additional test locations include the fuel and hydraulic selector valves, the copilot's door, the rear seat, and the baggage compartment.

Extinguisher agent concentrations near the point of extinguisher discharge ranged between 8 and 9 percent for Halon 1211, and averaged above 10 percent for Halon 1301. Near the pilot-copilot belt level, Halon 1211 extinguisher agent averaged about 6 percent and from 7.0 to 7.7 percent for Halon 1301, and dose for both extinguishers at this location averaged somewhat over 2.3 percent-minutes to 3.0 percent-minutes. Agent concentrations at the pilot's nose height averaged between 2.6 to slightly over 4.0 percent and dose averaged from about 1.0 to 1.5 percent minutes. Extinguisher gases usually dissipated to low levels in less than 1 minute. The utilization of four mannequins or test dummies for the cabin seating arrangement and placement of baggage in the baggage compartment caused somewhat higher gas concentrations and somewhat higher dose calculations than those measurements documented in reference 1. The use of Halon extinguishers of 2.5-pound and 3.0-pound capacity were demonstrated to be safe for use in the test aircraft as maximum dose was only 60 percent of the limit. Measurements were recorded to investigate distribution of extinguisher gases under the instrument panel. When extinguishers were discharged either on the copilot's side or pilot's side, high levels were measured on the discharge side and about 4.0 percent gas

concentration was measured on the opposite side of the instrument panel. Stratification of extinguisher gases in the cabin was determined. The three sample lines were placed on the cabin floor. High measurements in excess of 11 percent maximum were obtained in all locations.

CONCLUSIONS

1. Halon 1211 extinguishers of 2.5-pound capacity are safe for use in small general aviation aircraft. Halon 1301 extinguishers of 3.0-pound capacity are safe for use in small general aviation aircraft. Maximum dose calculations for neat Halon 1211 gases were only 60 percent of the recommended human exposure limits. Maximum dose calculations for neat Halon 1301 gases were only 30 percent of the recommended human exposure limits.

2. Extinguisher agent stratification and normal flight ventilation are major factors in producing safe conditions in the cabin at the pilot's nose level.


REFERENCES

1. Slusher, G. R., Wright, J., Demaree, J. E., and Neese, W. E., <u>Extinguisher</u> <u>Agent Behavior in a Ventilated Small Aircraft</u>, DOT/FAA/CT-83/30, January 1984.

2. NFPA 12A Halon 1301 Fire Extinguishing Systems and NFPA 12B Halon 1211 Fire Extinguishing Systems, National Fire Protection Association.

3. Hand Fire Extingusher for Use in Aircraft, Advisory Circular, AC No.; 20-42C, U.S. Department of Transportation, Federal Aviation Administration, 1984.

4. Eklund, T. I., <u>Analysis of Dissipation of Gaseous Extinguisher Agents in</u> <u>Ventilated Compartments</u>, DOT/FAA/CT-83/1, May 1883.

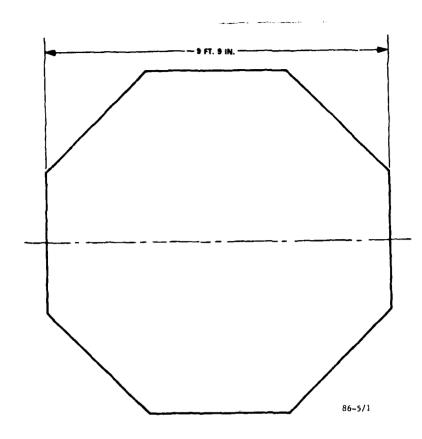

.

FIGURE 1. GENERAL AVIATION AIRFLOW FACILITY TEST SECTION - CROSS SECTION

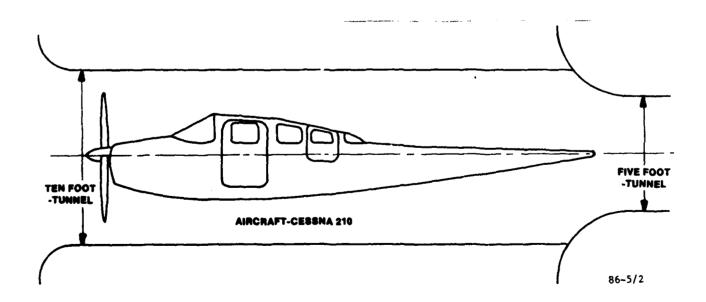


FIGURE 2. GENERAL AVIATION AIRFLOW FACILITY TEST SECTION - PROFILE





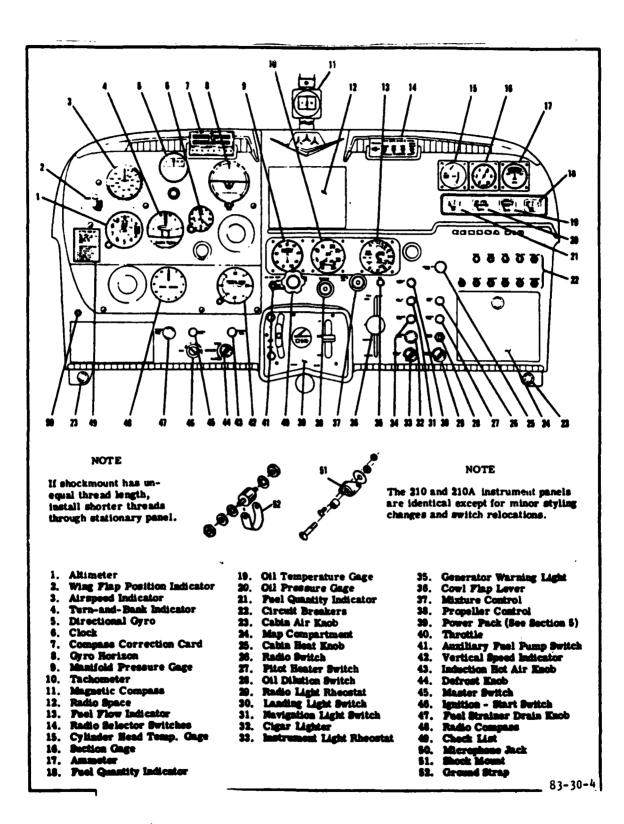


FIGURE 4. INSTRUMENT PANEL - CESSNA MODEL 210C AIRPLANE

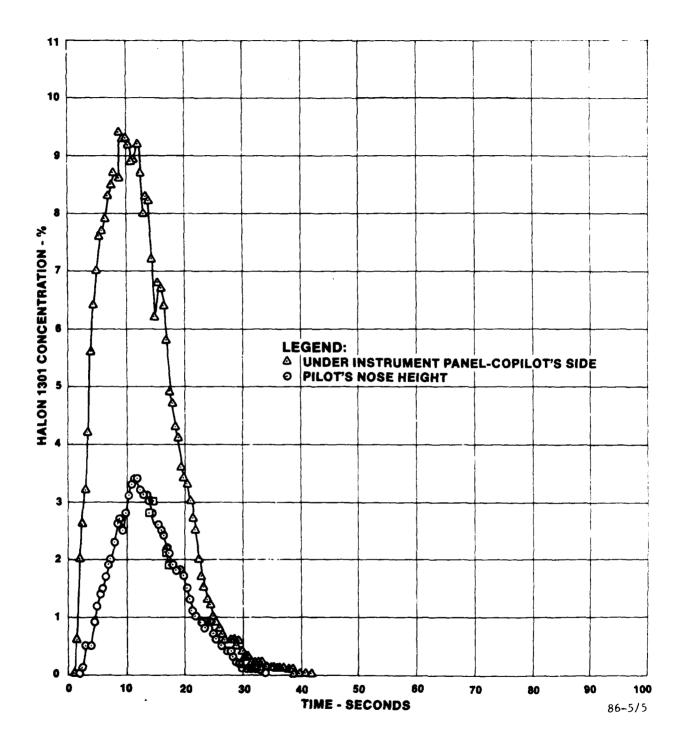


FIGURE 5. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - COPILOT'S SIDE - OVERHEAD VENTS OPEN

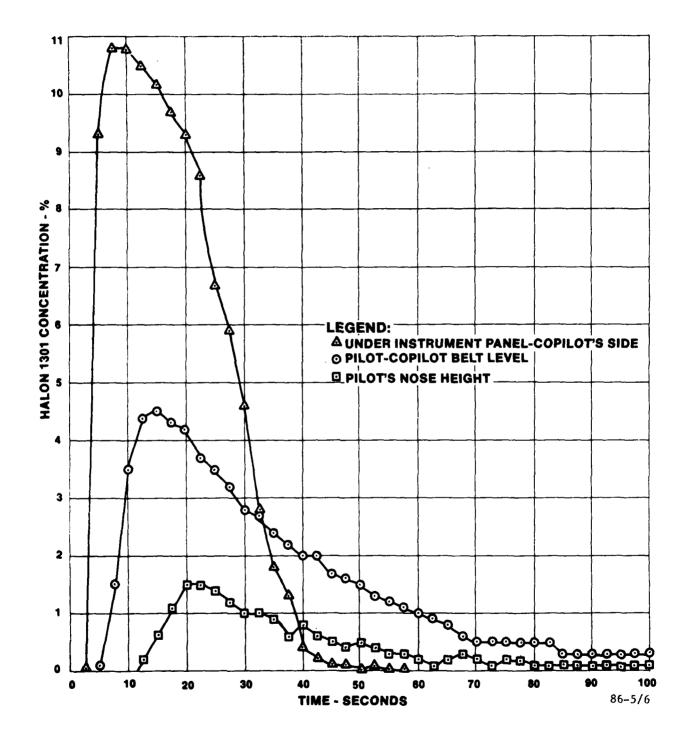


FIGURE 6. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - COPILOT'S SIDE - OVERHEAD VENTS CLOSED

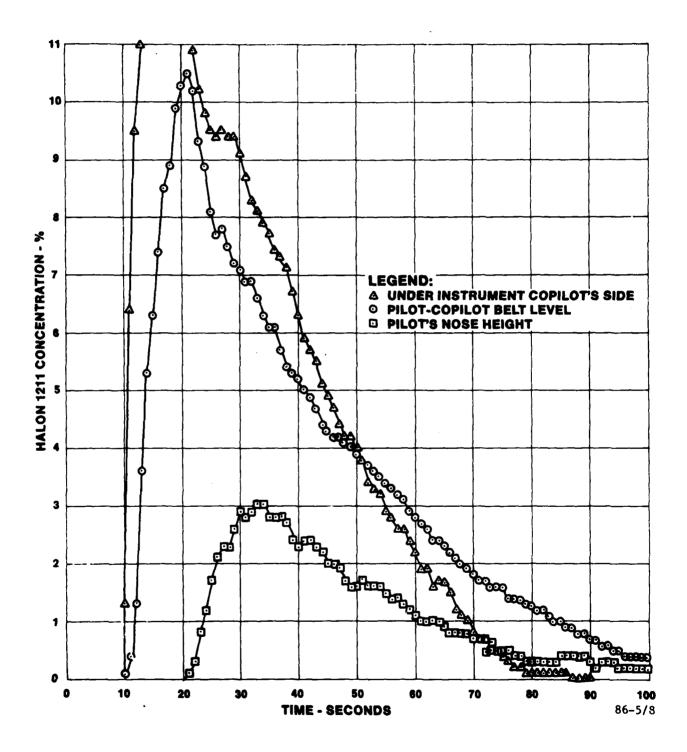


FIGURE 8. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - COPILOT'S SIDE - OVERHEAD VENTS CLOSED

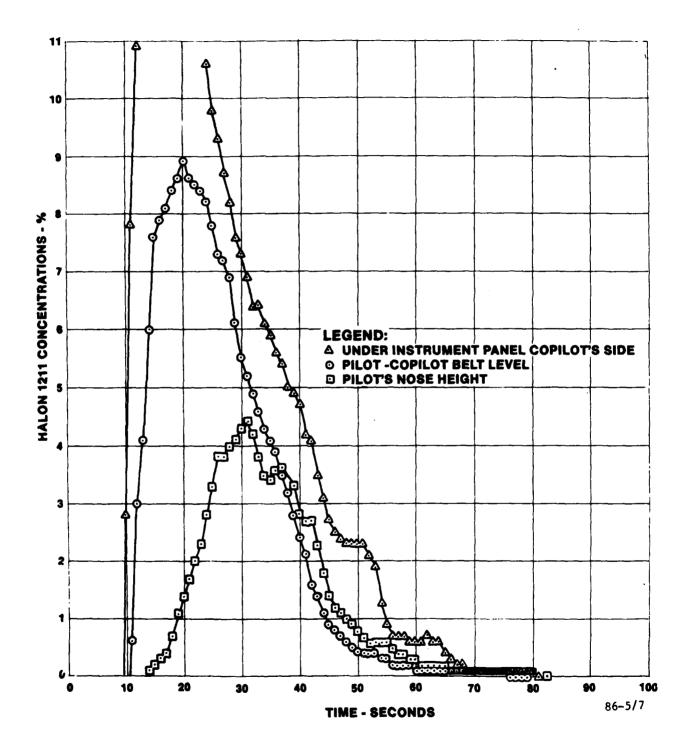


FIGURE 7. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - COPILOT'S SIDE - OVERHEAD VENTS OPEN

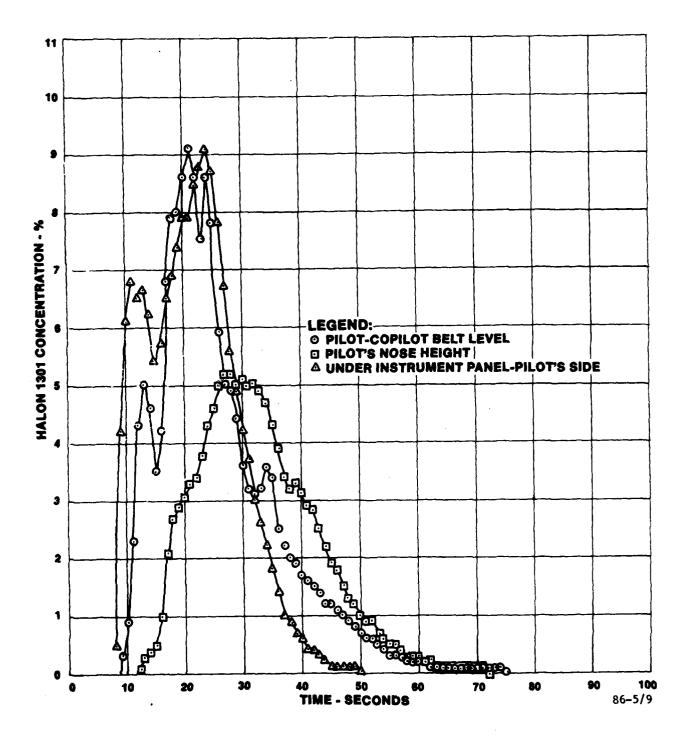


FIGURE 9. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - PILOT'S SIDE - OVERHEAD VENTS OPEN

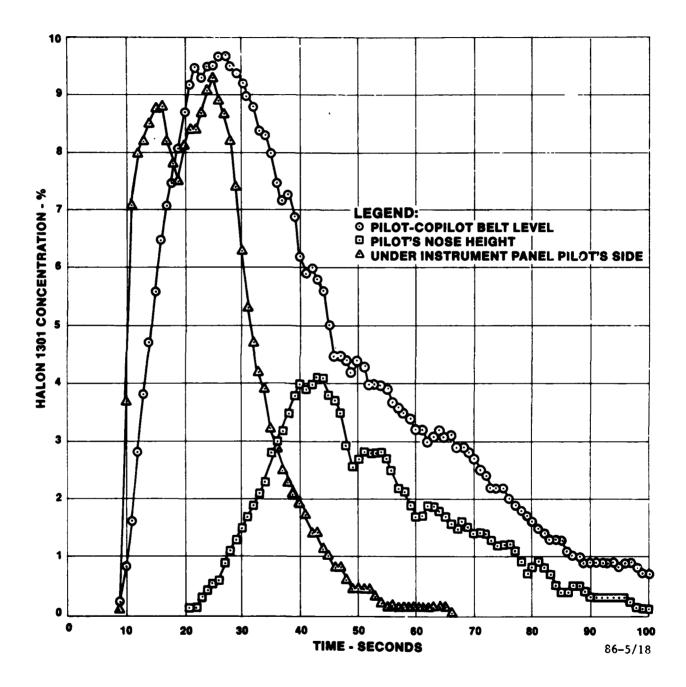


FIGURE 10. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED TO THE COPILOT'S DOOR - OVERHEAD VENTS CLOSED

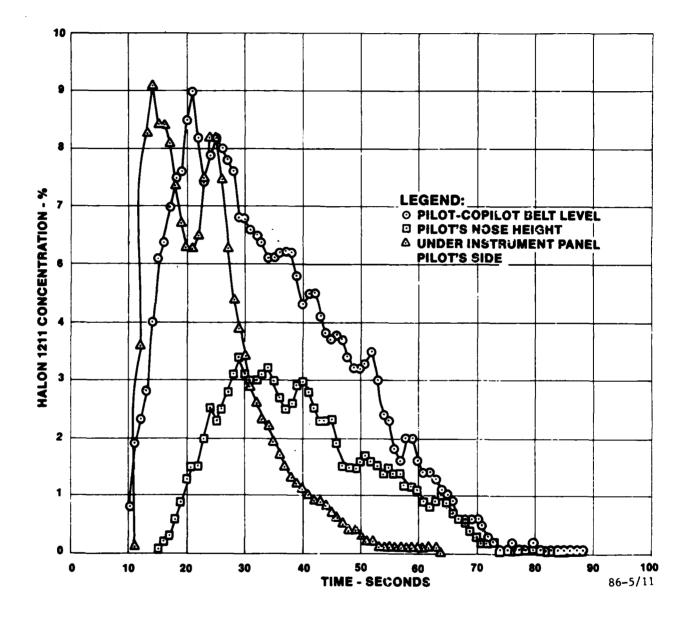


FIGURE 11. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - PILOT'S SIDE - OVERHEAD VENTS OPEN

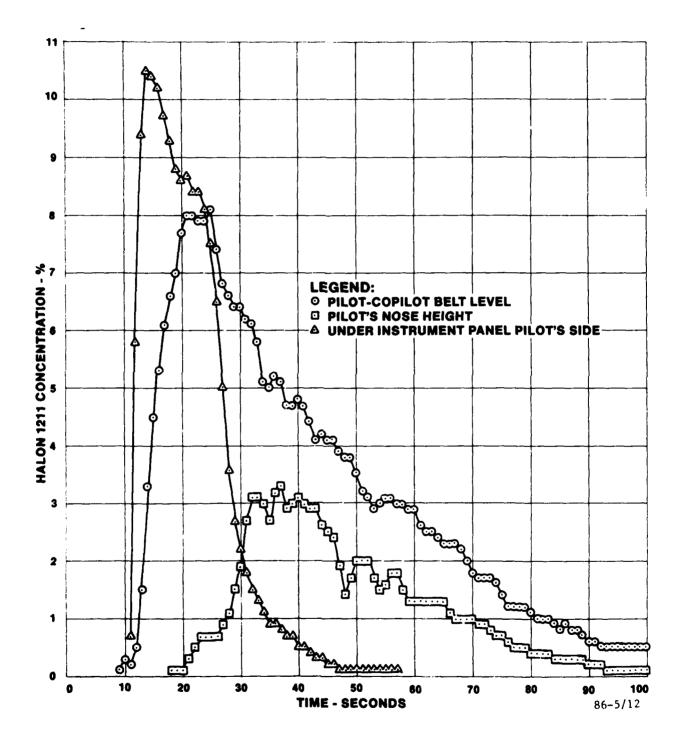


FIGURE 12. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - PILOT'S SIDE - OVERHEAD VENTS CLOSED


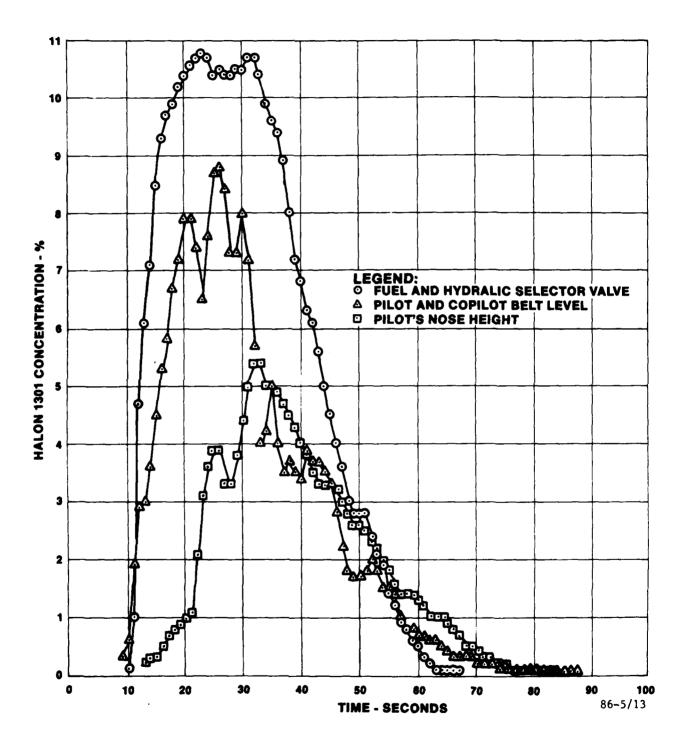


FIGURE 13. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED TO THE FUEL AND HYDRAULIC SELECTOR VALVES - OVERHEAD VENTS OPEN

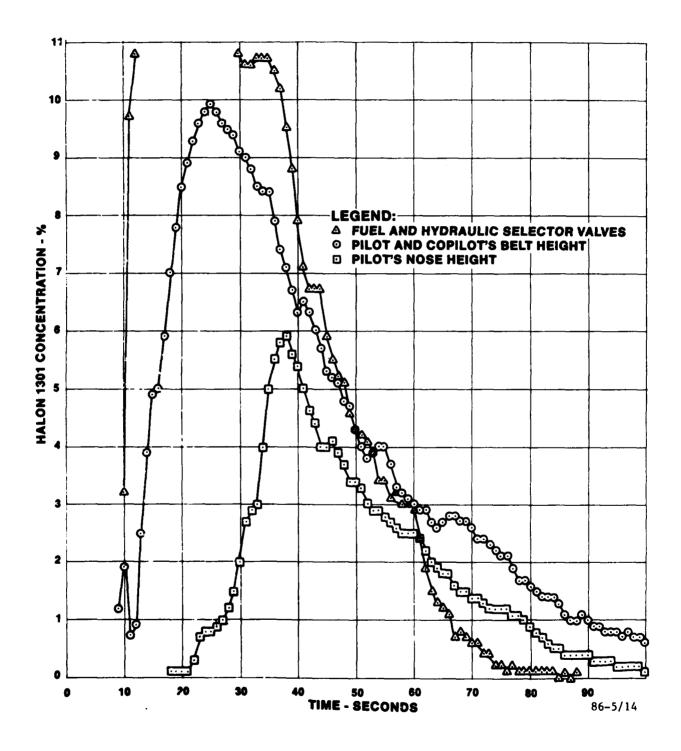


¥.

į

Į

FIGURE 14. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED TO THE FUEL AND HYDRAULIC SELECTOR VALVES - OVERHEAD VENTS CLOSED

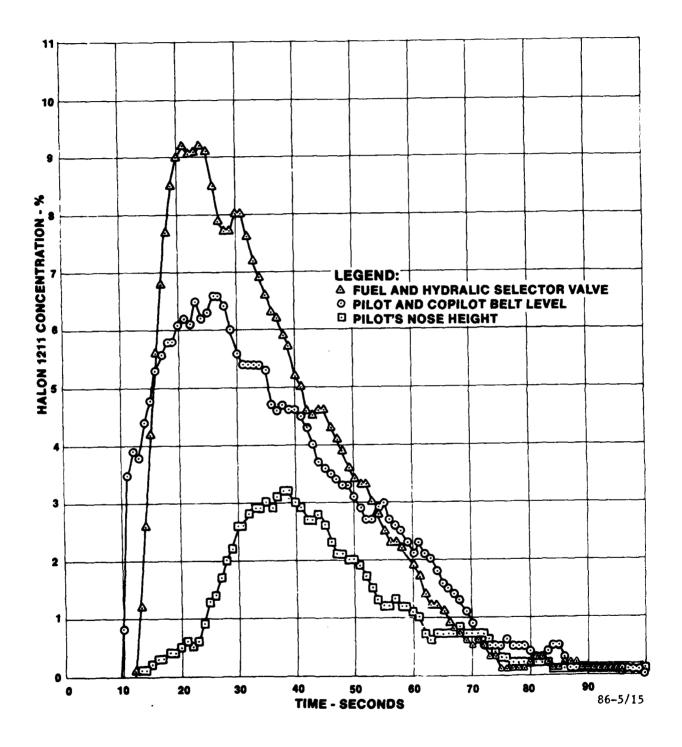

ľ

FIGURE 15. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE FUEL AND HYDRAULIC SELECTOR VALVES - OVERHEAD VENTS OPEN


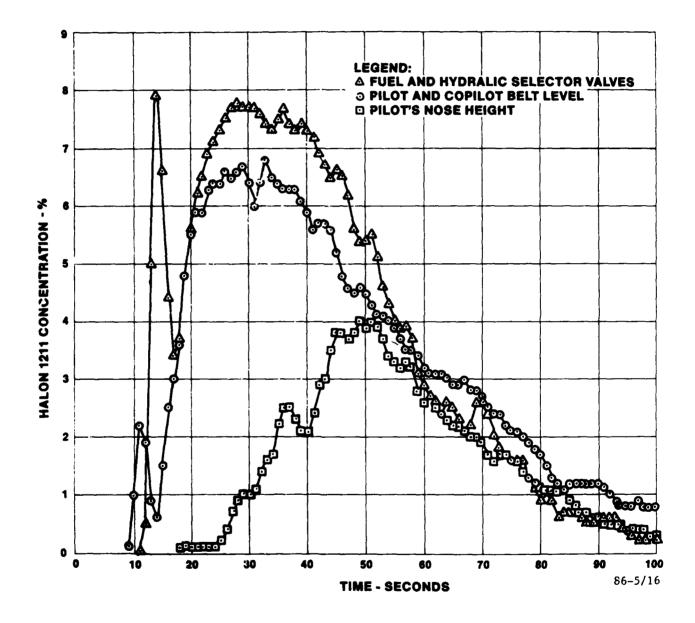


FIGURE 16. HALON 1211 CONCENTRATIONS ~ 2.5-POUND EXTINGUISHER DIRECTED TO THE FUEL AND HYDRAULIC SELECTOR VALVES - OVERHEAD VENTS CLOSED

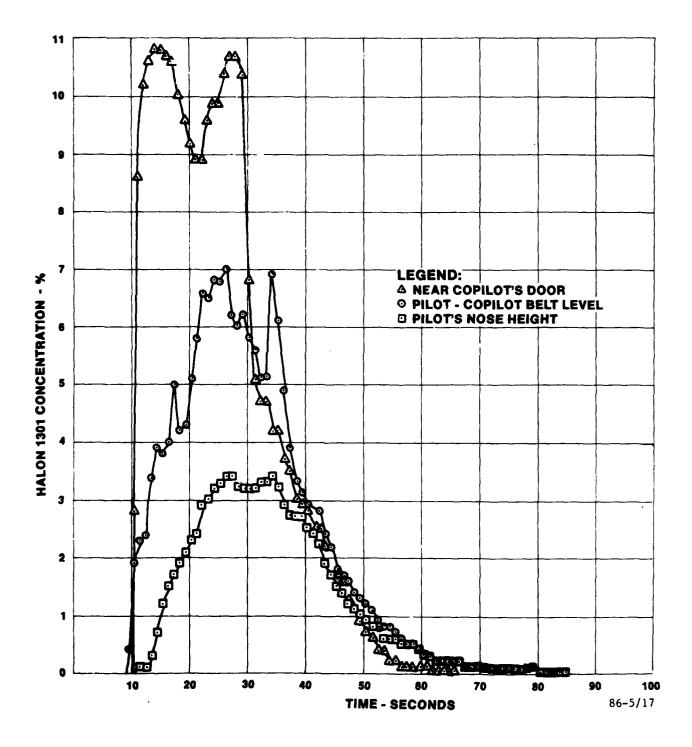

Þ

FIGURE 17. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED TO THE COPILOT'S DOOR - OVERHEAD VENTS OPEN


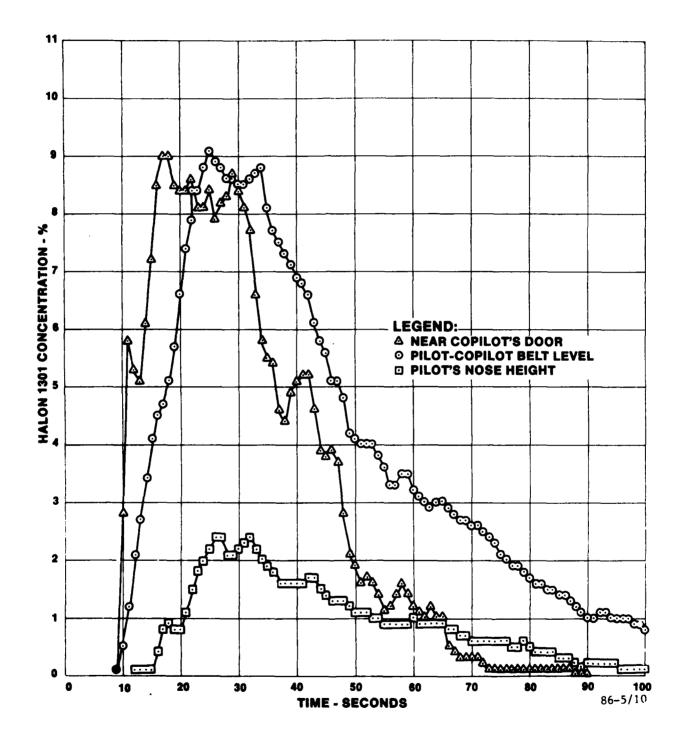


FIGURE 18. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED UNDER INSTRUMENT PANEL - PILOT'S SIDE - OVERHEAD VENTS CLOSED

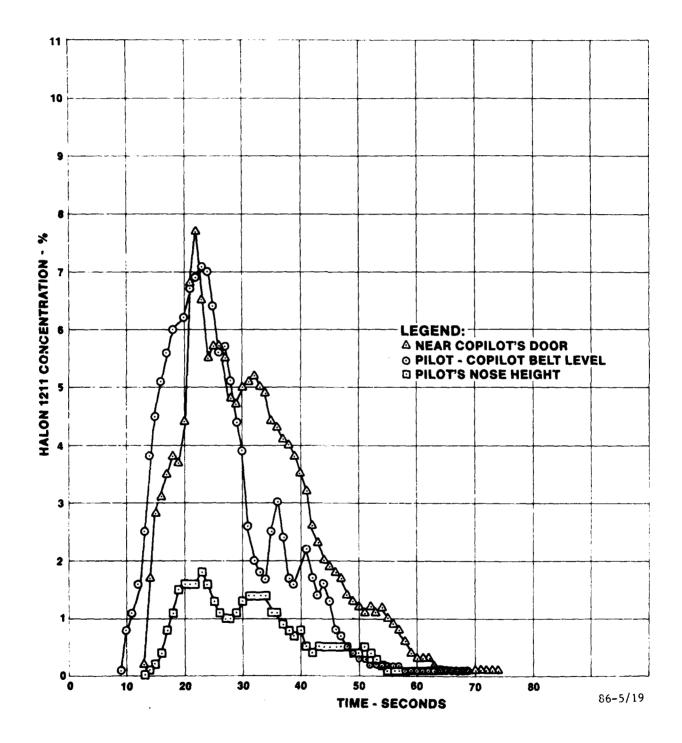

. •

FIGURE 19. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE COPILOT'S DOOR - OVERHEAD VENTS OPEN

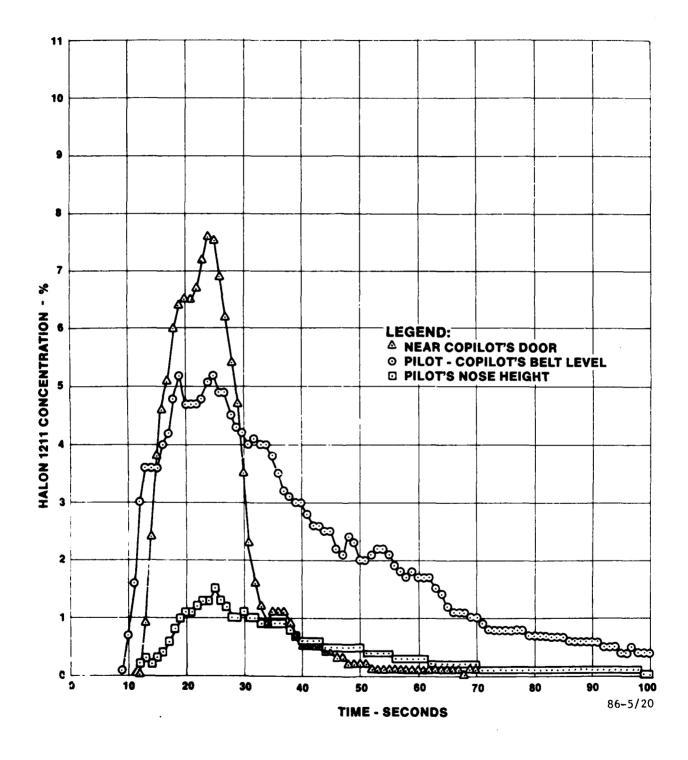


FIGURE 20. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE COPILOT'S DOOR - OVERHEAD VENTS CLOSED

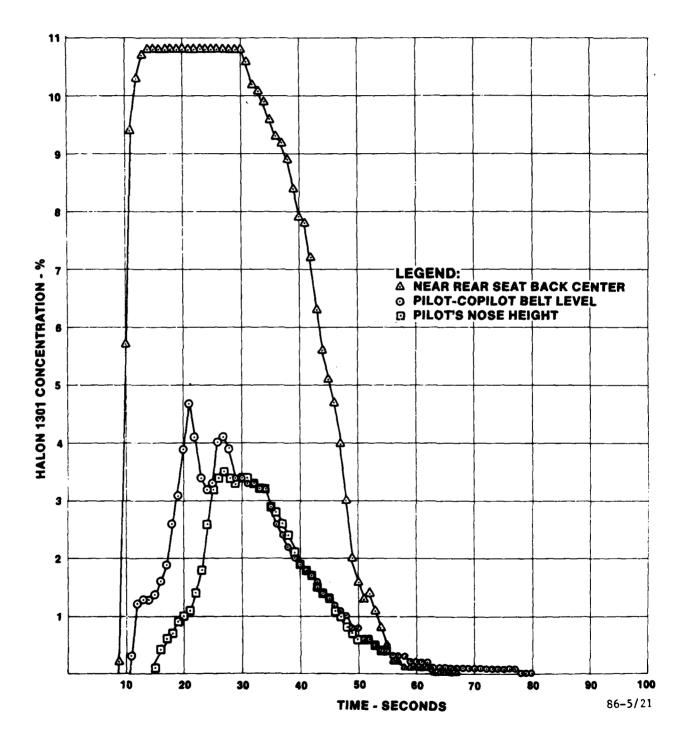


FIGURE 21. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED TO THE REAR SEAT - OVERHEAD VENTS OPEN


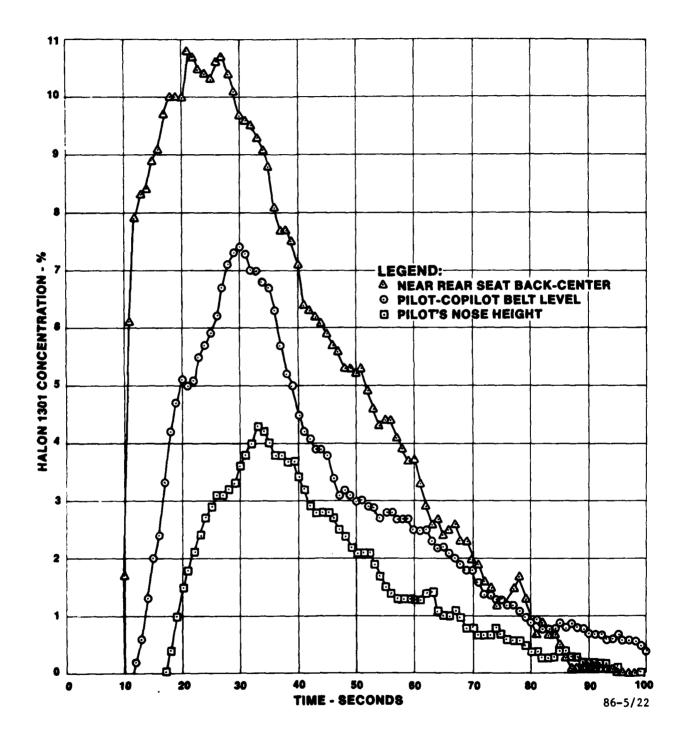


FIGURE 22. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED TO THE REAR SEAT - OVERHEAD VENTS CLOSED

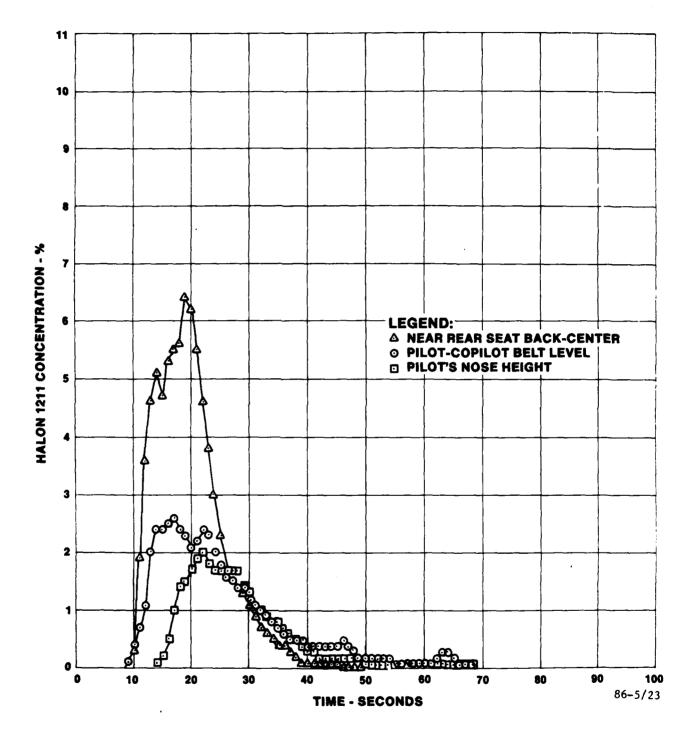

Γ

FIGURE 23. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE REAR SEAT - OVERHEAD VENTS OPEN

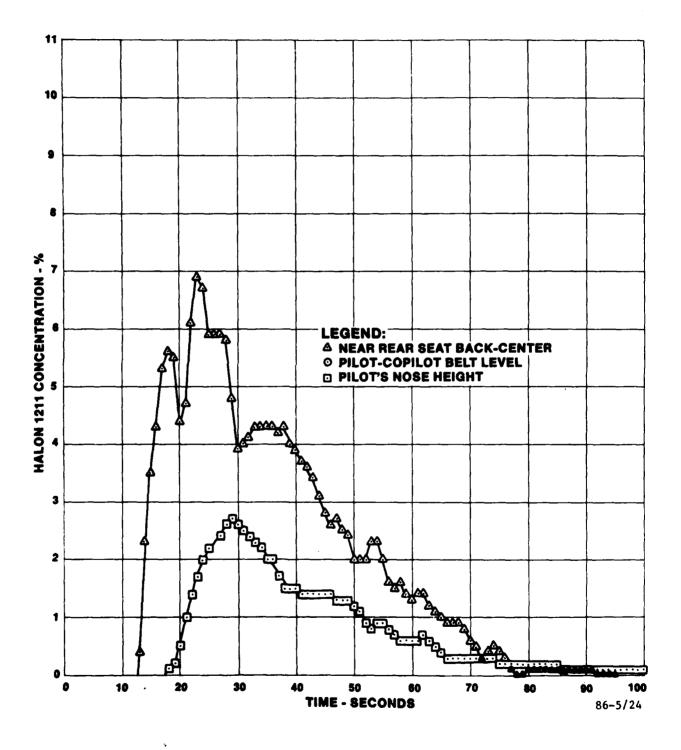


FIGURE 24. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE REAR SEAT - OVERHEAD VENTS CLOSED

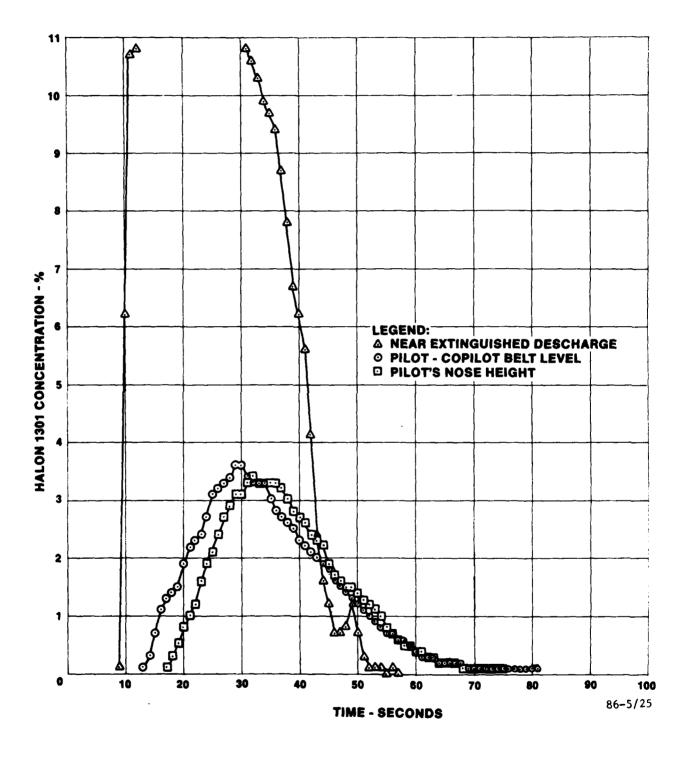


FIGURE 25. HALON 1301 CONCENTRATIONS ~ 3-POUND EXTINGUISHER DIRECTED TO THE BAGGAGE CONPARTMENT - OVERHEAD VENTS OPEN

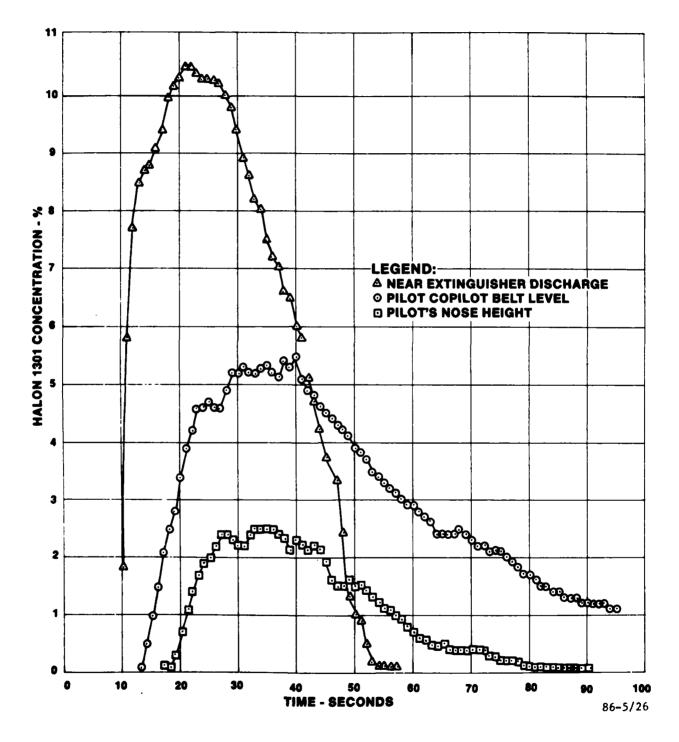


FIGURE 26. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED TO THE BAGGAGE COMPARTMENT - OVERHEAD VENTS CLOSED

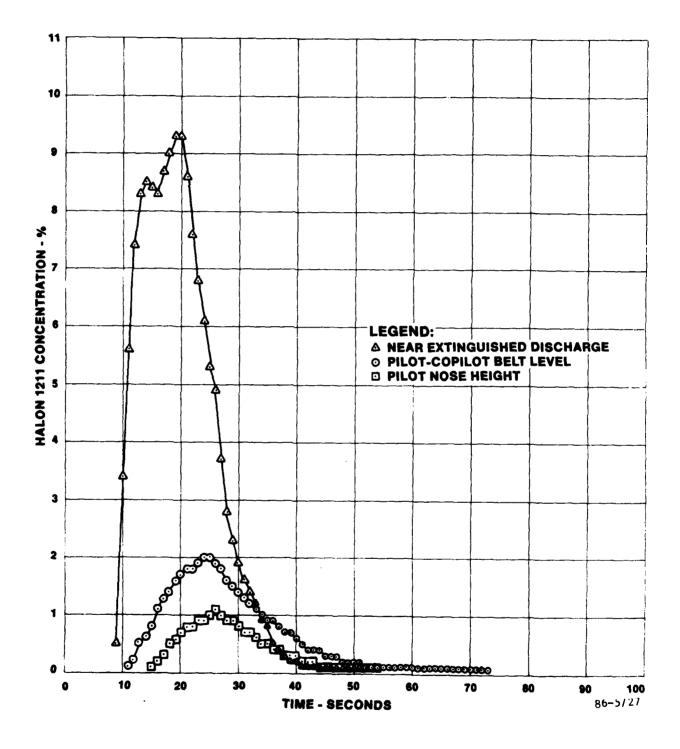


FIGURE 27. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE BAGGAGE COMPARTMENT - OVERHEAD VENTS OPEN



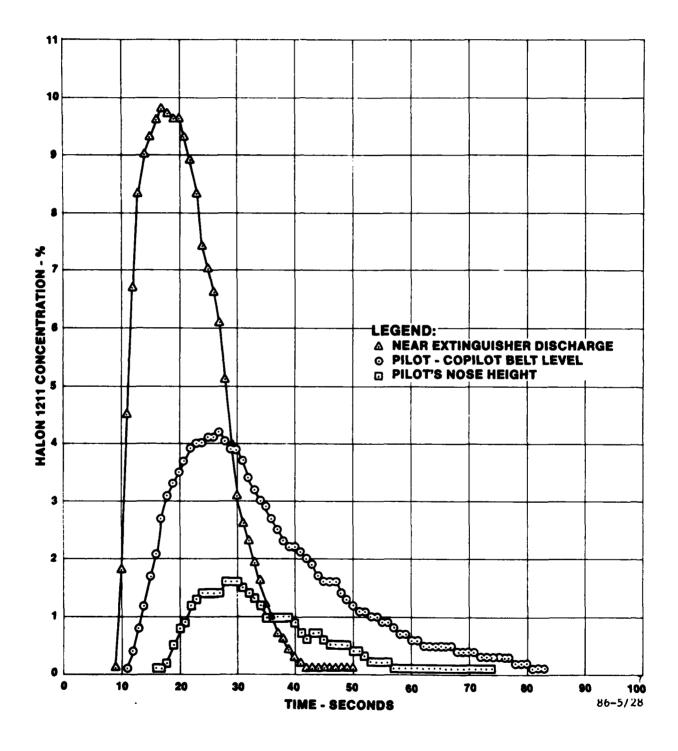


FIGURE 28. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE BAGGAGE COMPARTMENT - OVERHEAD VENTS CLOSED

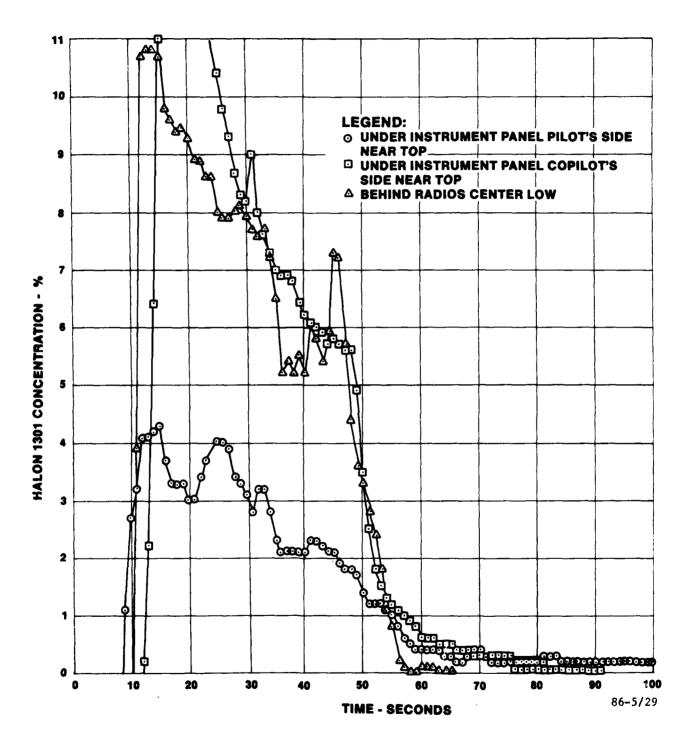

ŀ

FIGURE 29. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED UNDER THE INSTRUMENT PANEL - COPILOT'S SIDE - ALL SAMPLE LINES UNDER INSTRUMENT PANEL

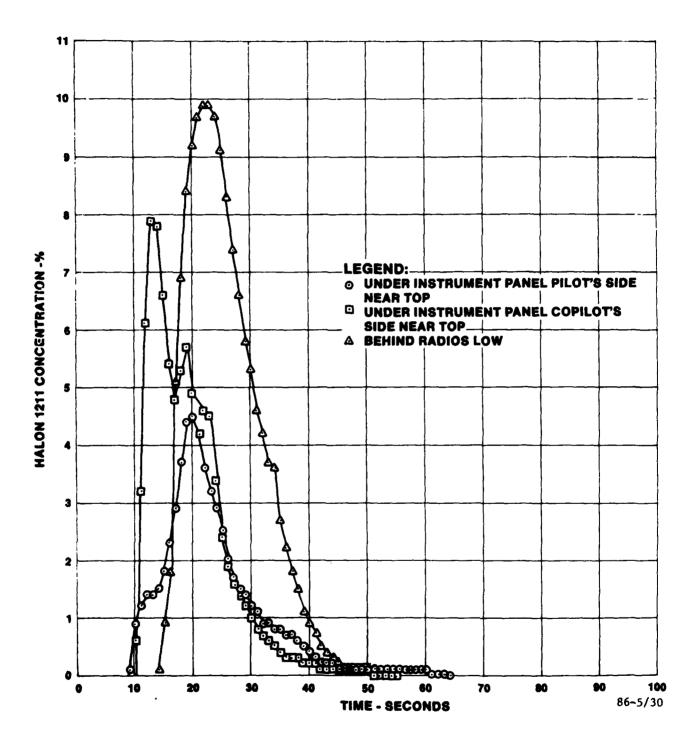

ľ

FIGURE 30. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED UNDER THE INSTRUMENT PANEL - COPILOT'S SIDE - ALL SAMPLE LINES UNDER INSTRUMENT PANEL

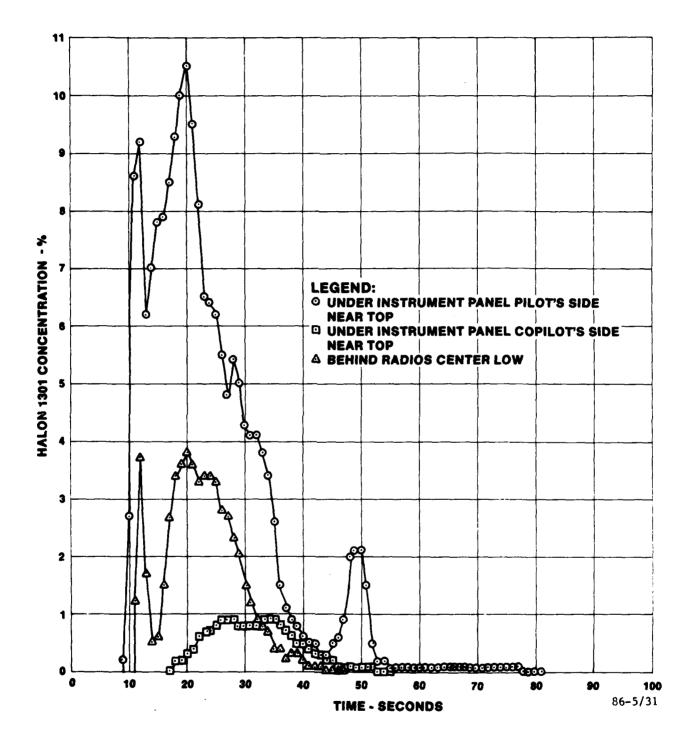


FIGURE 31. HALON 1301 CONCENTRATIONS - 3-POUND EXTINGUISHER DIRECTED UNDER THE INSTRUMENT PANEL - PILOT'S SIDE - ALL SAMPLE LINES UNDER THE INSTRUMENT PANEL

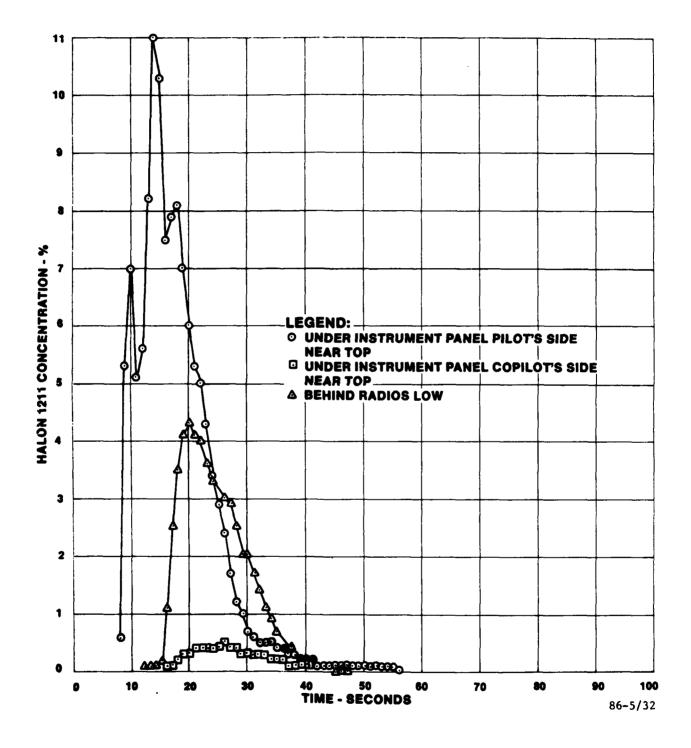


FIGURE 32. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED UNDER THE INSTRUMENT PANEL - PILOT'S SIDE - ALL SAMPLE LINES UNDER THE INSTRUMENT PANEL

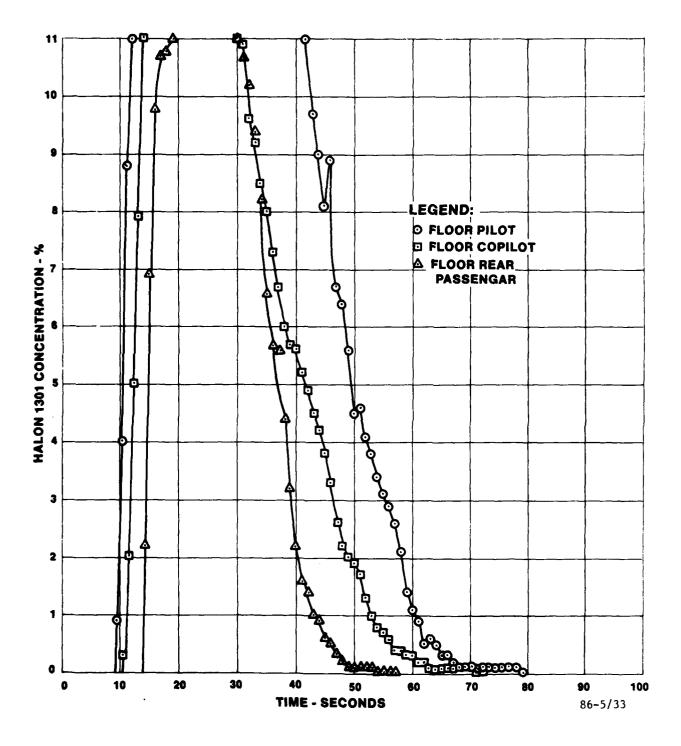


FIGURE 33. HALON 1301 CONCENTRATIONS ~ 3-POUND EXTINGUISHER DIRECTED TO THE FUEL AND HYDRAULIC SELECTOR VALVES - ALL SAMPLE LINES LOCATED ON THE FLOOR


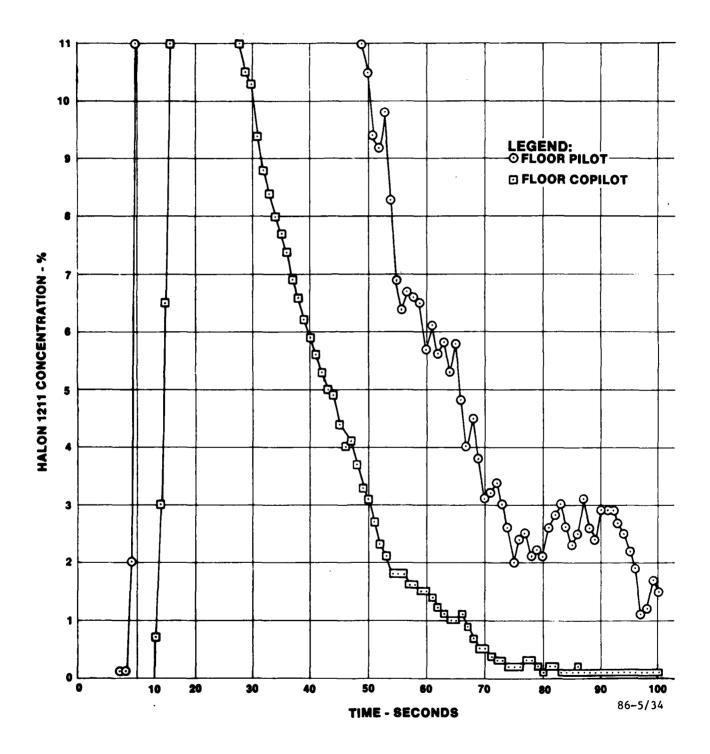


FIGURE 34. HALON 1211 CONCENTRATIONS - 2.5-POUND EXTINGUISHER DIRECTED TO THE FUEL AND HYDRAULIC SELECTOR VALVES - ALL SAMPLE LINES LOCATED ON THE FLOOR

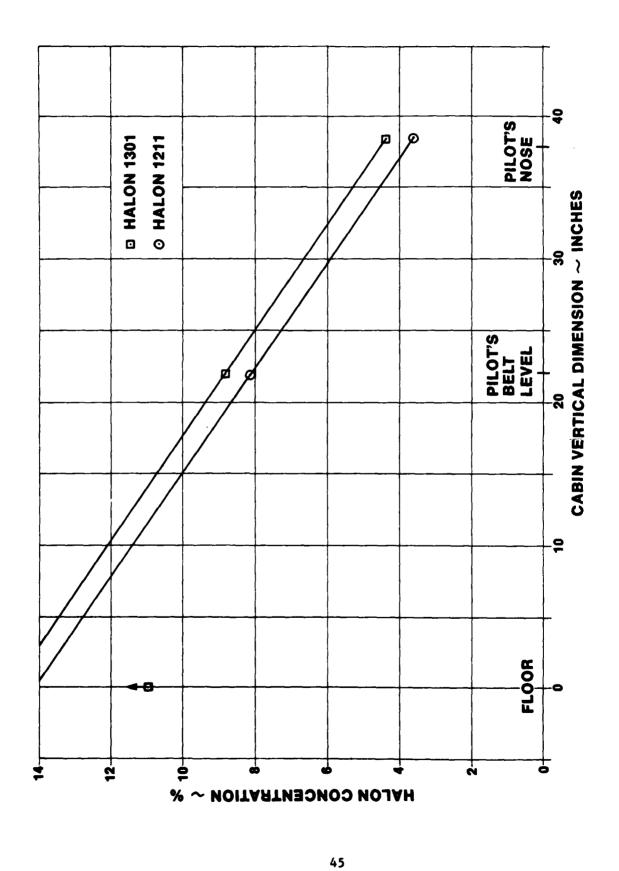

APPENDIX A

DISTRIBUTION LIST

Region Libraries

Alaska AAL-64 Central ACE-66 Eastern AEA-62 AGL-60 Great Lakes ANE-40 New England Northwest-Mountain ANM-60AWP-60 Western-Pacific Southern ASO-63d Southwest ASW-40

Center Libraries

Technical Center ACT-64 Aeronautical Center AAC-44.4

Civil Aviation Authority Aviation House 129 Kingsway London WC2B 6NN England

Embassy of Australia Civil Air Attache 1601 Mass Ave. NW Washington, D. C. 20036

Scientific & Tech. Info FAC Attn: NASA Rep. P.O. Box 8757 BWI Aprt Baltimore, Md. 21240

DOT-FAA AEU-500 American Embassy APO New York, N. Y. 09667

Headquarters (Wash. DC)

ADL-1 ADL-32 (North) APM-1 APM-13 (Nigro) ALG-300 APA-300 APA-300 API-19 AAT-1 AWS-1 AES-3

OST Headquarters Library

M-493.2 (Bldg. 10A)

University of California Sers Dpt Inst of Trsp Std Lib 412 McLaughlin Hall Berkely, CA 94720

British Embassy Civil Air Attache ATS 3100 Mass Ave. NW Washington, DC 20008

Dir. DuCentre Exp DE LA Navigation Aerineene 941 Orly, France

Northwestern University Trisnet Repository Transportation Center Lib. Evanston, Ill. 60201 Mr. Fred Jenkins, ANM-130L Federal Aviation Administration 4344 Donald Douglas Drive Long Beach, California 90808

Mr. Dan Gross B-66 Technology Building National Bureau of Standards Washington, DC 20234

Dr. James M. Peterson The Boeing Company MS/73-43 Seattle, Washington 98124

Dr. John O. Punderson E.I. Dupont De Nemours P.O. Box 1217 Parkersburg, West VA 26102

Commander U.S. Army AVSCOM Attn: DRSAV-EI (Mr. John P. Dow) 4300 Goodfellow Blvd. St. Louis, MD 63120

Mr. L. C. Virr Civil Aviation Authority Barbazon House Redhill Surrey RH1 1SQ England

Mr. Ray Young Engineering and Air Safety Dep't Airline Pilots Association 1625 Massachusetts Ave., NW Washington, DC 20036

Dr. Calyton E. Hathaway Monsanto Company 800 N. Lindberg BLvd. Mail Zone R3B St. Louis, MO 63166

Dr. Leo P. Parts Monsanto Research Corp. 1515 Nicholas Road Datyton, Ohio 45407 Mr. Matthew M. McCormick National Transportation Safety Board Bureau of Technoloty Washington, DC 20594

Mr. A. Delman The Wool Bureau, Inc. Technical Services Center 225 Crossways Park Drive Woodbury, L.I., New York 11797

Dr. L. Benisek International Wool Secretariat Technical Center, Valley Drive Ilkley, West Yorkshire, LS29 8PB England

Mr. John A. Leland Username: Dept E-29 Douglas Aircraft Co. 35-14 3855 Lakewood Blvd. Long Beach CA 90846

Mr. Stan Ames Fire Research Station Borehamwood Hertfordshire WDG 2BL England

Mr. Arthur G. Thorning Civil Aviation Authority CAA House 45-59 Kingsway London WC2B GTE England

Mr. Lee Hoyt Weber Aircraft Co. 2820 Ontario Street Burbank, CA 91505

Julia M. Baer Celanese Fibers Marketing Comp. P.O. Box 32414 Charlotte, NC 28232

Mr. James O. Price Heath Tecna Corp. 19819 84th Avenue South Kent, Washington 98031 Mr. Richard M. Harrison Custom Products Company P.O. Box 699 Sun Valley, California 91352

Mt. T. E. Waterman IIT Research Institute 10 West 35th Street Chicago, Illionis 60616

Mr. Henri Branting FAA Headquarters AWS-120 800 Indepednce Avenue SW Washington, DC 20591

Dr. James E. Mielke Science Policy Research Div. Congressional Research Services Library of Congress Washington, DC 20540

Mr. Thomas Madgwick British Areospace p.l.c. Aircraft Group Weybridge-Bristol Division Filton House Bristol BS99 7AR Englang

Mr. Joseph L. Buckley Factory Mutual System 1151 Boston-Providence Turnpike Norwood, Mass. 02062

Mr. John Hoffmann Port of New York & New Jersey Authority One Path Plaza (4th Floor) Jersey City, NJ 07306

Mr. Robert E. Kraus Raychem Corp. 300 Constitution Drive Menlo Park, California 94025

Mr. John A. Blair Manager, Standards E.I. Dupont deNemours & Co. ;PP+R Chestnut Run Wilmington, Delaware 19898 Mr. Bill Martinez, Mgr. Data Service AMI Industries, Inc. P.O. Box 370 Colorado Springs, California 80901

Mr. J. J. Brenneman Fire Protection Engineer United Airlines, Inc. P.O. Box 66100 Chicato, Illionis 60666

Mr. Edward L. Lopez Lockheed Aircraft Corp. Dept. 74-75, Bldg. 229-A Box 551 Burbank, CA 91503

Dr. D. Kourtides Chemical Research Center NASA/AMES Research Center Moffett Field, CA 94035

Mr. C. Hayden Leroy TE-10 Bldg. 10-A National Transportation Safety Board Washington, DC 20594

Mr. Richard Nelson ANM-110 17900 Pacific Highway South C-G8966 Seattle, WA 98168

Dr. Charles R. Crane FAA, CAMI, AAC-114 P.O. Box 25082 Oklahoma, OK 73125

Mr. Reginald Utting The Boeing Company Commercial Airplane Group, 747 Div. P.O. Box 3707 Seattle, Washington 98124

Dr. Joseph C. Reed E.I. Dupont de Nemours & Co. Plastics Department Fluorocarbons Division Wilmington, Delaware 19898 Dr. Fumiharu Saito Building Research Institute Ministry of Construction Tatehara-1 Oho-Machi Tsukuba-Gun Ibaraki Prefecture, Japan

Dr. Robert Keith Laboratory Industrial Medicine Eastman Chemical Company Kingsport, Tenn. 37662

Mr. Kenton D. Warner Puritan-Bennet Aero Systems Co. 10800 Pflumm Road Lenexa, Kansas 66215

Mr. Geroge Veryioglou Systems Technology Staff Boeing Commercial Airplane Co. P.O. Box 3707, MS 77-70 Seattle, WA 98124

Mr. Donald Schroeder Federal Aviation Administration APM-710 800 Independence Ave. SW Washington, DC 20591

Mr. Calvin J. Cruz Textile Fibers Dept. E.I. Dupont deNemours & Co., Inc. Wilmington, Delaware 19898

Dr. C. Perry Bankston Energy and Materials Research Sec. Jet Propulsion Laboratory 4800 Oak Grove Drive Pasadena, California 91103

Mr. Joseph A. Krist Athol Manufacturing Corporation 1350 Broadway New York, New York 10018

Mr. W. G. Dye Director of Engineering Fairchild Burns Company 1455 Fairchild Drive Winston Salem, NC 27023 Mr. Peter Meiklem Civil Air Attach's (Safety) British Embassy 3100 Massachusetts Ave. NW Washington, DC 20008

Dr. H. R. Dvorak Wesson and Associates, Inc. 510 South Webster Postal Box 1082 Norman, OK 73070

Mr. Erich Feldkirchner Airbus Insustrie Headquarters, BP No. 33 31700 Blagnac, France

Ms. Diane Boulavsky American Textile Mfgrs. Institute 1101 Connecticut Ave. NW Suite 350 Washington, DC 20036

Mr. Gregory Smith B.F. Goodrich Technical Center P.O. Box 122 Avon Lake, Ohio 44012

Mr. George M. Johnson Cheif Chemist Pan American Airways, Inc. Bldg. 208 Room 2228 J F Kennedy Int'l Airport Jamaica, New York 11430

Dr. Lloyd H. Back Energy and Materials Research Sec. Jet Propulsion Laboratory 4800 Oak Grove Drive Pasadena, California 91103

Dr. A. Carlos Fernandez-Pello Mechanical Engineering Department University of California, Berkely Berkely, California 9420

Mr. S. F. Taylor College of Aeronautics Cranfield Institute of Technology Cranfield, Bedford MK3OAL England Mr. William R. Kane System Engineering Group ASD/ENFEF Wright-Patterson AFB, Ohio 45433

Mr. A. J. Christopher Royal Aircraft Establishment Materials Department South Farnborough Hants, England

Manager Flight Attendant Training & Standard Western Airlines 6060 Avion Drive Los Angeles, California 90009

Mr. Everett A. Tustin Boeing Commerical Airplane Company P.O. Box 3707, M/S GF-26 Seattle, Washington 98124

Mr. R. G. Clodfelter AFWAL/POSH Wright-Patterson AFB Ohio 45433

Dr. Edwin Smith Ohio State University 140 W. 19th Avenue Columbus, Ohio 43214

Mr. Walter Perkowski The Boeing Company Commercial Airplane Group P.O. Box 3707, MS/73-43 Seattle, Washinton 98124

Mr. William Snoddy American Airlines P.O. Box 51009 Mail Stop #10 Tulsa, Oklahoma 74151

Mrs. Charlotte Gebhart Rohm & Haas Company Independence Mall West Philadelphia, PA 19105 Wm. Kirkham, Phd., Md, AAC-144 DOT/FAA/ CAMI Aeronautical Center P.O. Box 25082 Oklahoma City, Oklahoma 73125

Mr. Henry J. Koux Product Fire Performance Armstrong World Industries, Inc. Lancaster, PA 17604

Mr. John Ed Ryan National Forest Products Assoc. 50 North Franklin Turnpike P.O. Box 314 Hohokus, New Jersey 07423

C. M. Sliepcevich Flame Dynamics Laboratory University of Oklahoma 1215 Westheimer Street Norman, Oaklahoma 73069

Mr. Louis Frisco Wire & Cable Division Raychem Corp. 300 Constitution Drive Menlo Park, California 94205

Dr. John A. Parker Chemical Research Projects Office NASA/AMES Research Center M.S. 223-6 Moffett Field, California, 94035

Bernard Grendahl, Mgr. Tech. Service Aerospace Division Universal Oil Products Company Bantam, Conn. 06750

A. Tewarson FMRC 1151 Boston-Providence T'Pke Norwood, Mass. 02062

Dr. Rosalind C. Anderson Arthur D. Little, Inc. Acorn Park Cambridge, Mass. 02140 Mr. Matthew Finucane Aviation Consumer Action Project P.O. Box 19029 Washington, DC 20036

Mr. Leo Fisher Crest Foam 100 Carol Place Moonachie, NJ 07074

Mr. Philip J. DiNenno Professional Loss Control, Inc. P.O. Box 446 Oak Ridge, TN 37830

Mr. James A. Milke Department of Fire Protection Engineering University of Maryland College Park, MD 20742

Mr. John P. Reese
Aerospace Industries Association of America, Inc.
1725 Desales Street, N.W.
Washington, DC 20036

Mr. Jim Brown General Dynamics Electric Boat Div. Station CG2 Eastern Point Road Groton, Conn. 06340

Mr. John R. Powers Delta Airlines, Inc. Hartsfield Atlanta International Airport Atlanta, Georgia 30320

Mr. S. M. Hooper Eastern Airlines Miami International Airport Miami, Florida 33148

Dr. Charles P. Lazzara US Bureau of Mines Pgh. Research Center P.O. Box 18070 Pittsburgh, PA 15236 Dr. James G. Ouintiere National Bureau of Standards Bldg. 224, Room B-356 Washington, DC 20234

Mr. Stan Martin & Assoc. 860 Vista Drive Redwood City, California 94062

Mr. A. L. Bridgman General Electric Company Plastics Technology Department 1 Plastics Avenue Pittsfield, MA 01201

Mr. Walter T. Clark Jr. Clark Engineering Service 312 E. Main Street Lancaster, Texas 75146

Commanding General U.S. Army Test & Evaluation Command Attn: DRSTE-AD-A (D. Conley) Aberdeen Proving Ground, MD 21005

Mr. Charles Macaluss U.S. Testing 5555 Telegraph Road Los Angeles, CA 90040

Mr. Steve Waldrip Republic Airlines 7500 Airline Drive Minneapolis, Minnesota 55450

T. F. Laughlin, Jr. Lockheed-California Company D/98-01, B/90-4, A-1 P.O. Box 551 Burbank, California 91520

Kirke Comstock Manager of Interior Engineering United Airlines Maint. Oper. Center Engineering Department San Francisco International Airport San Francisco, California 94128

A_-6

Dr. John Leverton Civil Regulations Manager Civil Business Group Westland Helicopters, LTD. Yeovil, BA20 2YB Somerset, England

Dr. Dale G. Onderak John Schneller & Associates 6019 Powdermill Road Kent, Ohio 44240

Mr. Mike Bauccio U.S. Army Aviation R&D Command AVSCOM/DRSAV-NS St. Louis Missouri 63120

Mr. Vyto Babrauskas National Bureau of Standards Bldg. 224, Room A-345 Washington, DC 20234

Mr. Pascal Dranitsaris Ontario Research Foundation Sheridan Park Research Community Mississauga, Ontario, Canada L5K1B3

Mr. V. W. Ballenger Director, Engineering and Maint. Air Transport Association 1709 New York Avenue, N.W. Washington, DC 20006

Mr. William K. Greer General Electric Company l Plastics Avenue Pittsfield, Massachusetts Ol2Ol D. A. Radice Manager, Flexible Sales CPR Division of Upjohn Company 555 Alaska Avenue Torrence, California 90503

Mr. Micheal Tyler Aviation Safety Bureau Transport Canada Ottawa, Ontario, Canada KIAON8

Mr. Charles W. McGuire Department of Transportation 400 7th Street S.W. Washington, DC 70590

Mr. A. T. Peacock Douglas Aircraft Company Internal Mail Code 36-41 3855 Lakewood Blvd. Long Beach, California 90846

Mr. Eric W. Simmons Ontario Research Foundation Sheridan Park Research Community Mississauga, Ontario, Canada L5K1B3

Mr. James H. Keeler General Electric Company 1 Plastics Avenue Pittsfield, Massachusetts 01201

DUS. GOVERNMENT PRINTING OFFICE: 1986-605-071/40065

