

AD 608290

AD 608 290

28

QUART PRO REPT #2

25 NOV 64

NOV 64

NOR 64-278

AF 33(615)-1341

DEVELOPM
FOR PROD
AND

DEVELOPMENT OF MANUFACTURING CAPABILITY FOR
PRODUCING HIGH PERFORMANCE ALUMINUM AND
MAGNESIUM ALLOY CASTINGS. ILER, A.J.

ACTION

MF:

PUB:

48p

HC \$2.00

JRL, ISS:

DATE/ISS

MF \$0.50

REL. DATE

LIMIT: 0

QUARTERLY PROGRESS REPORT NO. 2

NOR 64-278

November 1964

Air Force Materials Laboratory
Research and Technology Division

Air Force Systems Command
Wright-Patterson Air Force Base, Ohio

Project No. 8-119

ARCHIVAL COPY

RECEIVED
NOV 25 1964
EDC MA B

Prepared under Contract No. AF 33(615)-1341

NORTHROP CORPORATION
NORAIR DIVISION
Hawthorne, California

A. J. Iler, Author

Best Available Copy

FOREWORD

This interim technical report covers the work performed under Contract AF 33(615)-1341 from 1 August 1964 through 31 October 1964. It is published for technical information only and does not necessarily represent the recommendations, conclusions, or approval of the Air Force.

This Contract with Northrop Norair is administered under the direction of Lieutenant W. T. O'Hara of the Air Force Materials Laboratory, MATB, Project Nr. 8-119, Systems Engineering Group (RTD), Wright-Patterson AFB, Ohio.

A. J. Iler of Northrop Norair's Materials Engineering Group was the principal engineer in charge. Major subcontractor was Electronic Specialty Co., Pomona Division, Pomona, California, with Mr. Joseph Raffin, metallurgist in charge of the subcontract engineering effort.

The primary objective of this Air Force Materials Laboratory Program is to assure successful manufacturing methods that will provide aluminum and magnesium alloy systems for "premium quality" cast parts of high strength levels. This report is being disseminated in order that methods and/or alloys may be used throughout the industry, thereby reducing costs and making available higher strength cast aerospace components.

Comments are solicited on the potential utilization of the information contained herein as applied to present or future production programs. Suggestions concerning additional manufacturing technology development required on this subject are solicited.

* * * * *

PUBLICATION REVIEW

Approved by:



W. R. Varney
Chief, Materials Engineering

TABLE OF CONTENTS

| | <u>PAGE</u> |
|---|-------------|
| I INTRODUCTION | 1 |
| II CONTRACT SUMMARY | 1 |
| PHASE I - DEVELOPMENT AND EVALUATION OF FOUNDRY PROCESSING METHODS | 1 |
| PHASE II - TRIAL PRODUCTION | 1 |
| PHASE III - PILOT PRODUCTION | 1 |
| III CONCLUSION OF PHASE I - DEVELOPMENT AND EVALUATION OF FOUNDRY PROCESSING METHODS | 2 |
| Mg-Zn-Ag-Zr CASTING ALLOY SYSTEM | 2 |
| ZQ64 EVALUATION | 2 |
| ZQ71 | 5 |
| ZQ91 | 12 |
| PHASE I - ALUMINUM ALLOY SYSTEMS | 13 |
| IV PHASES II AND III CASTINGS | 21 |
| STRESS CORROSION ASPECTS | 27 |
| V WORK PROJECTED FOR NEXT QUARTER | 27 |
| DISTRIBUTION LIST | 32 |

LIST OF ILLUSTRATIONS

| <u>FIGURE</u> | | <u>PAGE</u> |
|---------------|---|-------------|
| 1 | TYPICAL SMALL PERMANENT MOLD CASTING WITH GATING MADE IN AN IRON MOLD CAVITY (PART NO. 4055698) | 6 |
| 2 | PART NO. 4655698, SHOWING TEST COUPON REMOVAL SITES | 7 |
| 3 | Mg-Zn-Ag-Zr CASTING ALLOYS PHASE I SAND CASTING | 14 |
| 4 | ZQ71 SEPARATELY CAST TEST BARS (.505) | 15 |
| 5 | PHASE I CASTING CONFIGURATION WITH GATING | 16 |
| 6 | STEPPED TEST CASTING WITH GATING PRODUCED IN AN IRON PERMANENT MOLD WITH AN INSERTED ALUMINUM MOLD CAVITY | 18 |
| 7 | COPE AND DRAG PATTERN FOR LANDING GEAR STRUT CYLINDER CASTING | 22 |
| 8 | GATING AND CHILLING OF LANDING GEAR STRUT CYLINDER CASTING MOLD | 23 |
| 9 | ALUMINUM ALLOY 356 CASTING MADE WITH FIRST MOLD RIGGING | 24 |
| 10 | ZQ64 MAGNESIUM ALLOY | 25 |
| 11 | ZQ64 CASTING AFTER SHAKEOUT | 26 |
| 12 | PATTERN FOR STRESS CORROSION TEST CAST RINGS | 28 |
| 13 | TYPICAL T-38 MAIN LANDING GEAR STRUT STRESS CORROSION TEST COUPON | 29 |
| 14 | ALTERNATE IMMERSION BATH FOR STRESS CORROSION TEST ON T-38 LANDING GEAR | 30 |

I INTRODUCTION

This report is the second in a series of interim reports concerning work performed under Contract AF 33(615)-1341 for development of aluminum and magnesium alloy systems and their associated quality cast parts of high strength levels.

The reporting period covered in this document extends from 1 August to 31 October 1964.

This report describes development work on the Mg-Zn-Ag-Zr alloys; further work on aluminum alloys ST60 and M710; development of a modified aluminum alloy 195; Phase II and Phase III configuration pattern; the first founding experience in the Mg-Zn-Ag-Zr alloy, and a general summary of the program development in terms of significance to the program objective.

II CONTRACT SUMMARY

The following brief summary of the primary contract work statement elements is presented for continuity of this report:

PHASE I - DEVELOPMENT AND EVALUATION OF FOUNDRY PROCESSING METHODS

- (a) Development and evaluation of foundry processing methods as related to the most advanced foundry techniques, with further development of those factors offering the most potential to achieve the advance performance characteristics for Air Force requirements.
- (b) Selection and evaluation of the most promising magnesium and aluminum base alloys for further development.

PHASE II - TRIAL PRODUCTION

- (a) Selection of one magnesium and one aluminum alloy which shows promise for high performance castings.
- (b) Production of experimental castings of each alloy using the best casting method, mold materials and processing.
- (c) Selection of casting configuration.
- (d) Testing of the resulting castings.

PHASE III - PILOT PRODUCTION

- (a) Produce 25 aluminum and 25 magnesium castings of the selected configuration of Phase II. These are to be tested metallurgically, environmentally, and statically.
- (b) Correlate test data in an attempt to improve current specifications, inspection standards, and design allowables.

III CONCLUSION OF PHASE I - DEVELOPMENT AND
EVALUATION OF FOUNDRY PROCESSING METHODS

Mg-Zn-Ag-Zr CASTING ALLOY SYSTEM

The Mg-Zn-Ag-Zr system of magnesium casting alloys was selected for casting development in this program. Metallurgy and founding principles peculiar to the system were obtained from J. W. Meier, Principal Metallurgist (Non Ferrous); and B. Lagowski, Senior Scientific Officer, Canadian Department of Mines and Technical Surveys, Mines Branch, Physical Metallurgy Division. This alloy system incorporates variables of zinc and silver content. These variables may be selected for tailoring alloys for specific engineering requirements in keeping with the new premium engineered concept of casting. Engineering requirements may vary with respect to ductility, tensile strength, and economy. Tensile testing and nondestructive testing performed to date indicate that these criteria may be favored, to a significant degree, by adjustment in zinc and silver content. For instance, a six percent zinc with four percent silver alloy may, in some configurations, produce the highest tensile properties, but might create a microporosity problem requiring time consuming mold rigging development to correct, and a more expensive production procedure with respect to chilling, feeding, and subsequent clean-up. There is ample evidence in actual production that costs increase with mechanical properties and that such costs are congruent with sound economy and usefulness¹. Where the highest mechanical properties are not required, longer feeding distances and less tendency to develop microporosity can be achieved by increasing zinc and decreasing silver in the alloy².

ZQ64 EVALUATION

The first casting effort designated E0001 was with ZQ64, (four percent silver) which would allow an economical use of remelts (gates, risers, and pigs) in subsequent melts using less silver. The load consisted of:

| | | |
|----------------------|-------------------|-------------|
| Magnesium | 99.9 percent pure | 75.0 pounds |
| Electrolytic Zinc | 99.9 percent pure | 5.0 pounds |
| Fine Silver Shot | 99.9 percent pure | 3.33 pounds |
| Fused Zirconium Salt | | 8.30 pounds |

The fused salt³ was a mixture of 2 parts zirconium tetrachloride, 1 part sodium chloride and one part potassium chloride, and contains approximately 20 percent zirconium by weight. Melting was performed in a steel crucible heated in a gas-fired furnace. The magnesium was melted, using Dow 310 flux to prevent burning during the melt-down. The zinc was added to the magnesium at 1300F, and the silver at 1400F. After thoroughly stirring this alloy the fused salt was added at 1400F by containing it in an iron basket until dissolved. The melt was then stirred ten minutes, with a rolling motion from the bottom to the top, while Dow 310 flux was added to control surface burning. After fifteen minutes settling time two samples were taken; one for grain size examination, and one for spectroscopic determination of the zirconium content. Examination showed fine grain and zirconium content of 0.85 percent.

The melt was brought to 1450F, then the crucible was removed from the furnace. Fluorspar was sprinkled on the surface of the melt and the thickened flux skimmed off, using Dow 180 agent to control burning. When the melt was ready to be poured, it was noticed that more liquid flux was rising to the surface, so the crucible was replaced in the furnace to maintain temperature while more fluorspar was added and more skimming done until the surface of the melt appeared flux free.

The molding sand for this casting effort was a 50-50 combination of 35 and 70 AFS fineness Ventura sand, bonded with 2 percent western and 4.5 percent southern bentonite, and inhibited with 2 percent sulphur, 0.3 percent boric acid and 0.5 percent diethyleneglycol.

Two spiral fluidity molds, (2) 0.505 inch diameter test bar molds, and (3) Phase I test casting molds were rammed and coated with carbon black (amorphous carbon).

After pouring the molds, more flux rose to the surface which appeared to contain some metal, so the remainder of the melt was pigged. It was concluded that the difficulty in removing the flux was caused by the closeness of the specific gravity of the Dow 310 flux and the alloy, preventing separation of the flux from the metal. To eliminate this problem HE Blue flux was successfully evaluated and will be used for further work in this magnesium casting alloy system.

Solution heat treatment of the test castings was scheduled at 850F in sulphur dioxide furnace (SO₂) atmosphere for 5 hours. Unfortunately, after 4 hours and 40 minutes, the castings ignited and were reduced to ashes. Apparently, the concentration of SO₂ in the atmosphere had become too weak to inhibit ignition, although external controls appeared to be functioning correctly.

Significant observations from this casting effort are indicated below. Fluidity as indicated by the spiral extension, is comparable to alloy AZ91. Uncoated spirals reached mark 20 compared to mark 22 for AZ91, but carbon black coated spirals reached mark 23 3/4 compared with mark 24 for AZ91; zirconium content was determined spectrographically at 0.85 percent after 15 minutes of settling, 0.83 percent after 45 minutes, and 0.80 percent after 65 minutes (which was immediately before pouring). Zinc content was analyzed at 6.2 percent by spectrographic analysis of a test casting and the silver content at 4.19 percent by wet analysis. The average mechanical properties of the as cast test bars were as follows:

| | |
|------------------------|-------------|
| Tensile strength | 32,700 psi |
| Yield strength | 19,600 psi |
| Elongation in 2 inches | 4.5 percent |

ZQ64 - Mechanical Properties

A second melt of ZQ64, designated E0004, was prepared and poured under the same foundry conditions reported for melt E0001 except that HE Blue flux was used with no problems of flux removal from the melt. Mechanical properties were as follows:

Sand Castings

Separately Cast .505 inch diameter Test Bars

| <u>Heat Treat Condition</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inch</u> |
|-----------------------------|------------------------------|----------------------------|-------------------------------------|
| As cast | 33,000 | 21,000 | 4.0 |
| T4 (Solution 830F) | 47,000 | 19,000 | 13.0 |
| T6 (Solution 830F) | | | |
| ranged from a low of | 48,000 | 32,000 | 6.0 |
| to a high of | 51,000 | 30,000 | 9.0 |

Sand Cast Phase I Casting

| Section Thickness | <u>-T4 Condition</u> | | | <u>-T6 Condition</u> | | |
|-------------------|--------------------------------|------------------------------|---|--------------------------------|------------------------------|---|
| | <u>Tensile Strength</u> psi | <u>Yield Strength</u> psi | <u>Elongation</u> Percent in 2 inches | <u>Tensile Strength</u> psi | <u>Yield Strength</u> psi | <u>Elongation</u> Percent in 2 inches |
| .750 | 40,600 | 17,800 | 10.0 | 46,500 | 32,700 | 5.5 |
| .250 | 44,700 | 22,500 | 10.0 | 48,000 | 36,500 | 5.0 |
| .500 | 38,800 | 20,400 | 7.5 | 43,300 | 32,400 | 4.0 |
| .250 | 40,200 | 21,600 | 8.0 | 43,500 | 35,700 | 3.5 |
| .380 | 41,800 | 25,100 | 6.0 | 47,300 | 34,500 | 7.0 |
| .125 | 41,900 | 28,700 | 8.0 | 40,600 | 34,700 | 2.0 |
| .125 | -- | -- | -- | 46,100 | 31,600 | 6.0 |
| .125 | -- | -- | -- | 49,800 | 34,500 | 12.0 |

Permanent Mold Cast

Separately Cast .505 inch Diameter Test Bars

| <u>Heat Treat Condition</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation</u> Percent in 2 inches | <u>Quality</u> (ASTM E155-60T) |
|-----------------------------|------------------------------|----------------------------|--|-----------------------------------|
| As Cast | 31,100 | -- | 5.0 | #4 Microporosity |
| T4 Air Quench | 38,900 | 19,600 | 8.0 | #4 Microporosity |
| T6 Air Quench | 42,400 | 28,600 | 3.5 | #4 Microporosity |

(Water Quenched Cast Bars Cracked)

Permanent Mold Stepped Castings

| <u>Section Thickness</u> | <u>Quench Method</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation</u> Percent in 2 inches | <u>Quality</u> |
|--------------------------|----------------------|------------------------------|----------------------------|--|--|
| 1.00 | Air | 36,100 | 28,400 | 3.0 | 6-7 Micro- porosity |
| .50 | Air | 44,800 | 30,900 | 7.0 | 5-6 " |
| .30 | Air | 43,000 | 33,600 | 4.5 | 2-3 " & Flux inclusions |
| .30 | Water | 41,000 | 35,000 | 2.5 | 2-3 " " |
| .20 | Water | 43,700 | 35,400 | 3.0 | 4-6 Micro- porosity & Flux inclu- sions |
| .10 | Air | 42,400 | 33,600 | 4.0 | 5-7 Micro- porosity |
| .10 | Water | 39,200 | 32,700 | 1.5 | 5-7 " & Flux inclusions |

ZQ64 Quality

Microporosity observed in the Phase I castings was less than that of ASTM E155-60T Grade 1. In the similar permanent mold stepped casting, microporosity ranged from Grade 2 to 3 in the 0.380 inch section to Grade 7 in the 0.100 inch section. It is interesting to note how insensitive the tensile properties are to such gross microporosity. Fluorescent penetrant inspection revealed gas pin holes approaching Grade 1 in the appearance of flow lines.

Part Number 4655698 (Figures 1 and 2)

ZQ64 was cast in this production permanent mold and coupons existed as noted. Mechanical properties were noticeably improved by water quench:

| <u>Coupon Identity</u> | <u>Quench Method</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> | <u>Quality (ASTM E1555-60T)</u> |
|------------------------|----------------------|------------------------------|----------------------------|---------------------------------------|---------------------------------|
| *L (Flat) | Air | 48,100 | 36,900 | 7.0 | 1 |
| H (Round) | Air | 50,500 | 34,250 | 9.4 | 1 |
| H (Round) | Water | 51,000 | 35,150 | 14.1 | 1 |

* Specimen failed prematurely because of a flaw.

ZQ71

An experimental casting effort in ZQ71 designated H0001 was made. The load consisted of:

| | |
|----------------------|-------------------------------|
| Alloy ZQ64 | 20.0 pounds |
| Magnesium | 99.9 percent pure 59.4 pounds |
| Zinc | 99.9 percent pure 4.6 pounds |
| Fused Zirconium Salt | 7.0 pounds |

Melting practice was similar to that used with ZQ64 except that the HE Blue flux was used with no problems of flux removal.

The sand was 35-70 sand as used for ZQ64, which tested:

| | |
|----------------------------|-------------|
| Permeability | 86 AFA |
| Green Compressive Strength | 11.5 psi |
| Moisture | 3.4 percent |

Four 0.505 inch diameter test bar molds with four cavities each, three spiral fluidity molds, two chilled Phase I casting molds, and one unchilled Phase I casting mold were rammed and poured. The castings were solution heat treated at 860F for 16 hours. Added precautions included a new bottle of sulphur dioxide (SO₂) and additional thermocouple probes which were placed in different furnace locations near the castings.

Iron pyrite was placed in the furnace to provide an additional source of sulphur dioxide to the regular supply which is fed from a liquified sulphur dioxide tank.

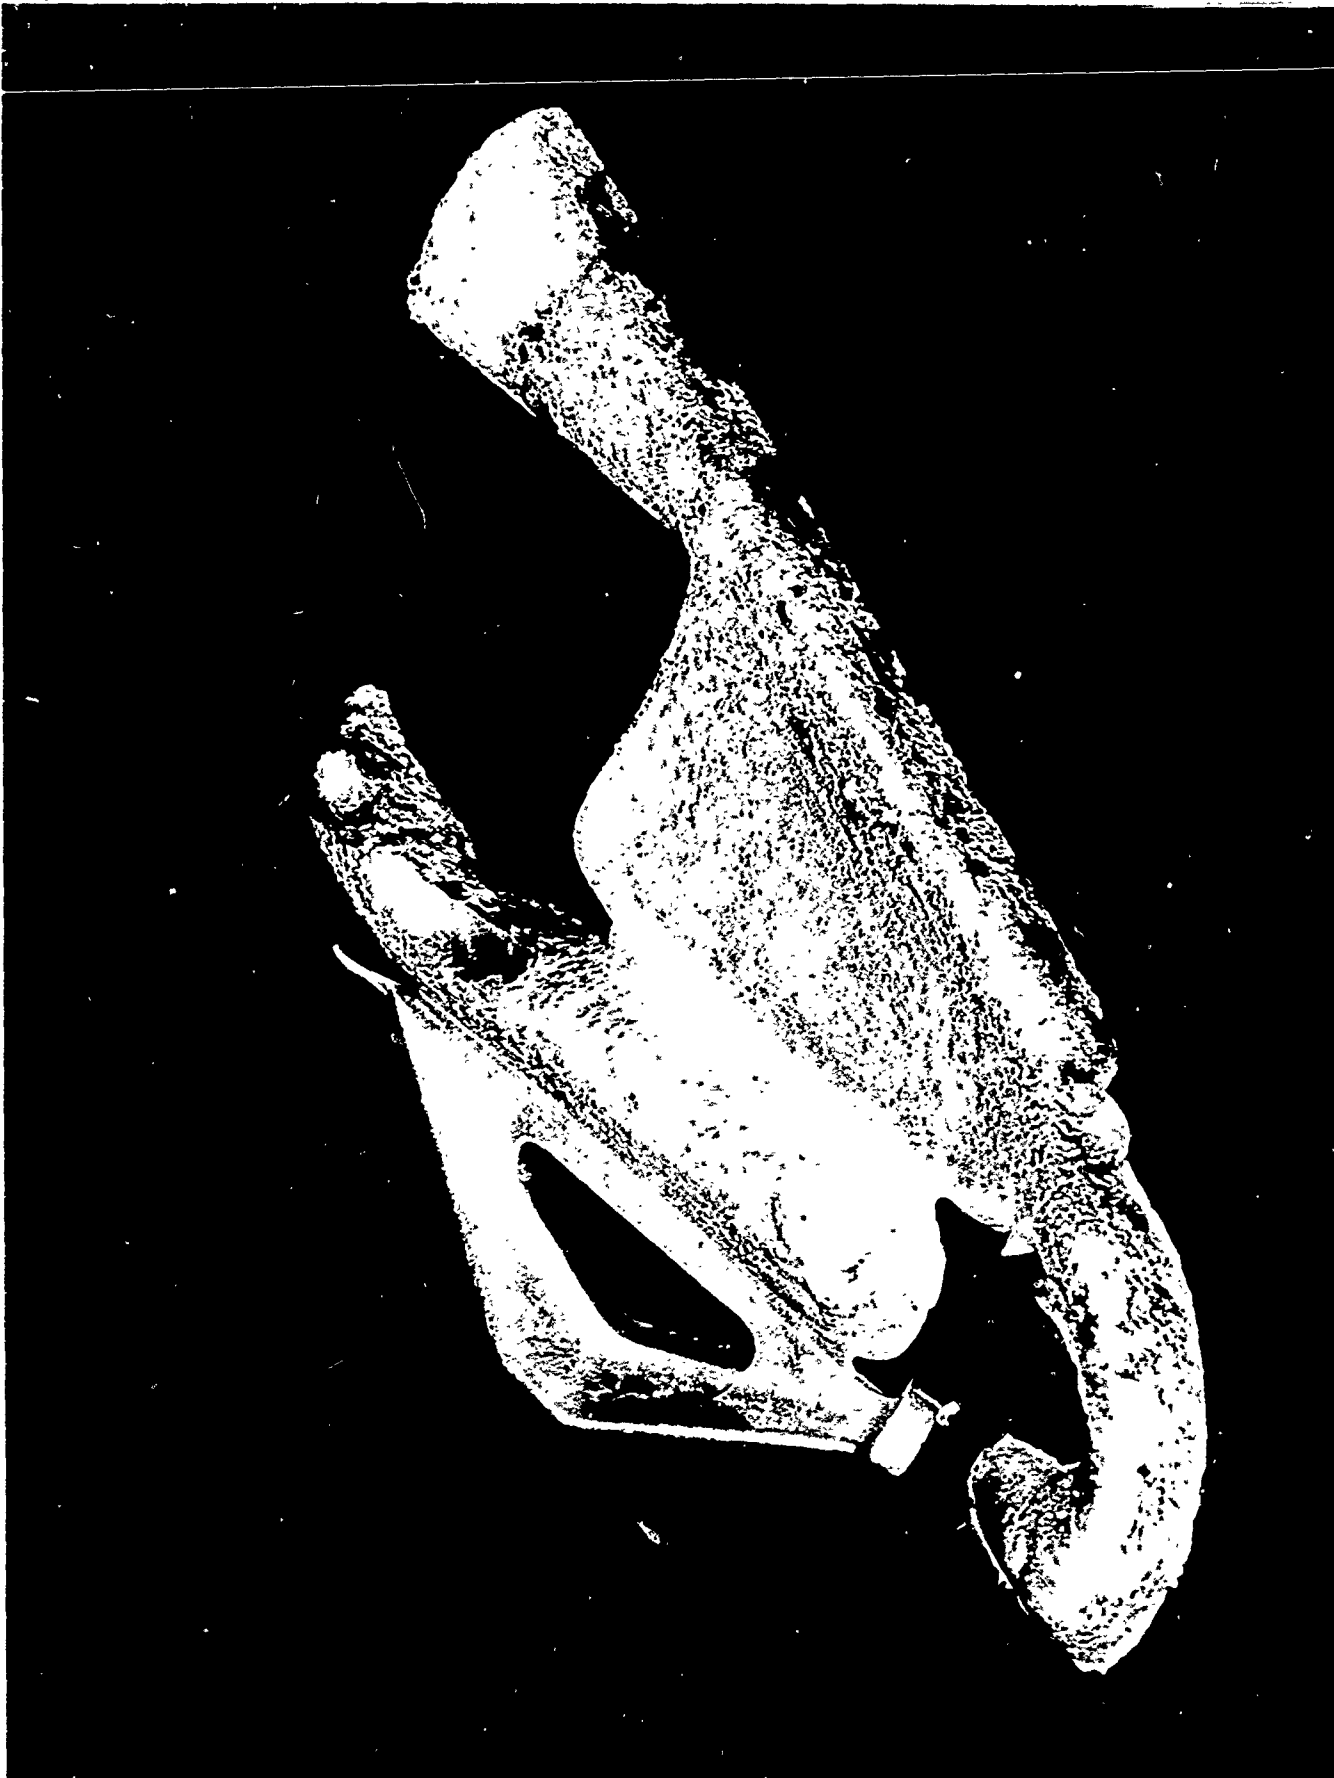


FIGURE 1 TYPICAL SMALL PERMANENT MOLD CASTING WITH GATING MADE IN AN IRON MOLD CAVITY (PART NO. 4055698)



FIGURE 2 PART NO. 4655698, SHOWING TEST COUPON REMOVAL SITES

Quenching was done by cold air blast, and the parts were subsequently aged at 300F for 48 hours.

Fluorescent penetrant inspection indicated good quality castings with no cracks or cold shuts. X-ray inspection of the chilled castings revealed excellent quality in the 0.12 inch and 0.15 inch thick sections of the test castings, approximately Grade 1 microporosity in the 0.38 and 0.50 inch sections, and Grade 2 in the 0.75 inch sections. (Graded according to ASTM E155-60T). The unchilled casting had very heavy spongy microshrinkage; approximately Grade 8 in the heavy areas, approximately Grade 5 in the 0.38 inch area, Grade 2 in the 0.25 inch thick area and no microporosity in the 0.12 inch thick area. A logical conclusion is that thin areas can be solidified (with respect to grosser types of radiographic micro-discontinuities) with good quality without chills providing feeding is not starved, and that feeding distances are shortened in proportion to section thickness.

The zinc and zirconium contents were determined spectographically at 7.2 and 0.84 percent respectively. The silver content was determined by wet analysis at 0.84 percent.

Tensile test results for the 0.505 diameter test bars were as follows:

| <u>Heat Treat Condition</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|-----------------------------|------------------------------|----------------------------|---------------------------------------|
| T4 | 36,800 | 18,200 | 8.5 |
| T6 | 45,400 | 30,400 | 5.7 |
| As Cast | 37,400 | 20,700 | 6.5 |

Values for the As Cast and T4 conditions are reported from the test of one bar each and for the T6 condition from an average of 3 bars.

The hot shortness characteristic of ZQ71 has not been found to be critical. The vertical tabs on the Phase I test casting, placed there for determining this characteristic, showed on cracking tendency, and permanent mold castings in both aluminum and iron molds did not exhibit cracks which would indicate problems of any great magnitude.

Microshrinkage is intense in heavy sections when a strong directional solidification is not induced by chills and gating, or risers. The following table summarizes the radiographic inspection of stepped castings in both sand and permanent mold, with respect to spongy microshrinkage.

| <u>Section Thickness</u> | <u>Phase I Sand Casting</u> | | <u>* Permanent Mold Stepped Casting</u> |
|--------------------------|-----------------------------|------------------|---|
| | <u>Chilled</u> | <u>Unchilled</u> | |
| .100-.120 | Less than 1 | Less than 1 | 6 |
| .200-.250 | Less than 1 | Less than 2 | 3 |
| .300-.380 | 1 | 5 | 4 |
| .500 | 1 | 8 | 6 |
| .750-1.00 | 2 | 8 | 8 |

* Graded per ASTM E155-60T.

ZQ71 Mechanical Properties

The mechanical property averages for ZQ71 in various heat treat conditions and cast in various molding media are as follows:

Sand Castings

Separately Cast Test Bars

| <u>Heat Treat Condition</u> | <u>Tensile Strength,psi</u> | <u>Yield Strength,psi</u> | <u>Elongation Percent in 2 inches</u> |
|---------------------------------------|-----------------------------|---------------------------|---------------------------------------|
| As Cast | 37,400 | 20,700 | 6.5 |
| T4 Solution at 840F air quench | 44,200 | 16,300 | 15.5 |
| T4 Solution at 840F with water quench | 44,400 | 18,300 | 16.0 |
| T6 Air quench heavy blast | 48,600 | 30,300 | 5.5 |
| T6 Water quench | 48,100 | 31,800 | 2.5 |
| T6 Air quench moderate blast | 46,200 | 30,400 | 6.0 |

Phase I Casting - T6 Condition

| <u>Section Thickness</u> | <u>Quench Method</u> | <u>Tensile Strength,psi</u> | <u>Yield Strength,psi</u> | <u>Elongation Percent in 2 inches</u> |
|--------------------------|----------------------|-----------------------------|---------------------------|---------------------------------------|
| .75 | Air | 45,500 | 29,500 | 10.0 |
| .25 | Air | 47,200 | 32,200 | 13.0 |
| .50 | Air | 46,300 | 31,300 | 12.5 |
| .50 | Water | 47,500 | 35,000 | 9.5 |
| .25 | Air | 45,900 | 31,700 | 10.5 |
| .38 | Air | 48,200 | 35,300 | 6.0 |
| .12 | Air | 36,700 | 32,600 | 9.5 |
| .12 | Air | 45,200 | 31,400 | 10.0 |
| .12 | Water | 49,200 | 36,500 | 10.0 |

Permanent Mold

Separately Cast Test Bars

| <u>Heat Treat Condition</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|------------------------------|------------------------------|----------------------------|---------------------------------------|
| As Cast | 35,500 | 17,000 | 8.0 |
| T4 Condition Air Quench | 39,600 | 18,200 | 14.0 |
| T4 Condition Water Quench | 39,600 | 15,800 | 13.0 |
| T6 Condition Air Quench | 45,100 | 29,200 | 6.5 |
| T6 Condition Water Quench | 46,600 | 29,900 | 6.0 |

Stepped Casting - T6 Condition

| <u>Section Thickness</u> | <u>Quench Method</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|--------------------------|----------------------|------------------------------|----------------------------|---------------------------------------|
| .500 | Air | 39,300 | 38,800 | 3.0 |
| .300 | Air | 40,400 | 30,200 | 3.5 |
| .200 | Air | 44,700 | 34,100 | 6.5 |
| .100 | Air | 43,700 | 32,700 | 5.0 |

Casting No. 4655698

| | | | | |
|------|-------|--------|--------|------|
| .100 | Air | 44,100 | 33,800 | 6.0 |
| .100 | Water | 45,000 | 35,600 | 4.0 |
| .250 | Air | 48,900 | 34,100 | 4.1 |
| .250 | Water | 50,300 | 36,500 | 14.1 |

A review and analysis of the foregoing test data indicates that the effect of soundness, chilling, and heat treating practices on the mechanical properties of ZQ71 may be summarized thus:

Tensile Strength

Unchilled separately sand cast .505 inch diameter test bars had an average tensile strength of 48,600 psi when air quenched before a strong fan blast; 48,100 psi when water quenched, and 46,600 psi air quenched before a weak blast.

Permanent mold separately cast test bars averaged 45,100 psi when quenched in water. Considering the Grades 4 and 5 (ASTM E155-60T) microshrinkage found in these test bars, these results are excellent when compared with the less than Grade 1 in the sand cast test bars.

In chilled sand castings with thick and thin sections (Phase I test castings) tensile strengths ranged from 45,200 psi to 48,200 psi in air quenched castings, and 47,500 psi to 49,200 psi in water quenched castings. Section thickness had little effect on tensile strength. For instance, 45,200 psi was exhibited in the 0.12 inch section and 45,500 psi in the 0.75 inch section, with 48,200 psi obtained in the 0.38 inch section.

Permanent mold castings appear to be practical when thin, fairly uniform, sections are specified. Properties in Part No. 4655698, which has fairly uniform sections and did not develop microshrinkage, ranged from 44,100 psi air quenched to 50,300 psi water quenched.

Yield Strength

| <u>Sand Casting</u> | <u>Quenching Method</u> | |
|--------------------------|-------------------------|----------------------|
| | <u>Air</u> | <u>Water</u> |
| 0.505 Diameter Test Bars | 30,300 psi | 31,800 psi |
| Phase I castings | 29,500 to 32,600 psi | 35,000 to 36,500 psi |

Permanent Mold Castings

| | | |
|--------------------------|----------------------|----------------------|
| 0.505 Diameter Test Bars | 29,200 psi | 29,900 psi |
| Stepped Casting | 28,800 to 34,100 psi | 35,600 to 36,500 psi |

Elongation

Elongation in separately sand cast 0.505 inch diameter test bars ranged from 5.5 to 6.0 percent air quenched, but dropped to 2.5 percent when water quenched. Permanent mold separately cast .505 inch test bars ranged from 6.0 to 6.5 percent in spite of microshrinkage which appears to be inherent in permanent mold castings in this alloy. Chilled sand castings averaged 10 percent whether air or water quenched. Elongation in permanent mold specimens ranged from 3 to 14 percent and was proportional to the intensity of the microshrinkage. Water quenching did not affect elongation.

ZQ71 Phase I Summary

Alloy ZQ71 has good fluidity, and hot shortness is not a serious problem. Feeding capability is poor, but proper rigging will overcome this difficulty and should contribute to good premium strength castings. There is a tendency for dross and flux contamination. Mechanical properties obtained are worth the effort. Chilling and interspersed gating will have to be used extensively because of relatively short feeding distances. Large or complex castings will be proportionately difficult to produce with optimum properties throughout. It should be mandatory that stress zone marking be furnished for practical economical utilization of the capabilities of magnesium alloy ZQ71.

It is recommended that foundry practice should provide for more than one screen in the gating, dross traps, careful sand analysis and inert gas purging of the mold cavity before pouring.

ZQ91

As recommended by J. W. Meier, a melt of ZQ91 designated J0001 was prepared. Mr. Meier had done work with this alloy at the Canadian Bureau of Mines and found castings to be exceptionally free of microporosity while exhibiting mechanical properties somewhat comparable to other alloys of the Mg-Zn-Ag-Zr system.

The charge was composed of:

| | | |
|------------------------------|-------------------|-------------|
| Magnesium | 99.9 percent pure | 27.0 pounds |
| Gates & pigs from melt H0002 | | 55.0 pounds |
| Zinc | 99.9 percent pure | 3.6 pounds |
| Fine silver shot | | .3 pound |
| Fused zirconium salts | | 6.0 pounds |

Sand molds were prepared as follows:

- 1 Phase I casting with no chills
- 1 Phase I casting with small chill (1.25 inch wide)
- 1 Phase I casting with heavy chill (2.50 inch wide)
- 1 spiral fluidity casting
- 2 4-cavity 0.505 inch test bars
- 5 stress corrosion test rings

The castings were solution heat treated at 750F for 5 hours, using approximately 2 percent concentration of SO₂ gas atmosphere plus iron pyrite in the furnace. Thermocouples were placed on the castings for accurate temperature control. Quenching was done with a strong blast of room temperature air, and 2 test bars were quenched in 190F water. All but 2 test bars were aged at 265F for 48 hours and these two test bars were not aged.

Mechanical Properties

Mechanical Properties resulted as follows:

Phase I Test Casting - With no Chills

| <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> | <u>Microporosity</u> |
|--------------------------|------------------------------|----------------------------|---------------------------------------|----------------------|
| .75 | 42,400 | 32,400 | 5.0 | Grade 5 |
| .25 | 41,500 | 30,700 | 4.0 | Grade 4 |
| .50 | 38,500 | 28,600 | 3.0 | Grade 6 |
| .25 | 44,400 | 30,800 | 6.0 | Less than 1 |
| .38 | 47,000 | 32,200 | 8.5 | Less than 1 |
| .12 | 40,600 | 30,000 | 4.0 | Less than 1 |

Phase I Test Casting - With Small Chill

| <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> | <u>Microporosity</u> |
|--------------------------|------------------------------|----------------------------|---------------------------------------|----------------------|
| .75 | 42,400 | 29,800 | 5.0 | 1 |
| .25 | 44,900 | 31,600 | 6.5 | 1 |
| .50 | 44,800 | 30,700 | 7.5 | 1 |
| .25 | 47,100 | 31,500 | 11.0 | 1 |
| .38 | 44,600 | 30,900 | 7.5 | 1 |
| .11 | 41,200 | 34,000 | 3.0 | 1 |

Phase I Test Casting - With Heavy Chill

| <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> | <u>Microporosity</u> |
|--------------------------|------------------------------|----------------------------|---------------------------------------|----------------------|
| .75 | 43,200 | 29,150 | 5.0 | 1 |
| .25 | 43,250 | 30,900 | 4.5 | 1 |
| .50 | 43,000 | 30,450 | 5.5 | 1 |
| .25 | 45,900 | 29,650 | 7.5 | 1 |
| .38 | 44,700 | 31,150 | 7.0 | 1 |
| .12 | 44,450 | 31,950 | 5.5 | 1 |

These reports indicate that ZQ91 produces nearly optimum mechanical properties, when properly fed without chills in thin sections; properties drop a little as sections increase, and are subject to rejectionable microporosity in heavy sections. They also indicate that moderate chilling is as effective as heavy chilling.

The graphs shown in Figures 3 and 4 summarize test data of the Mg-Zn-Ag-Zr testing accrued through Phase I activity.

PHASE I ALUMINUM ALLOY SYSTEMS

M710

Appendix I of interim Report Number One, listed some typical properties obtained from M710 cast in the Phase I pattern molds before the gating had been modified. It was noted that test bars excised from the castings were fracturing at the extreme end of the gage length opposite the gate. The gating was modified by placing runners and gating on both sides of the pattern (Figure 5) to supply good feeding; as a result better mechanical properties were obtained.

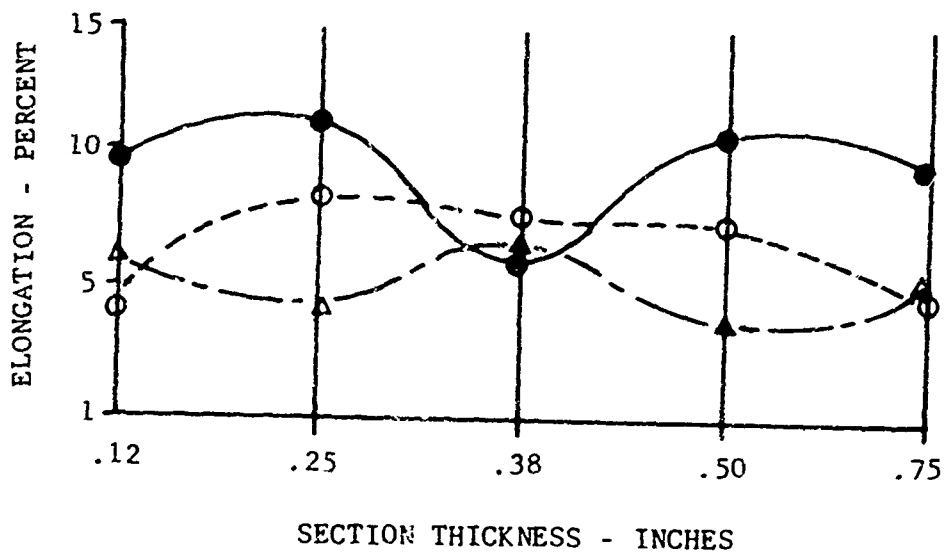
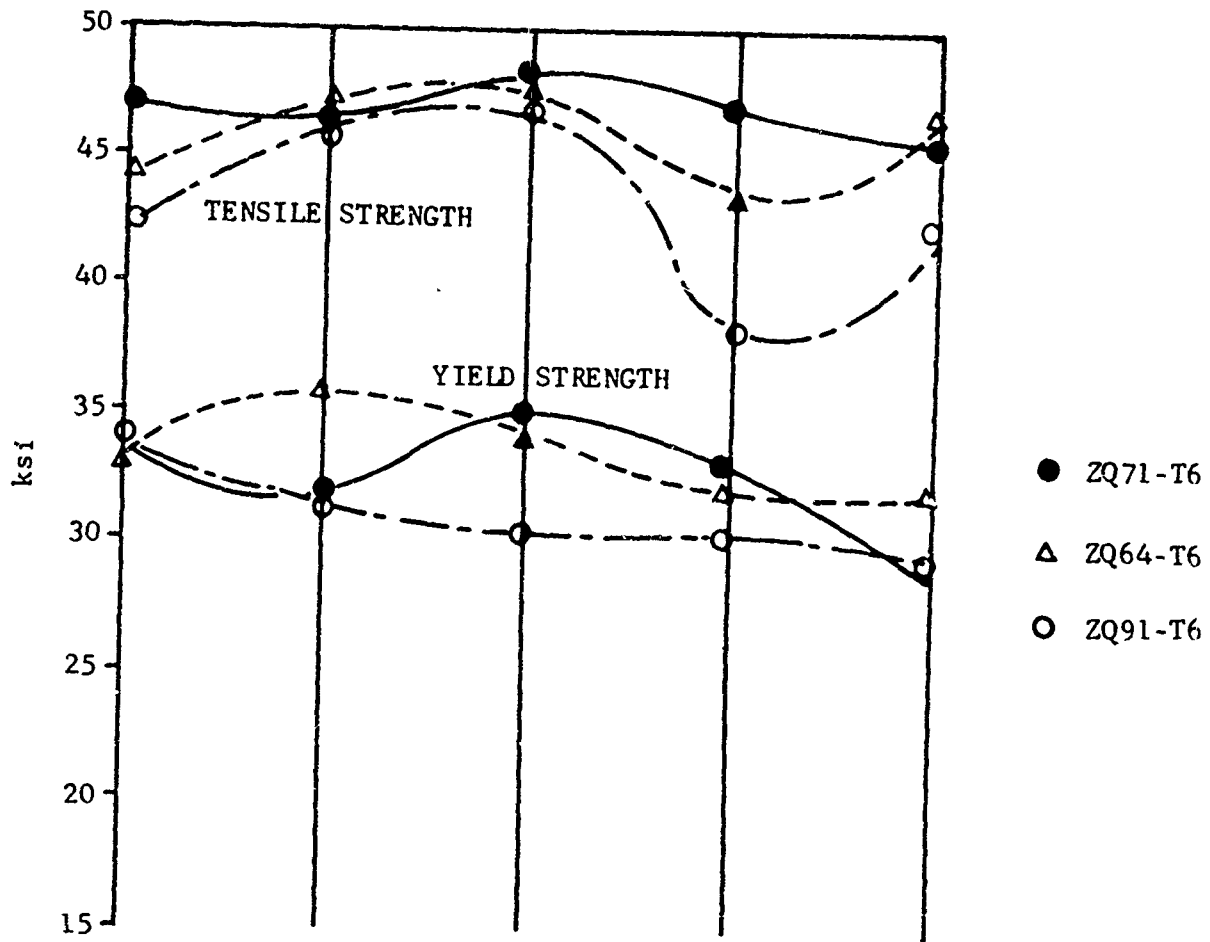


FIGURE 3 Mg-Zn-Ag-Zr CASTING ALLOYS PHASE I SAND CASTING

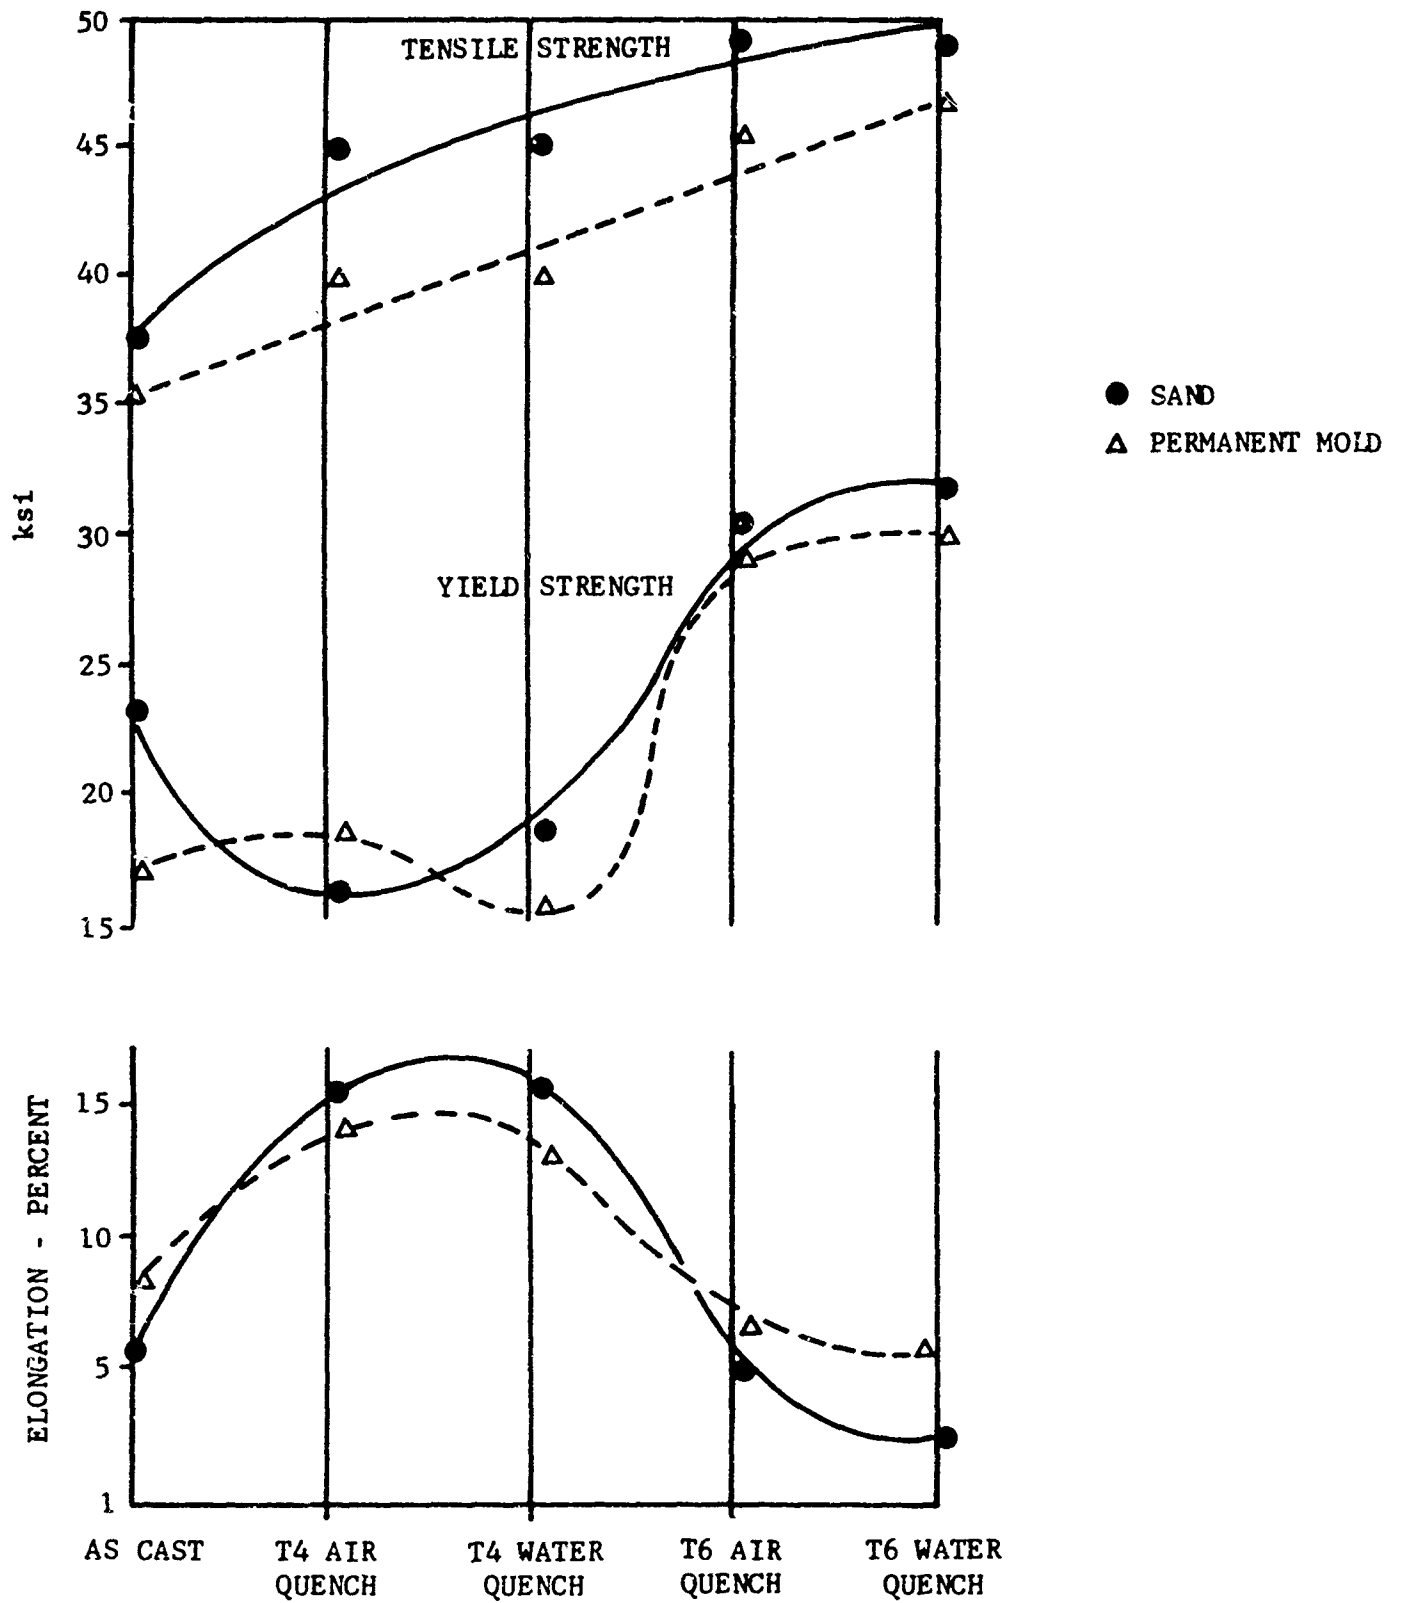


FIGURE 4 ZQ71 SEPARATELY CAST TEST BARS (.505)

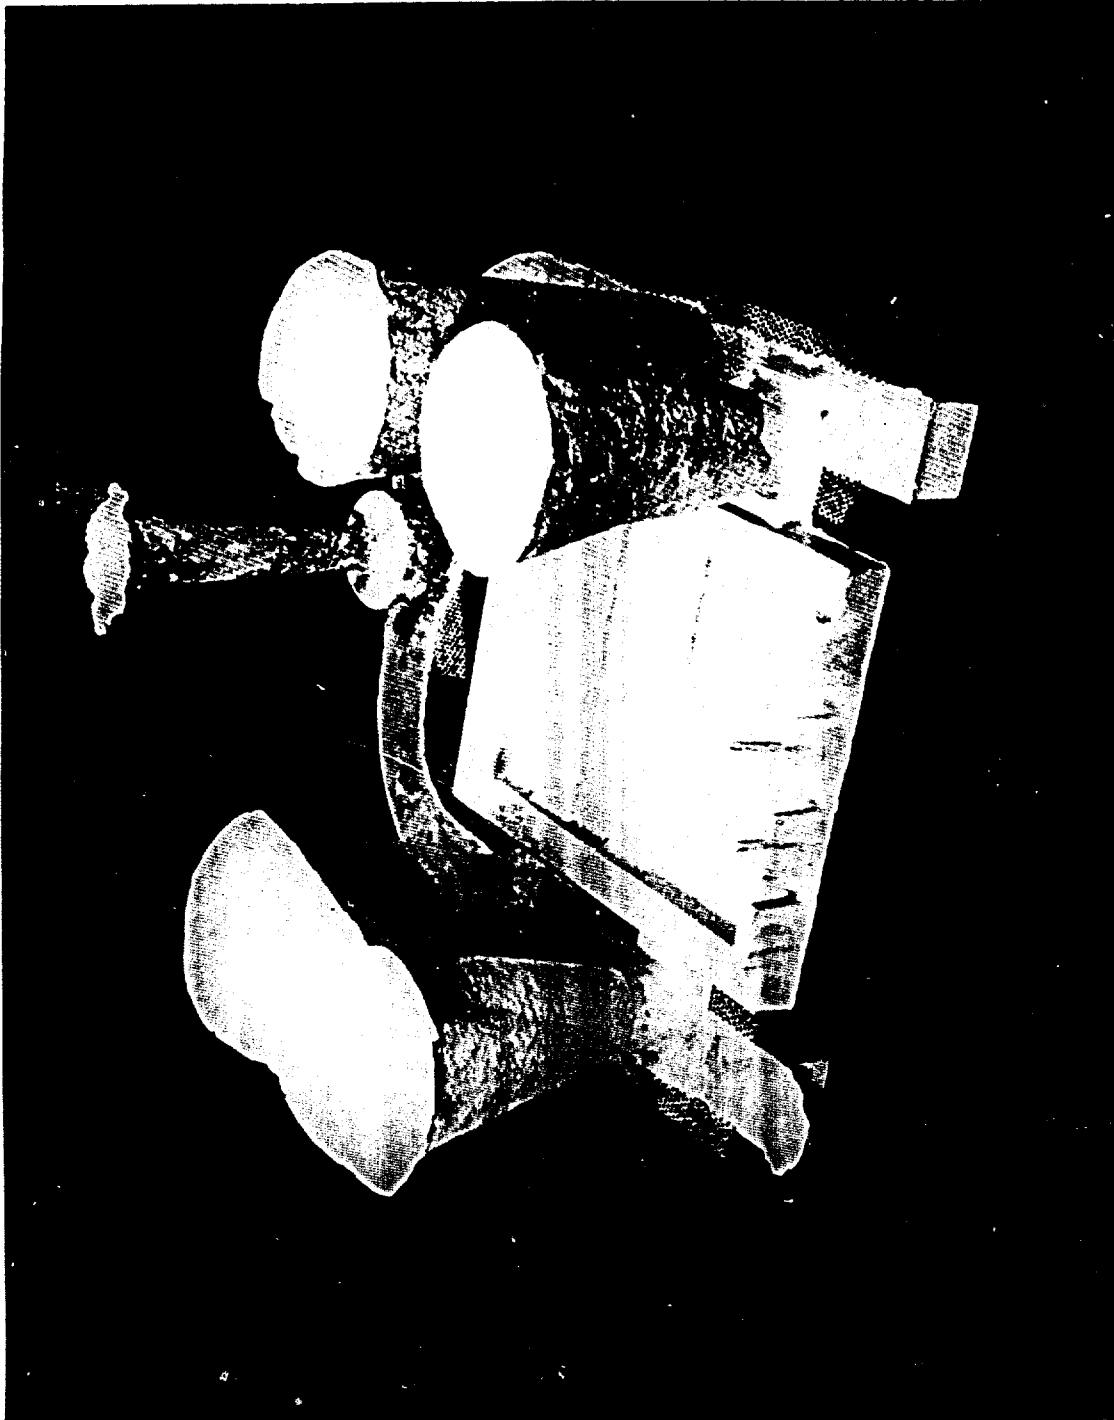


FIGURE 5 PHASE I CASTING CONFIGURATION WITH GATING

● SAND
▲ PERMANENT MOLD

Typical properties are as follows:

Sand Castings

Phase I Casting T6 Condition

| <u>Coupon Identity</u> | <u>Tensile Strength,psi</u> | <u>Yield Strength,psi</u> | <u>Elongation Percent in 2 inches</u> |
|------------------------|-----------------------------|---------------------------|---------------------------------------|
| 1 | 50,700 | 44,150 | 6.0 |
| 2 | 52,800 | 45,000 | 6.5 |
| 3 | 52,500 | 44,900 | 8.5 |
| 4 | 53,150 | 45,600 | 8.0 |
| 5 | 52,650 | 44,100 | 9.0 |
| 6 | 51,400 | 43,000 | 5.0 |
| 7 | 53,900 | 42,800 | 11.0 (in 1 inch) |

Permanent Mold, PART NO. 4655698

| | <u>Tensile Strength,psi</u> | <u>Yield Strength,psi</u> | <u>Elongation Percent in 2 inches</u> |
|-----------|-----------------------------|---------------------------|---------------------------------------|
| Round Bar | 53,400 | 51,200 | Insufficient gage length |
| Flat Bar | 57,050 | 53,650 | 3.0 (1.00 inch gage length) |

Permanent Mold Stepped Casting, Figure 6

| <u>Coupon Identity</u> | <u>Tensile Strength,psi</u> | <u>Yield Strength,psi</u> | <u>Elongation Percent in 2 inches</u> |
|------------------------|-----------------------------|---------------------------|---------------------------------------|
| 2 | 56,050 | 53,300 | 3.5 |
| 3 | 57,600 | 54,500 | 4.0 |
| 4 | 58,100 | 53,050 | 3.5 |
| 5 | 56,200 | 50,200 | 3.5 |

(Coupon No. 1, a one inch section, had a piping defect)

It is noticeable that this alloy responds favorably to rapid chilling. The stepped permanent mold is an aluminum mold cavity insert in an iron permanent mold which transfers heat more rapidly than conventional iron permanent molds. The difference in elongation between the sand castings and the permanent mold castings is considered to be a result of aging time and/or temperature variables rather than the molding method. It is interesting also to note how comparable the yield and tensile strengths are.

ST60

Previous reporting listed mechanical properties obtained from Phase I sand casting effort, using the Phase I pattern, as:

| <u>Tensile Strength,psi</u> | <u>Yield Strength,psi</u> | <u>Elongation Percent in 2 inches</u> |
|-----------------------------|---------------------------|---------------------------------------|
| High - 59,600 | 45,500 | 15.0 |
| Low - 55,150 | 42,300 | 9.0 |
| Average - 57,100 | 43,800 | 9.8 |

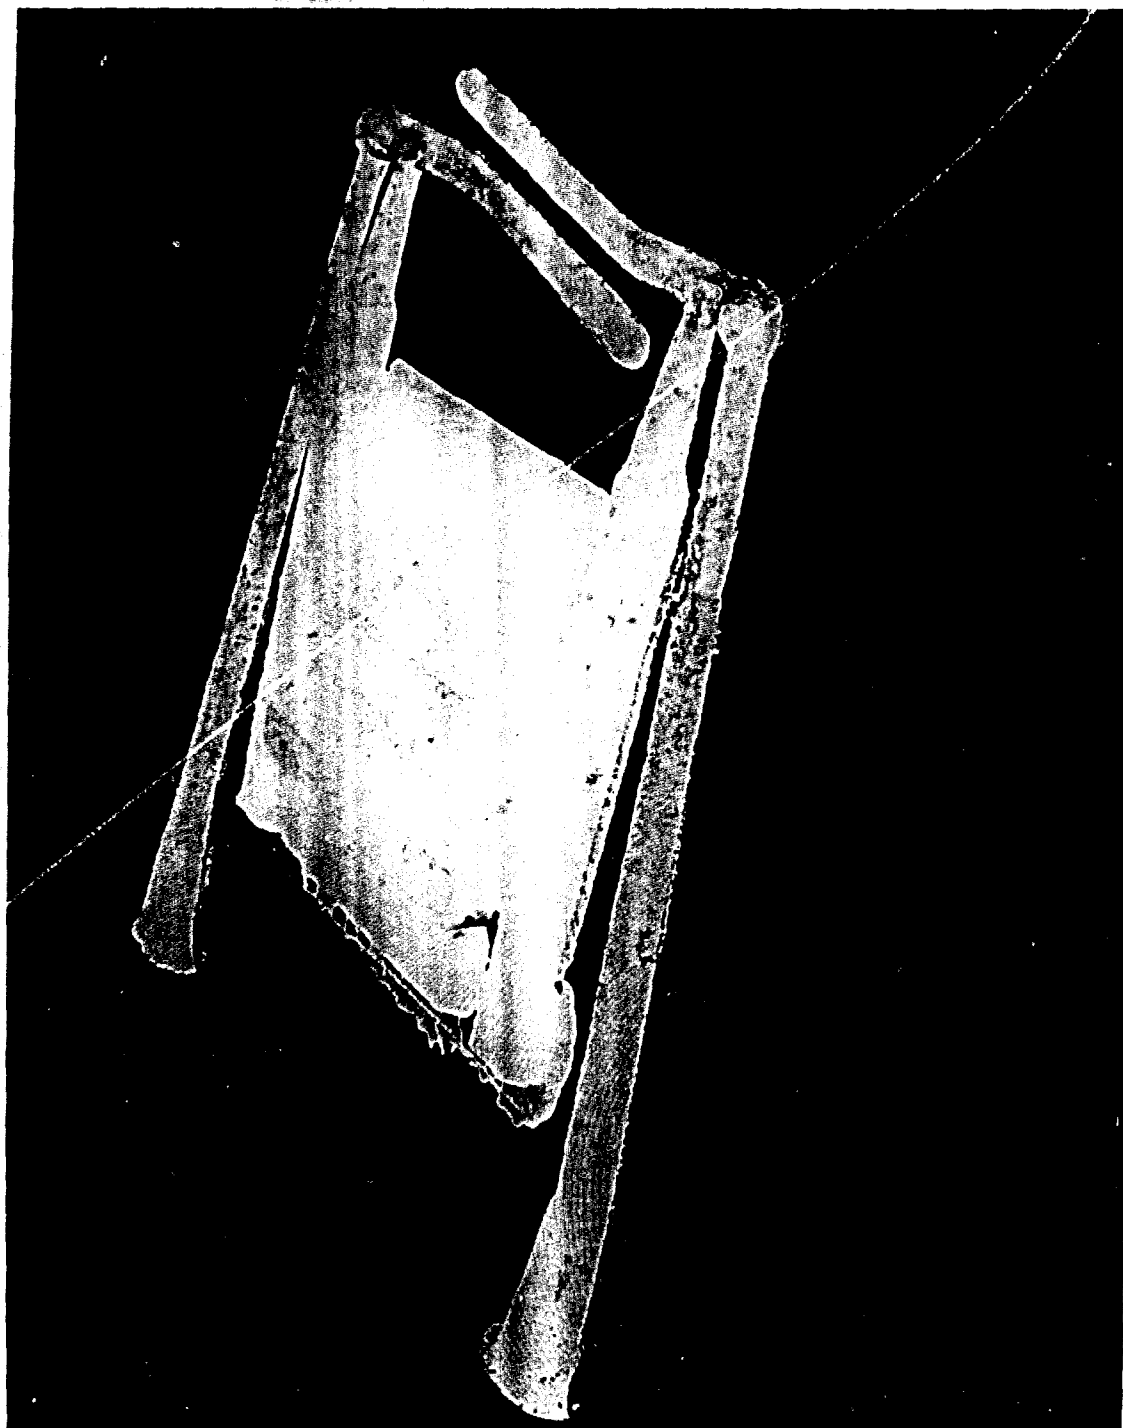


FIGURE 6 STEPPED TEST CASTING WITH GATING PRODUCED IN AN IRON PERMANENT
MOLD WITH AN INSERTED ALUMINUM MOLD CAVITY

The mechanical properties obtained from tests of specimens from the second and third heats which had been poured in Phase I sand molds with modified gating and using chills with only a light mold wash resulted as follows:

| <u>Coupon Identity</u> | <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|------------------------|--------------------------|------------------------------|----------------------------|---------------------------------------|
| 1-2 | .75 | 53,850 | 43,300 | 6.0 |
| 2-2 | .25 | 56,000 | 44,900 | 7.0 |
| 3-2 | .50 | 54,950 | 43,400 | 7.5 |
| 4-2 | .25 | 54,200 | 44,900 | 5.5 |
| 5-2 | .38 | 55,000 | 42,400 | 8.0 |
| 6-2 | .12 | 57,250 | 42,300 | 10.0 |
| 7-2 | .12 | 59,850 | 45,150 | 15.0 (in 1 Inch) |

The fourth heat was poured in a permanent mold, using the stepped aluminum insert mold referred to previously. Two castings solution heat treated at 930F for 20 hours and aged at 320F for 10 hours and 14 hours respectively were tested. Coupon number 1 was defective and not tested. The results were as follows:

| <u>Section Thickness</u> | <u>Coupon Identity</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|--------------------------|------------------------|------------------------------|----------------------------|---------------------------------------|
| .75 | 2-1 | 46,450 | 40,650 | 2.0 |
| .50 | 3-1 | 48,600 | 43,850 | 2.0 |
| .30 | 4-1 | 52,300 | 45,050 | 3.0 (flaw) |
| .20 | 5-1 | 49,300 | 44,900 | 2.0 (flaw) |
| .75 | 2-2 | 46,550 | 43,250 | 1.0 |
| .50 | 3-2 | 50,250 | 48,200 | 1.5 (flaw) |
| .30 | 4-2 | 52,650 | 49,350 | 2.0 (flaw) |
| .20 | 5-2 | 56,200 | 47,600 | 6.0 |

Modified Aluminum Alloy 195

Foundry metallurgists have, for years, endeavored to utilize the superior potential mechanical property capabilities of aluminum alloy 195, but have not progressed to the point of resolving hot short tendencies and susceptibility to stress corrosion. Recent developments in mold rigging and alloying have renewed the interest among foundrymen, so an effort in this direction is included in this program.

Mr. Joseph Raffin, Chief Metallurgist, Electronic Specialty Company, did some work in a radical modification of alloy 195 in 1962. As this alloy is considered proprietary, the chemistry will not be reported at this time. Several heats were poured in the Phase I casting and in the stepped permanent mold. Some of the results are listed as follows:

Phase I Test Casting -T6 Condition Unchilled

| <u>Coupon Identity</u> | <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|------------------------|--------------------------|------------------------------|----------------------------|---------------------------------------|
| 1 | .75 | 46,350 | 30,400 | 9.0 |
| 2 | .25 | 51,100 | 37,150 | 8.0 |
| 3 | .50 | 43,850 | 30,450 | 10.0 |
| 4 | .25 | 45,200 | 33,300 | 9.0 |
| 5 | .38 | 43,150 | 29,500 | 9.5 |
| 6 | .12 | 47,750 | 35,200 | 7.0 |
| 7 | .12 | 52,750 | 34,150 | 20.0 (in 1 inch) |

Phase I Test Casting -T6 Condition Chilled

| <u>Coupon Identity</u> | <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|------------------------|--------------------------|------------------------------|----------------------------|---------------------------------------|
| 1 | .75 | 60,000 | 38,200 | 11.0 |
| 2 | .25 | 63,650 | 44,100 | 11.0 |
| 3 | .50 | 58,700 | 45,000 | 11.5 |
| 4 | .25 | 59,900 | 43,350 | 12.5 |
| 5 | .38 | 60,550 | 39,700 | 14.0 |
| 6 | .12 | 64,100 | 39,700 | 12.0 |
| 7 | .12 | 65,900 | 43,750 | 20.0 (in 1 inch) |

Phase I Test Casting -T6 Condition Chilled

| <u>Coupon Identity</u> | <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|------------------------|--------------------------|------------------------------|----------------------------|---------------------------------------|
| 1 | .75 | 62,250 | 44,500 | 11.0 |
| 2 | .25 | 67,250 | 49,550 | 11.5 |
| 3 | .50 | 60,850 | 44,150 | 14.0 |
| 4 | .25 | 61,000 | 47,700 | 8.0 (flaw) |
| 5 | .38 | 58,050 | 45,550 | 14.0 |
| 6 | .12 | 64,400 | 46,900 | 9.0 |
| 7 | .12 | 67,550 | 48,350 | 16.0 (in 1 inch) |

This alloy apparently responds to heavily chilled sand casting with better results than to permanent mold casting. Two permanent mold stepped castings were poured, with the following results:

| <u>Coupon Identity</u> | <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|-------------------------|--------------------------|------------------------------|----------------------------|---------------------------------------|
| <u>Casting Number 1</u> | | | | |
| 1-1 | 1.00 | 53,250 | 45,700 | 4.0 |
| 2-1 | .50 | 58,950 | 45,550 | 10.0 |
| 3-1 | .30 | 53,650 | 49,250 | 3.0 |
| 4-1 | .20 | 62,800 | 49,250 | 8.0 |
| 5-1 | .10 | 61,950 | 46,900 | 10.00 |

| <u>Coupon Identity</u> | <u>Section Thickness</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|-------------------------|--------------------------|------------------------------|----------------------------|---------------------------------------|
| <u>Casting Number 2</u> | | | | |
| 1-2 | 1.00 | 45,100 | 36,350 | 3.5 |
| 2-2 | .50 | 55,750 | 37,800 | 11.0 |
| 3-2 | .30 | 53,700 | 41,500 | 4.5 |
| 4-2 | .20 | 62,350 | 38,550 | 11.0 |
| 5-2 | .10 | 58,350 | 41,650 | 9.5 |

Two permanent mold castings of Part No. 4655698 were tested with the following results:

| <u>Coupon Identity</u> | <u>Tensile Strength, psi</u> | <u>Yield Strength, psi</u> | <u>Elongation Percent in 2 inches</u> |
|-------------------------|------------------------------|----------------------------|---------------------------------------|
| <u>Casting Number 1</u> | | | |
| F-1 | 50,550 | 49,050 | 3.0 (flaw) |
| R-1 | 61,450 | 58,750 | 4.0 |

| | | | |
|-------------------------|--------|--------|------|
| <u>Casting Number 2</u> | | | |
| F-2 | 63,050 | 41,700 | 15.0 |
| R-2 | 57,800 | 40,000 | 6.0 |

IV PHASE II AND III CASTINGS

The basis for selection of the final test configuration included:

- Typical founding problems
- Direct comparison to correlative wrought product
- Current component need in Air Force weapon systems
- Availability of an existing environmental testing apparatus
- Configuration complexity sufficient to prove the adequacy of founding materials and processes

The T-38 Talon supersonic trainer nose landing gear strut cylinder met these needs. In addition, the severe static testing these parts will be subjected to, when Phase III castings are tested, may add more quantitative information to the growing realization that there may be stress redundancy in premium quality castings, not usually considered in stress analysis.

A cope and drag pattern was prepared, Figure 7, gating and chilling tried for first casting attempt, Figure 8, and a casting produced in aluminum alloy A356, Figure 9. With this rigging, one each of ZQ64, ZQ71, and modified 195 alloy have been poured to test the effect of gating and chilling. (Figures 10 and 11)

The ZQ71 casting did not exhibit fluorescent penetrant or X-ray defects caused by hot shortness, but ZQ64 and modified 195 alloys had some hot cracking. The rigging will be modified to correct this before further casting effort is made.

Tensile testing of the landing gear strut cylinder castings has not been accomplished to date.

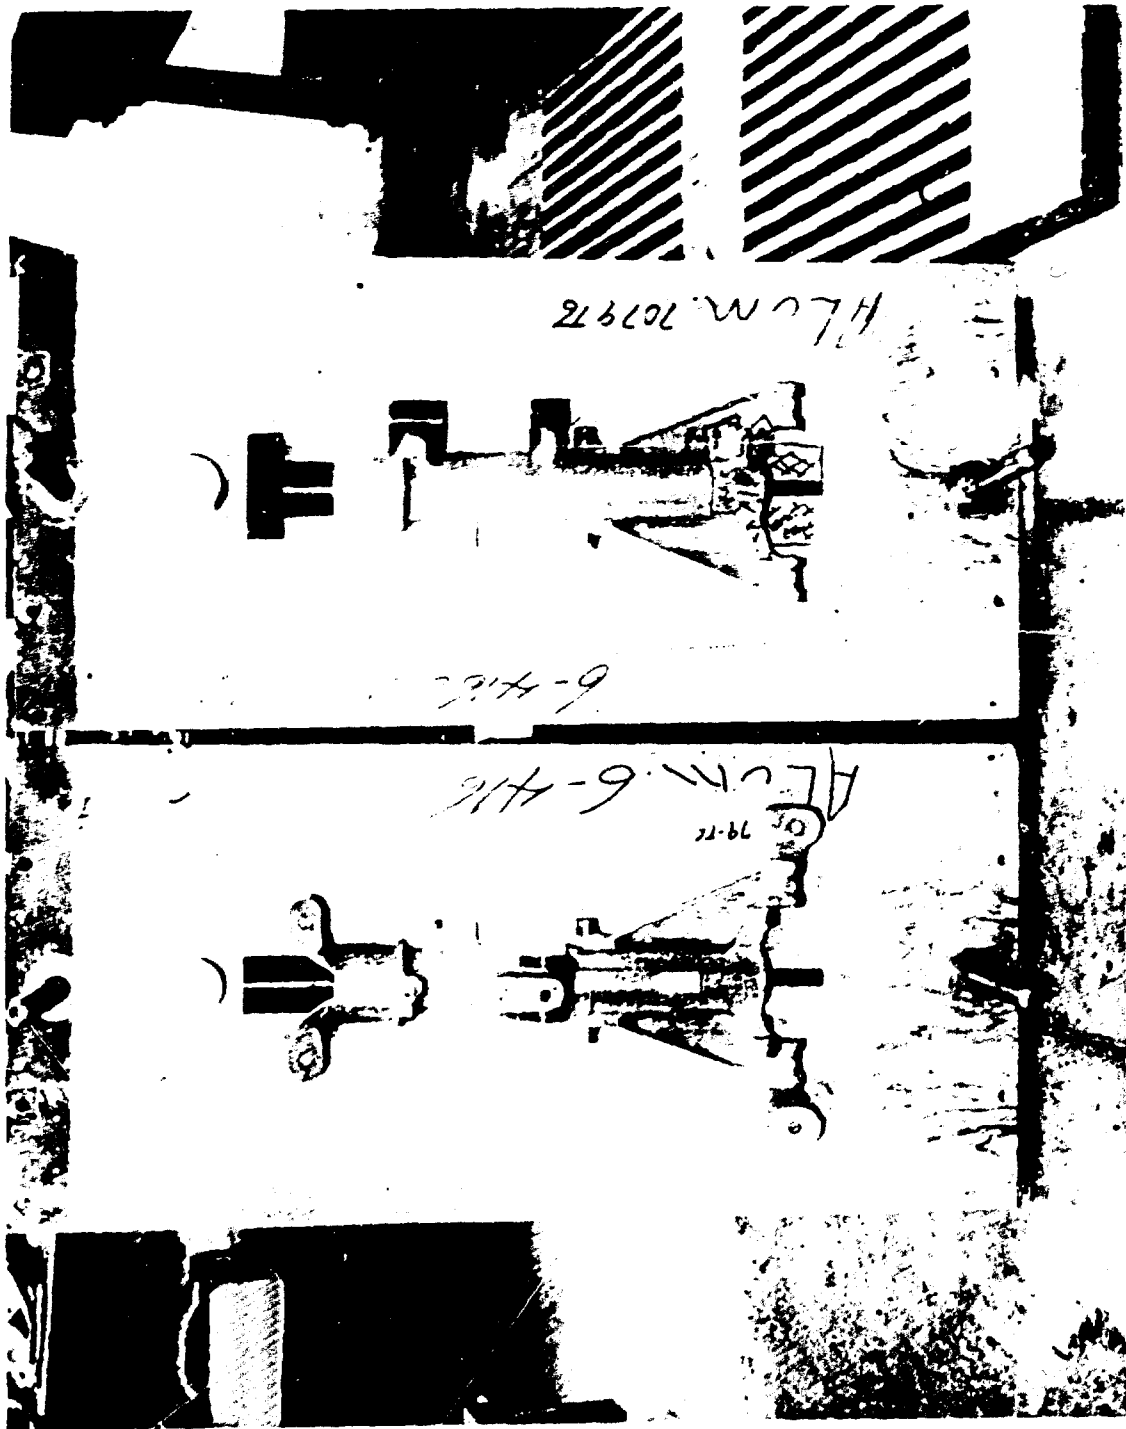


FIGURE 7 COPE AND DRAG PATTERN FOR LANDING GEAR STRUT CYLINDER CASTING



FIGURE 8 GATING AND CHILLING OF LANDING GEAR STRUT CYLINDER CASTING MOLD

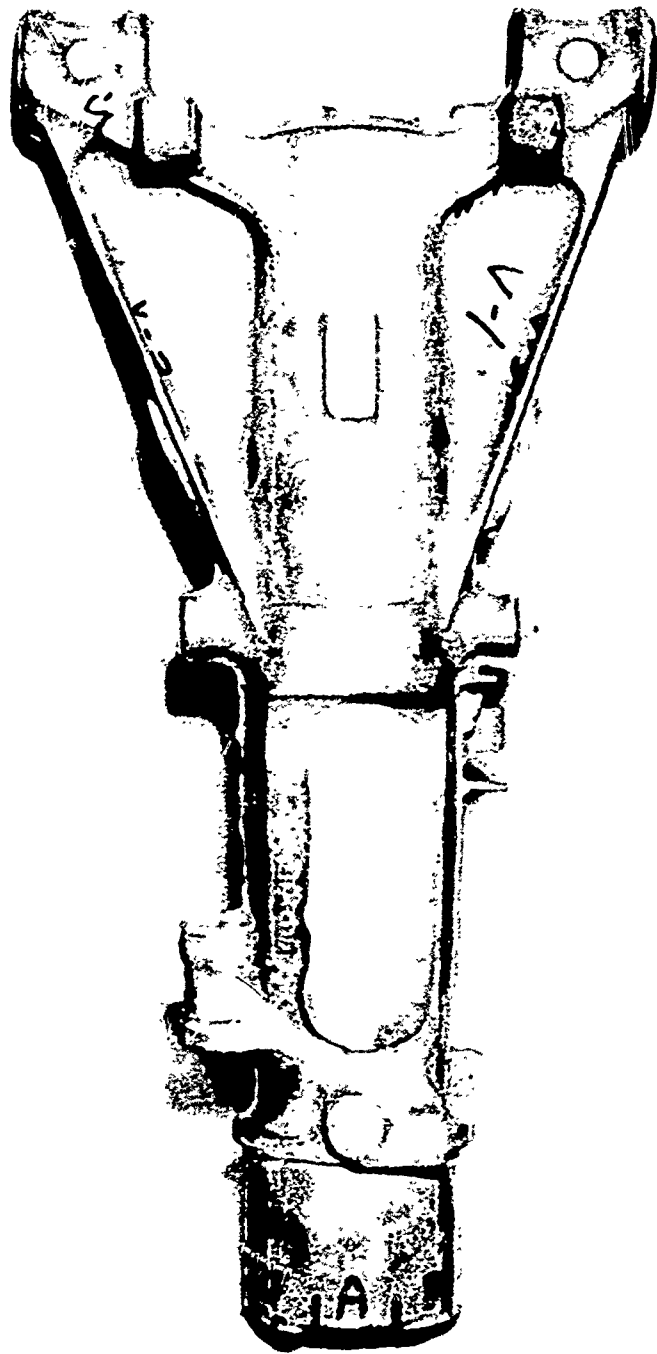


FIGURE 9 ALUMINUM ALLOY 356 CASTING MADE WITH FIRST MOLD RIGGING



FIGURE 10 POURING ZQ64 MAGNESIUM ALLOY



FIGURE 11 2064 CASTING AFTER SHAKE-OUT

STRESS CORROSION ASPECTS

Production use of the alloys in this program will encounter some gradient of susceptibility to stress corrosion attack. Since aluminum alloy 356 and magnesium alloy AZ91 are currently standard alloys for 80 percent of light alloy castings used on Air Force weapons systems, stress corrosion coupons are being cast of these alloys as well as of the new alloys being studied in the program. Figure 12 shows the pattern prepared for this purpose. Rings, with sections as equal as is common to the sand casting method, are being cast. The gate shown on this pattern has been enlarged because a concentration of microshrinkage near the gate was in evidence in the magnesium cast rings. These rings will furnish a continuity of test methods used to study stress corrosion susceptibility of T-38 main landing gear strut cylinders, thereby correlating with other data. Figures 13 and 14 illustrate the method. Details of the cast ring stress corrosion testing will be delineated in later reporting.

V WORK PROJECTED FOR NEXT QUARTER

Continuing modification of the landing gear strut cylinder casting mold rigging to produce the optimum in quality and mechanical properties.

Dimensional check and, if necessary, pattern correction to assure accuracy of parts to be used in Phase III environmental testing.

Casting the landing gear strut in each of the magnesium and aluminum alloys considered best for Phase III activity until the process is refined with respect to acceptable nondestructive testing quality.

Determine the mechanical properties of each landing gear strut by tensile testing coupons excised from stress significant areas.

Perform stress corrosion testing of the cast rings.

Perform fatigue and charpy impact testing of coupons from landing gear struts cast in each of the selected alloys.

Prepare a summary of Phase II activity for Air Force approval.

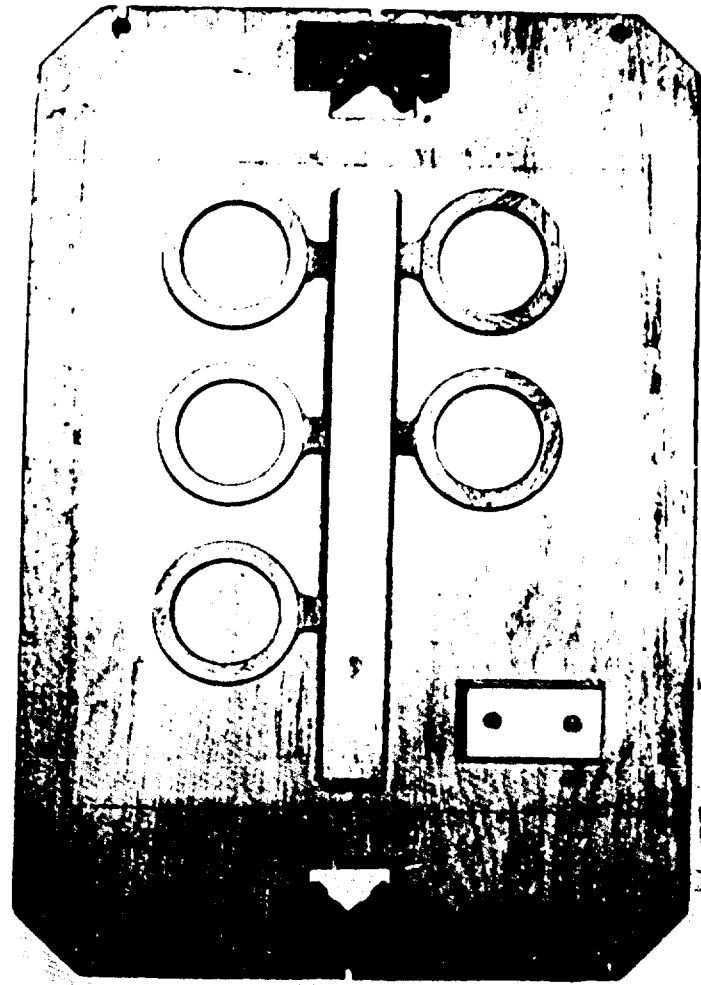


FIGURE 12 PATTERN FOR STRESS CORROSION TEST CAST RINGS

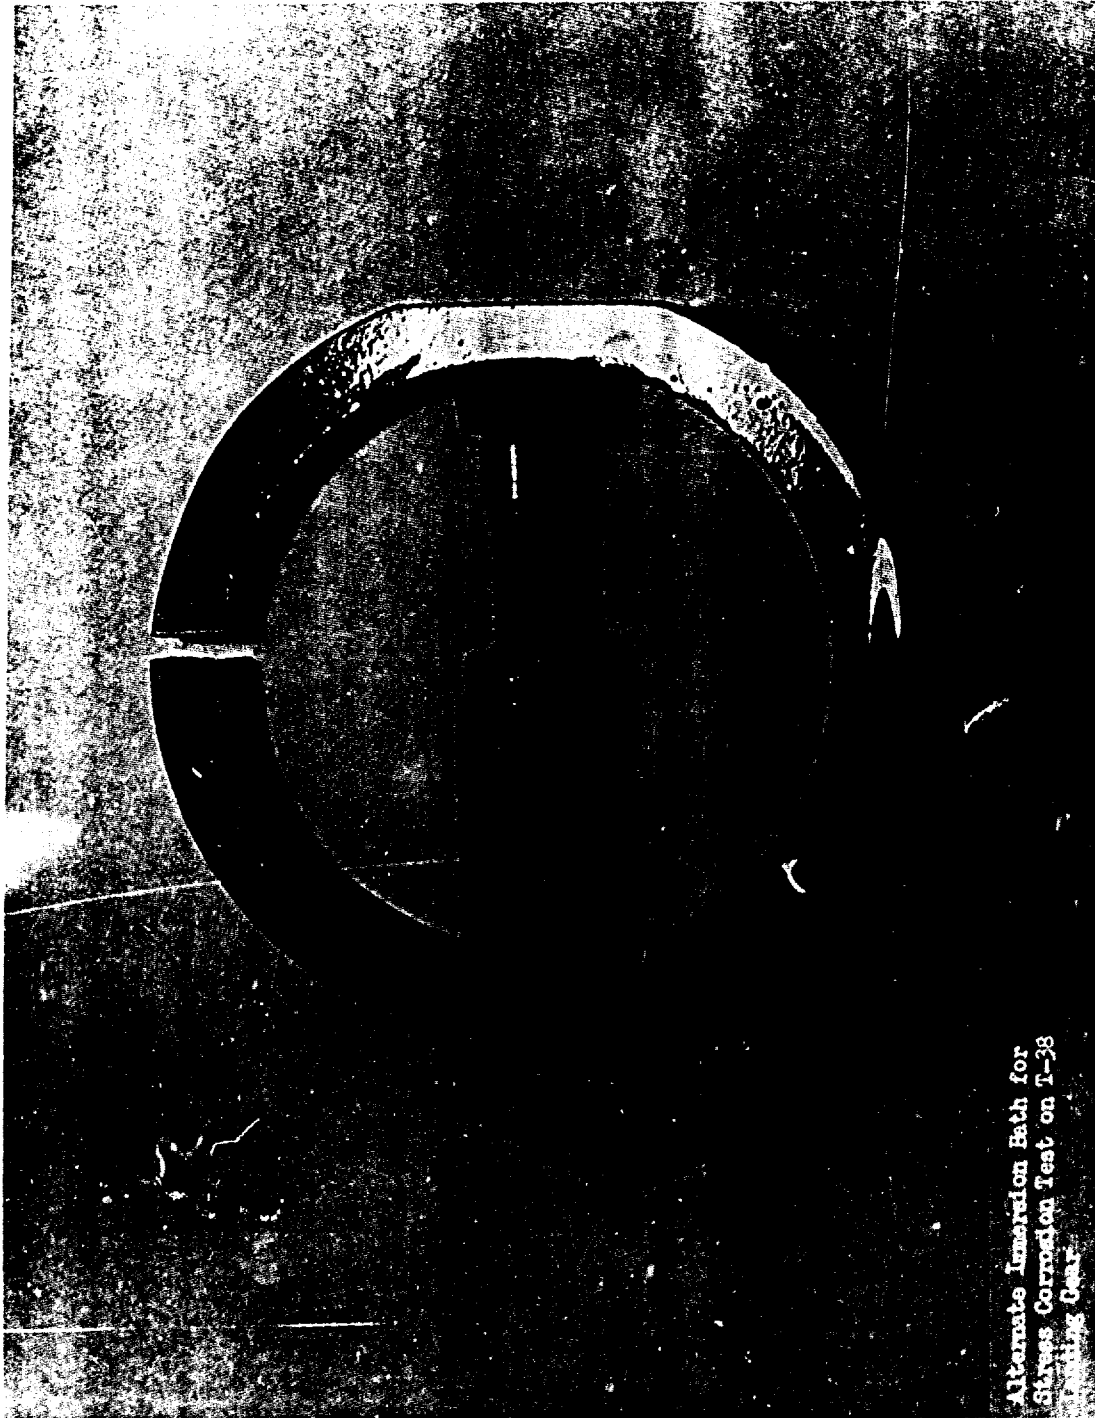


FIGURE 13 TYPICAL T-38 MAIN LANDING GEAR STRUT STRESS CORROSION TEST COUPON

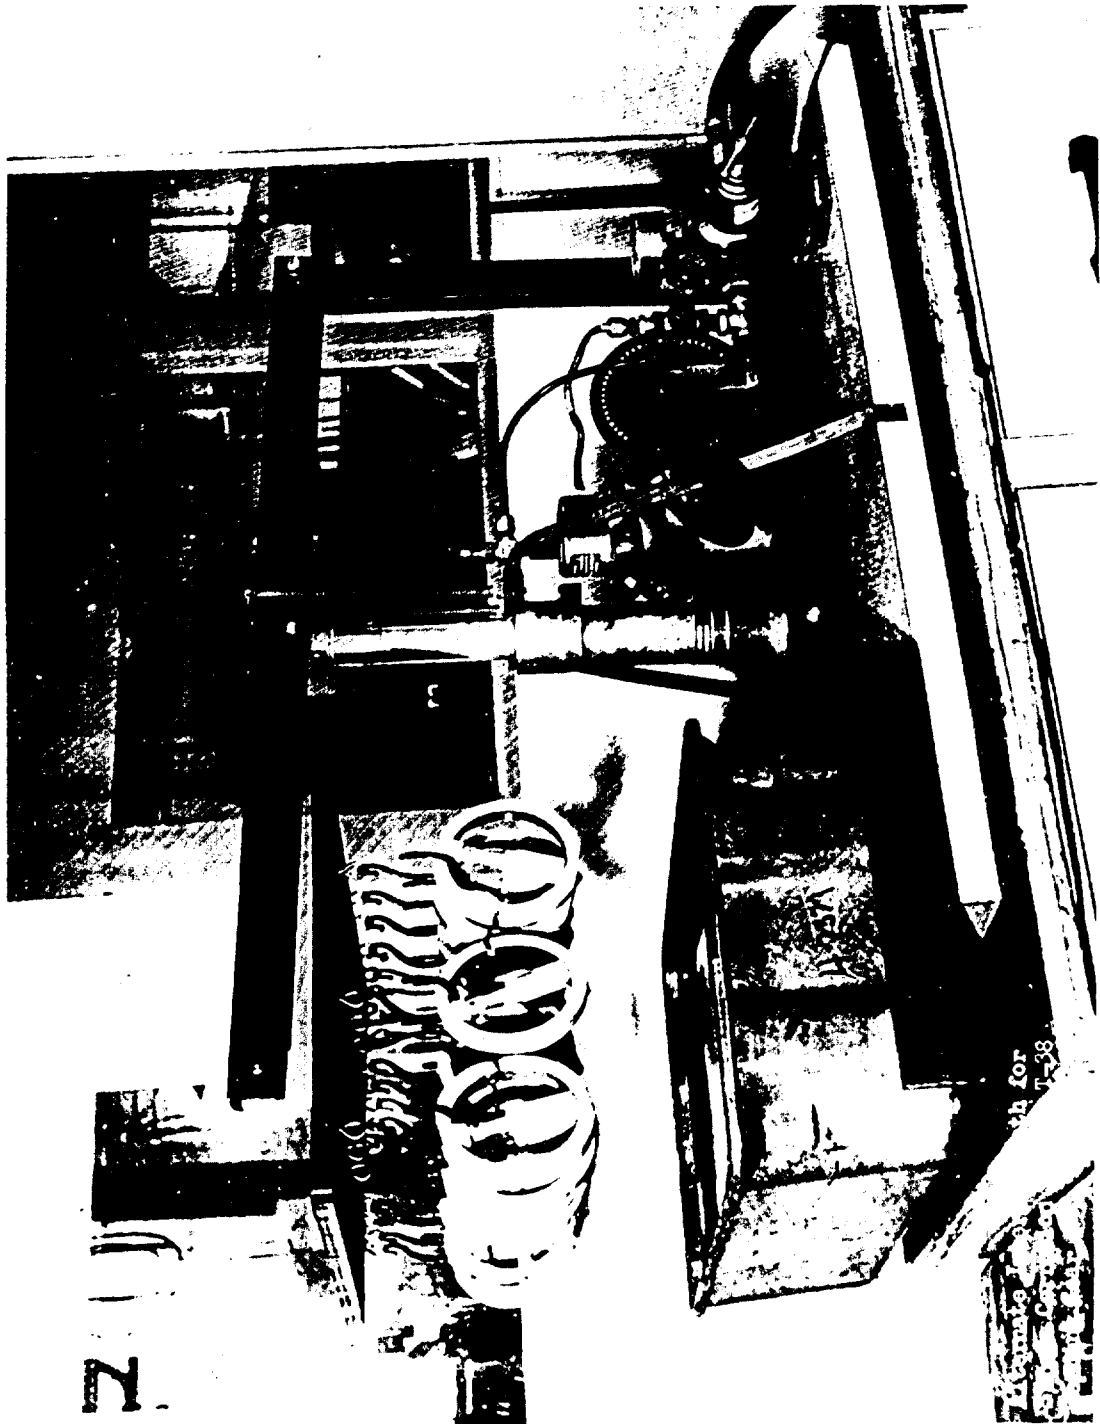


FIGURE 14 ALTERNATE IMMERSION BATH FOR STRESS CORROSION TEST OF T-38 LANDING GEAR

REFERENCES

1. Castings - Aerospace Application, A. J. Iler, American Ordnance Association Proceedings, April 1964
2. Development of High-Strength Magnesium Casting Alloys Containing Silver, Zinc and Zirconium, B. Lagowski and J. W. Meier, AFS Transactions, October 1964
3. Made by National Lead Company
4. Made by Magnesium Electron Limited, Manchester, England

DISTRIBUTION LIST

DISTRIBUTION LIST - CONTRACT AF 33(615)1341

AFFDL (FDTS)
Wright-Patterson AFB, Ohio 45433

AFFDL (FDTS)
Attn: MSgt. J. D. Ingram
Wright-Patterson AFB, Ohio 45433

AFML (MAA)
Attn: Mr. D. H. Cartolano
Wright-Patterson AFB, Ohio 45433

AFML (MAA)
Attn: Mr. J. Teres
Wright-Patterson AFB, Ohio 45433

AFML (MAA)
Attn: Mr. C. L. Harmsworth
Wright-Patterson AFB, Ohio 45433

AFML (MAMP)
Attn: Mr. Tom Cooper
Wright-Patterson AFB, Ohio 45433

AFML (MAAM)
Attn: Library
Wright-Patterson AFB, Ohio 45433

AFML (MAMP)
Attn: Mr. Ken Elbaum
Wright-Patterson AFB, Ohio 45433

AFML (MAMP)
Attn: Mr. N. M. Geyer
Wright-Patterson AFB, Ohio 45433

AFML (MAMP)
Attn: Mr. S. Inouye
Wright-Patterson AFB, Ohio 45433

AFML (MAMP)
Attn: Mr. Ken Kojola
Wright-Patterson AFB, Ohio 45433

AFML (MAP)
Attn: Mr. H. A. Johnson
Wright-Patterson AFB, Ohio 45433

AFML (MATB) (25 copies)
Attn: Lt. Wm. T. O'Hara
Wright-Patterson AFB, Ohio 45433

AFML (MAX)
Attn: Dr. A. L. Lovelace
Wright-Patterson AFB, Ohio 45433

Air Force Plant Representative
RWRHA-RWRHP (1 ea.)
Northrop Norair
Hawthorne, California

ASD (SEVS)
Wright-Patterson AFB, Ohio 45433

Defense Documentation Center (DDC)
Cameron Station
5010 Duke Street
Alexandria, Virginia 22312 (30 cys)

Foreign Technology Division
Attn: TDEWP
Wright-Patterson AFB, Ohio 45433

Headquarters USAF (AFRSTC)
Attn: Lt. Col. Hamlin
Washington 25, D.C.

LACMSD (RWFFP) (2 cys)
Air Force Unit Post Office
Los Angeles, Calif. 90045

RTD (SEKRB)
Attn: Mr. Thomas A. Payne
Wright-Patterson AFB, Ohio 45433

RTD (SETFS)
Attn: Mr. J. F. Rosenkranz
Wright-Patterson AFB, Ohio 45433

Research Technology Division
Attn: SEG (SEJDA)
Wright-Patterson AFB, Ohio 45433

Aerojet-General Corp.
Attn: Technical Library
P. O. Box 1947
Sacramento, California
MATB 031264

Aerojet-General Corporation
Attn: Vice President, Manufacturing
P. O. Box 296
Azusa, California
MATB

Aerojet-General Corporation
Metallurgical Engineering
Department 1184
11711 South Woodruff Avenue
Downey, California
MATB

Aerojet-General Nucleonics
Attn: Manager Metallurgy Department
P. O. Box 77
San Ramon, California
MATB

Air Research Mfg. Company
Attn: H. E. Stout
2525 W. 190th Street
Torrance, California

Air Research Manufacturing Company
of Arizona
Attn: Library
P. O. 5217
Phoenix, Arizona
MATB 031264

Allis-Chalmers Manufacturing Company
Defense Products Division
P. O. Box 512
Milwaukee, Wisconsin 53201
MATB

Aluminum Company of America
Vernon Plant
Attn: C. R. Gardner
Vernon, California

Aluminum Company of America
Alcoa Research Laboratories
Attn: Asst. Director of Research
P. O. Box 772
New Kensington, Pennsylvania
MATB

Aluminum Company of America
Attn: Mr. Frederick C. Pyne
1200 Ring Building
Washington, D. C.
MATB

American Brake Shoe Company
Research Center
Attn: Manager Contract R & D
Mahwah, New Jersey
MATB

American Society for Metals
Attn: Dr. Taylor Lyman
Metals Park
Novelty, Ohio
MATB

Armco Steel Corporation
Research Center
Attn: Technical Library
Door 225
Curtis Street
Middletown, Ohio

Atlantic Research Corporation
Attn: Librarian
Shirley Highway at Edsall Road
Alexandria, Virginia
MATB

Avco Corporation
Lycoming Division
Attn: Superintendent
Manufacturing Engineering
Stratford, Connecticut
MATB

Babcock & Wilcox Company
Attn: Mr. James Barrett
Beaver Falls, Pennsylvania
MATB

Barogenics, Inc.
Attn: Mr. A. Zeitlin
51 East 42nd Street
New York 17, New York
MATB

Battelle Memorial Institute
Attn: P. J. Rieppel, Assoc. Manager
Dept. of Metallurgy & Physics
505 King Avenue
Columbus 1, Ohio
MATB

Beech Aircraft Corporation
Attn: Chief, Structures &
Weight Control
9707 E. Central Avenue
Wichita 1, Kansas
MATB

Bell Aerosystems Company
ATTN: Manager
Advanced Manufacturing Engineering
Internal Mail Zone C-53
P. O. Box 1
Buffalo 5, New York
MATB

Bell Helicopter Company
Attn: Mr. Neil J. MacKenzie
Chief Design Engineer
P. O. Box 482
Fort Worth 1, Texas
MATB

Bell Helicopter Company
Attn: Manager
Production Engineering
P. O. Box 482
Fort Worth 1, Texas

The Bendix Corporation
Attn: R. L. Burham, Manager
Purchasing, Mechanical
P. O. Box 1159
Kansas City Division
Kansas City, Missouri 64141

The Bendix Corporation
Bendix Foundries
Attn: R. D. Ferguson
Teterboro, New Jersey

The Bendix Corporation
Bendix Products Aerospace Division
Attn: Technical Librarian
717 N. Bendix Drive
South Bend 20, Indiana
MATB

The Bendix Corporation
Utica Division
Attn: Director of Engineering
Utica, New York
MATB

The Beryllium Corporation
Attn: Mr. William Santschi
P. O. Box 1462
Reading, Pennsylvania
MATB

Bethlehem Steel Company
Attn: Mr. J. K. Killmer
Chief Metallurgical Engineer
Bethlehem, Pennsylvania
MATB

Bethlehem Steel Company
Research Dept.
Bldg. A-C251
Bethlehem, Pennsylvania
MATB 031264

The Boeing Company
Aerospace Division, X-20 Branch
Attn: Chief Materials & Processes
Mail Stop 22-98
P. O. Box 3707
Seattle 24, Washington
MATB

The Boeing Company
Aerospace Division
Attn: Manufacturing Development
2-930 45-23
P. O. Box 3707
Seattle 24, Washington
MATB

The Boeing Company
Aerospace Division
Attn: Chief Materials & Processes
P. O. Box 3707
Seattle 24, Washington
MATB

The Boeing Company
Airplane Division
Attn: Materials & Process Unit Chief
Renton, Washington
MATB

The Boeing Company
Airplane Division - Wichita Branch
Attn: Manager, Mfg. R&D Section
Organization 3070
3801 S. Oliver
Wichita, Kansas
MATB

Bridgeport Brass Company
Reactive Metals Products
Attn: Mr. L. C. McCoy
Miles, Ohio 4446
MATB

Brush Beryllium Company
Attn: Mr. John Estees
17876 St. Claim Avenue
Cleveland 10, Ohio

Brush Beryllium Company
Attn: Mr. W. W. Beaver
4301 Perkins Avenue
Cleveland 3, Ohio
MATB

BSD (BSR)
Norton AFB, California
MATB

California Institute of Technology
Jet Propulsion Laboratory
Attn: Library
4800 Oak Grove Drive
Pasadena 3, California
MATB

Canadian Bureau of Mines
Mines Branch
Physical Metallurgy Division
Attn: J. W. Meier, Principle Metallurgist
568 Booth Street
Ottawa, Ontario

Chase Brass & Copper Company
Attn: Director
Research and Development
Waterbury 20, Connecticut
MATB

Chemical & Metallurgical Research, Inc.
Attn: Dr. Julian Glosser
Professional Building
Chattanooga, Tennessee
MATB

Chief, Bureau of Naval Weapons
Department of the Navy
Attn: RRMA-2
Washington 25, D. C.
MATB

Cincinnati Milling Machine Company
Attn: Mr. L. E. Melhope
Marburg Avenue
Cincinnati, Ohio 45209
MATB

Clevite Corporation
Mechanical Research Division
Attn: Library (Miss Phyllis Whalen)
540 E. 105th Street
Cleveland 8, Ohio
MATB

Climax Molybdenum Company
Attn: Dr. Janet Briggs
1270 Avenue of Americas
New York 20, New York
MATB

Climax Molybdenum Co. of Michigan
Attn: Library
14410 Woodrow Wilson Boulevard
Detroit, Michigan 48238
MATB

Climax Molybdenum Co. of Michigan
Refractory Metal Division
14410 Woodrow Wilson Boulevard
Detroit, Michigan 48238
MATB

Commanding Officer
U. S. Naval Engineering
Experiment Station
Attn: Mr. W. L. Williams
Annapolis, Maryland
MATB

Continental Avia & Engr Corp
Attn: T. Weidig
Research and Advanced Development
12700 Kercheval
Detroit 15, Michigan
MATB 031264

Crucible Steel Company of America
Attn: Dr. Walter Finley
Director of Research
P. O. Box 88
Pittsburg 30, Pennsylvania
MATB

Crucible Steel Company of America
Process Research Laboratory
Attn: Mr. F. C. Langenberg
Box 988
Pittsburgh, Pennsylvania
MATB

Curtiss-Wright Corporation
Curtiss Division
Attn: Chief Engineer, Materials
U. S. Route No. 46
Caldwell, New Jersey
MATB

The Dow Chemical Company
Attn: R. C. Karpick
Scientific Projects Lab.
1710 Building
Midland, Michigan
MATB

Curtiss-Wright Corporation
Metals Processing Division
Attn: Chief Engineer
760 Northland Avenue
Buffalo 15, New York
MATB

Dow Metal Products Company
Attn: Dr. T. E. Leontis
Hopkins Building
Midland, Michigan
MATB

Curtiss-Wright Corporation
Wright Aeronautical Division
Attn: Manager, Metallurgy
Wood-Ridge, New Jersey
MATB

E. I. Du Pont de Nemours & Company, Inc.
Pigments Dept., Metals Products
Attn: Dr. E. M. Mahla
Technical Assistant to Director
Wilmington 98, Delaware, MATB

Defense Metals Information Center
Battelle Memorial Institute
505 King Avenue
Columbus 1, Ohio
MATB

Elgin National Watch Company
Industrial Group
Attn: Mr. T. L. Boswell
107 National Street
Elgin, Illinois MATB

Douglas Aircraft Company
Incorporated Aircraft Division
Attn: Technical Library
3855 Lakewood Boulevard
Long Beach, California 90801
MATB

Firth Sterling, Incorporated
Attn: Mr. R. K. Hopkins
3113 Forbes Avenue
Pittsburgh 30, Pennsylvania
MATB

Douglas Aircraft Company, Inc.
Aircraft Division
Attn: Chief Materials Research &
Process Engineering
3855 Lakewood Boulevard
Long Beach, California 90801
MATB

Freightliner Corporation
Attn: Mr. S. R. Galluzzo
Director of Purchasing & Planning
P. O. Box 3591
Portland 18, Oregon

Douglas Aircraft Company, Inc.
Engineering Library - D-260
2000 N. Memorial Drive
Tulsa, Oklahoma
MATB

General Dynamics/Astronautics
Attn: Mr. A. Hurlich, Chief
Materials Research
Mail Zone 592-10
P. O. Box 166
San Diego 12, California, MATB

Douglas Aircraft Company, Inc.
Missile & Space Systems Division
Attn: Research & Development Library
3000 Ocean Park Boulevard
Santa Monica, California MATB

General Dynamics/Astronautics
Attn: Supervisor, AMR/PD
Technical Service
P. O. Box 1128
Mail Zone 290-30
San Diego, California 92112
MATB

General Dynamics/Convair
Attn: Mr. E. W. Fedderson, Manager
Manufacturing Engineering
P. O. Box 1950
San Diego, California 92112

General Dynamics/Convair
Attn: Mr. M. D. Weisinger, Chief
Manufacturing Research and Development
P. O. Box 1950
San Diego, California 92112
MATB

General Dynamics/Fort Worth
Attn: Mr. R. K. May, Chief
Applied Mfg. Research & Proc. Develop.
P. O. Box 748
Fort Worth 1, Texas
MATB

General Dynamics/Fort Worth
Attn: Structural Sciences Group
Research Library (Mr. C. W. Rogers)
P. O. Box 748
Fort Worth, Texas 76101
MATB

General Dynamics/Pomona
Attn: Manager
Manufacturing Engineering
P. O. Box 1011
Pomona, California
MATB

General Electric Company
Aircraft Gas Turbine Division
Attn: Engineering Manager
Metallurgical Engineering Operations
Large Jet Engine Department
Building 501
Cincinnati 15, Ohio
MATB

General Electric Company
Hanford Atomic Products Operation
Attn: Dr. T. T. Claudson
Building 326, Area 300
P. O. Box 550
Richland, Washington
MATB

General Electric Company
Lamp Metals & Component Department
Attn: Manager, Engineering
21800 Tungsten Road
Cleveland 17, Ohio
MATB

General Electric Co.
Lamp Metals and Components Dept.
Attn: Mgr. of Metals Research
21800 Tungsten Road
Cleveland 17, Ohio
MATB 031264

General Electric Company
Materials Development
Laboratory Operations
AETD Mail Drop G-22
Attn: Mr. L. P. Jahnke
Cincinnati 15, Ohio MATB

General Electric Company
Metallurgical Products Department
Specialty Alloys Section
Attn: Manager of Manufacturing
Box 237, G.P.O.
Detroit 32, Michigan
MATB

General Electric Company
Re-Entry Systems Department
Attn: Manager of Mfg. Engineering
Room 1924
3198 Chestnut Street
Philadelphia 1, Pennsylvania
MATB

General Electric Company
Small Aircraft Engine Department
Thompson Engineering Laboratory
Metalworking Research Laboratory
Building 2-68
1000 Western Avenue
West Lynn 3, Massachusetts
MATB

General Electric Company
Valley Forge Space Technology Center
Manufacturing Engineering R&D
Room 3210U
P. O. Box 8555
Philadelphia 1, Pennsylvania

General Motors Corporation
Electro-Motive Division
Attn: Mr. J. E. Martin
Materials Engineer
La Grange, Illinois

Green River Steel Corporation
Attn: Chief Metallurgist
Metallurgical Department
Owensboro, Kentucky 42301
MATB

Grumman Aircraft Engineering Corp.
Test Equipment and Process Engineering
Technical Information File
Attn: Mrs. S. Moxley, Plant No. 12
Bethpage, Long Island, New York
MATB

H. M. Harper Company
Attn: General Manager of Metals Div.
Lehigh Avenue and Oakton Street
Morton Grove, Illinois
MATB

Harvey Aluminum, Incorporated
Attn: Mr. C. W. Moudry
Technical Director
19200 S. Western Avenue
Torrance, California
MATB

Hiller Aircraft Company
Attn: Mr. Edward Kempf
Engineering Division
Palo Alto, California
MATB

Hills-McCanna Company
Foundry Division
Attn: Donald Krings
2950 N. Oakley Street
Chicago 18, Illinois

Hoskins Manufacturing Company
Attn: Research & Development Dept.
4445 Lawton Avenue
Detroit, Michigan 48208
MATB

Hughes Aircraft Company
Attn: Mr. H. B. Dobyns
Manager of Production Engineering
P. O. Box 90426
Los Angeles 9, California
MATB

Hughes Aircraft Company
Process Engineering Department
P. O. Box 11337
Tucson, Arizona
MATB

Hughes Tool Company
Aircraft Division
Attn: Contracts Department
Building 2, Mail Station T-7A
Florence Avenue at Teale
Culver City, California
MATB

Indiana Gear Works
A Division of the Buehler Corporation
Attn: Mr. R. C. Ferguson
Engineering Manager
9000 Precision Drive
Indianapolis, Indiana 46236

IIT Research Institute
Metals Research Division
Attn: Dr. D. J. McPherson
110 West 35th Street
Chicago 16, Illinois
MATB

International Nickel Company
Technical Library, 16th Floor
67 Wall Street
New York 5, New York
MATB

Jessop Steel Company
Attn: Director of Metallurgy
Washington, Pennsylvania MATB

Jones & Laughlin Steel Corporation
Attn: Security Officer
900 Agnew Road
Pittsburgh, Pennsylvania 15227
MATB

Kaiser Aluminum & Chemical Corp.,
Department of Metallurgical Research
Spokane, Washington 99215
MATB

Kawecki Chemical Company
Attn: Research Manager
Boyertown, Pennsylvania
MATB

Kelsey-Hayes Company
Utica Division
Attn: Mr. W. Shanayda
Chief Metallurgist
2415 Whitesboro Street
Utica 4, New York
MATB

Ladish Company
Attn: Metallurgical Library
5481 S. Packard Avenue
Cudahy, Wisconsin
MATB

Ladish Company
Attn: Mr. Jack Yoblin
Director of Research & Development
Cudahy, Wisconsin
MATB

Latrobe Steel Company
Attn: Manager of Research
Latrobe, Pennsylvania 15650
MATB

Latrobe Steel Company
Research & Development Dept.
2626 Lingonier Street
Latrobe, Pennsylvania

Lear Siegler, Incorporated
Attn: Chief Engineer
Component Engineering Department
1700 East Grand Avenue
E' Segundo, California
MATB

Ling-Temco-Vought, Incorporated
Vought Aeronautics Division
Attn: Library
P. O. Box 5907
Dallas, Texas 75222
MATB

Lockheed-California Company
Control Library
Department 72-25
Building 63-1, Plant A1
Burbank, California
MATB

Lockheed-California Company
Attn: Division Engineer
Value Engineering
Burbank, California
MATB

Lockheed Missiles & Space Company
Attn: Mr. T. Carolan
Materials and Processes
D/62-80, B/523
P. O. Box 504
Sunnyvale, California 93088

Magnesium Alloy Products
Attn: James Long
2420 N. Alameda Street
Compton, California
MATB

The Magnesium Association
Attn: James S. Kirkpatrick
1907 Book Building
1249 Washington Blvd.
Detroit 26, Michigan
MATB

P. R. Mallory & Company, Inc.
Attn: Technical Library
3029 East Washington Street
Indianapolis 6, Indiana
MATB

Martin Company
Attn: Chief, Libraries
Mail 398
Baltimore, Maryland 21203
MATB

Martin-Marietta Corporation
Denver Division
Attn: Chief, Materials Engineering
Mail No. L-8
Denver 1, Colorado

Martin-Marietta Corporation
Orlando Division
Attn: Mr. G. G. Pfaff, Jr.
Mail No. MP-61
P. O. Box 5837
Orlando, Florida
MATB

Martin-Marietta Corporation
Orlando Division
Attn: Mr. G. Bean, MP-62
P. O. Box 5837
Orlando, Florida
MATB

Marquardt Corporation
Attn: Manager
Materials & Process Section
1300 West 33rd Street
Ogden, Utah
MATB

The Marquardt Corporation
Attn: Manager
Manufacturing & Materials Department
16555 Saticoy Street
Van Nuys, California
MATB

Martin Metals Company
Metals Technology Laboratory
Attn: Director
9340 Southwest Barnes Road
Portland 25, Oregon
MATB

Massachusetts Institute of Technology
Attn: Professor Merton C. Flemings, 35-316
Cambridge 39, Massachusetts
MATB

McDonnell Aircraft Corporation
Attn: Manager, Production Engineering
Lambert St. Louis Municipal Airport
Box 516
St. Louis 66, Missouri
MATB

Metcut Research Associates, Inc.
Attn: Dr. J. F. Kahles
3980 Rosalyn Drive
Cincinnati, Ohio 45209
MATB

Misco Precision Casting Company
Attn: Chief Metallurgist
1713 Seventh Street
Muskegon, Michigan
MATB

Modern Castings
AFS Technical Center
Attn: Jack H. Schaum, Editor
Golf & Wolf Roads
Des Plaines, Illinois
MATB

National Aeronautics Space Admin.
Lewis Research Center
Attn: Library, Mail Stop 3-7
21000 Brookpark Road
Cleveland, Ohio 44135
MATB

National Aeronautics & Space Admin. (2)
Head, Operations Section
Scientific and Technical Information Div.
(SAK/DL)
P. O. Box 5700
Bethesda, Maryland 20014

National Research Corporation
Metals Division
Attn: Dr. Maurice L. Torti
45 Industrial Place
Newton 61, Massachusetts MATB

National Research Corporation
Technical Information Center
70 Memorial Drive
Cambridge 42, Massachusetts
MATB

North American Aviation, Inc.
Producibility Metals
Department 185-054
International Airport
Los Angeles 45, California

North American Aviation, Inc.
Space & Information Systems Division
Attn: Chief Librarian
12214 Lakewood Boulevard
Downey, California 90241
MATB

North American Aviation, Inc.
Los Angeles Division
Attn: Director Laboratories
International Airport
Los Angeles 45, California
MATB 031264

North American Aviation, Inc.
Columbus Division
Engineering Data Services
4800 East Fifth Avenue
Columbus 16, Ohio
MATB

North American Aviation, Inc.
Attn: LAD Library, Department 262
International Airport
Los Angeles Airport, 90009 MATB

Northrop Corporation
Norair Division
Attn: Technical Information
3901 East Broadway
Hawthorne, California MATB

Nuclear Metals, Incorporated
Materials Research & Development
Attn: Manager
West Concord, Massachusetts 01781
MATB

Oak Ridge National Laboratory
Metals and Ceramics Division
Attn: Mr. W. C. Thurber
P. O. Box X
Oakridge, Tennessee
MATB

Oregon Metallurgical Corporation
Attn: Director of Research
Albany, Oregon
MATB

Pacific Light Metals Foundry Co.
Attn: Mr. C. R. Utterback
4200 N. Q. Yeon Ave.,
Portland, Oregon 97210

Pratt & Whitney Aircraft Division
United Aircraft Corporation
Attn: Chief, Materials Engineering
East Hartford 8, Connecticut

Precision Castings Company
Attn: John Hall
2044 Placentia Avenue
Costa Mesa, California

Precision Forge Company
Attn: Mr. E. C. Rork, President
2152 Colorado Avenue
Santa Monica, California
MATB

Republic Aviation Corporation
Attn: Director, Mfg.
Farmingdale, Long Island
New York MATB

Revere Copper & Brass Co., Inc.
Attn: Manager
Special Product Sales
230 Park Avenue
New York 17, New York
MATB

Revere Copper & Brass, Inc.
Research and Development Center
Attn: Mr. E. S. Bunn, Vice President
Rome, New York 13440
MARB

Reynolds Industries, Inc.
Attn: Mr. L. F. Leavitt
2105 Colorado Avenue
Santa Monica, California

Reynolds Metals Company
Metallurgical Research Division
Attn: General Director
Richmond 19, Virginia
MATB

Rocketdyne Division
North American Aviation, Inc.
Solid Rocket Division
Attn: Engineering Library
MacGregor, Texas
MATB

Rohr Aircraft Company
Attn: Chief
Materials & Process Engineering
Chula Vista, California
MATB

Ryan Aeronautical Company
Attn: Manufacturing Administration
Department 500
2701 Harbor Drive
San Diego, California, 92112
MATB

Scientific & Tech. Information Facility
Attn: NASA Representative (SAK/DL)
P. O. Box 5700
Bethesda, Maryland 20014
MATB

Sikorsky Aircraft Division
United Aircraft Corporation
Attn: Chief of Test Engineering Branch
Stratford, Connecticut
MATB

Solar Division, Inc.
Harvester Company
Attn: Director of Research
2200 Pacific Coast Highway
San Diego, California 92112
MATB

Southern Research Institute
Metallurgy Division
2000 9th Avenue South
Birmingham 5, Alabama
MATB

Special Metals, Inc.
Attn: Library
New Hartford, New York
MATB

Standard Pressed Steel Company
Attn: Mr. A. C. Hood
Manager, R & D
Jenkinstown, Pennsylvania
MATB

Stauffer Metals Division
Attn: Technical Sales Department
1201 South 47th Street
Richmond, California
MATB

Steel Improvement & Forge Company
Attn: Mr. Charles Smith, President
970 East 64th Street
Cleveland 3, Ohio
MATB

Sundstrand Aviation-Denver
Attn: Mr. Harry Wilson
2480 West 70th Avenue
Denver 21, Colorado
MATB

Sylvania Electric Products, Inc.
Product Development Department
Attn: Mr. L. D. Tiala
Towanda, Pennsylvania
MATB

Sylvania Electric Products, Inc.
Sylcor Division
Attn: Manager of Marketing
Cantiague Road
Hicksville, New York
MATB

Thiokol Chemical Corporation
Wasatch Division
Attn: Technical Library
Brigham City, Utah
MATB

Thompson Ramo Wooldridge, Inc.
Materials Processing Department
Attn: Dr. A. S. Nony
23555 Euclid Avenue
Cleveland 17, Ohio
MATB

Titanium Metals Corp. of America
Attn: Technical Services Department
233 Broadway
New York 7, New York
MATB

Union Carbide Corporation
Stellite Division
Attn: Manager of Technology
1020 N. Park Avenue
Kokomo, Indiana 46901
MATB

Universal Cyclops Steel Corporation
Refractomet Division
Attn: General Manager
Bridgeville, Pennsylvania
MATB

Vanadium Alloys Steel Company
Attn: Manager of Research
Latrobe, Pennsylvania
MATB

Wah Chang Corporation
Attn: Librarian
P. O. Box 366
Albany, Oregon
MATB

The Wellman Bronze and Aluminum Co.
Attn: Glen Ehrig
801 Andre Street
Bay City, Michigan
MATB

Western Gear Corporation
Attn: Mr. Martin Hoadman
Director of Research
Imperial Boulevard
Lynwood, California
MATB

Western Pneumatic Tube Company
P. O. Box W
Kirkland, Washington
MATB

Westinghouse Electric Corporation
Attn: Mr. Frank R. Parks (3 copies)
1306 Farr Drive
Dayton 4, Ohio
MATB

Wolverine Tube Division
Attn: Director R & D
Calumet and Hecla, Inc.
17200 Southfield Road
Allen Park, Michigan
MATB

Wyman-Gordon Company
Technical Information Center, R & D
North Grafton Plant
Worcester 1, Massachusetts 01601
MATB

Wyman-Gordon Company
Attn: Chief Metallurgist
North Grafton, Massachusetts
MATB