

AD-A196 327

Report

Naval Weapons Development & Engineering Center
P.O. Box 10000, Orlando, Florida 32816-0000

Report 2489

Stressed Fabric Abrasion Test Procedure for Urethane Coated Fabric Fuel Tanks


Pat Butler
Authorized By: Dave Flanagan

Report Date: June 1988

Approved for public release; distribution unlimited.

DTIC
ELECTE
S JUL 27 1988 D
H

88 7 25 065

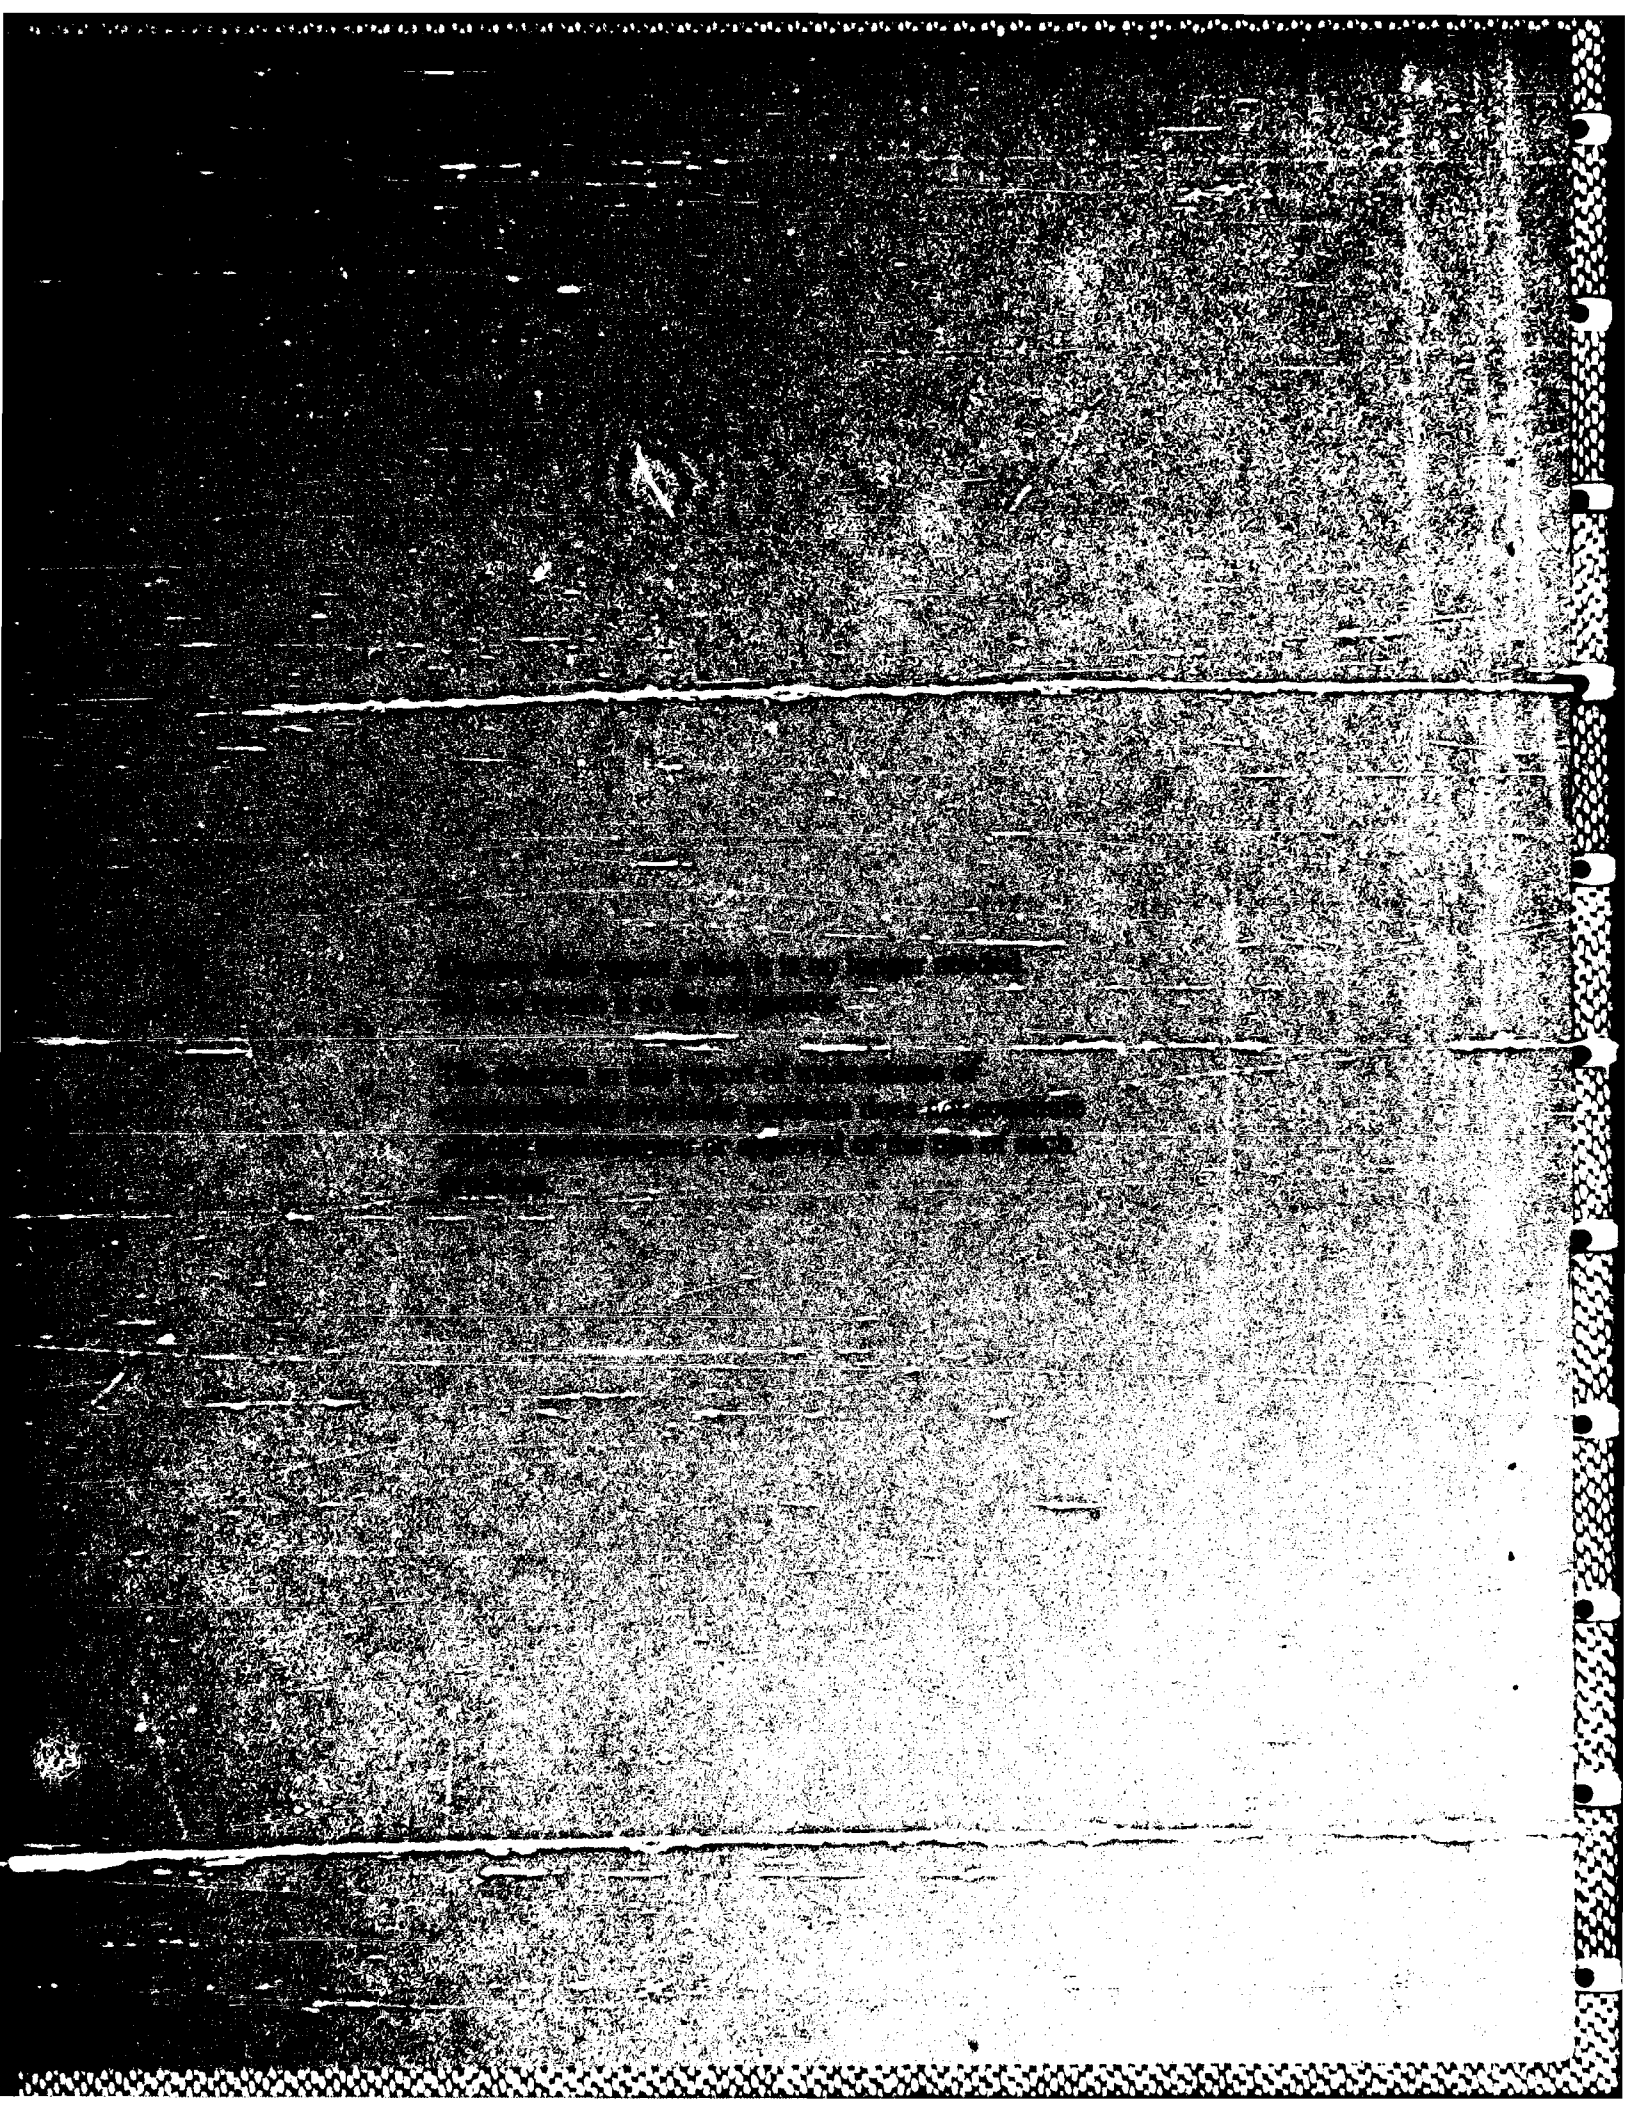

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE

REPORT DOCUMENTATION PAGE				Form Approved OMB No. 0704-0188	
1a. REPORT SECURITY CLASSIFICATION Unclassified		1b. RESTRICTIVE MARKINGS None			
2a. SECURITY CLASSIFICATION AUTHORITY		3. DISTRIBUTION/AVAILABILITY OF REPORT Approved for public release; distribution unlimited.			
2b. DECLASSIFICATION/DOWNGRADING SCHEDULE					
4. PERFORMING ORGANIZATION REPORT NUMBER(S) No. 2469		5. MONITORING ORGANIZATION REPORT NUMBER(S)			
6a. NAME OF PERFORMING ORGANIZATION Materials, Fuels and Lubricants Dir. Rubber and Coated Fabrics Research Grp.		6b. OFFICE SYMBOL (If applicable) STRBE-VU	7a. NAME OF MONITORING ORGANIZATION		
6c. ADDRESS (City, State, and ZIP Code) Belvoir RD&E Center Fort Belvoir, VA 22060-5606		7b. ADDRESS (City, State, and ZIP Code)			
8a. NAME OF FUNDING/SPONSORING ORGANIZATION		8b. OFFICE SYMBOL (If applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER		
8c. ADDRESS (City, State, and ZIP Code)		10. SOURCE OF FUNDING NUMBERS			
		PROGRAM ELEMENT NO.	PROJECT NO.	TASK NO.	WORK UNIT ACCESSION NO.
11. TITLE (Include Security Classification) Stressed Fabric Abrasion Test Procedure for Urethane Coated Fabric Fuel Tanks (U)					
12. PERSONAL AUTHOR(S) Pat Butler and Dave Flanagan					
13a. TYPE OF REPORT Final		13b. TIME COVERED FROM <u>Apr 87</u> TO <u>Apr 88</u>		14. DATE OF REPORT (Year, Month, Day) June 1988	
15. PAGE COUNT 14					
16. SUPPLEMENTARY NOTATION					
17. COSATI CODES		18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number) Abrasion, Urethanes, Collapsible Tanks			
FIELD	GROUP				
19. ABSTRACT (Continue on reverse if necessary and identify by block number) This report details investigations conducted and results obtained in efforts to develop a test procedure for measuring the effects of abrasion under stress in urethane-coated fabric tanks. The Rubber and Coated Fabrics Research Group, Materials, Fuels and Lubricants Directorate, Belvoir Research, Development and Engineering Center, prepared all samples from material submitted by coated fabric suppliers, performed all tests, and documented results. Four different urethane materials were tested on the Taber Abrader which was modified to test the fabric under stress. The urethanes showed a marked decline in the ability to withstand abrasion while under stress. <i>K. G. ...</i>					
20. DISTRIBUTION/AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input checked="" type="checkbox"/> SAME AS REPORT <input type="checkbox"/> DTIC USERS			21. ABSTRACT SECURITY CLASSIFICATION Unclassified		
22a. NAME OF RESPONSIBLE INDIVIDUAL Pat Butler		22b. TELEPHONE (Include Area Code) 703-664-1127		22c. Office Symbol STRBE-VC	

DD Form 1473, JUN 86

Previous editions are obsolete.

SECURITY CLASSIFICATION OF THIS PAGE

UNCLASSIFIED

CONTENTS

	Page
SECTION I BACKGROUND	1
SECTION II INVESTIGATION	2
Mechanics of Abrasion	2
Test Apparatus	2
Materials	7
SECTION III DISCUSSION	8
SECTION IV CONCLUSIONS	8
 FIGURES	
1 Urethane Unstressed	3
2 Urethane Stressed.....	4
3 Stressed Abrasion Tester (schematic)	5
4 Taber Wheels	6

SECTION I. BACKGROUND

The Army began using collapsible fuel tanks in quantity during World War II. A system was needed to temporarily hold fuel being off-loaded at the front until its use, and a rubber-coated tank was simpler to set up than a bolted steel tank. These early tanks were built along the same lines as a bias ply tire with multiple plies vulcanized into a fuel resistant rubber liner. They were very bulky and hard to handle by today's standards, but the military found the system more desirable than the previously used bolted steel tanks.

During the Vietnam war, weaknesses became evident in the tank design. The empty tank's weight and size made it very difficult to transport into the field. Its black color did not blend into the background and, by absorbing the sunlight, caused the fuel to overheat. A new type of holding tank was needed with the following requirements: lightweight for easy transport to forward areas and a light color that would blend into the environment. Longevity was not a consideration. The new tank was constructed of a single ply fabric coated with either a nitrile or a thermosetting urethane. The coated fabric was seamed together, forming a pillow-shaped tank that was easily transportable and capable of storing fuel for short periods of time. The tank was still considered an expendable item during tactical maneuvers.

In today's austere fiscal atmosphere, items having the price tags of collapsible tanks are unexpendable. The Army's current direction is toward a lightweight fuel tank having a 20-year shelf life and a 5-year service life. Except for a major material shift to thermoplastic urethanes, no major changes to the tank's design are planned. The new material must better withstand the effects of the elements and abuse.

A problem with trying to improve the material used in collapsible tanks was the unavailability of long term field data; therefore, laboratory data needed to be generated to prove a material's worth. In storage, factors degrading the tank are moisture, ozone, and abrasion as the tank is shifted around in the box. In service, the major factors affecting the tank are ultraviolet light and abrasion from movement while the tank is being set up. This report deals with the abrasion of the urethane in a stressed condition caused by folding the tank for storage or dragging an empty tank over the ground in such a way as to abrade the corners.



Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Avail and/or	
Dist	Special
A-1	

SECTION II. INVESTIGATION

Current specifications for collapsible tanks do not include an abrasion requirement because the standard tests used in the rubber industry are unreliable indicators of field performance. The mode of abrasion failure in the field is *stressed abrasion*. Stressed abrasion occurs when the outer coating of the material is under a tensile load induced by a fold or a compound fold of the tank.

MECHANICS OF ABRASION

Abrasion is defined as "the wear of a material due to the effect of friction."^{*} When two materials come into contact with each other, they plastically deform and some atoms from the material come into close enough proximity of each other to form atomic bonds. In the formula

$$F = f \cdot N,$$

Where F = Friction
 N = Normal Force
 f = coefficient of friction

The coefficient of friction is caused by these atomic bonds. This is the reason that the coefficient of static friction is higher than the coefficient of sliding friction—more bonds form when a body is at rest. Wear caused by atomic bonding is known as *adhesive wear*. Another type of wear, *mechanical abrasion*, is caused by a rough surface cutting into a material and tearing pieces out.

In urethanes, adhesive abrasion occurs when the adhesive force between adjoining materials is stronger than the chemical bond in the polymer chain. When an atom is removed through this process, the chain is weakened and wear occurs more rapidly. When a urethane is under a tensile stress, the chemical bonds are spread out and adhesive wear can occur with less of an atomic force applied (see Figures 1 and 2). For the same reason, mechanical friction occurs more readily when the urethane is under a tensile stress.

TEST APPARATUS

For this test, an apparatus was designed and made that placed the urethane under a constant and reproducible stress. Because putting material into a compound fold configuration would make the test dependent on the thickness of the material, this solution was unacceptable. Instead, a Taber Abrader was modified to accept a platen that would be adjustable for height in the center with a ring on the outside edge to clamp the material down (Figure 3). In use, the material would be placed

^{*}McClintock, Frank A. and Argon, Ali S., *Mechanical Behavior of Materials*, Addison-Wesley Publication Company, Reading MA, 1966.

on the platten with the center ring in the down position. After the material is secured to the outer ring, the center section would be raised to a height of $\frac{1}{4}$ inch. The vertical distance between the edge of the center section and the outer ring is $\frac{1}{2}$ inch, giving the material a bend of -30° from the horizontal position (Figure 4). A ceramic abrader wheel (Figure 3) Calibrade H-18 manufactured by Taber Instruments was mounted onto a swivel arm so that the edge of the wheel would ride on the crease created by the platten at an angle of 10° from the horizontal plane. The sample was then subjected to a number of cycles sufficient to expose the base fabric. The ceramic wheel was resurfaced every 500 cycles to minimize error associated with clogging or a worn surface. A standard Taber Abrader was used to gather information about the abrasion characteristics of an unstressed sample from each material.

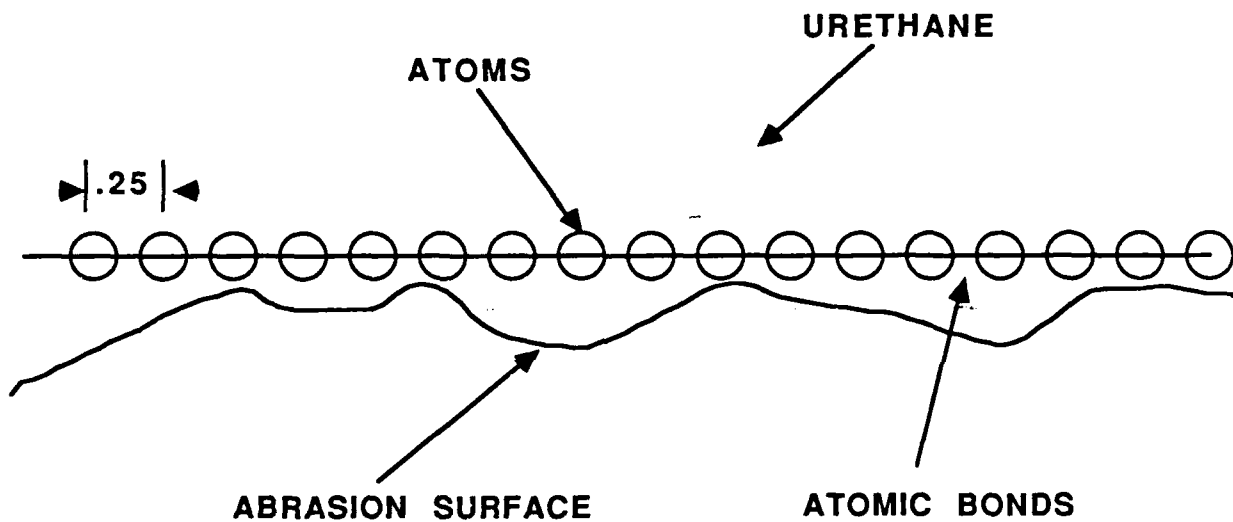


Figure 1. Urethane Unstressed

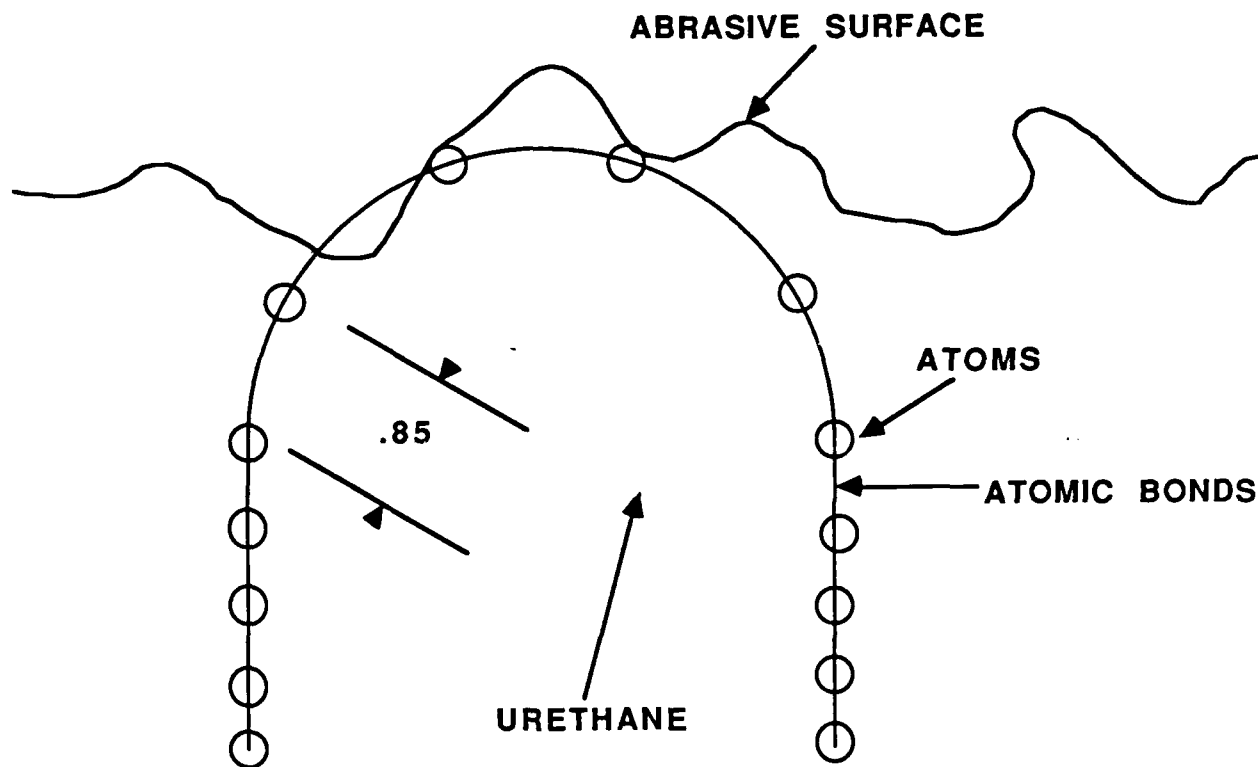


Figure 2. Urethane Stressed

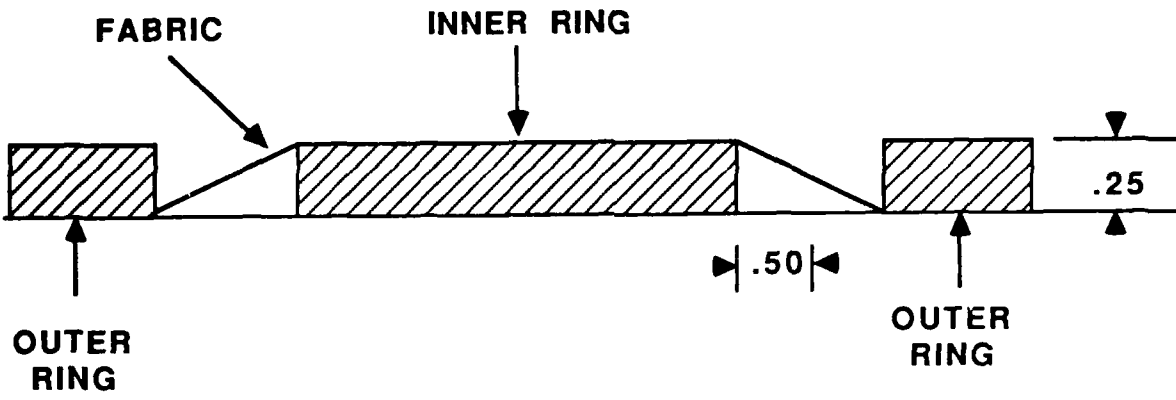


Figure 3. Stressed Abrasion Tester

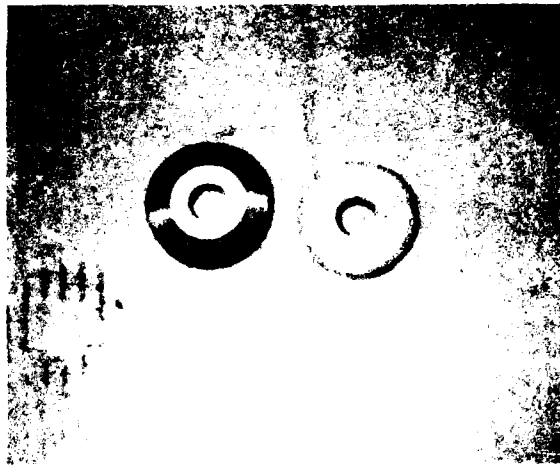
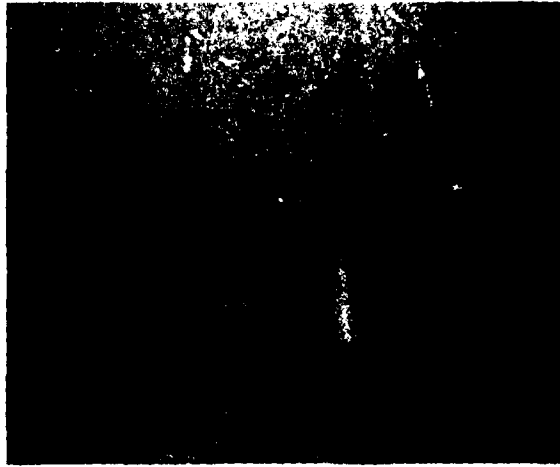


Figure 4. Taber Wheels

MATERIALS

Four different materials were chosen to demonstrate that a stressed fabric abrasion test is possible. All of the materials are either now being used in the manufacture of collapsible tanks or are proposed materials.

Material #1 is a nitrile coated nylon 0.68mm thick currently being used to manufacture a lightweight water tank.

Material #2 is a thermoplastic urethane coated nylon 1.10mm thick currently being used to manufacture pillow tanks.

Material #3 is a different thermoplastic urethane coated nylon that is 1.22mm thick. It has been recommended as an alternate material in the manufacture of pillow tanks.

Material #4 is not a urethane, and the chemical composition is unknown. It is a thermoplastic coating material over a polyester fabric currently being considered for use in berm-liner procurements.

Each of these materials was tested in both the stressed and the unstressed configuration. The results are tabulated in the following table.

ABRASION TO FABRIC EXPOSURE

MATERIAL	TABER CYCLES	STRESS CYCLES	STRESSED/ TABER RATIO	COATING THICKNESS MM	CYCLES/MM UNSTRESSED	CYCLES/MM STRESSED
#1	1,000	129	7.75	0.254	3,937	508
#2	100,000*	1,978	50.65*	3.048	32,808*	
#3	100,000*	2,046	48.88*	3.046	32,830*	672
#4	1,100	600	18.33	3.302	333	182

* Estimated minimum

SECTION III. DISCUSSION

Because of the difference in the thickness of the materials, a direct comparison of the absolute values of the data was meaningless. Taking the ratio of the Taber results over the stressed abrasion results yielded a dimensionless number used to directly compare the fabrics to one another. The thickness of each coating material was also determined and the cycles/mm were calculated for both the stressed and unstressed abrasion conditions.

The low ratio for material #1 (7.75) was not unexpected because nitriles do not seem to abrade more on the creases in the field. Also, the Taber Abrader results for this material were quite low.

The 100,000 cycle estimate for the Taber Abrader on materials #2 and #3 was necessary because all the wear on these samples occurred within the first 5,000 cycles. The wheels on the Taber Abrader were cleaned, but the abrasion did not increase.

The very high ratios in the urethane samples showed that the materials were very susceptible to stress abrasion and that normal unstressed abrasion tests would show these materials to be very good at abrasion resistance. The cycles/mm in the stressed configuration showed that urethanes did not exhibit a better stress abrasion resistance than nitrile when subjected to stress. In the field, the urethane tanks would be more susceptible to abrasion failure at the seams.

The low value for material #4 (18.33) demonstrated that the urethanes did not succumb to stressed abrasion because of the inherent nature of thermoplastics. This material, a thermoplastic, did not exhibit the drastic change in abrasion due to stress that the urethanes exhibited.

SECTION IV. CONCLUSIONS

The test apparatus looks very promising. It showed that urethanes are inherently susceptible to stress abrasion and that the test method as designed will work. The apparatus needs to be modified to permit the use of two serrated Taber wheels instead of the one ceramic wheel. This would eliminate some of the error inherent in the machine due to the fact that the ceramic wheel clogs.

Field data must be collected and compared to the laboratory results of all the tanks in the Army's inventory so a minimum ratio number can be established for inclusion into the pertinent military specifications. This is becoming more and more important as the military continues to request tanks having a longer life.

DISTRIBUTION FOR REPORT NO. 2469

DEPARTMENT OF DEFENSE

1 Director, Technical Information
Defense Advanced Research Projects
Agency
1400 Wilson Blvd.
Arlington, VA 22209

1 Director
Defense Nuclear Agency
ATTN: TITL
Washington, DC 20305

2 Defense Technical Information Center
Cameron Station
ATTN: DTIC-FDAC
Alexandria, VA 22304-6145

DEPARTMENT OF THE ARMY

1 HQDA (DAMA-AOA-M)
Washington, DC 20310

1 HQDA (DALO-TSM)
Washington, DC 20310

1 HQDA (DAEN-RDL)
Washington, DC 20314

1 HQDA (DAEN-MPE-T)
Washington, DC 20314

1 Commander
US Army Missile Research & Development
Command
ATTN: AMSMI-PR
Redstone Arsenal, AL 35809

1 Director
Army Materials and Mechanics Research
Center
ATTN: AMXMR-RL Technical Library
Watertown, MA 02172-0001

1 Commander
Chemical Research R&D Center
ATTN: SMCCR-SPS (Tech Library)
Aberdeen Proving Ground, MD 21005

1 Commander
US Army Aberdeen Proving Ground
ATTN: STEAP-MT-U (GE Branch)
Aberdeen Proving Ground, MD 21005

1 Director
US Army Materiel Systems Analysis Agency
ATTN: AMXSY-MP
Aberdeen Proving Ground, MD 21005-5071

1 Director
US Ballistics Research Laboratory
ATTN: AMXBR-OD-ST (STINFO)
Aberdeen Proving Ground, MD 21005-5066

1 Director
US Army Engineer Waterways Experiment
Station
ATTN: Chief, Library Branch
Technical Information Center
Vicksburg, MS 39180

1 Commander
US Army Armament Research &
Development Command
ATTN: SMCAR-TSS
Dover, NJ 07801-5001

1 Commander
US Army Troop Support & Aviation
Materiel Readiness Command
ATTN: DRSTS-MES (1)
4300 Goodfellow Blvd.
St. Louis, MO 63120

2 Director
Petrol & Fld Svc Dept
US Army Quartermaster School
Fort Lee, VA 23801

- | | |
|--|--|
| <p>1 US Army Tank Automotive Command
ATTN: DRSTA-TSL
Warren, MI 48090</p> <p>1 US Army Laboratory Command
ATTN: M. Levy SLCMT-MN
Materials Technology Laboratory
Watertown, MA 02172-0001</p> <p>1 US Army Laboratory Command
ATTN: J. Wells SLCMT-MCZ
Materials Technology Laboratory
Watertown, MA 02172-0001</p> <p>1 Commander
US Army Electronics Research &
Development Command
ATTN: DELSD-L
Fort Monmouth, NJ 07703-5301</p> <p>1 President
US Army Aviation Test Board
ATTN: STEBG-PO
Fort Rucker, AL 36360</p> <p>1 US Army Aviation School Library
PO Drawer O
Fort Rucker, AL 36360</p> <p>1 HQ 193D Infantry Brigade (Panama)
ATTN: AFZU-FE
APO Miami 34004</p> <p>2 Special Forces Detachment, Europe
ATTN: PBO
APO New York 09050</p> <p>2 Engineer Representative
USA Research & Standardization Group
(Europe)
Box 65
FPO 09510</p> <p>1 Commander
Rock Island Arsenal
ATTN: SARRI-LPL
Rock Island, IL 61299-7300</p> | <p>1 HQDA
ODCSLOG
DALO-TSE
Room 1E588, Pentagon
Washington, DC 20310-0561</p> <p>1 Plastics Technical Evaluation Center
ARRADCOM, Bldg 3401
Dover, NJ 07801</p> <p>1 Commandant
US Army Engineer School
ATZA-CDD
Fort Belvoir, VA 22060</p> <p>1 US Army AMCCOM
ATTN: Joseph Menke
1032 N. Thornwood
Davenport, IA 52804</p> <p>1 Commander
Headquarters, 39th Engineer Bn (Cbt)
Fort Devens, MA 01433</p> <p>1 President
US Army Airborne, Communications &
Electronics
ATTN: STEBF-ABTD
Fort Bragg, NC 28307</p> <p>1 President
US Army Armor and Engineer Board
ATTN: ATZK-AE-PD-E
Fort Knox, KY 40121-5470</p> <p>1 Director
ATTN: STSTO-TPP
Tobyhanna Army Depot
Tobyhanna, PA 18466-5097</p> <p>1 Commander and Director
USA FESA
ATTN: FESA-TS
Fort Belvoir, VA 22060</p> |
|--|--|

- 1 HQ, USAEUR & Seventh Army
Deputy Chief of Staff, Engineer
ATTN: AEAEN-MT-P
APO New York 09403
- 1 Director
US Army TRADOC
Systems Analysis Activity
ATTN: ATAA-SL (Tech Lib)
White Sands Missile Range, NM 88002

BELVOIR RD&E CENTER

- 1 Commander STRBE-Z
Deputy Commander STRBE-ZD
Technical Director STRBE-ZT
Assoc Tech Dir (E&A) STRBE-ZTE
Assoc Tech Dir (R&D) STRBE-ZTR
Executive Officer STRBE-ZX
Sergeant Major STRBE-ZM
Advanced Systems Concept Dir STRBE-H
Program Planning Div STRBE-HP
Foreign Intelligence Div STRBE-HF
Systems and Concepts Div STRBE-HC
- 4 STRBE-V
- 15 STRBE-VU
- 3 Tech Reports Ofc STRBE-BPG
- 3 Security Ofc (for liaison officers) STRBE-S
- 2 Tech Lib STRBE-BT
- 1 Public Affairs Ofc STRBE-I
- 1 Ofc of Chief Counsel STRBE-L
- 5 STRBE-FSH

DEPARTMENT OF THE NAVY

- 1 Director
Physics Program (421)
Office of Naval Research
Arlington, VA 22217
- 2 Commander
Naval Facilities Engineering Command
Department of the Navy
ATTN: Code 032-B
062
200 Stovall Street
Alexandria, VA 22332

- 1 US Naval Oceanographic Office
Navy Library/NSTL Station
Bay St. Louis, MO 39522
- 1 Library (Code L08A)
Civil Engineering Laboratory
Naval Construction Battalion Center
Port Hueneme, CA 93043
- 1 Director
Earth Physics Program
Code 464
Office of Naval Research
Arlington, VA 22217
- 1 Naval Training Equipment Center
ATTN: Technical Library
Orlando, FL 32813
- 3 Naval Sea Systems Command
ATTN: P. Schneider PMS377J1
Washington, DC 20362-5101
- 1 Naval Air Development Center
ATTN: V. S. Agarwala, Code 6062
Warminster, PA 18974
- 3 David W. Taylor Naval Research Center
ATTN: A. G. S. Morton
Code 2813
Annapolis, MD 21402

DEPARTMENT OF THE AIR FORCE

- 1 HQ USAF/RDPT
ATTN: Commander
Washington, DC 20330
- 1 HQ USAF/PREEU
Chief, Utilities Branch
Washington, DC 20330
- 1 HQ Air Force Engineering & Services Ctr
Technical Library FL7050
Tyndall AFB, FL 32403

1 US Air Force
Warner Robins Air Logistics Center
WR-ALC/MMEM
Warner-Robins AFB, GA 31098

1 Chief, Lubrications Branch
Fuels & Lubrications Div
ATTN: AFWAL/POSL
Wright-Patterson AFB, OH 45433