

DTIC FILE COPY

USAARL Report No. 88-10

2



## SPH-4 Helmet Retention Assembly Reinforcement

AD-A200 432

DTIC  
ELECTE  
NOV 10 1988  
S D  
D C

By

Ronald W. Palmer  
J. L. Haley, Jr.

Biodynamics Research Division

July 1988

88 11 09 070

United States Army Aeromedical Research Laboratory  
Fort Rucker, Alabama 36362-5292

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.


Disposition


Destroy this document when it is no longer needed. Do not return it to the originator.

Disclaimer


The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Reviewed:

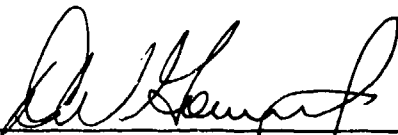  
\_\_\_\_\_  
DANIEL W. GOWER, JR.  
MAJ, MS  
Director, Biodynamics Research  
Division

  
\_\_\_\_\_  
J. D. LAMOTHE, Ph.D.  
COL, MS  
Chairman, Scientific  
Review Committee

Released for publication:

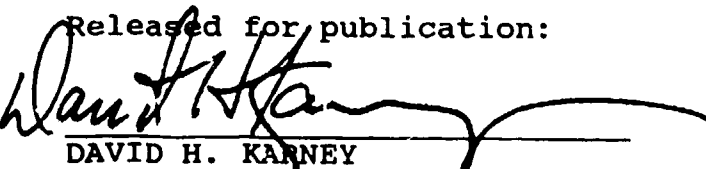  
\_\_\_\_\_  
DAVID H. KARNEY  
Colonel, MC  
Commanding

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE

## REPORT DOCUMENTATION PAGE

Form Approved  
OMB No. 0704-0188

1a. REPORT SECURITY CLASSIFICATION <b>UNCLASSIFIED</b>		1b. RESTRICTIVE MARKINGS	
2a. SECURITY CLASSIFICATION AUTHORITY		3. DISTRIBUTION/AVAILABILITY OF REPORT Public release; distribution unlimited	
2b. DECLASSIFICATION/DOWNGRADING SCHEDULE			
4. PERFORMING ORGANIZATION REPORT NUMBER(S) USAARL Report No. 88-10		5. MONITORING ORGANIZATION REPORT NUMBER(S)	
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory	6b. OFFICE SYMBOL (if applicable) SGRD-UAD-IE	7a. NAME OF MONITORING ORGANIZATION U.S. Army Medical Research and Development Command	
6c. ADDRESS (City, State, and ZIP Code) P.O. Box 577 Fort Rucker, AL 36362-5292		7b. ADDRESS (City, State, and ZIP Code) Fort Detrick, Frederick, MD 21701-5012	
8a. NAME OF FUNDING/SPONSORING ORGANIZATION	8b. OFFICE SYMBOL (if applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER	
8c. ADDRESS (City, State, and ZIP Code)		10. SOURCE OF FUNDING NUMBERS	
		PROGRAM ELEMENT NO. 62787A	PROJECT NO. 3E162787A87B
		TASK NO. AG	WORK UNIT ACCESSION NO. 138
11. TITLE (Include Security Classification) SPH-4 helmet retention assembly reinforcement (U)			
12. PERSONAL AUTHOR(S) Ronald W. Palmer and J. L. Haley, Jr.			
13a. TYPE OF REPORT Final	13b. TIME COVERED FROM _____ TO _____	14. DATE OF REPORT (Year, Month, Day) 1988, July	15. PAGE COUNT 20
16. SUPPLEMENTARY NOTATION			
17. COSATI CODES		18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)	
FIELD	GROUP	SUB-GROUP	
23	04		
23	05		
		helmet, retention system, life support equipment, chinstrap, protective clothing. (SDIO)	
19. ABSTRACT (Continue on reverse if necessary and identify by block number)			
<p>The purpose of a helmet's retention assembly is to keep the helmet firmly and securely in place on the wearer's head, thus preventing the exposure of the cranium to direct impact. The standard SPH-4 retention assembly is prone to excessive elongation under stress, and allows excessive helmet displacement and cranium exposure. A modified SPH-4 retention assembly, reinforced with 0.75-inch tubular nylon webbing, was manufactured in this laboratory and tested quasi-statically on a testing machine which exerted a force at a constant speed. A standard SPH-4 retention assembly was also tested as a control. The reinforced retention assembly withstood a 450-lb load without failure. Elongation of the reinforced retention assembly, measured at 300-lb load, was almost 50 percent less than that of the standard retention assembly measured at the same load. Keywords:</p>			
20. DISTRIBUTION/AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT. <input type="checkbox"/> DTIC USERS		21. ABSTRACT SECURITY CLASSIFICATION UNCLASSIFIED	
22a. NAME OF RESPONSIBLE INDIVIDUAL Chief, Scientific Information Center		22b. TELEPHONE (Include Area Code) (205) 255-6907	22c. OFFICE SYMBOL SGRD-UAX-SI

DD Form 1473, JUN 86

Previous editions are obsolete.

SECURITY CLASSIFICATION OF THIS PAGE  
UNCLASSIFIED

## Table of contents

	Page
List of figures.....	2
Introduction.....	3
Methods.....	3
Materials.....	8
Results.....	8
Discussion.....	10
Conclusions.....	11
Recommendation.....	11
References.....	12
List of equipment manufacturers.....	13

Accession For	
NTIS CR&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
A-1	



## List of figures

Figure	Page
1. Reinforced retention assembly.....	5
2. Reinforced retention assembly as installed in an SPH-4 helmet with ANSI Z-90.1 simulated "chin" loading device.....	6
3. Standard retention assembly as installed in an SPH-4 helmet sustaining the load from a simulated "chin".....	7
4. Comparison of the SPH-4 helmet displacement from the head when restrained by a standard and a reinforced retention system.....	9
5. Failure of the left, forward retention tab stitching in the standard retention assembly.....	10

## Introduction

The importance of a helmet's retention system is equal to the importance of its protective covering in providing protection to its wearer. A helmet that is exposed to the impact forces that occur in an accident can be displaced by these forces or, possibly, come off the head entirely, thereby exposing the cranium to direct impact. A helmet with adequate impact protection structure that displaces or does not remain on the head will not provide the protection against the initial or secondary impacts that occur in many rotary-wing accidents.

The SPH-4 flight helmet, with the stronger double-snap chinstrap, does not come off the head easily as is revealed by our Aviation Life Support Equipment Retrieval Program (ALSERP), but the excessive elongation of the retention harness (chinstrap and nape-ear cloth assembly) permits excessive cranium exposure. A new experimental helmet retention test, using a humanoid head and neck attached to a pendulum, also has revealed excessive rotation of the SPH-4 helmet so that the forward blow of the helmet rests on the chin in some simulated "crashes" (Gruver and Haley, 1987). Also, it previously has been reported that retention assembly failure is a significant factor in those cases in which helmet loss occurs (Reading, et al., 1984).

This report will show how the existing SPH-4 retention harness can be reinforced to reduce by 50 percent the stretch of the harness. It is obvious that stiffening the chinstrap and adjacent harness will reduce upward displacement of the helmet when the head is pitched violently forward in an accident. By reducing upward displacement, the degree to which the helmet will displace on the head (forward and backward) also will be reduced, thereby maintaining the protective covering of the head.

## Methods

A reinforced retention assembly (Figure 1) was made by removing the retention tabs from a standard SPH-4 retention assembly and stitching 0.75-in. tubular nylon webbing along both sides of each earcup. The thread used was Nymo UVR, size EE, nylon monocord,\* which has a strength of 15.5 lbs. Fourteen

---

\* See Appendix

stitches per inch were sewn. The upper ends of the webbing extended beyond the upper edge of the retention assembly by 1.75 inches. These extensions were grommeted and they provided the points of attachment to the helmet shell, taking the place of the original retention tabs. The webbing on the left rearward side extended 1.5 inches beyond the lower edge of the retention assembly and had two D-rings sewn into its end. The webbing on the right rearward side extended 13 inches beyond the lower edge and formed the chinstrap. No snaps were used. The chinstrap anchor points were located 1 inch to the rear of the original anchor points, as seen in Figures 1a and 1b. However, an impromptu fit test indicated the standard SPH-4 geometry should have been used in regard to the location of the chinstrap anchor points. The reinforced retention assembly weighed 0.22 lb as opposed to the standard retention assembly (including chinstrap) which weighed 0.24 lb.

Two standard, extra-large size SPH-4 helmets were used in the test. One helmet (Figure 2) contained the webbing-reinforced retention assembly and the other (Figure 3) contained the standard SPH-4 retention assembly. The retention assemblies were tested quasistatically on a testing machine which exerted a downward force at a constant speed.



1a. Left side view



1b. Right side view



1c. Front view



1d. Rear view

Figure 1. Reinforced retention assembly.



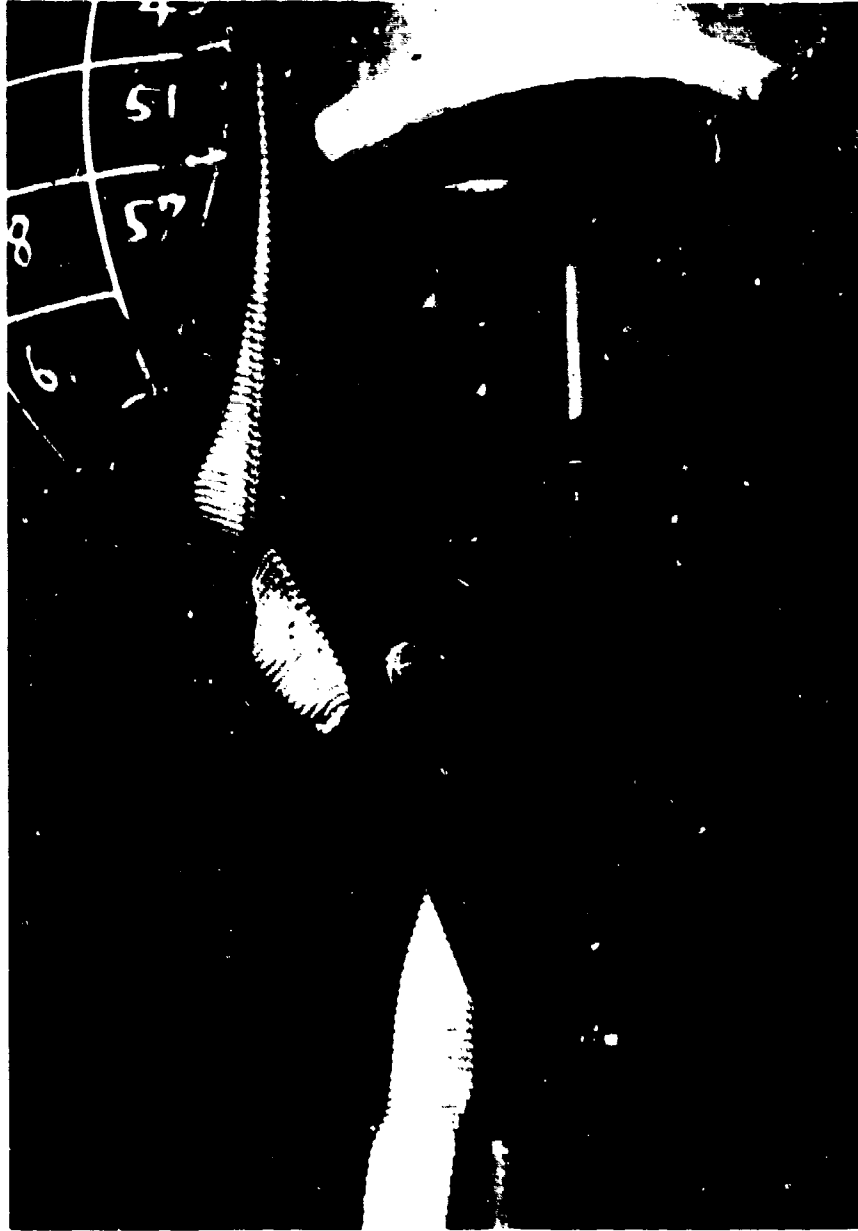


Figure 2. Reinforced retention assembly as installed in an SPH-4 helmet with ANSI Z-90.1 simulated "chin" loading device.



Figure 3. Standard retention assembly as installed in an SPH-4 helmet sustaining the load from a simulated "chin."

## Materials

The testing machine used in this experiment was the Tinius-Olsen Locap\* testing machine. A 600-pound Revere load cell\* was used. The rate of loading was 1.5 inches per minute.

## Results

The results are depicted in Figure 4. The reinforced retention assembly did not fail under a load of 450 lb. Deflection was 2.1 in. The reinforced retention assembly was not stressed to failure; however, slight fraying around the grommet of the left, forward retention tab (extension) was seen. Initially, the standard retention assembly failed at 250 lb. However, after the test it was noted that the left, forward retention tab had not been stitched in accordance with MIL-H-43925 because the stitching extended approximately half way across the width of the retention tab. Another retention assembly was tested and loaded to 400 lb with a deflection of 3.2 inches when failure occurred in the left, forward retention tab, as shown in Figure 5.

Deflections of the reinforced and standard retention assemblies, measured at 300 lb loads, were compared and the reinforced retention assembly was shown to have stretched 45 percent less than the standard retention assembly.

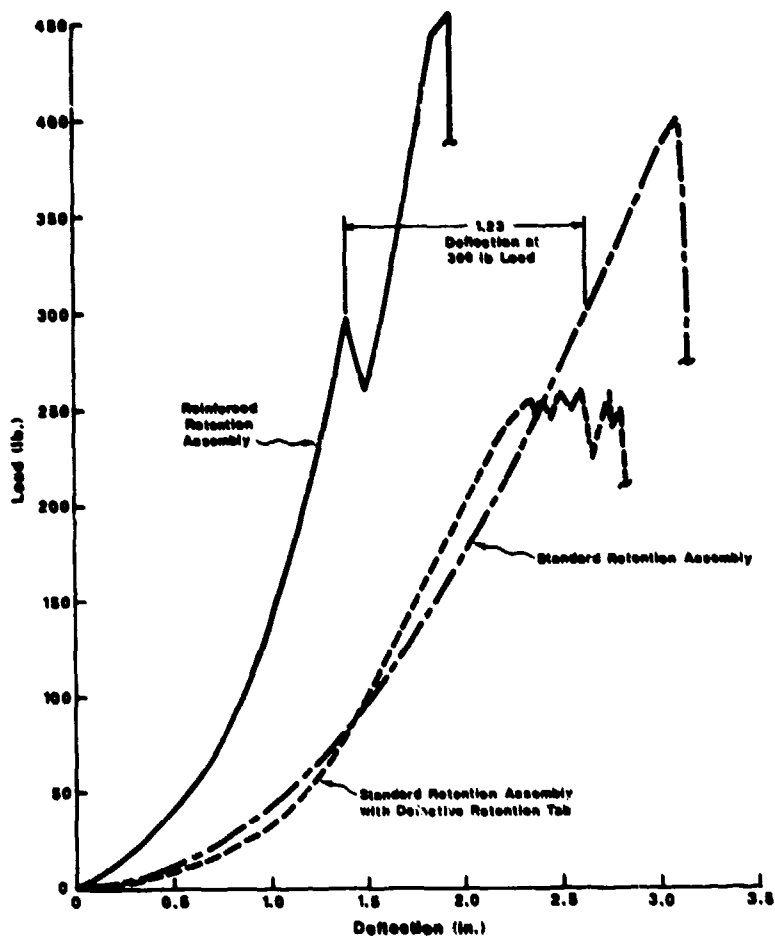


Figure 4. Comparison of the SPH-4 helmet displacement from the head when restrained by a standard and a reinforced retention system.



Figure 5. Failure of the left, forward retention tab stitching in the standard retention assembly.

#### Discussion

All retention assemblies tested either failed or showed slight fraying at the left, forward retention tab, an indication that the test method produced an uneven load distribution among the four retention tabs. Current military specifications for the SPH-4 require that the retention assembly be able to withstand a load of 300 lb which is equivalent to 75 lb per retention tab. The results of this study indicate retention tab failure will occur if the standard SPH-4 retention assembly is subjected to an unequally distributed load, not an unusual event in accidents. Both of the failures observed in this test were due to failure of the retention tab stitching.

The reinforced retention assembly stretched much less than the standard retention assembly. This performance was due to three factors. First, by stitching the tubular nylon webbing longitudinally along the entire length of the retention assembly, the load is distributed directly to the retention material surrounding the earcups and to the chin of the user. This is in contrast to the standard retention assembly in which load is concentrated at four points. Second, each webbing strap was secured to the retention assembly by two parallel

rows of stitching which made the assembly resistant to stitching failure. Third, because the nylon tubular webbing is less elastic than the cloth which surrounds the earcups, the reinforced retention assembly stretches far less than the standard retention assembly which results in reduced deflection under stress.

The effect of excessive chinstrap deflection cannot be overemphasized. Prior helmet retention testing on the U.S Army Aeomedical Research Laboratory pendulum (dynamic) tester revealed the excessive movement of the standard SPH-3 and SPH-4 helmets by comparison to the HGU-33 and HGU-54 helmets (Gruber and Haley, 1987).

### Conclusions

1. The standard SPH-4 retention assembly easily can be modified so that it can withstand loads up to 450 lb.
2. Such a modification eliminates retention tab stitching failure and distributes the load over a greater, continuous area.
3. Modification of the standard retention assembly in this way causes the assembly to stretch less when under load and, thus, facilitates helmet retention.
4. Modification of the standard retention assembly in this way will prevent premature retention assembly failure during uneven loading.

### Recommendation

Recommend further development and field evaluation of the reinforced retention system to determine its suitability for use in the SPH-4 helmet.

## References

- Gruver, D. M. and Haley, J. L. 1987. Development of a test method for evaluating the effectiveness of Helmet Retention Systems. U.S. Army Aeromedical Research Laboratory. USAARL Letter Report. In press.
- Reading, T. E., Haley, J. L., Jr., Sippo, A. C., Licina, J. R., and Schopper, A. W. 1984. SPH-4 U.S. Army flight helmet performance 1972-1983. Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. USAARL 85-1.

## Appendix

### List of equipment manufacturers

Belding Corticelli Thread Company  
1430 - T Broadway  
New York, NY 10018

Tinius Olsen Testing Machine Company, Inc.  
Easton Road, Box 429  
Willow Grove, PA 19090



Initial distribution

Commander  
U.S. Army Natick Research  
and Development Center  
ATTN: Documents Librarian  
Natick, MA 01760

Naval Submarine Medical  
Research Laboratory  
Medical Library, Naval Sub Base  
Box 900  
Groton, CT 05340

Commander/Director  
U.S. Army Combat Surveillance  
& Target Acquisition Lab  
ATTN: DELCS-D  
Fort Monmouth, NJ 07703-5304

Commander  
10th Medical Laboratory  
ATTN: Audiologist  
APO NEW YORK 09180

Commander  
Naval Air Development Center  
Biophysics Lab  
ATTN: G. Kydd  
Code 60B1  
Warminster, PA 18974

Naval Air Development Center  
Technical Information Division  
Technical Support Detachment  
Warminster, PA 18974

Dr. E. Hendler  
Human Factors Applications, Inc.  
295 West Street Road  
Warminster, PA 18974

Under Secretary of Defense  
for Research and Engineering  
ATTN: Military Assistant  
for Medical and Life Sciences  
Washington, DC 20301

Commander  
U.S. Army Research Institute  
of Environmental Medicine  
Natick, MA 01760

U.S. Army Avionics Research  
and Development Activity  
ATTN: SAVAA-P-TP  
Fort Monmouth, NJ 07703-5401

U.S. Army Research and Development  
Support Activity  
Fort Monmouth, NJ 07703

Chief, Benet Weapons Laboratory  
LCWSL, USA ARRADCOM  
ATTN: DRDAR-LCB-TL  
Watervliet Arsenal, NY 12189

Commander  
Man-Machine Integration System  
Code 602  
Naval Air Development Center  
Warminster, PA 18974

Commander  
Naval Air Development Center  
ATTN: Code 6021 (Mr. Brindle)  
Warminster, PA 18974

Commanding Officer  
Naval Medical Research  
and Development Command  
National Naval Medical Center  
Bethesda, MD 20014

Director  
Army Audiology and Speech Center  
Walter Reed Army Medical Center  
Washington, DC 20307-5001

COL Franklin H. Top, Jr., MD  
Walter Reed Army Institute  
of Research  
Washington, DC 20307-5100

HQ DA (DASG-PSP-0)  
Washington, DC 20310

Naval Research  
Laboratory Library  
Code 1433  
Washington, DC 20375

Harry Diamond Laboratories  
ATTN: Technical Infor-  
mation Branch  
2800 Powder Mill Road  
Adelphi, MD 20783-1197

U.S. Army Materiel Systems  
Analysis Agency  
ATTN: Reports Processing  
Aberdeen proving Ground  
MD 21005-5017

U.S. Army Ordnance Center  
and School Library  
Building 3071  
Aberdeen Proving Ground,  
MD 21005-5201

U.S. Army Environmental Hygiene  
Agency Laboratory  
Building E2100  
Aberdeen Proving Ground,  
MD 21010

Technical Library  
Chemical Research  
and Development Center  
Aberdeen Proving Ground,  
MD 21010-5423

Commander  
U.S. Army Institute  
of Dental Research  
Walter Reed Army Medical Center  
Washington, DC 20307-5300

Naval Air Systems Command  
Technical Air Library 950D  
Rm 278, Jefferson Plaza II  
Department of the Navy  
Washington, DC 20361

Naval Research Laboratory Library  
Shock and Vibration Infor-  
mation Center, Code 5804  
Washington, DC 20375

Director  
U.S. Army Human Engineer-  
ing Laboratory  
ATTN: Technical Library  
Aberdeen Proving Ground,  
MD 21005-5001

Commander  
U.S. Army Test  
and Evaluation Command  
ATTN: AMSTE-AD-H  
Aberdeen Proving Ground,  
MD 21005-5055

Director  
U.S. Army Ballistic  
Research Laboratory  
ATTN: DRXBR-OD-ST Tech Reports  
Aberdeen Proving Ground,  
MD 21005-5066

Commander  
U.S. Army Medical Research  
Institute of Chemical Defense  
ATTN: SGRD-UV-AO  
Aberdeen Proving Ground,  
MD 21010-5425

Commander  
U.S. Army Medical Research  
and Development Command  
ATTN: SGRD-RMS (Ms. Madigan)  
Fort Detrick, Frederick, MD 21701

Commander  
U.S. Army Medical Research  
Institute of Infectious Diseases  
Fort Detrick, Frederick,  
MD 21701

Director, Biological  
Sciences Division  
Office of Naval Research  
600 North Quincy Street  
Arlington, VA 22217

Commander  
U.S. Army Materiel Command  
ATTN: AMCDE-S (CPT Broadwater)  
5001 Eisenhower Avenue  
Alexandria, VA 22333

Commandant  
U.S. Army Aviation  
Logistics School  
ATTN: ATSQ-TDN  
Fort Eustis, VA 23604

U.S. Army Training  
and Doctrine Command  
ATTN: ATCD-ZX  
Fort Monroe, VA 23651

Structures Laboratory Library  
USARTL-AVSCOM  
NASA Langley Research Center  
Mail Stop 266  
Hampton, VA 23665

Naval Aerospace Medical  
Institute Library  
Bldg 1953, Code 102  
Pensacola, FL 32508

Command Surgeon  
U.S. Central Command  
MacDill Air Force Base  
FL 33608

Air University Library  
(AUL/LSE)  
Maxwell AFB, AL 36112

Commander  
U.S. Army Medical Bioengineering  
Research and Development Lab  
ATTN: SGRD-UBZ-I  
Fort Detrick, Frederick,  
MD 21701

Defense Technical  
Information Center  
Cameron Station  
Alexandria, VA 22313

U.S. Army Foreign Science  
and Technology Center  
ATTN: MTZ  
220 7th Street, NE  
Charlottesville, VA 22901-5396

Director,  
Applied Technology Laboratory  
USARTL-AVSCOM  
ATTN: Library, Building 401  
Fort Eustis, VA 23604

U.S. Army Training  
and Doctrine Command  
ATTN: Surgeon  
Fort Monroe, VA 23651-5000

Aviation Medicine Clinic  
TMC #22, SAAF  
Fort Bragg, NC 28305

U.S. Air Force Armament  
Development and Test Center  
Eglin Air Force Base, FL 32542

U.S. Army Missile Command  
Redstone Scientific  
Information Center  
ATTN: Documents Section  
Redstone Arsenal, AL 35898-5241

U.S. Army Research and Technology  
Laboratories (AVSCOM)  
Propulsion Laboratory MS 302-2  
NASA Lewis Research Center  
Cleveland, OH 44135

AFAMRL/HEX  
Wright-Patterson AFB. JH 45433

University of Michigan  
NASA Center of Excellence  
in Man-Systems Research  
ATTN: R. G. Snyder, Director  
Ann Arbor, MI 48109

John A. Dellinger, MS, ATP  
University of Illinois-  
Willard Airport  
Savoy, IL 61874

Project Officer  
Aviation Life Support Equipment  
ATTN: AMCPO-ALSE  
4300 Goodfellow Blvd.  
St. Louis, MO 63120-1798

Commander  
U.S. Army Aviation  
Aviation Systems Command  
ATTN: DRSAB-ED  
4300 Goodfellow Blvd  
St. Louis, MO 63120

Commanding Officer  
Naval Biodynamics Laboratory  
P.O. Box 24907  
New Orleans, LA 70189

U.S. Army Field Artillery School  
ATTN: Library  
Snow Hall, Room 14  
Fort Sill, OK 73503

Commander  
U.S. Army Health Services Command  
ATTN: HSOP-SO  
Fort Sam Houston, TX 78234-6000

U.S. Air Force Institute  
of Technology (AFIT/LDEE)  
Building 640, Area B  
Wright-Patterson AFB, OH 45433

Henry L. Taylor  
Director, Institute of Aviation  
University of Illinois-  
Willard Airport  
Savoy, IL 61874

Commander  
U.S. Army Aviation  
Systems Command  
ATTN: DRSAB-WS  
4300 Goodfellow Blvd  
St. Louis, MO 63120-1798

Commander  
U.S. Army Aviation  
Systems Command  
ATTN: SGRD-UAX-AL (MAJ Lacy)  
4300 Goodfellow Blvd., Bldg 105  
St. Louis, MO 63120

U.S. Army Aviation  
Systems Command  
Library and Information  
Center Branch  
ATTN: DRSAB-DIL  
4300 Goodfellow Blvd  
St. Louis, MO 63120

Federal Aviation Administration  
Civil Aeromedical Institute  
CAMI Library AAC 64D1  
P.O. Box 25082  
Oklahoma City, OK 73125

Commander  
U.S. Army Academy  
of Health Sciences  
ATTN: Library  
Fort Sam Houston, TX 78234

Commander  
U.S. Army Institute  
of Surgical Research  
ATTN: SGRD-USM (Jan Duke)  
Fort Sam Houston, TX 78234-6200

Director of Professional Services  
AFMSC/GSP  
Brooks Air Force Base, TX 78235

U.S. Army Dugway Proving Ground  
Technical Library  
Bldg 5330  
Dugway, UT 84022

U.S. Army Yuma Proving Ground  
Technical Library  
Technical Library  
Yuma, AZ 85364

AFFTC Technical Library  
6520 TESTG/ENXL  
Edwards Air Force Base,  
CAL 93523-5000

Commander  
Code 3431  
Naval Weapons Center  
China Lake, CA 93555

Aeromechanics Laboratory  
U.S. Army Research  
and Technical Labs  
Ames Research Center,  
M/S 215-1  
Moffett Field, CA 94035

Sixth U.S. Army  
ATTN: SMA  
Presidio of San Francisco,  
CA 94129

Commander  
U.S. Army Aeromedical Center  
Fort Rucker, AL 36362

Directorate  
of Combat Developments  
Bldg 507  
Fort Rucker, AL 36362

U.S. Air Force School  
of Aerospace Medicine  
Strughold Aeromedical Library  
Documents Section, USAFSAM/TSK-4  
Brooks Air Force Base, TX 78235

Dr. Diane Damos  
Department of Human Factors  
ISSM, USC  
Los Angeles, CA 90089-0021

U.S. Army White Sands  
Missile Range  
Technical Library Division  
White Sands Missile Range,  
NM 88002

U.S. Army Aviation Engineering  
Flight Activity  
ATTN: SAVTE-M (Tech Lib)  
Stop 217  
Edwards Air Force Base,  
CA 93523-5000

U.S. Army Combat Developments  
Experimental Center  
Technical Information Center  
Bldg 2925  
Fort Ord, CA 93941-5000

Commander  
Letterman Army Institute  
of Research  
ATTN: Medical Research Library  
Presidio of San Francisco,  
CA 94129

Director  
Naval Biosciences Laboratory  
Naval Supply Center, Bldg 844  
Oakland, CA 94625

Commander  
U.S. Army Aviation Center  
and Fort Rucker  
ATTN: ATZQ-CDR  
Fort Rucker, AL 36362

Directorate  
of Training Development  
Bldg 502  
Fort Rucker, AL 36362

Chief  
Army Research Institute  
Field Unit  
Fort Rucker, AL 36362

Commander  
U.S. Army Safety Center  
Fort Rucker, AL 36362

U.S. Army Aircraft Development  
Test Activity  
ATTN: STEBG-MP-QA  
Cairns AAF  
Fort Rucker, AL 36362

Chief  
Defence and Civil Institute  
of Environmental Medicine  
P.O. Box 2000  
ATTN: Director MLSD  
Downsview, Ontario Canada M3M 3B9

Staff Officer, Aerospace Medicine  
RAF Staff, British Embassy  
3100 Massachusetts Avenue, NW  
Washington, DC 20008

Canadian Society  
of Aviation Medicine  
c/o Academy of Medicine, Toronto  
ATTN: Ms. Carment King  
288 Bloor Street West  
Toronto, Canada M5S 1V8

Canadian Forces  
Medical Liaison Officer  
Canadian Defence Liaison Staff  
2450 Massachusetts Avenue, NW  
Washington, DC 20008

Officer Commanding  
School of Operational  
and Aerospace Medicine  
DCIEM P.O. Box 2000  
1133 Sheppard Avenue West  
Downsview, Ontario, Canada M3M 3B9

Chief  
Human Engineering Laboratory  
Field Unit  
Fort Rucker, AL 36362

Commander  
U.S. Army Aviation Center  
and Fort Rucker  
ATTN: ATZQ-T-ATL  
Fort Rucker, AL 36362

President  
U.S. Army Aviation Board  
Cairns AAF  
Fort Rucker, AL 36362

USA Medical Liaison Officer  
U.S. Embassy Box 54  
ATTN: USADO-AMLO  
FPO New York 09509

HQ, Department of the Army  
Office of The Surgeon General  
British Medical Liaison Officer  
DASG-ZX/COL M. Daly  
5109 Leesburg Pike  
Falls Church, VA 22401-3258

Canadian Airline Pilot's  
Association  
MAJ (Retired) J. Soutendam  
1300 Steeles Avenue East  
Brampton, Ontario, Canada L6T 1A2

Commanding Officer  
404 Squadron CFB Greenwood  
Greenwood, NS, Canada B0P 1N0

National Defence Headquarters  
101 Colonel By Drive  
ATTN: DPM  
Ottawa, Ontario, Canada K1A 0K2

Commanding Officer  
Headquarters, RAAF Base  
Point Cook Victoria,  
Australia 3029

Canadian Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

Netherlands Army Liaison Office  
Buildingg 602  
Fort Rucker, AL 36362

German Army Liaison Office  
Buildingg 602  
Fort Rucker, AL 36362

British Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

French Army Liaison Office  
Building 602  
Fort Rucker, AL 36362