

AD-A26 1 969



DTIC
ELECTE
MAR 22 1993
S C D

2

ARMY RESEARCH LABORATORY



The Effects of Small Changes in the Input Data on the Determination of Closed-Bomb Burning Rates and Surface Area

Frederick W. Robbins
Karen A. Cieslewicz

ARL-TR-83

March 1993

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION IS UNLIMITED.

98 3 19 037

93-05884



8804

NOTICES

Destroy this report when it is no longer needed. DO NOT return it to the originator.

Additional copies of this report may be obtained from the National Technical Information Service, U.S. Department of Commerce, 5285 Port Royal Road, Springfield, VA 22161.

The findings of this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

The use of trade names or manufacturers' names in this report does not constitute indorsement of any commercial product.

REPORT DOCUMENTATION PAGE			Form Approved OMB No. 0704-0188	
Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.				
1. AGENCY USE ONLY (Leave blank)	2. REPORT DATE March 1993	3. REPORT TYPE AND DATES COVERED Final, Oct 89 - Oct 90		
4. TITLE AND SUBTITLE The Effects of Small Changes in the Input Data on the Determination of Closed-Bomb Burning Rates and Surface Area			5. FUNDING NUMBERS PR: 1L162618AH80	
6. AUTHOR(S) Frederick W. Robbins and Karen A. Cieslewicz				
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES)			8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING / MONITORING AGENCY NAME(S) AND ADDRESS(ES) U.S. Army Research Laboratory ATTN: AMSRL-OP-CI-B (Tech Lib) Aberdeen Proving Ground, MD 21005-5066			10. SPONSORING / MONITORING AGENCY REPORT NUMBER ARL-TR-83	
11. SUPPLEMENTARY NOTES				
12a. DISTRIBUTION / AVAILABILITY STATEMENT Approved for public release; distribution is unlimited.			12b. DISTRIBUTION CODE	
13. ABSTRACT (Maximum 200 words) In order to ascertain the effects of small changes in the input data on the determination of closed-bomb burning rates, a series of related computer programs was developed. The computer programs allow a qualitative and quantitative evaluation of the effects of varying thermodynamic properties and, if desired, the propellant grain dimensions. Program listings and sample runs are included, along with Fortran listings of common form functions.				
14. SUBJECT TERMS closed bomb tests; burning rate; interior ballistics			15. NUMBER OF PAGES 98	
			16. PRICE CODE	
17. SECURITY CLASSIFICATION OF REPORT UNCLASSIFIED	18. SECURITY CLASSIFICATION OF THIS PAGE UNCLASSIFIED	19. SECURITY CLASSIFICATION OF ABSTRACT UNCLASSIFIED	20. LIMITATION OF ABSTRACT UL	

INTENTIONALLY LEFT BLANK.

ACKNOWLEDGMENTS

The authors wish to acknowledge the efforts of Ms. T. Keys in the preparation and review of this report and Ms. K. Meyers for the technical illustrations presented in this report. We also wish to acknowledge the excellent reviews provided by Mr. R. Anderson and Mr. W. Oberle. (Note: The U.S. Army Ballistic Research Laboratory was deactivated on 30 September 1992 and subsequently became a part of the U.S. Army Research Laboratory (ARL) on 1 October 1992.)

DTIC QUALITY IS EXPECTED

Accession For	
NTIS CRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input checked="" type="checkbox"/>
Unannounced	<input checked="" type="checkbox"/>
Justification	
By	
Distribution /	
Availability Codes	
Dist	Avail and/or Special
A-1	

TABLE OF CONTENTS

	<u>Page</u>
ACKNOWLEDGMENTS	iii
LIST OF FIGURES	vii
LIST OF TABLES	ix
1. INTRODUCTION	1
2. DERIVATION OF EQUATIONS	2
3. CALCULATIONS FOR MODIFIED VARIABLES	5
4. CALCULATIONS FOR APPLICATION ANALYSIS	21
5. ADDITIONAL NOTES	21
6. CONCLUSIONS	21
7. REFERENCES	23
APPENDIX A: FORM FUNCTION EQUATIONS	25
APPENDIX B: USER'S MANUAL FOR THE PROGRAMS PT, SURF, AND BR	45
APPENDIX C: PROGRAM LISTING FOR PT	53
APPENDIX D: PROGRAM LISTING FOR SURF	61
APPENDIX E: PROGRAM LISTING FOR BR	71
APPENDIX F: PROGRAM LISTING FOR FORMFN	81
LIST OF SYMBOLS	93
DISTRIBUTION LIST	95

INTENTIONALLY LEFT BLANK.

LIST OF FIGURES

<u>Figure</u>	<u>Page</u>
1. Pressure-Time Curve From the Baseline Case for the 19-Perforated Right Circular Cylindrical Grain	7
2. Pressure-Time Curve From the Baseline Case for the Slotted Single-Perforated Right Circular Cylindrical Grain	7
3. Surface Area Difference Fraction-Distance Curve for the 19-Perforated Right Circular Cylindrical Grain	9
4. Surface Area Difference Fraction-Distance Curve for the Slotted Single-Perforated Right Circular Cylindrical Grain	9
5. Burning Rate-Pressure Curve for the 19-Perforated Right Circular Cylindrical Grain	10
6. Burning Rate-Pressure Curve for the Slotted Single-Perforated Right Circular Cylindrical Grain	10
7. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Specific Heat Capacity for the 19-Perforated Right Circular Cylindrical Grain	13
8. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Specific Heat Capacity for the Slotted Single-Perforated Right Circular Cylindrical Grain	13
9. Burning Rate-Pressure Curve With a 10% Reduction of the Specific Heat Capacity for the 19-Perforated Right Circular Cylindrical Grain	14
10. Burning Rate-Pressure Curve With a 10% Reduction of the Specific Heat Capacity for the Slotted Single-Perforated Right Circular Cylindrical Grain	14
11. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Perforation Diameter for the 19-Perforated Right Circular Cylindrical Grain	15
12. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Perforation Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain	15
13. Burning Rate-Pressure Curve With a 10% Reduction of the Perforation Diameter for the 19-Perforated Right Circular Cylindrical Grain	16

<u>Figure</u>	<u>Page</u>
14. Burning Rate-Pressure Curve With a 10% Reduction of the Perforation Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain	16
15. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Propellant Density for the 19-Perforated Right Circular Cylindrical Grain	17
16. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Propellant Density for the Slotted Single-Perforated Right Circular Cylindrical Grain	17
17. Burning Rate-Pressure Curve With a 10% Reduction of the Propellant Density for the 19-Perforated Right Circular Cylindrical Grain	18
18. Burning Rate-Pressure Curve With a 10% Reduction of the Propellant Density for the Slotted Single-Perforated Right Circular Cylindrical Grain	18
19. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Grain Diameter for the 19-Perforated Right Circular Cylindrical Grain	19
20. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Grain Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain	19
21. Burning Rate-Pressure Curve With a 10% Reduction of the Grain Diameter for the 19-Perforated Right Circular Cylindrical Grain	20
22. Burning Rate-Pressure Curve With a 10% Reduction of the Grain Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain	20
A-1. Spherical Grain	29
A-2. Rectangular Grain	29
A-3. Right Circular Cylindrical Grain	31
A-4. Single-Perforated Right Circular Cylindrical Grain	31
A-5. 7-Perforated Right Circular Cylindrical Grain	33
A-6. 19-Perforated Right Circular Cylindrical Grain	36
A-7. 19-Perforated Right Hexagonal Grain With Rounded Corners	38
A-8. Slotted Single-Perforated Right Circular Cylindrical Grain	41

LIST OF TABLES

<u>Table</u>		<u>Page</u>
1.	Analysis for the Precision of the Baseline Case	8
2.	Analysis of the Surface Area of Modified Variables	11
3.	Analysis of the Burning Rate of Modified Variables	12
4.	Effects of Burning Rate in Gun Systems	22

INTENTIONALLY LEFT BLANK.

1. INTRODUCTION

A *closed bomb* is a fixed volume chamber in which gun propellant is burned. One purpose of a closed bomb is to collect pressure vs. time data, which allows the calculation of the linear burning rate (i.e., rate of grain regression). The burning rate can be determined from the known propellant geometry, the thermodynamic properties of the propellant, and the pressure-time curve.

In order to ascertain the effects of small changes in the input data on the determination of closed-bomb burning rates, a series of related computer programs was developed. The computer programs allow a qualitative and quantitative evaluation of the effects of varying thermodynamic properties and, if desired, the propellant grain dimensions. Similar capabilities have been provided in the new closed-bomb analysis program, BRLCB (Oberle and Kooker, to be published). Appendixes C, D, and E contain the source code listings for the computer programs PT, SURF, and BR. The computer programs are based on a previous procedure for the numerical simulation of a closed-bomb pressure-time curve (Robbins and Horst 1976). Each program requires the thermodynamic properties and two of the three input variables: 1) a pressure-time curve, 2) a surface area profile, and 3) a burning rate curve. The programs fix two of the three inputs; from these, information can be calculated for the third variable. Therefore, for the given thermodynamic properties of the propellant:

- the program PT calculates a set of pressure-time points from the surface area profile and the burning rate information;
- the program SURF calculates the surface area profile from the pressure-time and the burning rate information; and
- the program BR calculates a set of burning rates, pressure points from a given pressure-time curve, and a surface area profile.

The program PT is used to calculate the pressure vs. time curve from the baseline thermodynamic properties, surface area, and burning rate. Any of the input variables can be modified to assess the effect on the calculated burning rate or the calculated surface area.

For example, input variables can be modified to affect the grain geometry (i.e., perforation diameter, grain diameter, grain length, slot width, and density), or thermodynamic values (i.e., specific heat capacity, flame temperature, molecular weight, and covolume).

Two studies were conducted to determine how the modification of single variables affects the calculated burning rate and surface area of both single-perforated cylindrical slotted grains and 19-perforated cylindrical grains. Studies were performed to evaluate the effects of modifying the constant volume specific heat, grain diameter, perforation diameter, and the density of the propellant.

After studying how the modified variables influence the burning rate or surface area, the effects of the changed burning rate on interior ballistic calculation for a 120-mm and a 155-mm gun system were calculated.

2. DERIVATION OF EQUATIONS

If the igniter, air, and burned propellant gases completely mix, the following energy balance equation follows (see the List of Symbols):

$$m_i C_{vi}(FT_i - T) + m_p C_{vp}(FT_p - T) + m_a C_{va}(T_a - T) - L = 0 \quad (1)$$

where all energy losses are contained in L.

Solving Equation 1 for T, and assuming the igniter burns in the initial stage, one can write a covolume (Noble-Abel) equation of state in the following form:

$$P [V_o - m_{po}/d_p + m_p (1/d_p - n_p) - m_i n_i - m_a n_a] \\ = mR_h (m_p C_{vp} FT_p + m_i C_{vi} FT_i + m_a C_{va} T_a - L) / (m_p C_{vp} + m_i C_{vi} + m_a C_{va}) \quad (2)$$

where

$$\begin{aligned}R_h &= (R/mw_i + R/mw_a + R/mw_p) / m \\ &= (R_i + R_a + R_p) / m \\ m &= m_i + m_a + m_p.\end{aligned}$$

A direct solution for P is allowed of the form:

$$P = f(m_p). \quad (3)$$

With some rearrangement of terms, Equation 2 can be rewritten as a quadratic function of m_p :

$$Am_p^2 + Bm_p + C = 0 \quad (4)$$

where

$$A = P(1/d_p - n_p)C_{vp} - R_p C_{vp} FT_p$$

$$\begin{aligned}B &= (m_i C_{vi} + m_a C_{va}) P(1/d_p - n_p) + C_{vp} P(V_o - m_{po}/d_p - m_i n_i - m_a n_a) \\ &\quad - C_{vp} FT_p (m_i R_i + m_a R_a) - R_p (m_i C_{vi} FT_i + m_a C_{va} T_a - L)\end{aligned}$$

$$\begin{aligned}C &= (-m_i n_i + V_o - m_{po}/d_p - m_a n_a) P(m_i C_{vi} + m_a C_{va}) \\ &\quad - (m_i R_i + m_a R_a) (m_i C_{vi} FT_i + m_a C_{va} T_a - L).\end{aligned}$$

Hence, solutions can be found to the inverse problem of the form:

$$m_p = g(P). \quad (5)$$

A solution for Equation 3 is required to simulate the pressure-time profile obtained by burning a given quantity of propellant in a closed chamber. This is obtained by making use of assumed or previously determined burning rate data and numerically integrating the standard burning rate "law" $dx/dt = aP^n$ to obtain a depth burned. A corresponding value for m_p is then generated in the conventional manner from the propellant geometry (form function). The assumptions employed include the complete burning of the igniter; instantaneous ignition of all propellant surfaces; and regression normal to these surfaces. In addition, an empirical energy loss description is employed as

$$DH = a + kP \quad (6)$$

where

$$\begin{aligned} DH &= \text{Energy Loss up to time } t \\ P &= P_t \end{aligned}$$

and a and k are constants. In these studies, the value for a (an extra energy loss in the program) is set to zero. The value for k is obtained from the following:

$$k = (DH - a) / P_{\max} = C_v m DT / P_{\max} \quad (7)$$

where

$$\begin{aligned} C_v &= (C_{vi}m_i + C_{vp}m_p + C_{va}m_a) / (m_i + m_p + m_a) \\ DT &= d_{p\max} (V_o - m_i n_i - m_p n_p - m_a n_a) / m R_h \\ d_{p\max} &= P_{\text{THEO}} - P_{\max} \end{aligned}$$

An iterative procedure is required for the evaluation of k since the heat loss is a function of pressure, which is the value determined in the computer program PT. The proper pressure is assumed to have been calculated when the relative error is less than 10^{-5} .

To obtain the surface area one must know dm/dt . This is accomplished by determining two consecutive masses of burned propellant from the input p - t curve by using Equation 5 and creating a linear derivative. Then, using the computed burning rate at the current pressure, the surface area is computed from Equation 8:

$$S = (dm/dt) / (\rho * (dx/dt)) . \quad (8)$$

For the solution to the inverse problem (the standard burning rate reduction program), the computer program employs Equation 5, obtaining mass and referring to the form function to determine x (the distance burned into the propellant grain). Then two consecutive x 's are used to form a numerical estimate of dx/dt . It should be mentioned that while $dm/dt = f(P, dp/dt)$ could be obtained analytically, numerical differentiation of P would then be required.

3. CALCULATIONS FOR MODIFIED VARIABLES

The intended use of these interrelated programs is to discover the effect of changing a single parameter in a particular system. This should provide the user a better understanding to what extent error in the input data might influence the calculated surface area and burning rate (i.e., geometric error in measurements). The calculated value can then be compared with the known surface area or known burning rate. The user manual and the input databases, used to calculate the pressure-time curves, surface areas, and the burning rates, can be found in Appendix B.

The program PT calculates a set of pressure-time points from the surface area profile and the burning rate information. The pressure-time curve generated from this program is plotted and points are stored as an output file that will be used as input for the programs SURF and BR.

The program SURF generates a surface area profile from an input p - t file and the burning rate information. The surface area difference fraction (determined as the theoretical minus calculated surface area divided by the theoretical surface area) is also generated for easy comparison of the calculated and known theoretical surface areas. The theoretical surface area equations (form functions) can be found in Appendix A.

The program BR calculates a burning rate (r) vs. pressure (P) profile. A least-square fit of burning rate vs. pressure for the equation $r = aP^n$ can be fitted over different pressure ranges. This program uses the same input databases as SURF and PT, as well as the generated pressure-time curves from PT, as input.

Two studies have been performed as examples of the use of the computer programs. The first study used a slotted single-perforated grain (base.in) and the second used a 19-perforated right circular cylindrical grain (base1.in). To start the analysis, pressure-time curves were generated from the program PT. Figure 1 is a plot of the pressure time curve generated in PT using the "base1.in" input database (19-perforated right circular cylindrical grain) and Figure 2 is for "base.in" (slotted single-perforated grain).

The computer-generated p-t curves from PT (for different grains) may be used as input in the programs SURF and BR to check the precision of these programs. For the appropriate thermodynamics, the inverse calculations of surface areas and burning rates are performed. The precision of the computer-generated output compared against the known surface areas and burning rates is displayed in Table 1 for a slotted single-perforated and 19-perforated granulation. Plots of the calculated burning rates and the surface area difference fraction are given in Figures 3-6.

The influences of a 10.0% reduction of the specific heat capacity (CV), grain diameter (GRGD), perforation diameter (GRPD), and density (DEN) of the propellant have been calculated and investigated. The tabulated results include pressure, base value of the surface area and burning rate, value of the surface area and burning rate after the reduction, and the percent difference of the base value and value after the reduction. These results are shown in Tables 2 and 3.

Surface area difference fractions and the burning rate curves for the slotted single-perforated right circular cylindrical and for the 19-perforated right circular cylindrical grain are displayed for each reduction case in Figures 7-22. The one (1) added to the designator on the plots indicates a 19-perforated cylindrical grain.

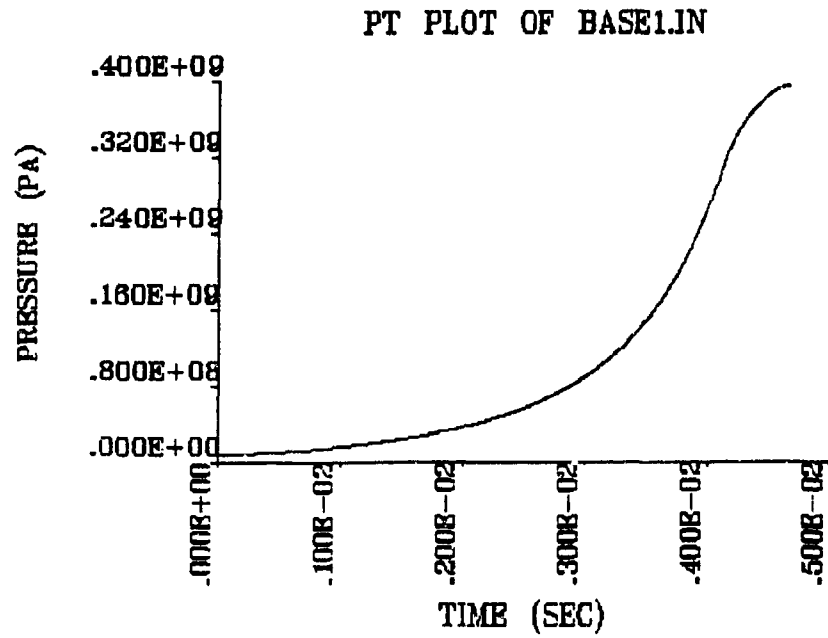


Figure 1. Pressure-Time Curve From the Baseline Case for the 19-Perforated Right Circular Cylindrical Grain.

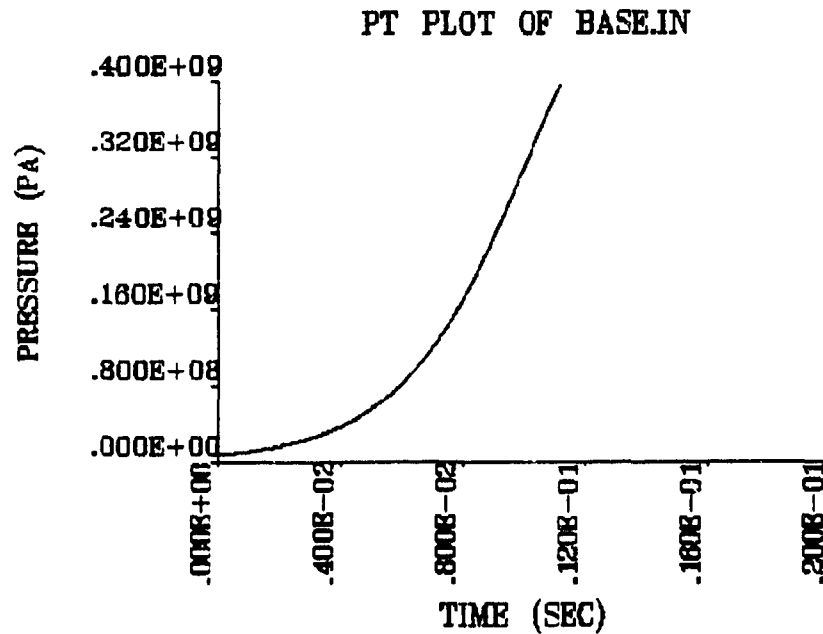


Figure 2. Pressure-Time Curve From the Baseline Case for the Slotted Single-Perforated Right Circular Cylindrical Grain.

Table 1. Analysis for the Precision of the Baseline Cases

Case Study	Computer Program	Pressure (MPa)	Given Known Surface Area (m ²)	Program Value Surface Area (m ²)	% Diff
SLOTTED	SURF	50	.0003825	.0003822	0.078
		100	.0003547	.0003547	0.000
		250	.0002637	.0002639	0.076
		350	.0001886	.0001888	0.106
19-PERF	SURF	50	.0007540	.0007533	0.093
		100	.0008236	.0008232	0.049
		250	.0009894	.0009888	0.061
		350	.0004683	.0004735	01.10
			Given Known Burning Rate (m/s)	Program Value Burning Rate (m/s)	
SLOTTED	BR	50	.0552595	.0554013	0.256
		100	.1105190	.1103527	0.150
		250	.2762975	.2759470	0.127
		350	.3868165	.3851048	0.443
19-PERF	BR	50	.0552595	.0552683	0.016
		100	.1105190	.1105305	0.010
		250	.2762975	.2763236	0.009
		350	.3868165	.3878025	0.254

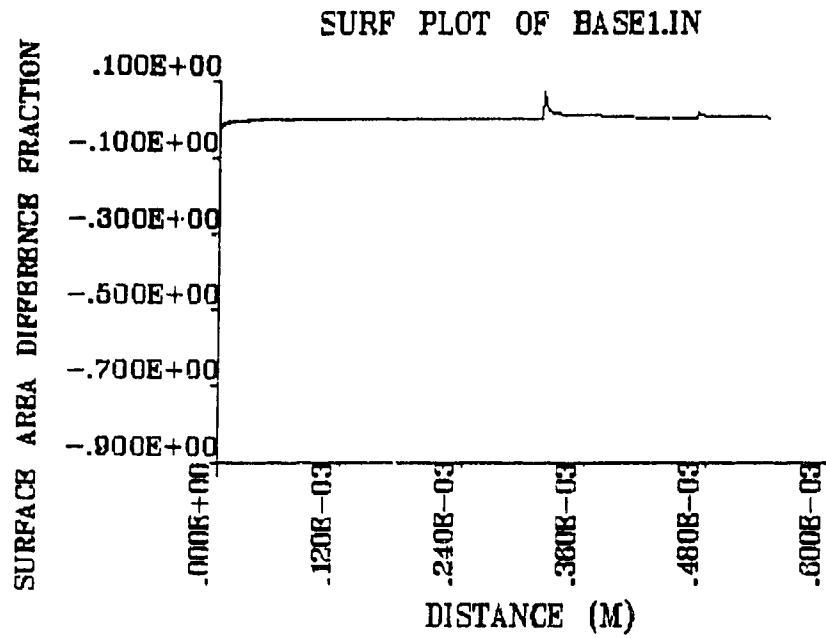


Figure 3. Surface Area Difference Fraction-Distance Curve for the 19-Perforated Right Circular Cylindrical Grain.

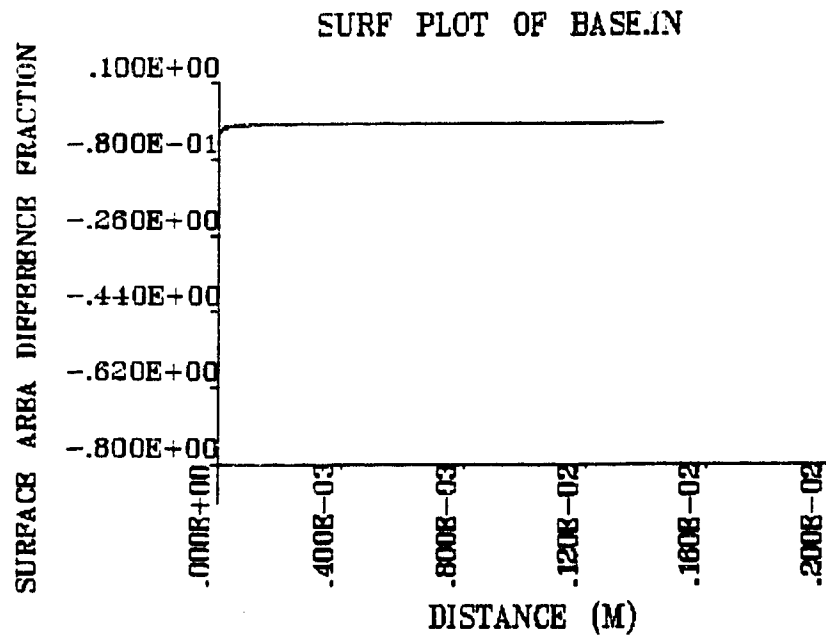


Figure 4. Surface Area Difference Fraction-Distance Curve for the Slotted Single-Perforated Right Circular Cylindrical Grain.

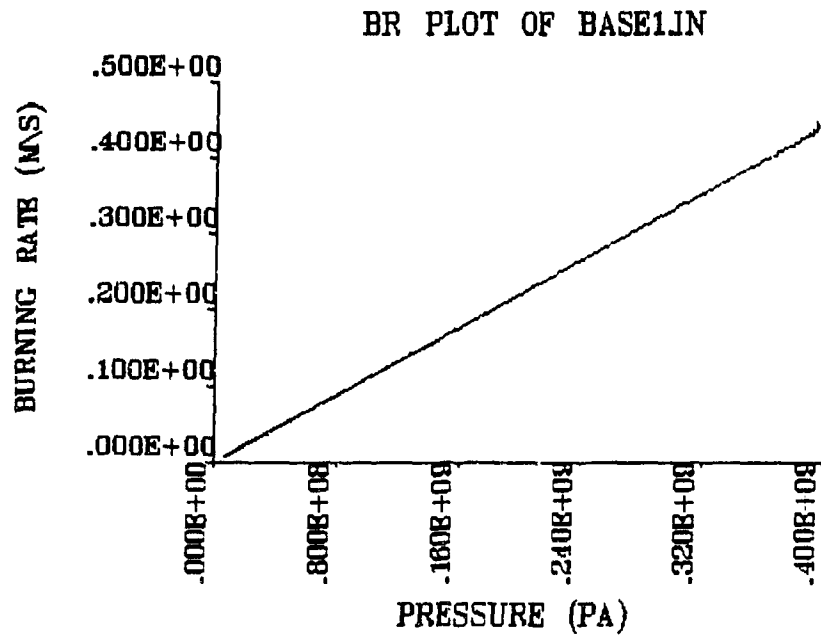


Figure 5. Burning Rate-Pressure Curve for the 19-Perforated Right Circular Cylindrical Grain.

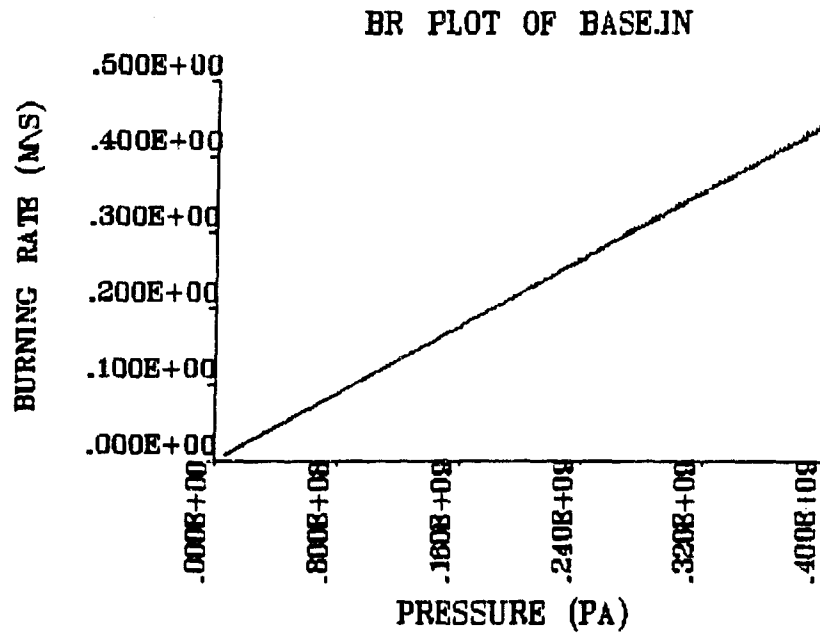


Figure 6. Burning Rate-Pressure Curve for the Slotted Single-Perforated Right Circular Cylindrical Grain.

Table 2. Analysis of the Surface Area of Modified Variables

Variable to be Changed	Reduction of the Variable (%)	Grain Type	Pressure (MPa)	Base Value Surface Area (m ²)	Value of Surface Area (m ²)	Program Diff Rate (%)
SPECIFIC HEAT	10.0	SLOTTED	50	.0003826	.0003822	0.105
			100	.0003547	.0003547	0.000
			250	.0002637	.0002639	0.076
			350	.0001886	.0001888	0.106
SPECIFIC HEAT	10.0	19-PERF	50	.0007540	.0007532	0.106
			100	.0008236	.0008233	0.049
			250	.0009894	.0009889	0.051
			350	.0004683	.0004736	01.12
GRAIN DIAMETER	10.0	SLOTTED	50	.0003388	.0003090	08.80
			100	.0003124	.0002868	08.19
			250	.0002261	.0002134	05.62
			350	.0001528	.0001526	0.065
GRAIN DIAMETER	10.0	19-PERF	50	.0007174	.0005907	17.66
			100	.0007876	.0006456	18.03
			250	.0008865	.0007754	12.53
			350	.0002499	.0003713	32.70
PERFORATION DIAMETER	10.0	SLOTTED	50	.0003814	.0003826	0.314
			100	.0003536	.0003551	0.422
			250	.0002629	.0002642	0.492
			350	.0001879	.0001890	0.582
PERFORATION DIAMETER	10.0	19-PERF	50	.0007182	.0007728	07.07
			100	.0007885	.0008445	06.63
			250	.0009561	.0010143	05.74
			350	.0005850	.0004857	16.97
DENSITY OF PROPELLANT	10.0	SLOTTED	50	.0003827	.0003718	02.85
			100	.0003548	.0003485	01.78
			250	.0002639	.0002667	01.05
			350	.0001887	.0001943	02.88
DENSITY OF PROPELLANT	10.0	19-PERF	50	.0007536	.0007382	02.04
			100	.0008232	.0008087	01.76
			250	.0009890	.0009991	01.01
			350	.0004702	.0004874	03.53

Table 3. Analysis of the Burning Rate of Modified Variables

Variable to be Changed	Reduction of the Variable (%)	Grain Type	Pressure (MPa)	Given Known Burning Rate (m/s)	Value of Burning Rate (m/s)	Program Diff Rate (%)
SPECIFIC HEAT	10.0	SLOTTED	50	.0552595	.0552328	0.048
			100	.1105190	.1103581	0.146
			250	.2762975	.2753570	0.340
			350	.3868165	.3879912	0.303
SPECIFIC HEAT	10.0	19-PERF	50	.0552595	.0552727	0.024
			100	.1105190	.1105478	0.026
			250	.2762975	.2763681	0.026
			350	.3868165	.3878083	0.256
GRAIN DIAMETER	10.0	SLOTTED	50	.0552595	.0501016	09.33
			100	.1105190	.1001044	09.42
			250	.2762975	.2465141	10.78
			350	.3868165	.3381188	12.59
GRAIN DIAMETER	10.0	19-PERF	50	.0552595	.0462781	12.59
			100	.1105190	.0932511	16.29
			250	.2762975	.2356334	14.72
			350	.3868165	.3510377	09.25
PERFORATION DIAMETER	10.0	SLOTTED	50	.0552595	.0556754	0.747
			100	.1105190	.1110111	0.443
			250	.2762975	.2771824	0.319
			350	.3868165	.3902079	0.869
PERFORATION DIAMETER	10.0	19-PERF	50	.0552595	.0590937	06.49
			100	.1105190	.1170415	05.57
			250	.2762975	.2883547	04.18
			350	.3868165	.3861553	0.171
DENSITY OF PROPELLANT	10.0	SLOTTED	50	.0552595	.0538193	02.61
			100	.1105190	.1078383	02.43
			250	.2762975	.2774611	0.419
			350	.3868165	.3968464	02.53
DENSITY OF PROPELLANT	10.0	19-PERF	50	.0552595	.0539383	02.39
			100	.1105190	.1090565	01.32
			250	.2762975	.2801590	01.38
			350	.3868165	.3871016	0.074

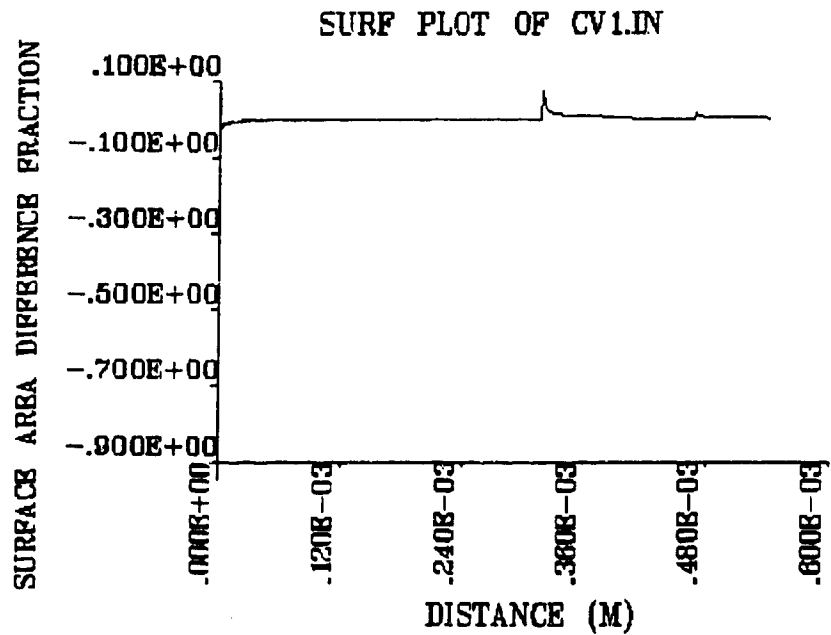


Figure 7. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Specific Heat Capacity for the 19-Perforated Right Circular Cylindrical Grain.

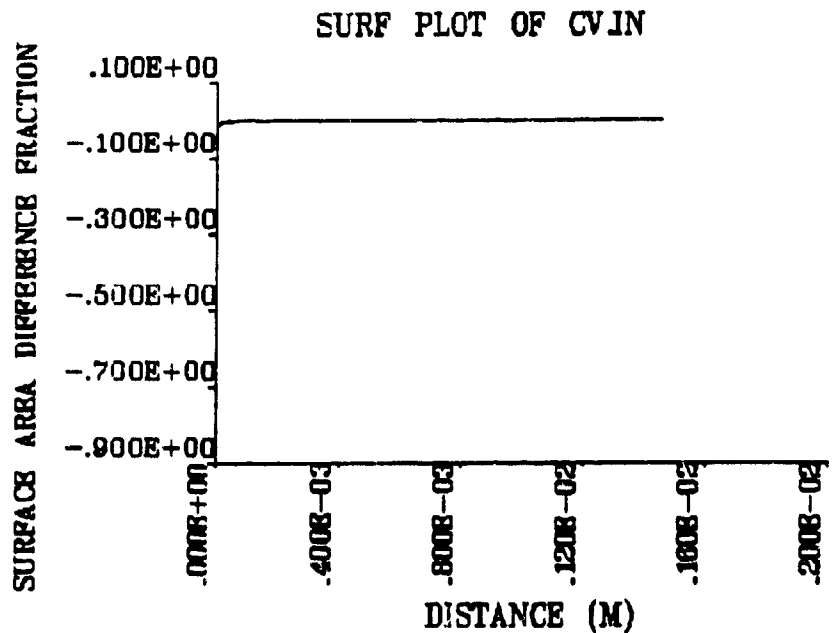


Figure 8. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Specific Heat Capacity for the Slotted Single-Perforated Right Circular Cylindrical Grain.

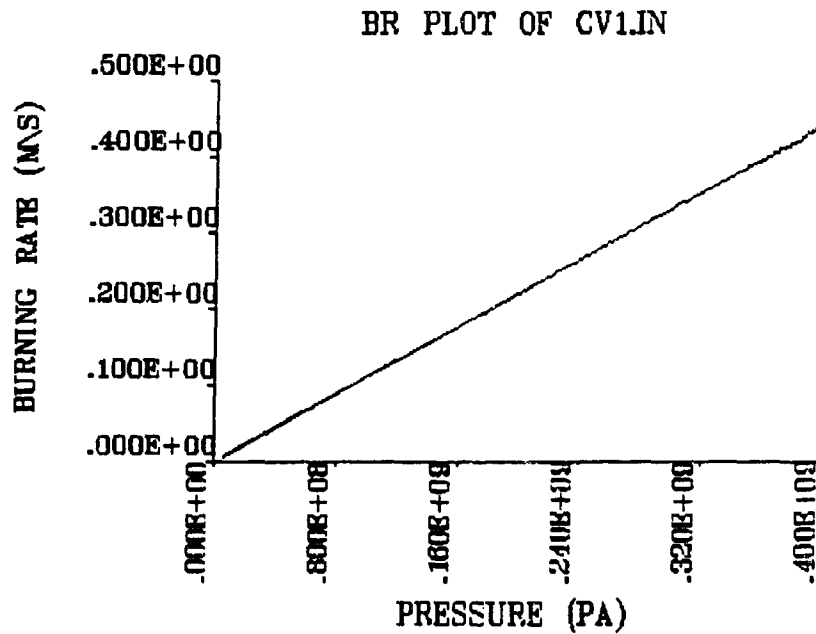


Figure 9. Burning Rate-Pressure Curve With a 10% Reduction of the Specific Heat Capacity for the 19-Perforated Right Circular Cylindrical Grain.

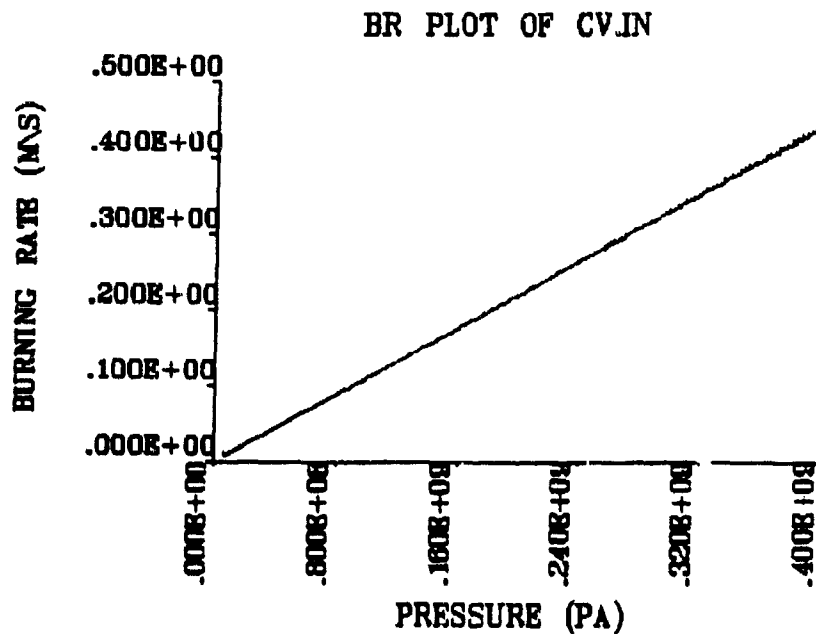


Figure 10. Burning Rate-Pressure Curve With a 10% Reduction of the Specific Heat Capacity for the Slotted Single-Perforated Right Circular Cylindrical Grain.

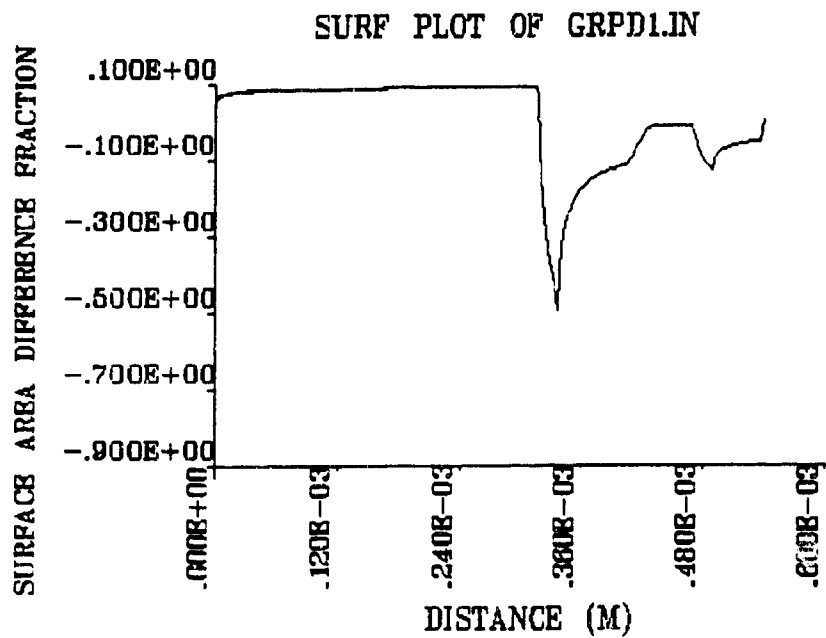


Figure 11. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Perforation Diameter for the 19-Perforated Right Circular Cylindrical Grain.

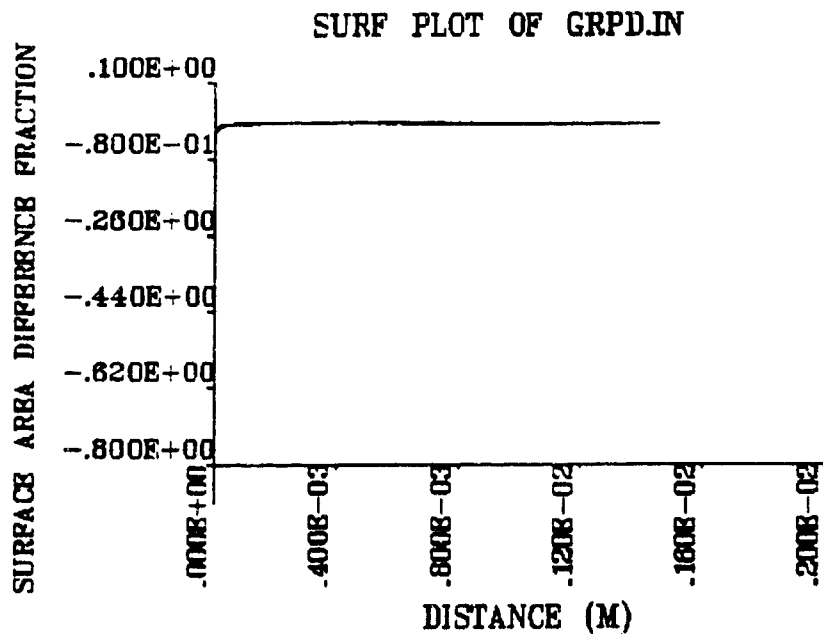


Figure 12. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Perforation Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain.

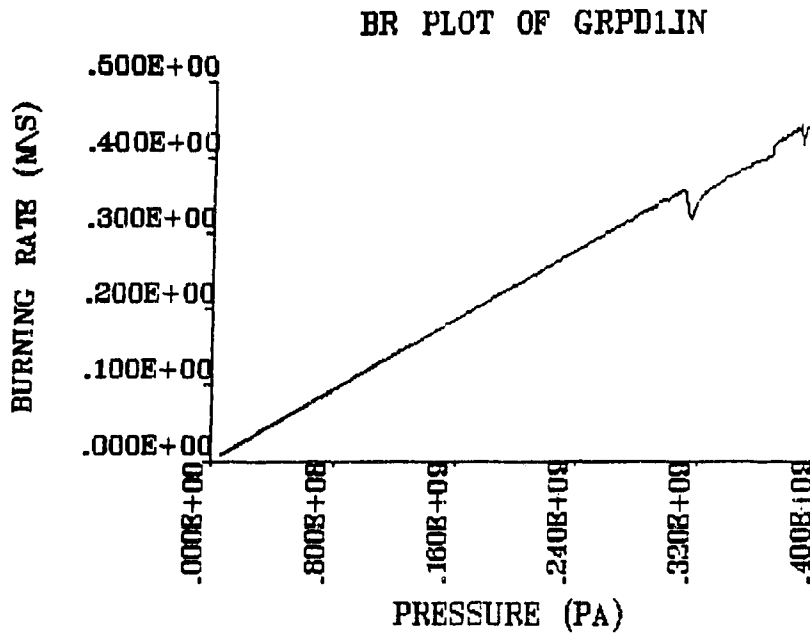


Figure 13. Burning Rate-Pressure Curve With a 10% Reduction of the Perforation Diameter for the 19-Perforated Right Circular Cylindrical Grain.

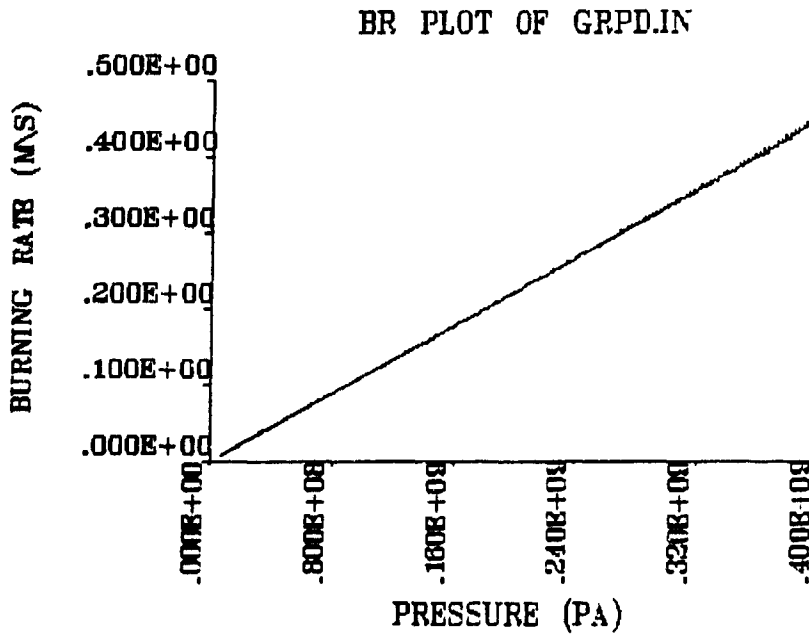


Figure 14. Burning Rate-Pressure Curve With a 10% Reduction of the Perforation Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain.

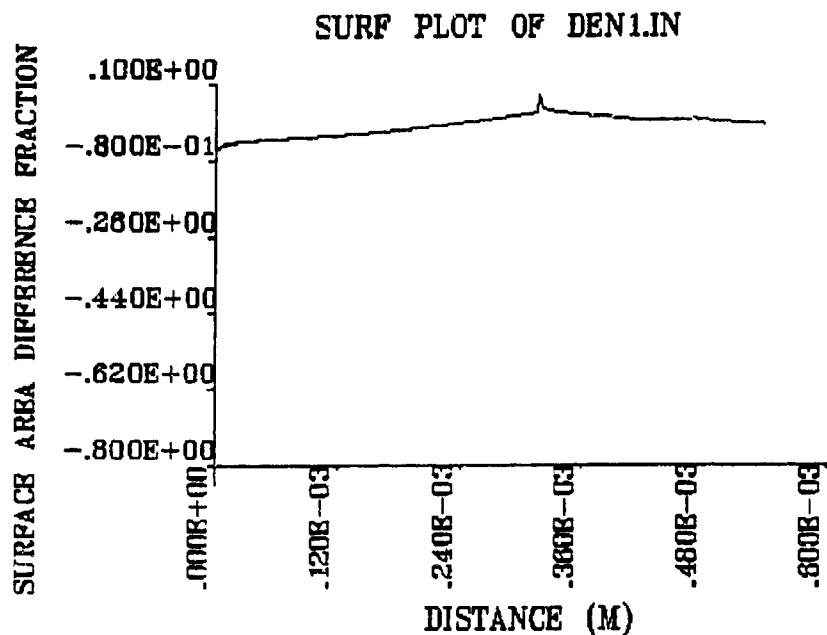


Figure 15. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Propellant Density for the 19-Perforated Right Circular Cylindrical Grain.

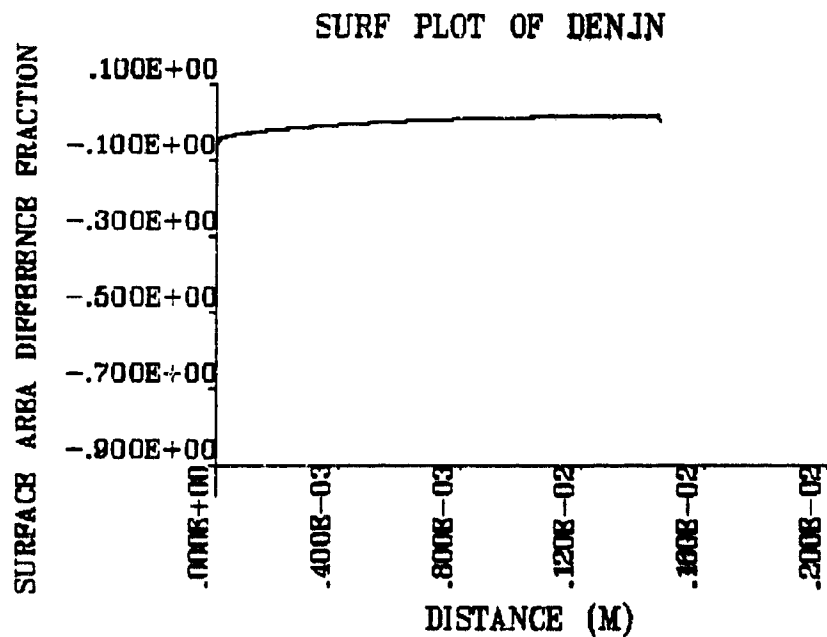


Figure 16. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Propellant Density for the Slotted Single-Perforated Right Circular Cylindrical Grain.

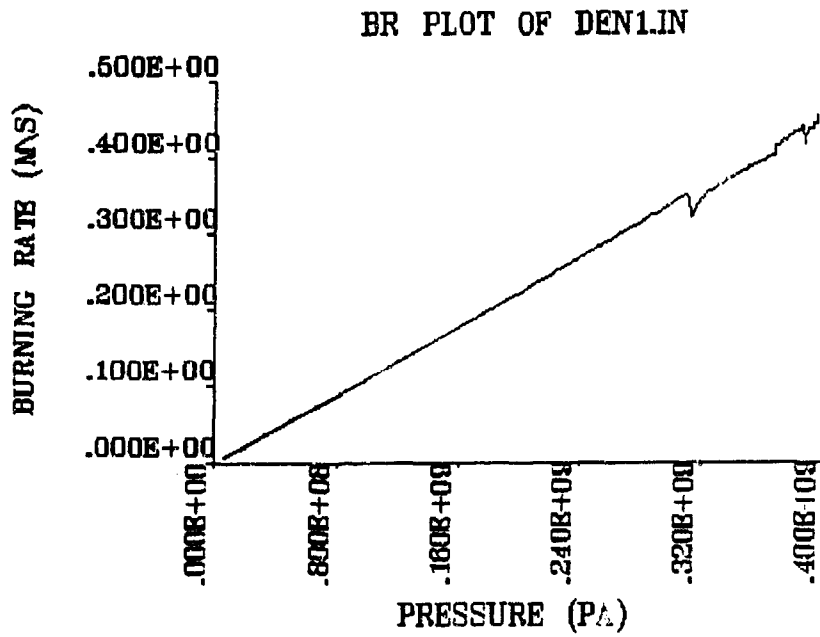


Figure 17. Burning Rate-Pressure Curve With a 10% Reduction of the Propellant Density for the 19-Perforated Right Circular Cylindrical Grain.

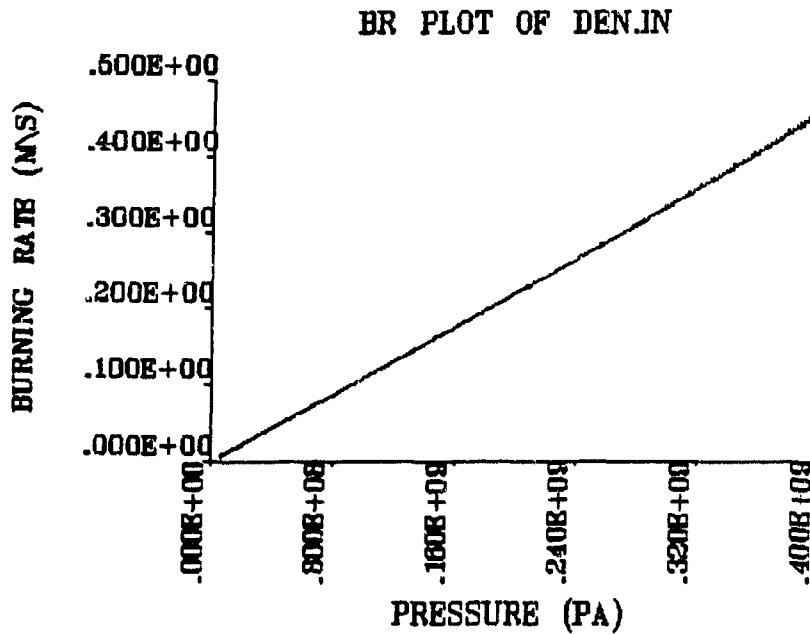


Figure 18. Burning Rate-Pressure Curve With a 10% Reduction of the Propellant Density for the Slotted Single-Perforated Right Circular Cylindrical Grain.

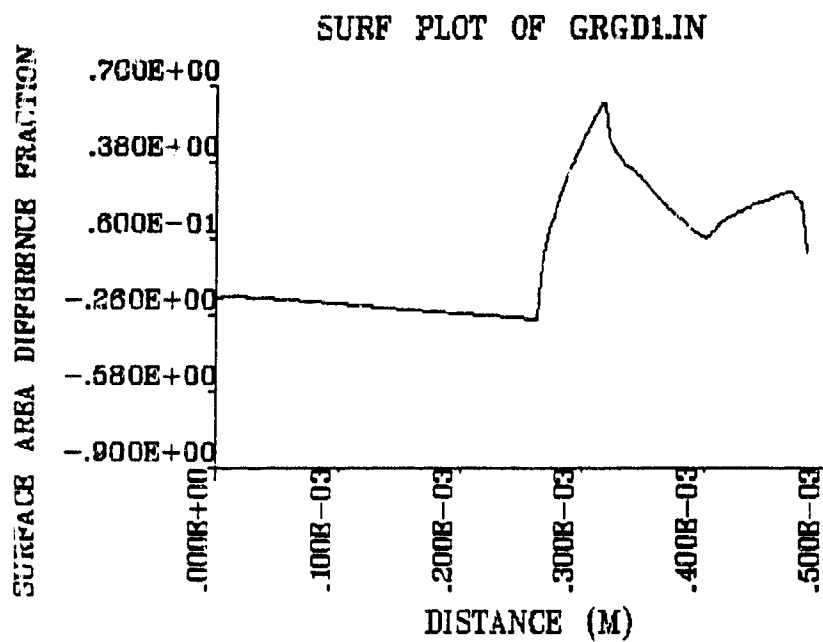


Figure 19. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Grain Diameter for the 19-Perforated Right Circular Cylindrical Grain.

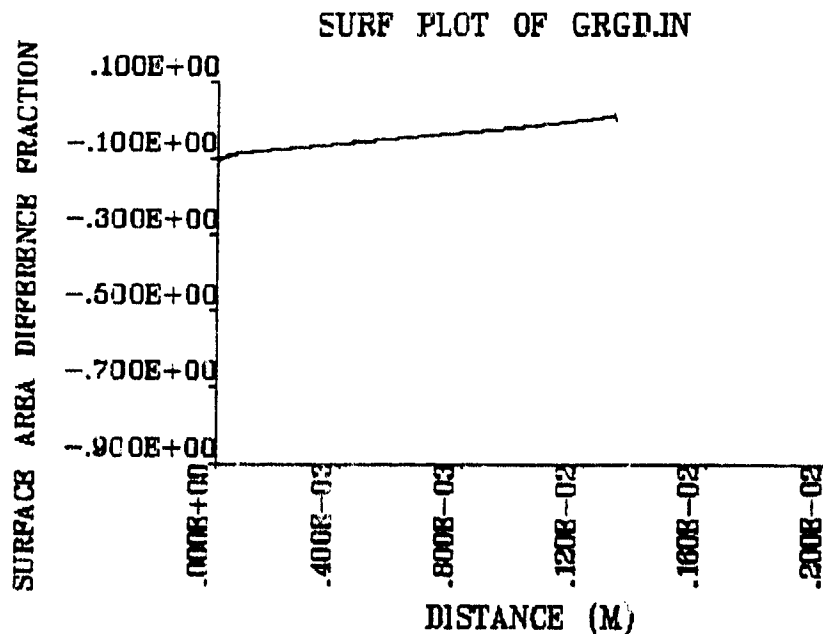


Figure 20. Surface Area Difference Fraction-Distance Curve With a 10% Reduction of the Grain Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain.

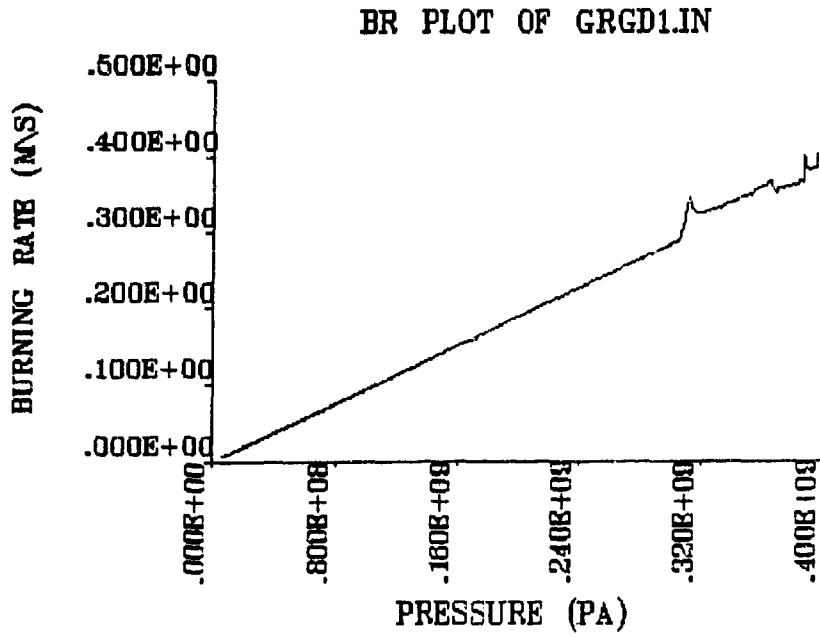


Figure 21. Burning Rate-Pressure Curve With a 10% Reduction of the Grain Diameter for the 19-Perforated Right Circular Cylindrical Grain.

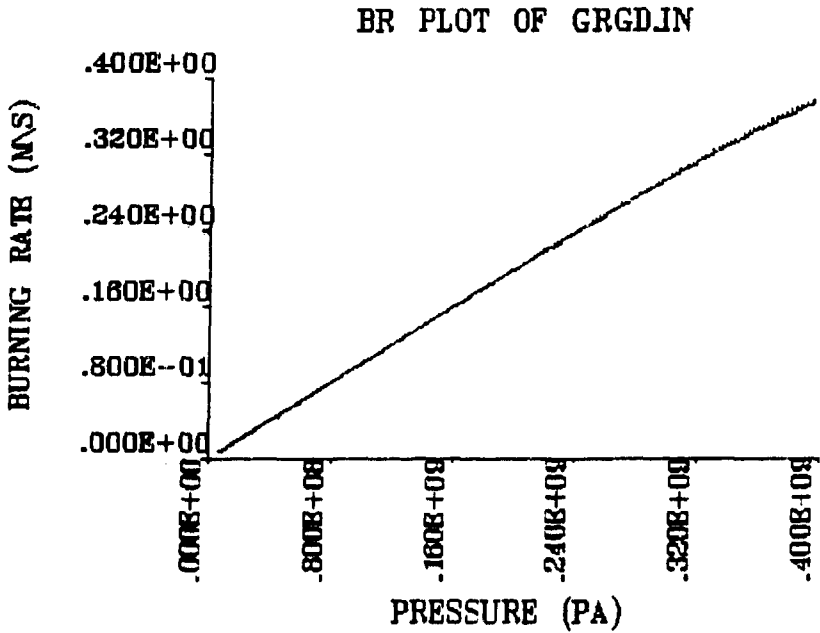


Figure 22. Burning Rate-Pressure Curve With a 10% Reduction of the Grain Diameter for the Slotted Single-Perforated Right Circular Cylindrical Grain.

4. CALCULATIONS FOR APPLICATION ANALYSIS

Interpreting the data is an important element of these case studies. Using IBHVG2 (Anderson and Fickie 1987), an analysis was performed to demonstrate the influence of the reduction of the burning rate on a 120-mm and 155-mm gun system. Shown in Table 4 are the calculated effects of the reduction in the burning rate on the maximum breech pressure and the exit velocity. Note the variable which may have caused a burning rate reduction was not changed in the IB database.

5. ADDITIONAL NOTES

The form function subroutine is provided and documented and can be used to calculate the volume, surface area, mass fraction, and ds/dx . Ds/dx is the rate of the change of the propellant surface area with respect to distance burned into the propellant, and is required with more complicated gradient equations used in lumped-parameter interior ballistic codes (Robbins, Anderson, and Gough 1990).

It was discovered that the first few calculated points in the burning rate analysis are often different by as much as the maximum calculated burning rate. These discrepancies are attributed to numerical problems with the solution techniques.

6. CONCLUSION

Three computer programs were developed to provide an analysis of the closed-bomb burning rate data—they are PT, SURF, and BR. PT is used to calculate a set of pressure-time points from the surface area profile and the burning rate information based on the given thermodynamic data. Calculation with SURF provides the surface area profile from the pressure-time curve and the burning rate information. And, with BR, a set of burning rates is calculated from the pressure-time curve and the surface area profile. The computer programs allow calculations of the effects of changes in variables on the determination of the burning rates and the surface areas for a closed-bomb system.

Table 4. Effects of Burning Rate in Gun Systems

Gun System	Burn Rate Reduction (%)	Grain Type	Breech Pressure (MPa)	Velocity (m/s)
120-mm	0	slotted	500.03	1,765.44
	5	slotted	451.06	1,721.76
	10	slotted	404.49	1,668.47
	0	19-perf	499.52	1,746.54
	5	19-perf	451.06	1,701.49
	10	19-perf	423.66	1,645.98
155-mm	0	slotted	344.99	746.03
	5	slotted	313.61	722.56
	10	slotted	283.60	693.53
	0	19-perf	344.23	743.70
	5	19-perf	307.81	720.43
	10	19-perf	273.60	692.44

Examples of the use of the program are given and demonstrate a large difference in the calculated burning rates and surface areas for the same percent change in the variable. An error of 10% in the calculated burning rate could result in errors as large as 20% in gun interior ballistic calculations.

7. REFERENCES

- Anderson, R. D., and K. D. Fickie. "IBHVG2--A User's Guide." BRL-TR-2829, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD, July 1987.
- Oberle, W. F., and D. E. Kooker. "BRLCB A Closed Chamber Data Analysis Program Theory and Users Manual." U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD (to be published).
- Robbins, F. W., R. D. Anderson, and P. S. Gough. "New Pressure Gradient Equations for Lumped-Parameter Interior Ballistic Codes." BRL-TR-3097, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD, May 1990.
- Robbins, F. W., and A. W. Horst. "Numerical Simulations of Closed Bomb Performance Based on BLAKE CODE Thermodynamic Data." IHMR 76-259, Naval Ordnance Station, Indian Head, MD, 29 November 1976.

INTENTIONALLY LEFT BLANK.

**APPENDIX A:
FORM FUNCTION EQUATIONS**

INTENTIONALLY LEFT BLANK.

Closed-bomb and interior ballistic computer codes require the surface area and/or the volume of the propellant grains as a function of depth burned into the propellant grain. This relationship is known as the *form function* for that granulation. The following is a series of form functions for specific grain types. They are: spherical, rectangular, right circular cylindrical, 1-perforated right circular cylindrical, 7-perforated right circular cylindrical, 19-perforated right circular cylindrical, 19-perforated right hexagonal with rounded corners, and a slotted single-perforated right circular cylindrical grain type.

It is assumed that the grains are of a constant density, perfectly symmetrical, and that the propellant grains all burn normal to all exposed surfaces. Burnout occurs under either of two conditions: the first condition is when the propellant is burned through from the ends, and the second condition is when the propellant is burned through from the lateral direction.

The form function subroutine, FORMFN, relies on an input consisting of all numerical parameters essential for running the code. Values may be in metric or in imperial units, but must be consistent throughout.

It is not normally necessary to calculate ds/dx , the change of the surface area with respect to distance burned, for standard closed bomb and interior ballistic codes. But ds/dx may be required when considering more advanced gradient equations and so are provided for all of the form functions. These are exact up to the slivering phase and approximations thereafter.

The analytic derivations for the surface area and the volume of the 7-perforated right circular cylindrical, 19-perforated right circular cylindrical, and 19-perforated right hexagonal grain with rounded corner types are based on the unpublished work of Jim Kudzal, August 1975, Naval Ordnance Station, Indian Head, MD.

The analytic derivations for the extension of the surface area and the volume of a 19-perforated right hexagonal grain to the one with rounded corners is based on the unpublished work of Glenn M. Mason, June 1985, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD.

The equations for the initial volume, volume, mass fraction, surface area, and ds/dx of a spherical grain type (Figure A-1) where x is the distance burned, are:

$$V_0 = 4/3 \cdot \pi \cdot (gd/2.)^3$$

$$V = 4./3. \cdot \pi \cdot (gd/2. - x)^3$$

$$\text{frac} = 1. - V/V_0$$

$$S = 4. \cdot \pi \cdot (gd/2. - x)^2$$

$$ds/dx = -8. \cdot \pi \cdot (gd/2. - x)$$

At burn out:

$$V = 0.$$

$$\text{frac} = 1.$$

$$S = 0.$$

$$ds/dx = 0.$$

The equations for a rectangular grain type (Figure A-2) are:

$$V_0 = w \cdot h \cdot gl$$

$$V = (w - 2. \cdot x) \cdot (h - 2. \cdot x) \cdot (gl - 2. \cdot x)$$

$$\text{frac} = 1. - V/V_0$$

$$S = 2. \cdot (w - 2. \cdot x) \cdot (h - 2. \cdot x) + 2. \cdot (h - 2. \cdot x) \cdot (gl - 2. \cdot x) \\ + 2. \cdot (w - 2. \cdot x) \cdot (gl - 2. \cdot x)$$

$$ds/dx = 2. \cdot (-4. \cdot w + 8. \cdot x) + 2. \cdot (-4. \cdot h + 8. \cdot x) + 2. \cdot (-4 \cdot gl + 8. \cdot x)$$

At burn out:

$$V = 0.$$

$$\text{frac} = 1.$$

$$S = 0.$$

$$ds/dx = 0.$$

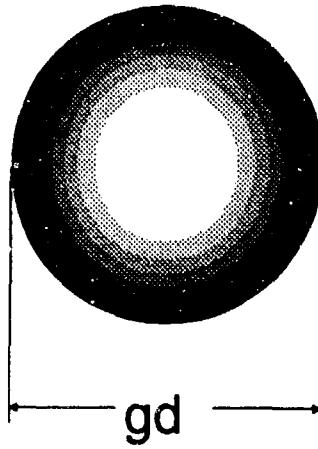


Figure 1-A. Spherical Grain.

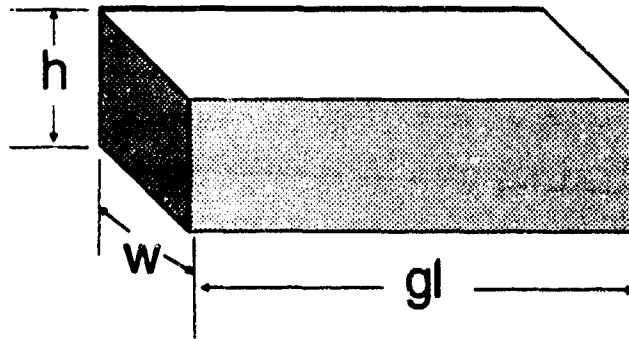


Figure 2-A. Rectangular Grain.

The equations for a right circular cylindrical grain type (Figure 3-A) are:

$$V_0 = \pi * gd * gd / 4 * gl$$

$$V = \pi * (gd - 2 * x)^2 / 4 * (gl - 2 * x)$$

$$\text{frac} = 1 - V/V_0$$

$$S = \pi / 2 * (gd - 2 * x)^2 + \pi * (gd - 2 * x) * (gl - 2 * x)$$

$$ds/dx = -2 * \pi * (2 * gd + gl - 6 * x)$$

At burn out:

$$V = 0.$$

$$\text{frac} = 1.$$

$$S = 0.$$

$$ds/dx = 0.$$

The equations for a single-perforated right circular cylindrical grain type (Figure 4-A) with equal webs, where x is the distance burned, are:

$$V_0 = \pi / 4 * (gd * gd - pd * pd) * gl$$

$$V = \pi / 4 * ((gd - 2 * x)^2 - (pd + 2 * x)^2) * (gl - 2 * x)$$

$$\text{frac} = 1 - V/V_0$$

$$S = \pi / 2 * ((gd - 2 * x)^2 - (pd + 2 * x)^2) + \pi * (gd - 2 * x) * (gl - 2 * x) \\ + \pi * (pd + 2 * x) * (gl - 2 * x)$$

$$ds/dx = -4 * \pi * (gd + pd)$$

At burn out:

$$V = 0.$$

$$\text{frac} = 1.$$

$$S = 0.$$

$$ds/dx = 0.$$

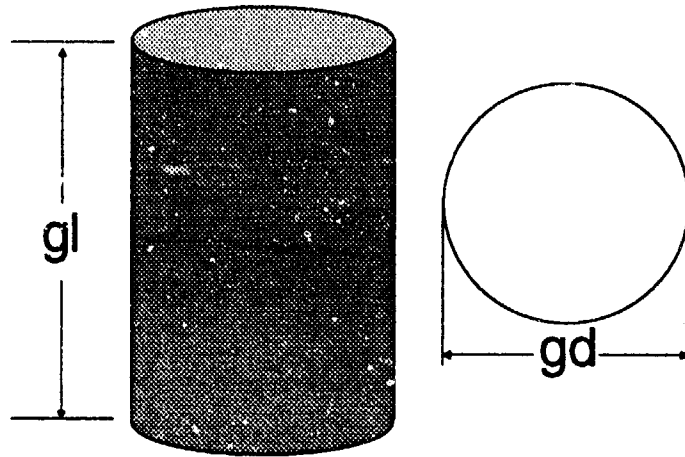


Figure 3-A. Right Circular Cylindrical Grain.

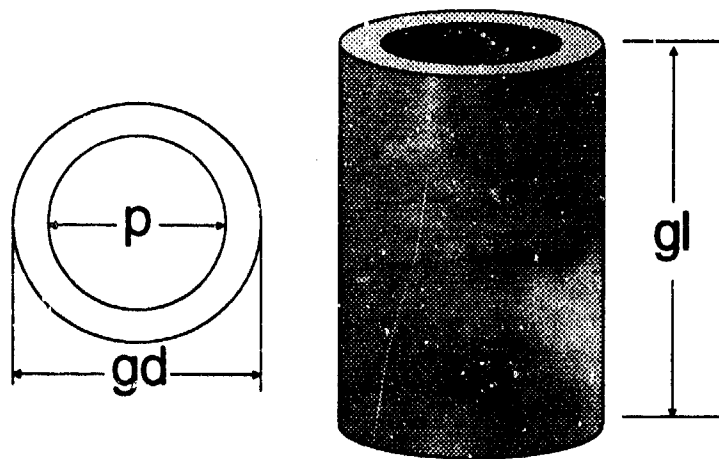


Figure 4-A. Single-Perforated Right Circular Cylindrical Grain.

The equations for a 7-perforated right circular cylindrical grain type (Figure A-5) with equal webs and perforations, where x is the distance burned, are:

For: $x \leq .5 * \text{web}$

$$V_0 = \pi/4 * g_l * (g_d * g_d - 7 * p_d * p_d)$$

$$V = \pi/4 * (g_l - 2 * x) * ((g_d - 2 * x)^2 - 7 * (p_d + 2 * x)^2)$$

$$\text{frac} = 1 - V/V_0$$

$$S = 2 * V / (g_l - 2 * x) + \pi * (g_l - 2 * x) * ((g_d - 2 * x) + 7 * (p_d + 2 * x))$$

$$ds/dx = -4 * \pi * (g_d + 7 * p_d - 3 * g_l + 18 * x)$$

For: $x > .5 * \text{web}$ (after slivering)

$$V = V_1 + V_2$$

$$\text{frac} = 1 - V/V_0$$

$$S = S_1 + S_2$$

$$ds/dx = -S/(X_2 - x) \text{ (approximately)}$$

For: $.5 * \text{web} < x < X_1$ (up to where the inner silver burns out)

$$V_1 = 3/4 * (g_l - 2 * x) * (2 * \sqrt{3} * d^2 - \pi * (p_d + 2 * x)^2 + 24 * a_1)$$

$$S_1 = (2 * V_1 / (g_l - 2 * x)) + 3 * (g_l - 2 * x) * (\pi - 6 * \theta) * (p_d + 2 * x)$$

For: $x \geq X_1$

$$V_1 = 0.$$

$$S_1 = 0.$$

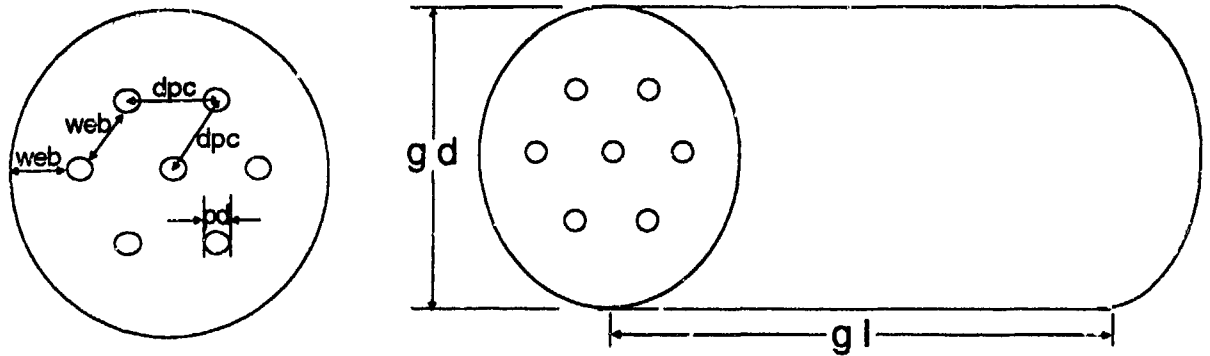


Figure 5-A. 7-Perforated Right Circular Cylindrical Grain.

For: $.5 * \text{web} < x < X_2$ (up to where the outer sliver burns out)

$$V_2 = (\pi * (gd - 2 * x)^2 - 6 * \sqrt{3} * d^2 - 4 * \pi * (pd + 2 * x)^2 + 24 * (a_1 + 2 * a_2)) * (gl - 2 * x) / 4.$$

$$S_2 = 2 * V_2 / (gl - 2 * x) + (gl - 2 * x) * ((\pi - 6 * \alpha) * (gd - 2 * x) + 2 * (2 * \pi - 3 * \phi - 3 * \theta) * (pd + 2 * x))$$

For: $x \geq X_2$

$$V_2 = 0.$$

$$S_2 = 0.$$

$$\text{frac} = 1.$$

$$ds/dx = 0.$$

where:

$$d = (\text{web} + \text{pd})$$

$$\text{dpc} = d$$

$$\text{web} = (\text{gd} - 3. * \text{pd})/4.$$

$$\text{theta} = \tan^{-1}(\sqrt{(\text{pd} + 2. * x)^2 - d * d}/d)$$

$$\text{chi} = \frac{\tan^{-1}(\sqrt{(\text{gd} - 2. * x)^2 - (5. * d - 2. * (\text{pd} + 2. * x))^2}}{(5. * d - 2. * (\text{pd} + 2. * x))}$$

$$\text{phi} = \frac{\tan^{-1}(\sqrt{(\text{pd} + 2. * x)^2 - (3. * d - 2. * (\text{pd} + 2. * x))^2}}{(3. * d - 2. * (\text{pd} + 2. * x))}$$

$$X_1 = d/\sqrt{3} - \text{pd}/2.$$

$$X_2 = (14.0 - 3.0 * \sqrt{3}) * d/13.0 - \text{pd}/2.$$

$$a_1 = \text{theta}/4. * (\text{pd} + 2. * x)^2 - d/4. * \sqrt{(\text{pd} + 2. * x)^2 - d * d}$$

$$a_2 = (\text{phi} * (\text{pd} + 2. * x)^2 - \text{chi} * (\text{gd} - 2. * x)^2 + 2. * \sqrt{3} * d * \sqrt{(3. * d - \text{pd} - 2. * x) * (3. * d - \text{gd} + 2. * x)})/8.$$

$$\text{sqrt3} = \sqrt{3}$$

The equations for a 19-perforated right circular cylindrical grain type (Figure 6-A) with equal webs and perforations, where x is the distance burned, are:

For: $x \leq .5 * \text{web}$

$$V_0 = \text{pi}/4. * \text{gl} * (\text{gd} * \text{gd} - 19. * \text{pd} * \text{pd})$$

$$V = \text{pi}/4. * (\text{gl} - 2. * x) * ((\text{gd} - 2. * x)^2 - 19. * (\text{pd} + 2. * x)^2)$$

$$\text{frac} = 1. - V/V_0$$

$$S = 2. * V/(\text{gl} - 2. * x) + \text{pi} * (\text{gl} - 2. * x) * (\text{gd} - 2. * x + 19. * (\text{pd} + 2. * x))$$

$$ds/dx = \text{pi} * (- 4. * \text{gd} + 36. * \text{gl} - 76. * \text{pd} - 216. * x)$$

For: $x > .5 * \text{web}$ (after slivering)

$$V = V_1 + V_2$$

$$\text{frac} = 1. - V/V_0$$

$$S = S_1 + S_2$$

$$ds/dx = -S/(X_2 - x) \text{ (approximately)}$$

For: $.5 * \text{web} < x < X_1$ (up to where the inner sliver burns out)

$$V_1 = 3. * (gl - 2. * x) * (2. * \text{sqrt}3 * (\text{web} + \text{pd})^2 - \text{pi} * (\text{pd} + 2. * x)^2 + 24. * a_1)$$

$$S_1 = 2. * V_1 / (gl - 2. * x) + 12. * (gl - 2. * x) * (\text{pi} - 6. * \text{theta}) * (\text{pd} + 2. * x)$$

For: $x \geq X_1$

$$V_1 = 0.$$

$$S_1 = 0.$$

For: $.5 * \text{web} < x < X_2$ (up to where the outer sliver burns out)

$$V_2 = .25 * (gl - 2. * x) * (\text{pi} * (\text{gd} - 2. * x)^2 - 7. * \text{pi} * (\text{pd} + 2. * x)^2 - 24. * \text{sqrt}3 * (\text{web} + \text{pd}) * (\text{web} + \text{pd}) + 48. * (a_1 + a_2 + a_3))$$

$$S_2 = 2. * V_2 / (gl - 2. * x) + (gl - 2. * x) * ((\text{gd} - 2. * x) * (\text{pi} - 6. * (\text{xi} + \text{delta})) + (\text{pd} + 2. * x) * (7. * \text{pi} - 6. * (2. * \text{theta} + \text{chi} + \text{phi})))$$

For: $x \geq X_2$

$$V_2 = 0.$$

$$S_2 = 0.$$

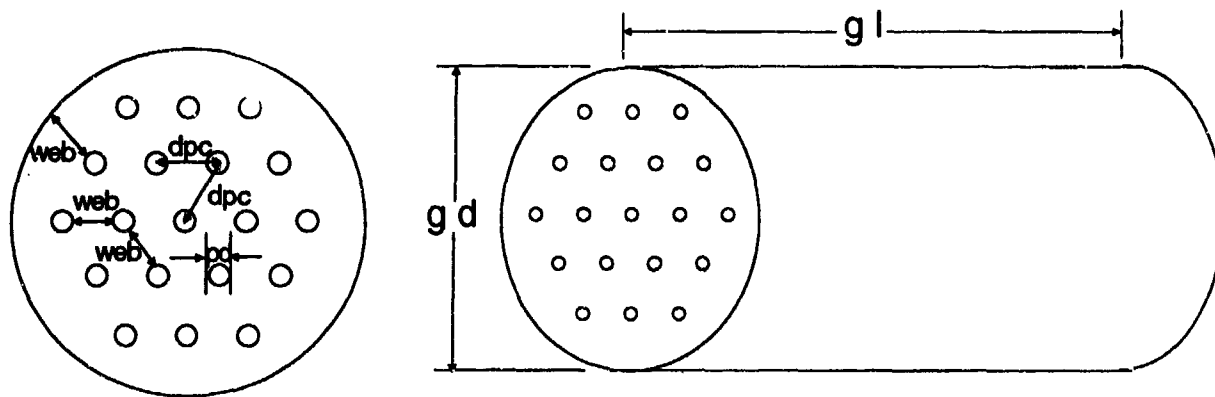


Figure 6-A. 19-Perforated Right Circular Cylindrical Grain.

where:

$$\text{web} = (\text{gd} - 5 \cdot \text{pd})/6.$$

$$\text{xi} = \cos^{-1}((13 \cdot \text{gd} - 5 \cdot \text{pd} - 36 \cdot \text{x})/(12 \cdot (\text{gd} - 2 \cdot \text{x})))$$

$$\text{chi} = \cos^{-1}((\text{gd} - 2 \cdot \text{pd} - 6 \cdot \text{x})/(\text{sqrt3} \cdot (\text{pd} + 2 \cdot \text{x})))$$

$$\text{delta} = \cos^{-1}((2 \cdot \text{gd} - \text{pd} - 6 \cdot \text{x})/(\text{sqrt3} \cdot (\text{gd} - 2 \cdot \text{x})))$$

$$\text{theta} = \cos^{-1}((\text{web} + \text{pd})/(\text{pd} + 2 \cdot \text{x}))$$

$$\text{phi} = \cos^{-1}((5 \cdot \text{gd} - 13 \cdot \text{pd} - 36 \cdot \text{x})/(12 \cdot (\text{pd} + 2 \cdot \text{x})))$$

$$\begin{aligned} \text{a}_1 &= \text{theta}/4 \cdot (\text{pd} + 2 \cdot \text{x})^2 - (\text{web} + \text{pd})/4 \cdot \text{sqrt}((\text{pd} + 2 \cdot \text{x})^2 \\ &\quad - (\text{web} + \text{pd}) \cdot (\text{web} + \text{pd})) \end{aligned}$$

$$\begin{aligned} \text{a}_2 &= .125 \cdot (\text{phi} \cdot (\text{pd} + 2 \cdot \text{x})^2 - \text{xi} \cdot (\text{gd} - 2 \cdot \text{x})^2 \\ &\quad + 2 \cdot \text{sqrt5} \cdot (\text{web} + \text{pd}) \cdot \text{sqrt}((5 \cdot (\text{web} + \text{pd}) - \text{pd} - 2 \cdot \text{x}) \\ &\quad \cdot (5 \cdot (\text{web} + \text{pd}) - \text{gd} + 2 \cdot \text{x}))) \end{aligned}$$

$$\begin{aligned} \text{a}_3 &= .125 \cdot (\text{chi} \cdot (\text{pd} + 2 \cdot \text{x})^2 - \text{delta} \cdot (\text{gd} - 2 \cdot \text{x})^2 \\ &\quad + 2 \cdot (\text{sqrt6} \cdot (\text{web} + \text{pd}) \cdot \text{sqrt}(6 \cdot (\text{web} + \text{pd}) \cdot (\text{pd} + 2 \cdot \text{x} - (\text{web} + \text{pd})) \\ &\quad - (\text{pd} + 2 \cdot \text{x})^2)) \end{aligned}$$

$$\text{dbc} = \text{web} + \text{pd}$$

$$X_1 = dbc/\sqrt{3} - pd/2.$$

$$X_2 = 0.25 * (dbc * (6. - \sqrt{10}) - 2. * pd)$$

$$\sqrt{3} = \sqrt{3}$$

The equations for a 19-perforation right hexagonal grain type (Figure 7-A) with equal webs and perforations, where x is the distance burned, are:

For: $x \leq .5 * web$

$$V_0 = gl/4. * (2. * \sqrt{3} * (2. * (\sqrt{3} * (web + pd) + pd/2. + web)^2 - 19. * pi * pd^2) - 6. * a * gl$$

$$V = .25 * (gl - 2. * x) * (2. * \sqrt{3} * (2. * (\sqrt{3} * (web + pd) + pd/2. + web) - 2. * x)^2 - 19 * pi * (pd + 2. * x)^2 - 6. * a * (gl - 2. * x)$$

$$frac = 1. - V/V_0$$

$$S = 2. * V / (gl - 2. * x) + (gl - 2. * x) * (2. * \sqrt{3} * (2. * (\sqrt{3} * (web + pd) + pd/2. + web) - 2. * x) + 19. * pi * (pd + 2. * x)) - 12. * a + (gl - 2. * x) * (web - 2. * x + (pd + 2. * x)/2.) * (4. * \sqrt{3} - 2. * pi)$$

$$ds/dx = -8. * \sqrt{3} * (2. * (\sqrt{3} * (web + pd) + pd/2. + web) - 2. * x) - 76. * pi * (pd + 2. * x) + (gl - 2. * x) * (-4. * \sqrt{3} + 38. * pi) + 16. * \sqrt{3} * (web + pd/2. - x) - 8. * pi * (web + pd/2. - x) + (gl - 2. * x) * (4. * \sqrt{3} - 2. * pi)$$

For: $x > .5 * web$ (after slivering)

$$V = V_1 + V_2$$

$$frac = 1. - V/V_0$$

$$S = S_1 + S_2$$

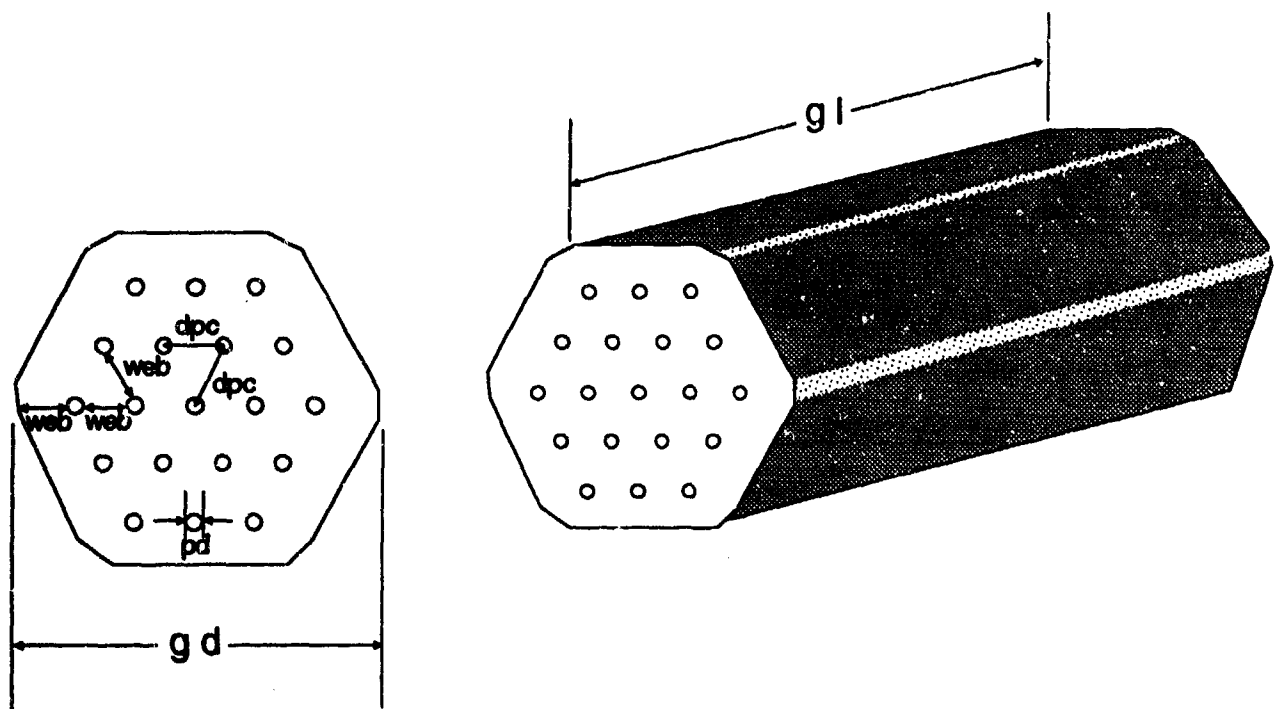


Figure A-7. 19-Perforated Right Hexagonal Grain With Rounded Corners.

$$S = S_1 + S_2$$

$$ds/dx = -S/(X_2 - x) \quad (\text{approximately})$$

For: $\text{web}/2. < x < X_1$ (up to where the inner sliver burns out)

$$V_1 = 3. * (gl - 2. * x) * (2. * \text{sqrt}3 * (\text{web} + \text{pd})^2 - \text{pi} * (\text{pd} + 2. * x)^2 + 24. * a_1)$$

$$V_2 = 6. * (gl - 2. * x) * (2. * (\text{web} + \text{pd})^2 - (\text{web} + \text{pd}) * (\text{pd} + 2. * x) - \text{pi}/4.$$

$$* (\text{pd} + 2. * x)^2 + 2. * a_1 + 4. * a_2)$$

$$S_1 = 2. * V_1 / (gl - 2. * x) + 12. * (gl - 2. * x) * (\text{pi} - 6. * \text{theta}) * (\text{pd} + 2. * x)$$

$$S_2 = 2. * V_2 / (gl - 2. * x) + 12. * (gl - 2. * x) * ((\text{web} + \text{pd})$$

$$+ (\text{pd} + 2. * x) * (\text{pi}/2. - \text{omega} - \text{theta} - \sin(\text{omega})))$$

$$V = V_1 + V_2$$

$$S = S_1 + S_2$$

For: $X_1 < x < X_2$ (up to where the outer sliver burns out)

$$V_1 = 0.$$

$$V_2 = 6. * (gl - 2. * x) * (2. * (web + pd)^2 - web + pd * (pd + 2. * x) - pi/4. * (pd + 2. * x)^2 + 2. * a_1 + 4. * a_2)$$

$$S_1 = 0.$$

$$S_2 = 2. * V_2 / (gl - 2. * x) + 12. * (gl - 2. * x) * ((web + pd) + (pd + 2. * x)) * (pi/2. - omega - theta - sin(omega))$$

$$V = V_1 + V_2$$

$$S = S_1 + S_2$$

For $x \geq X_2$

$$V_2 = 0.$$

$$\text{frac} = 1.$$

$$S_2 = 0.$$

$$ds/dx = 0.$$

where:

$$\text{web} = (gd - 5. * pd) / 6.$$

$$\text{omega} = \cos^{-1}(2. * (\text{web} + pd) / (pd + 2. * x) - 1)$$

$$\text{theta} = \cos^{-1}((\text{web} + pd) / (pd + 2. * x))$$

$$a = \sqrt{3} / 3. * (\text{web} - 2. * x + (pd + 2. * x) / 2.)^2 - pi / 6. * (\text{web} - 2. * x + (pd + 2. * x) / 2.)^2$$

$$a_1 = \text{theta} / 4. * (pd + 2. * x)^2 - (\text{web} + pd) / 4. * \sqrt{(pd + 2. * x)^2 - (\text{web} + pd)^2}$$

$$a_2 = .125 * (pd + 2. * x) * ((pd + 2. * x) * (\omega + \sin(\omega)) - 2. * (web + pd) * \sin(\omega))$$

$$dpc = web + pd$$

$$X_1 = dbc/\sqrt{3} - p/2.$$

$$X_2 = 0.125 * (5. * dbc - 4. * pd)$$

$$\sqrt{3} = \sqrt{3}$$

The equations for a slotted single-perforated right circular cylindrical grain type (Figure A-8) are:

$$V_0 = gl * ((\pi - \theta) * r_o^2 - (\pi - \alpha) * r_i^2 - (.5 * sw * r_o * \cos(\theta) - .5 * sw * r_i * \cos(\alpha)))$$

$$V = (gl - 2. * x) * ((\pi - \theta) * r_o^2 - (\pi - \alpha) * r_i^2 - (.5 * (sw + 2. * x) * r_o * \cos(\theta) - .5 * (sw + 2. * x) * r_i * \cos(\alpha)))$$

$$S_1 = 2. * (gl - 2. * x) * ((\pi - \alpha) * r_i + r_o * \cos(\theta) - r_i * \cos(\alpha))$$

$$S_2 = 2. * ((\pi - \theta) * r_o^2 - (\pi - \alpha) * r_i^2 - (.5 * (sw + 2. * x) * r_o * \cos(\theta) - .5 * (sw + 2. * x) * r_i * \cos(\alpha))) \quad (\text{end})$$

$$S_3 = 2. * (gl - 2. * x) * (\pi - \theta) * r_o \quad (\text{lateral})$$

$$S = S_1 + S_2 + S_3$$

$$\text{frac} = 1. - V/V_0$$

$$\begin{aligned} ds/dx_1 = & -4. * ((\pi - \alpha) * r_i + r_o * \cos(\theta) - r_i * \cos(\alpha)) + 2. \\ & * (gl - 2. * x) * ((\pi - \alpha) + r_i * (-d\alpha) + (-\cos(\theta))) \\ & + r_o * (-\sin(\theta)) * d\theta - \cos(\alpha) - r_i * (-\sin(\alpha)) \\ & * d\alpha \quad (\text{perforation}) \end{aligned}$$

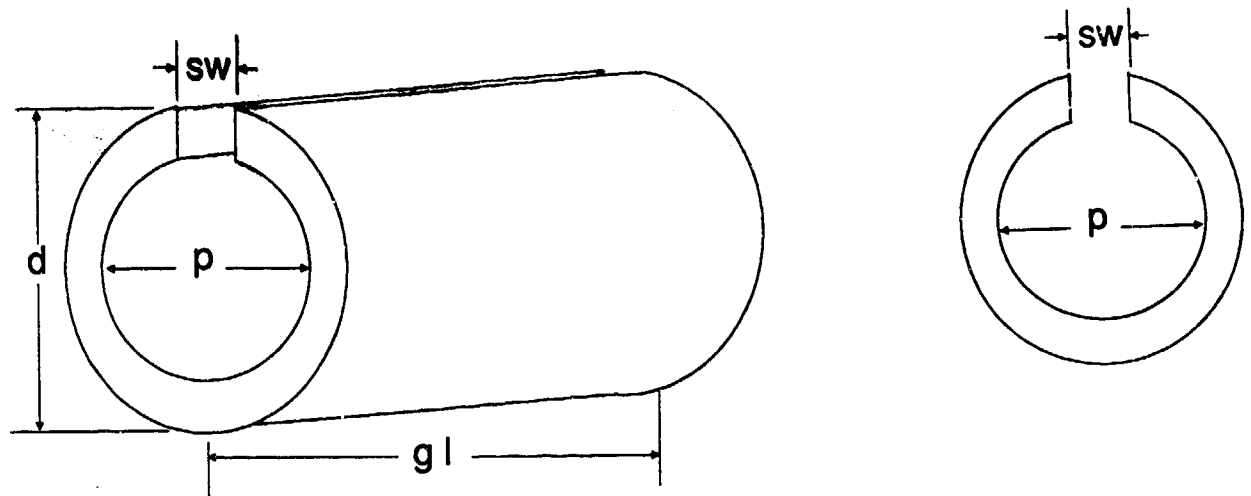


Figure A-8. Slotted Single-Perforated Right Circular Cylindrical Grain.

$$\begin{aligned}
 ds/dx_2 &= -2. * d\theta * r_o^2 - 4. * (\pi - \theta) * r_o + 2. * d\alpha * r_i^2 - 4. \\
 &\quad * (\pi - \alpha) * r_i - 2. * r_o * \cos(\theta) + (sw + 2. * x) * \cos(\theta) \\
 &\quad + (sw + 2. * x) * r_o * \sin(\theta) * d\theta + 2. * r_i * \cos(\alpha) \\
 &\quad + (sw + 2. * x) * \cos(\alpha) - (sw + 2. * x) * r_i * \sin(\alpha) \\
 &\quad * d\alpha \\
 ds/dx_3 &= -4. * (\pi - \theta) * r_o + 2. * (gl - 2. * x) * (- d\theta) * r_o + -2. * \\
 &\quad (gl - 2. * x) * (\pi - \theta) \quad \text{(lateral)} \\
 ds/dx &= dx/dx_1 + ds/dx_2 + ds/dx_3
 \end{aligned}$$

For: $x \geq X_2$

$$V_2 = 0.$$

$$\text{frac} = 1.$$

$$S_2 = 0.$$

$$ds/dx = 0.$$

where:

$$r_o = (d - 2 \cdot x)/2$$

$$r_i = (p + 2 \cdot x)/2$$

$$\theta = \sin^{-1}((.5 \cdot sw + x)/(d/2 - x))$$

$$d\theta = 2 \cdot (d + sw)/(d - 2 \cdot x)^2 / \sqrt{1 - ((sw + 2 \cdot x)/(d - 2 \cdot x))^2}$$

$$\alpha = \sin^{-1}((.5 \cdot sw + x)/(p/2 + x))$$

$$d\alpha = 2 \cdot (p - sw)/(p + 2 \cdot x)^2 / \sqrt{1 - ((sw + 2 \cdot x)/(p + 2 \cdot x))^2}$$

LIST OF SYMBOLS FOR THE FORM FUNCTION FUNCTIONS

<u>Symbols</u>	<u>Definition</u>	<u>Units</u>
gl	grain length	m
gd	major diameter	m
pd	perforation diameter	m
sw	slot width	m
web	web	m
w	grain width	m
h	grain height	m
x	distance burned	m
X_1	distance burned when inner slivers burns out	m
X_2	distance burned when outer slivers burn out	m
S	surface area of the grain	m ²
S_1	surface area of the inner grain except for the slotted grain which represents the perforated surface area	m ²
S_2	surface area of the outer grain except for the slotted grain which represents the end surface area	m ²
S_3	surface area of the lateral section of a slotted grain	m ²
V	volume of the grain	m ³
V_0	initial volume of the grain	m ³
V_1	volume of the inner sliver	m ³
V_2	volume of the outer sliver	m ³
ds/dx	the rate of change of the surface area with respect to distance	m
ds/dx ₁	the rate of change of the surface area for the perforation of a slotted grain with respect to distance	m
ds/dx ₂	the rate of change of the surface area for the end of a slotted grain with respect to distance	m
ds/dx ₃	the rate of change of the surface area for the lateral of a slotted grain with respect to distance	m

<u>Symbols</u>	<u>Definition</u>	<u>Units</u>
frac	mass fraction	
a	area	m ²
da	the rate of change of the area with respect to distance	m
a ₁	area of the inner slivers	m ²
da ₁	the rate of change of the area of the inner slivers with respect to distance	m
a ₂	area of the outer slivers	m ²
da ₂	the rate of change of the area of the outer slivers with respect to distance	m
a ₃	area to be removed from the outer sliver of a 19-perforated grain	m ²
da ₃	the rate of change of the area to be removed from the outer sliver of a 19-perforated grain with respect to distance	m
r _o	the radius of the grain diameter	m
r _i	the radius of the perforated diameter	m

APPENDIX B:

USER'S MANUAL FOR THE PROGRAMS PT, SURF, AND BR

INTENTIONALLY LEFT BLANK.

The user manual for the PT, SURF, and BR programs consists of a description of the numerical parameters necessary in running the computer codes. The programs are based on the metric system for the numerical parameters and must remain constant throughout the database. Below is the basic database showing the name and location for the variable with an alphabetical designator corresponding to the position at which the data is to appear, that is, from left to right. The data may be separated by blanks or commas, and measurement units, if any, are shown at the right of each input.

Title card - up to 60 characters of the title and identification.

Parameter information and placement:

A B C D E F

Metric

Record 1:

A.-Low pressure	MPa
B.-High pressure	MPa

Record 2:

A.-Heat capacity at constant volume of the propellant gases	cal/kg/k
B.-Heat capacity at constant volume of igniter gases	cal/kg/k
C.-Covolume of propellant	m ³ /kg
D.-Covolume of igniter	m ³ /kg

Record 3:

A.-Flame temperature of propellant gases	K
B.-Flame temperature of igniter gases	K
C.-Molecular weight of propellant gases	kg/kg mole
D.-Molecular weight of igniter gases	kg/kg mole

Record 4:

A.-Density of solid propellant kg/m³
B.-Density of solid igniter kg/m³

Record 5:

A.-Mass of propellant kg
B.-Mass of igniter kg
C.-Empty closed bomb volume m³

Record 6:

A.-Perforation diameter of the propellant m
B.-Grain diameter of the propellant m
C.-Grain length of the propellant m
D.-Slot width of the propellant m
E.-Indicator for the form function

Record 7:

A.-Heat loss up to the start of the calculation J
B.-Maximum pressure Pa
C.-Squib pressure Pa
D.-Print increment s
E.-Calculated delta time s

Record 8:

A.-Number of burning rate points

Record 9:

A.-a of aP^n equation m/(s·MPaⁿ)
B.-n of aP^n equation
C.-Upper limit pressure MPa
A.-a of aP^n equation m/(s·MPaⁿ)
B.-n of aP^n equation
C.-Upper limit pressure MPa

Below are the input databases for the two case studies. The first five databases are for the single-perforated right circular cylindrical slotted grain, and the other databases are for the 19-perforated right circular cylindrical grain.

BASE.IN
0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.0005.,0063.,0127.,0000254,11
0., 394911000.,344738.,.000005.,.000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

CV.IN
0.,388.
224.75,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.0005.,0063.,0127.,0000254,11
0., 394911000.,344738.,.000005.,.000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

GRGD.IN
0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.0005.,00567.,0127.,0000254,11
0., 394911000.,344738.,.000005.,.000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

GRPD.IN

0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.00045.,0063.,0127.,.0000254,11
0., 394911000.,344738.,.000005.,.000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

DEN.IN

0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1080.,1300.
0.06.,001.,.0002
0.0005.,0063.,0127.,.0000254,11
0., 394911000.,344738.,.000005.,.000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

BASE1.IN

0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.0005.,0063.,0127.,.0000254,19
0., 394911000.,344738.,.000005.,.000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

CV1.IN

0.,388.
310.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.0005.,0063.,0127.,.0000254,19
0., 394911000.,344738.,.000005.,.000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

GRGD1.IN
0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.0005.,00567.,0127.,0000254,19
0., 394911000.,344738.,.000005.,000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

GRPD1.IN
0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1200.,1300.
0.06.,001.,.0002
0.00045.,0063.,0127.,0000254,19
0., 394911000.,344738.,.000005.,000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

DEN1.IN
0.,388.
250.,300.,.000975437,.00101156
2500.,3000.,22.,23.
1080.,1300.
0.06.,001.,.0002
0.0005.,0063.,0127.,0000254,19
0., 394911000.,344738.,.000005.,000005
2
0.001105188 1. 689.476 .001105188 1. 689.476

INTENTIONALLY LEFT BLANK.

APPENDIX C:
PROGRAM LISTING FOR PT

INTENTIONALLY LEFT BLANK.

```

C 'PT - REDUCTION OF CLOSED BOMB DATA/PRESSURE-TIME'
C
PROGRAM PT
C /PT WITH METRIC UNITS
C
CHARACTER OUTFIL*10, ALABEL*40
CHARACTER BDFILE*10, PTFILE*10
CHARACTER*40 STRIN
CHARACTER*20 STRIN2
CHARACTER*35 STRIN3
DIMENSION HP(5000),HT(5000),BETA(10),ALPHA(10),PRESBR(10)
REAL MASSP,MASSI,MASAIR,K8
WRITE(*,16)
16 FORMAT(' INPUT NAME OF DATA FILE TO BE USED AS INPUT ')
READ(*,10)BDFILE
10 FORMAT(A10)
OPEN(UNIT=3,FILE=BDFILE,STATUS='OLD')
REWIND 3
WRITE(*,25)
25 FORMAT(' INPUT NAME OF OUTPUT FILE ')
READ(*,10)OUTFIL
OPEN(UNIT=5,FILE=OUTFIL)
OPEN(UNIT=4,FILE='SCRATCH')
WRITE(*,26)
26 FORMAT(' INPUT NAME OF P-T FILE')
READ(*,10)PTFILE
OPEN(UNIT=6,FILE=PTFILE)
50 READ(3,5) ALABEL
5 FORMAT(A40)
WRITE(5,401) ALABEL
401 FORMAT(1H , 'OUTPUT FROM PT' , /1X, A40)
C
C READ AND WRITE PRESSURE RANGE THAT BURNING RATE
C VERSUS PRESSURE WILL BE FIT TO INITALLY (BR=A*P**N)
C
READ(3,*)PLOW,PHIGH
WRITE(5,1040) PLOW,PHIGH
1040 FORMAT(/,1X,'LOW PRES VALUE MPA',E12.6,/,1X,
1 ' HIGH PRES VALUE MPA',E12.6)
C READ AND WRITE
C CVPV,CVIV... HEAT CAPACITY AT CONSTANT VOLUME PROP, IGN CAL/KG/K
C COVPV, COVIV... COVOLUME PROP,IGN M3/KG
C
READ(3,*)CVPV,CVIV,COVPV,COVIV
WRITE(5,470)CVPV,CVIV,COVPV,COVIV
470 FORMAT(' CV PROP CV IGN COVOLUME PROP COVOLUME IGN',/
1 ' CAL/KG/K CAL/KG/K M3/KG M3/KG',/
2 F9.3,1X,F9.3,3X,F9.5,4X,F14.5)
CVPV=CVPV*4.184
CVIV=CVIV*4.184
CVA=400.*4.184
C READ AND WRITE:
C FTPV,FTIV... FLAME TEMP PROP,IGN (K)
C RHPV,RHIV... MOL WT PROP,IGN CHANGED INTO R/MW
READ (3,*)FTPV,FTIV,RHPV,RHIV

```

```

WRITE(5,471)FTPV,FTIV,RHPV,RHIV
471  FORMAT(1X,'FLAME TEMP PROP  FLAME TEMP IGN  MOL WT PROP'
1'  MOL WT IGN' /
2'  '          K          K          K',
3'  '          K' /
4  4X,F7.1,4X,F14.1,1X,F14.2,3X,F11.2)
C
C  CHANGE MOL WT INTO UNIVERSAL GAS CONSTANT/MOL WT
C  TO MAKE MATHEMATICS EASIER
C
RHPV=8315./RHPV
RHIV=8315./RHIV
C
C  READ AND WRITE:
C  DENPRO,DENIGN... DENSITY OF PROP,IGN (KG/M3)
C
READ(3,*) DENPRO, DENIGN
C
C  READ AND WRITE:
C  MASSP,MASSI... MASS OF PROP,IGN (KG)
C  VOLBOM..... VOLUME OF BOMB (M3)
C
READ(3,*)MASSP,MASSI,VOLBOM
435  WRITE(5,130)MASSP,MASSI,DENPRO,DENIGN,VOLBOM
130  FORMAT(1H,'MASS PROP KG',F6.4,28X,'MASS IGN KG',F6.4,
1  /,'DEN PROP KG/M3',F8.2,23X,'DEN IGN KG/M3',F8.2/
2  'VOL BOMB M3',E12.6)
C
C  READ AND WRITE:
C  PERFDP,GRDP... PERF DIAMETER OF PROP,GRAIN DIAMETER PROP (M)
C  GLP,SW... GRAIN LENGTH PROP (M),SLOT WIDTH (M)
C  IFF... INDICATOR FOR FORM FUNCTIONS (0=CORD, 1=1 PERF,
C  7=7 PERF,19=19 PER CY,15=19 PERF HEX,11=SLOTTED GRAIN, 2=SPHERICAL,
C  12=SLAB)
C
READ(3,*)PERFDP,GRDP,GLP,SW,IFF
WRITE(5,473)PERFDP,GRDP,GLP,SW,IFF
473  FORMAT('PERF DIA ',
1  ' GRAIN DIA GRAIN LENGTH SLOT WIDTH '
2  ', ' INDICATOR FOR FORM FUNCTION ',/ ' M', 11X, 'M'
3  ',11X,'M',13X,'M'/F8.6, F10.6, F13.6,4X,F11.8,13X, I3)
C
C  READ AND WRITE:
C  HTLOSI... INITIAL HEAT LOSS (J)
C  PMAX,SQUIBP..... ACTUAL MAXIMUM PRESSURE,SQUIB PRESSURE (PSI)
C  PRTDT... PRINT TIME STEP (SEC)
C
READ(3,*)HTLOSI,PMAX,SQUIBP,PRTDT,CALDT
WRITE(5,190)HTLOSI,PMAX,SQUIBP, PRTDT,CALDT
190  FORMAT(1X,'INITIAL HEAT LOSS J',E12.6,16X,'MAX PRESSURE PA',E12.6/
1  ' SQUIB PRESSURE PA',E12.6,13X, 'PRINT INCREMENT S', E12.6,/
2  ' CALCULATION DELTA TIME S',E12.6)
READ(3,*)NBRP
READ(3,*) (BETA(I),ALPHA(I),PRESBR(I),I=1,NBRP)
WRITE(5,194)NBRP
WRITE(5,195) (BETA(I),ALPHA(I),PRESBR(I),I=1,NBRP)

```

```

194  FORMAT(1X,'NUMBER OF BURNING RATE POINTS',I3/
1  1X,'COEFFICIENT M/(S-MPA^EXP)  EXPONENT  PRESSURE MPA ')
195  FORMAT(1X,G18.6,12X,G11.6,2X,G11.6)
C
C  COVOLUME OF AIR
C
C  COVAIR = 30.*16.387/453.6*.001
C
C  MASS OF AIR IN CLOSED BCME
C
C  PA=101353.
C  MASAIR = PA*(VOLBOM-MASSP/DENPRO-MASSI/DENIGN)/(300.*8315./29.)
C  P = SQUIBP
C
C  INITIAL FREE VOLUME
C
C  VOL=VOLBOM-MASSI/DENIGN-MASSP/DENPRO-MASAIR*COVAIR
C
C  CALCULATE THE EXTRA MASS OF IGNITER THAT WOULD NEED TO BE
C  BURNED TO GIVE THE SQUIB PRESSURE AND ADD TO MASS OF IGNITER
C
C  THIS IS AN ESTIMATE TO ACCOUNT FOR THE PRESENCE OF THE
C  INITIATOR/SQUIB USED TO SET OFF THE IGNITER
C
C  AA11=RHIV*CVIV*FTIV
C  BB11=300.*RHIV*MASAIR*CVA+(8315./29.)*MASAIR*CVIV*FTIV-SQUIBP*
1  VOL*CVIV
C  CC11=300.*(8315./29)*CVA*MASAIR**2-SQUIBP*VOL*CVA*MASAIR
C  BB1=BB11/AA11
C  CC1=CC11/AA11
C  EXIGN=(-BB1+SQRT(BB1**2-4.*CC1))/2.0
C  MASSI = MASSI+EXIGN
C
C  CALCULATE THE THEORETICAL MAXIMUM PRESSURE FROM BURNING
C  UPDATED MASS OF IGNITER AND PROPELLANT, WITH NO HEAT LOSS
C
C  TEMPG=MASSP*CVPV*FTPV+MASSI*CVIV*FTIV+CVA*MASAIR*300.
C  TEMPG=TEMPG/(MASSP*CVPV+MASSI*CVIV+MASAIR*CVA)
C  VOL=VOLBOM-MASSP*COVPV-MASSI*COVIV-MASAIR*COVAIR
C  RHG=MASAIR*8315./29.+MASSI*RHIV+MASSP*RHPV
C  P=RHG*TEMPG/VOL
C  WRITE(5,187)P
187  FORMAT(1X,'THEORETICAL MAXIMUM PRESSURE  PA',G12.6)
C
C  CALCULATE ENERGY LOSS (J) REQUIRED TO GET FROM
C  THEORETICAL MAXIMUM PRESSURE DOWN TO ACTUAL PMAX
C
C  RHG=RHG/(MASSP+MASSI+MASAIR)
C  CV=(CVPV*MASSP+CVIV*MASSI+CVA*MASAIR)/(MASSP+MASSI+MASAIR)
C  HEATLS=CV*VOL*(P-PMAX)/RHG
C
C  CALCULATE AND PRINT K8 (ENERGY LOST PER PSI IN A LINEAR
C  MANNER (J/PA)) SIMPLE HEAT LOSS ASSUMPTION
C
C  K8=(HEATLS-HTLOSI)/(PMAX)
C  WRITE(5,30)K8
30  FORMAT(/,4X,'HEAT LOSS FACTOR =',G12.6,' J/PA',/)
C  TIME = 0.0

```

```

FRACI=1.0
PIGN=0.
HTLOLD=0.
C
C CALCULATE PRESSURE FROM BURNING ALL OF THE IGNITER AND
C SET SWITCHES FOR IGNITER HAVING ALL BEEN BURNT
C
ITER=0
426 PIGNO=PIGN
ITER=ITER + 1
VOL = VOLBOM-MASSP/DENPRO-MASAIR*COVAIR-MASSI*COVIV
RHG=MASAIR*8315./29. + MASSI*RHIV
TEMPG=(MASSI*CVIV*FTIV+CVA*MASAIR*300.-HTLOSI-HTLOLD)/
1 (MASSI*CVIV+MASAIR*CVA)
P = RHG*TEMPG/VOL
IGNBSW=0
PIGN=P
HTIOLD=PIGN*K8
IF(ITER.GT.20) GO TO 427
IF(ABS(PIGN-PIGNO).LT.0.00001*PIGN)GO TO 427
GO TO 426
427 WRITE(5,422)PIGN
422 FORMAT(1X,' IGNITION PRESSURE IS ',F10.2,' PA')
WRITE(5,423)
423 FORMAT(1X,' BURN RATE',8X,'PRESSURE',8X,'TIME'
1 ,8X,'DIST BURN',8X,'MASS PROP'/7X,'M/S',14X,
2 'PA',11X,'MSEC',12X,'M',16X,'KG')
C
C INITIALIZE CALL TO FORM FUNCTION
C
519 CALL FORMFN(PERFDP,GRDP,GLP,SW,IFF,0.0,FRACP,VOL2,SURFP,DSDX)
SURFP0=SURFP
C
C INITIALIZE VARIABLES
C
HTLOSS=0.
DXO=0.
TMPO=0.
TMASPO=0.0
PRTT=0.
DT1=CALDT
PIT=0.
DHDT=0.
POLD=0.
BD=0.
PNEW=0.
TXP=0.0
MUG1=0
P0=0.
TIMEPR=0.0
TIME=0.0
TIMEO=TIME
TMASI=MASSI
BDO=0.
193 P1=P
DO 196 I=1,NBRP
IF(P*1.E-6.GT.PRESBR(I))GO TO 196
GO TO 197

```

```

196 CONTINUE
   I=NBRP
197 CONTINUE
   POLD=P
   DXDT=BETA(I)*(P*1.E-G)**ALPHA(I)
   DX=DXDT*DT1
   BD=BDO+DX
   CALL FORMFN(PERFDP,GRDP,GLP,SW,IFF,BD,FRACP,VOL2,SURFP,DSDX)
   PROPM=FRACP*MASSP
   DHDT=K8*(P-P1)
   HTLOSS=HTLOLD+DHDT+HTLOSI
   TGAS=(-HTLOSS+TMASI*CVIV*FTIV+MASAIR*CVA*300.+PROPM*CVPV*FTPV)/
1   (TMASI*CVIV+MASAIR*CVA+PROPM*CVPV)
   RHAT=TMASI*RHIV+MASAIR*8315./29.+PROPM*RHPV
   VOL=VOLBOM-MASSF/DENPRO+PROPM/DENPRO-TMASI*COVIV-MASAIR*COVAIR
1   -PROPM*COVPV
   P=RHAT*TGAS/VOL
   IF(ABS(POLD-P).LT.0.00001*P)GO TO 428
   GO TO 197
428 TIME=TIME+DT1
   BDO=BDO+DX
   WRITE(4,*)P,TIME
   MUG1=MUG1+1
   HP(MUG1)=P
   HT(MUG1)=TIME
   TIMEMS=TIME*1000.
   HTLOLD=HTLOLD+DHDT
   WRITE(5,424)DXDT,P,TIMEMS,BD,PROPM
424 FORMAT(1X,F11.5,F17.2,F11.2,F17.6,F16.5)
   IF(P.GT..999*PMAX)GO TO 198
   GO TO 193
198 REWIND 4
   REWIND 6
   MUG2=MUG1+2
   WRITE(6,*)DT1
   WRITE(6,*)MUG2
   WRITE(6,*)PMAX
   WRITE(6,*)P0
   WRITE(6,*)PIGN
   DO 199 I=1, MUG1
   READ(4,*)P,TIME
   WRITE(6,*)P
199 CONTINUE
C   STRIN='          PT PLOT OF '//BDFILE
C   STRIN2='TIME (SEC)'
C   STRIN3='PRESSURE (PA)'
C   CALL PLOT(HT,HP,MUG1,STRIN2,STRIN3,STRIN)
END

```

INTENTIONALLY LEFT BLANK.

APPENDIX D:
PROGRAM LISTING FOR SURF

INTENTIONALLY LEFT BLANK.

```

C   'SURF - REDUCTION OF CLOSED BOMB DATA/SURFACE'
C
PROGRAM SURF
C   /SURF WITH METRIC UNITS
C
CHARACTER OUTFIL*10, ALABEL*40
CHARACTER BDFILE*10, PTFILE*10
CHARACTER*40 STRIN
CHARACTER*20 STRIN2
CHARACTER*35 STRIN3
DIMENSION PP(7), SAPP(7), SAPPF(7)
DIMENSION HSURFF(5000), HDIST(5000), BETA(10)
DIMENSION ALPHA(10), PRESBR(10)
REAL MASSP, MASSI, MASAIR, K8
DO 9 I=1,7
9  PP(I)=50.E6*I
WRITE(*,16)
16  FORMAT(' INPUT NAME OF DATA FILE TO BE USED AS INPUT ')
READ(*,10)BDFILE
10  FORMAT(A10)
OPEN(UNIT=3, FILE=BDFILE, STATUS='OLD')
REWIND 3
WRITE(*,25)
25  FORMAT(' INPUT NAME OF OUTPUT FILE ')
READ(*,10)OUTFIL
OPEN(UNIT=5, FILE=OUTFIL)
OPEN(UNIT=4, FILE='SCRATCH')
WRITE(*,26)
26  FORMAT(' INPUT NAME OF P-T FILE')
READ(*,10)PTFILE
OPEN(UNIT=6, FILE=PTFILE, STATUS='OLD')
50  READ(3,5) ALABEL
5   FORMAT(A20)
WRITE(5,401) ALABEL
401 FORMAT(1H , 'OUTPUT FROM SURF', /1X, A40)
C
C   READ AND WRITE PRESSURE RANGE THAT BURNING RATE
C   VERSUS PRESSURE WILL BE FIT TO INITALLY (BR=A*P**N)
C
READ(3,*)PLOW, PHIGH
WRITE(5,1040) PHIGH, PLOW
1040 FORMAT(/, 1X, 'HIGH PRES VALUE MPA', E12.6, /, 1X,
1 ' LOW PRES VALUE MPA', E12.6)
C   READ AND WRITE
C   CVPV, CVIV... HEAT CAPACITY AT CONSTANT VOLUME PROP, IGN CAL/KG/K
C   COVPV, COVIV... COVOLUME PROP, IGN M3/KG
C
READ(3,*)CVPV, CVIV, COVPV, COVIV
WRITE(5,470)CVPV, CVIV, COVPV, COVIV
470  FORMAT(' CV PROP    CV IGN    COVOLUME PROP    COVOLUME IGN', /
1 ' CAL/KG/K  CAL/KG/K    M3/KG    M3/KG', /
2 F9.3, 1X, F9.3, 3X, F9.5, 4X, F14.5)
CVPV=CVPV*4.184
CVIV=CVIV*4.184
CVA=400.*4.184
C   READ AND WRITE:
C   FTPV, FTIV... FLAME TEMP PROP, IGN (K)

```

```

C   RHPV,RHIV... MOL WT PROP,IGN CHANGED INTO R/MW
C
  READ (3,*)FTPV,FTIV,RHPV,RHIV
  WRITE(5,471)FTPV,FTIV,RHPV,RHIV
471  FORMAT(1X,'FLAME TEMP PROP   FLAME TEMP IGN   MOL WT PROP'
1'   MOL WT IGN'/
2'   '           K           K           K',
3'   '           K'/
4   4X,F7.1,4X,F14.1,1X,F14.2,3X,F10.2)

C
C   CHANGE MOL WT INTO UNIVERSAL GAS CONSTANT/MOL WT
C   TO MAKE MATHEMATICS EASIER
C
  RHPV=8315./RHPV
  RHIV=8315./RHIV

C
C   READ AND WRITE:
C   DENPRO,DENIGN... DENSITY OF PROP,IGN (KG/M3)
C
  READ(3,*) DENPRO, DENIGN

C
C   READ AND WRITE:
C   MASSP,MASSI... MASS OF PROP,IGN (KG)
C   VOLBOM..... VOLUME OF BOMB (M3)
C
  READ(3,*)MASSP,MASSI,VOLBOM
435  WRITE(5,130)MASSP,MASSI,DENPRO,DENIGN,VOLBOM
130  FORMAT(1H,'MASS PROP KG',F6.4,28X,'MASS IGN KG',F6.4,
1'  /,' DEN PROP KG/M3',F8.2,23X,'DEN IGN KG/M3',F8.2/
2'  ' VOL BOMB M3',E12.6)

C
C   READ AND WRITE:
C   PERFDP,GRDP... PERF DIAMETER OF PROP,GRAIN DIAMETER PROP (M)
C   GLP,SW... GRAIN LENGTH PROP (M), SLOT WIDTH (M)
C   IFF... INDICATOR FOR FORM FUNCTIONS (0=CORD,1=1 PERF,7=7 PERF,
C   19=19 PERF CY,15=19 PERF HEX,11=SLOTTED GRAIN,2=SPHERICAL,12=SLAB)
C
  READ(3,*)PERFDP,GRDP,GLP,SW,IFF
  WRITE(5,473)PERFDP,GRDP,GLP,SW,IFF
473  FORMAT('PERF DIA ',
1'  ' GRAIN DIA GRAIN LENGTH SLOT WIDTH '
2'  ', ' INDICATOR FOR FORM FUNCTION ',/ ' M', 11X, 'M'
3'  ',12X,'M',13X,'M'/F8.6, F10.6,F13.6,4X, F11.8,13X,I3)

C
C   READ AND WRITE:
C   HTLOSI... INITIAL HEAT LOSS (J)
C   PMAX,SQUIBP..... ACTUAL MAXIMUM PRESSURE,SQUIB PRESSURE (PA)
C   PRTDT... PRINT TIME STEP (SEC)
C
  READ(3,*)HTLOSI,PMAX,SQUIBP,PRTDT

C
C   READ FIRST NUMBER -- PDT IN SECONDS
C
  READ(6,*)PDT
  READ(6,*)NPT
  READ(6,*)PMAXH
  IF (PMAX.LE.0)PMAX = PMAXH

```

```

190 WRITE(5,190)HTLOSI,PMAX,SQUIBP, PRTDT,PDT
   FORMAT(1X,'INITIAL HEAT LOSS J',E12.6,16X,'MAX PRESSURE PA',E12.6/
1   ' SQUIB PRESSURE PA',E12.6,13X,'PRINT INCREMENT S', E12.6/
3   ' CALCULATION DELTA TIME S',E12.6)
   READ(3,*)NBRP
   READ(3,*) (BETA(I),ALPHA(I),PRESBR(I),I=1,NBRP)
   WRITE(5,194)NBRP
   WRITE(5,195) (BETA(I),ALPHA(I),PRESBR(I),I=1,NBRP)
194 FORMAT(1X,'NUMBER OF BURNING RATE POINTS',I3/
1   1X,'COEFFICIENT M/(S-MPA^EXP) EXPONENT PRESSURE MPA')
195 FORMAT(1X,G18.6,11X,G11.6,1X,G11.6)
C
C   COVOLUME OF AIR
C
C   COVAIR = 30.*16.387/453.6*.001
C
C   MASS OF AIR IN CLOSED BOMB
C
C   PA=101353.
C   MASAIR = PA*(VOLBOM-MASSP/DENPRO-MASSI/DENIGN)/(300.*8315./29.)
C   P = SQUIBP
C
C   INITIAL FREE VOLUME
C
C   VOL=VOLBOM-MASSI/DENIGN-MASSP/DENPRO-MASAIR*COVAIR
C
C   CALCULATE THE EXTRA MASS OF IGNITER THAT WOULD NEED TO BE
C   BURNED TO GIVE THE SQUIB PRESSURE AND ADD TO MASS OF IGNITER
C
C   THIS IS AN ESTIMATE TO ACCOUNT FOR THE PRESENCE OF THE
C   INITIATOR/SQUIB USED TO SET OFF THE IGNITER
C
C   AA11=RHIV*CVIV*FTIV
C   BB11=300.*RHIV*MASAIR*CVA+(8315./29)*MASAIR*CVIV*FTIV-SQUIBP*
1 VOL*CVIV
C   CC11=300.*(8315./29)*CVA*MASAIR**2-SQUIBP*VOL*CVA*MASAIR
C   BB1=BB11/AA11
C   CC1=CC11/AA11
C   EXIGN=(-BB1+SQRT(BB1**2-4.*CC1))/2.0
C   MASSI = MASSI+EXIGN
C
C   CALCULATE THE THEORETICAL MAXIMUM PRESSURE FROM BURNING
C   UPDATED MASS OF IGNITER AND PROPELLANT, WITH NO HEAT LOSS
C
C   TEMPG=MASSP*CVPV*FTPV+MASSI*CVIV*FTIV+CVA*MASAIR*300.
C   TEMPG=TEMPG/(MASSP*CVPV+MASSI*CVIV+MASAIR*CVA)
C   VOL=VOLBOM-MASSP*COVPV-MASSI*COVIV-MASAIR*COVAIR
C   RHG=MASAIR*8315./29.+MASSI*RHIV+MASSP*RHPV
C   P=RHG*TEMPG/VOL
C   WRITE(5,187)P
187 FORMAT(1X,'THEORETICAL MAXIMUM PRESSURE PA',G12.6)
C
C   CALCULATE ENERGY LOSS (J) REQUIRED TO GET FROM
C   THEORETICAL MAXIMUM PRESSURE DOWN TO ACTUAL PMAX

```

```

C
RHG=RHG/ (MASSP+MASSI+MASAIR)
CV= (CVPV*MASSP+CVIV*MASSI+CVA*MASAIR) / (MASSP+MASSI+MASAIR)
HEATLS=CV*VOL* (P-PMAX) /RHG
C
C
CALCULATE AND PRINT K8 (ENERGY LOST PER PA IN A LINEAR
C
MANNER (J/PA)) SIMPLE HEAT LOSS ASSUMPTION
C
K8= (HEATLS-HTLOSI) / (PMAX)
WRITE (5, 30) K8
30
FORMAT (/, 4X, 'HEAT LOSS FACTOR =', G12.6, ' J/PA', /)
TIME = 0.0
FRACI=1.0
PIGN=0.
HTLOLD=0.
C
C
CALCULATE PRESSURE FROM BURNING ALL OF THE IGNITER AND
C
SET SWITCHES FOR IGNITER HAVING ALL BEEN BURNT
C
ITER=0
426
PIGNO=PIGN
ITER=ITER + 1
VOL = VOLBOM-MASSP/DENPRO-MASAIR*COVAIR-MASSI*COVIV
RHG=MASAIR*8315./29. + MASSI*RHIV
TEMPG= (MASSI*CVIV*FTIV+CVA*MASAIR*300.-HTLOSI-HTLOLD) /
1 (MASSI*CVIV+MASAIR*CVA)
P = RHG*TEMPG/VOL
IGNBSW=0
PIGN=P
HTLOLD=PIGN*K8
IF (ITER.GT.20) GO TO 427
IF (ABS (PIGN-PIGNO) .LT..00001) GO TO 427
GO TO 426
427
WRITE (5, 422) PIGN
422
FORMAT (1X, ' IGNITION PRESSURE IS ', F10.2, ' PA')
C
C
INITIALIZE CALL TO FORM FUNCTION
C
519
CALL FORMFN (PERFDP, GRDP, GLP, SW, IFF, 0.0, FRACP, VOL2, SURFP, DSDX)
SURFP0=SURFP
TNG=MASSP/ (DENPRO*VOL2)
C
C
INITIALIZE VARIABLES
C
HTLOSS=0.
HTLOLD=0.
DXO=0.
TMPO=0.
TMASPO=0.0
PRTT=0.
DT1=0.
PIT=0.
DHDT=0.
POLD=0.
BD=0.
PNEW=0.
TXP=0.0
TMASP=0.0

```

```

MUG1=0
P1=P
TIMEPR=0.0
STMASP=-0.000001*MASSP
A1=0.0
TIME=0.0
MUG2=1
MUG3=0
TIMEO=TIME
KHOLD=0
BRMAX=0.0
PRMAX=0.0
DX=0.0000001
READ(6,*)P
TIME=0
P1 = PIGN
PRTT = TIME
TIMEO = TIME
OLDM=0.0
I2=1
SURFPO=0.0
SURFPP=0.0

C
C
C   READ P,T POINTS UNTIL PRESSURE IS GREATER THAN
C   ALL-BURNT IGNITER PRESSURE
C
303  READ(6,*)P
      MUG2=MUG2+1
      TIME=TIME+PDT
      IF(P.GT.PIGN+.000001*PIGN) GO TO 3332
      PRTT = TIME
      TIMEO = TIME
      GO TO 303

C
C   READ P,T POINT UNTIL PRESSURE IS GREATER THAN ZERO OR
C   GREATER THAN THE LAST USED PRESSURE POINT
202  READ(6,*)P
      MUG2=MUG2+1
      TIME=TIME+PDT
3332 DT1=TIME-TIMEO
      IF(P.LT.0.0) GO TO 202
333  IF(P.LE.P1+1.) GO TO 202
C
C   MASS OF IGNITER BURNT (TMA SI) (IN THIS CASE ALWAYS 100%)
208  TMA SI=MASSI*FRACI
C
C   CALCULATE HEAT LOSS UP TO NOW
C
      DHDT=K8*(P-P1)
      HTLOSS=HTLOLD+DHDT+HTLOSI

C
C   CALCULATE THE TOTAL MASS OF PROPELLANT BURNT UP TO
C   NOW (TMA SP), FROM PRESSURE AND COVOLUME EQUATION OF STATE
C   WITH THERMODYNAMIC DATA
C
      B1=P*(1./DENPRO-COVPV)*CVPV-RHPV*CVPV*FTPV

```

```

B2=(TMASI*CVIV+MASAIR*CVA)*P*(1./DENPRO-COVPV)
1 +CVPV*P*(VOLBOM-MASSP/DENPRO-MASSI/DENIGN+TMASI*(1./DENIGN-COIV))
2 -MASAIR*COVAIR)
B2=B2-CVPV*FTPV*(TMASI*RHIV+MASAIR*8315./29.)
1 -RHPV*(TMASI*CVIV*FTIV+MASAIR*CVA*300.-HTLOSS)
B3=(TMASI*(1./DENIGN-COIV)+VOLBOM-MASSP/DENPRO-MASSI/DENIGN
1 -MASAIR*COVAIR)*P*(TMASI*CVIV+MASAIR*CVA)
B3=B3-(TMASI*RHIV+MASAIR*8315./29.)*(TMASI*CVIV*FTIV+MASAIR*.4*
1 300.-HTLOSS)
TMASP=(-B2-SQRT(B2*B2-4.*B1*B3))/2./B1

C
C PRINT OUT PROPELLANT IGNITION (IN THIS CASE IT WILL BE
C ACCESSED ONLY ON FIRST PRESSURE POINT GREATER THAN
C PRESSURE FROM BURNING THE IGNITER)
C
220 FORMAT(' PROPELLANT IGNITION AT TIME =',F7.5,' S AND',
1 ' PRESSURE = ',F12.4,' PA'/)
240 FORMAT(1X,8HPRESSURE,6X,4HTIME,3X,'DIST BURN',2X,
1 9HMASS PROP,5X,'FORM SURFACE',5X,'CALC SURFACE')
241 IF(IGNBSW.NE.0)GO TO 529
WRITE(5,220) TIME,P
WRITE(5,240)
WRITE(5,2401)
2401 FORMAT(4X,'PA',10X,'SEC',7X,'M',10X,'KG',12X,
1 'M**2',13X,'M**2'/)
IGNBSW=1

C
C CHECK IF MASS OF PROPELLANT BURNED IS LESS THAN ZERO
C IF IT IS TRY NEXT HIGHER PRESSURE
C
529 IF(TMASP.LT.0.0) WRITE(5,15) TMASP,TMASI
IF(TMASP.LT.0.0) GO TO 202
15 FORMAT(1X,'TMASP',E12.5,' TMASI',E12.5)
DO 196 I=1,NBRP
IF(P*1.E-6.GT.PRESBR(I))GO TO 196
GO TO 197
196 CONTINUE
I=NBRP
197 DXDT=BETA(I)*(P*1.E-6)**ALPHA(I)
BD=DXDT*DT1
BD=BD+DX
CALL FORMFN(PERFDP,GRDP,GLP,SW,IFF,BD,FRACP,VOL2,SURFP,DSDX)
IF(SURFP.LE.0.0)GO TO 1202
DMDT=(TMASP-OLDM)/DT1
OLDM=TMASP
SURFP1=DMDT/DENPRO/DXDT
SURFP1=SURFP1/TNG
MUG3=MUG3+1
IF(I2.GT.7) GO TO 6346
IF(P.GE.PP(I2).AND.P1.LT.PP(I2)) THEN
SAPPF(I2)=SURFPP + (SURFP-SURFPP)/(P-P1)*(PP(I2)-P1)
SAPP(I2)=SURFPO + (SURFP1-SURFPO)/(P-P1)*(PP(I2)-P1)
I2=I2 + 1
ENDIF
6346 CONTINUE
IF (MUG3.LE.2) GO TO 198
MUG1=MUG1+1

```



```

HSURFF (MUG1) = (SURFP1-SURFP) / SURFP0
HDIST (MUG1) = BD
198 TIMEO=TIME
HTLOLD=HTLOLD+DHDT
P1=P
SURFPP=SURFP
SURFPO=SURFP1
TIMEMS = TIME*1000.
IF (TIME.LT.PRTT-.00001) GO TO 1041
WRITE (5,230) P, TIMEMS, BD, TASP, SURFP, SURFP1
PRTT=PRTT+PRDT
1041 CONTINUE
230 FORMAT (1X, E11.5, 3X, F7.3, E10.4, 1X, E11.5, 5X, E11.5, 5X, E11.5)
IF (P.GT.PMAX-.9999.OR.FRACP.GE..99999) GO TO 1202
IF (MUG2.EQ.NPT) GO TO 1202
GO TO 303
1202 STRIN=' SURF PLOT OF '//BDFILE
WRITE (5,4932) (PP (I), SAPP (I), SAPP (I), I=1,7)
4932 FORMAT (1X, E12.6, 5X, E15.8, 5X, E15.8)
MUG1=MUG1+1
HDIST (MUG1) = BD+DX
HSURFF (MUG1) = 0.0
C STRIN2='DISTANCE (M)'
C STRIN3='SURFACE AREA DIFFERENCE FRACTION'
C CALL PLOT (HDIST, HSURFF, MUG1, STRIN2, STRIN3, STRIN)
END

```

INTENTIONALLY LEFT BLANK.

APPENDIX E:
PROGRAM LISTING FOR BR

INTENTIONALLY LEFT BLANK.

```

C 'BR- REDUCTION OF CLOSED BOMB DATA'
C
PROGRAM BR
C /BR WITH METRIC UNITS
C
CHARACTER OUTFIL*10
CHARACTER BDFILE*10, PTFILE*10, ALABEL*40
CHARACTER*40 STRIN
CHARACTER*20 STRIN2
CHARACTER*35 STRIN3
DIMENSION HBR(5000), HP(5000), PP(7), PABR(7)
REAL MASSP, MASSI, MASAIR, K8
DO 9 I=1, 7
9 PP(I)= 50.E6*I
WRITE(*,16)
16 FORMAT(' INPUT NAME OF DATA FILE TO BE USED AS INPUT ')
PEAD(*,10)BDFILE
10 FORMAT(A10)
OPEN(UNIT=3, FILE=BDFILE, STATUS='OLD')
REWIND 3
WRITE(*,25)
25 FORMAT(' INPUT NAME OF OUTPUT FILE ')
READ(*,10)OUTFIL
OPEN(UNIT=5, FILE=OUTFIL)
OPEN(UNIT=4, FILE='SCRATCH')
WRITE(*,26)
26 FORMAT(' INPUT NAME OF P-T FILE')
READ(*,10)PTFILE
OPEN(UNIT=6, FILE=PTFILE, STATUS='OLD')
50 READ(3,5) ALABEL
5 FORMAT(A40)
WRITE(5,401) ALABEL
401 FORMAT(1H , 'OUTPUT FROM BR', /1X, A40)
C
C READ AND WRITE PRESSURE RANGE THAT BURNING RATE
C VERSUS PRESSURE WILL BE FIT TO INITALLY (BR=A*P**N)
C
READ(3,*)PLOW,PHIGH
WRITE(5,1040) PHIGH,PLOW
1040 FORMAT(/,1X,'HIGH PRES VALUE MPA',E12.6,/,1X,
1 ' LOW PRES VALUE MPA',E12.6)
C READ AND WRITE
C CVPV,CVIV... HEAT CAPACITY AT CONSTANT VOLUME PROP, IGN CAL/KG/K
C COVPV, COVIV... COVOLUME PROP,IGN M3/KG
C
READ(3,*)CVPV,CVIV,COVPV,COVIV
WRITE(5,470)CVPV,CVIV,COVPV,COVIV
470 FORMAT(' CV PROP CV IGN COVOLUME PROP COVOLUME IGN',/
1 ' CAL/KG/K CAL/KG/K M3/KG M3/KG',/
2 F9.3,1X,F9.3,3X,F9.5,4X,F14.5)
CVPV=CVPV*4.184
CVIV=CVIV*4.184
CVA=400.*4.184
C READ AND WRITE:
C FTPV,FTIV... FLAME TEMP PROP,IGN (K)
C RHPV,RHIV... MOL WT PROP,IGN CHANGED INTO R/MW

```

```

C
  READ (3,*)FTPV,FTIV,RHPV,RHIV
  WRITE(5,471)FTPV,FTIV,RHPV,RHIV
471  FORMAT(1X,'FLAME TEMP PROP   FLAME TEMP IGN   MOL WT PROP'
1'   MOL WT IGN' /
2'   '           K           K           K',
3'   '           K' /
4   4X,F7.1,4X,F14.1,1X,F14.2,3X,F11.2)

C
C   CHANGE MOL WT INTO UNIVERSAL GAS CONSTANT/MOL WT
C   TO MAKE MATHEMATICS EASIER
C
  RHPV=8315./RHPV
  RHIV=8315./RHIV

C
C   READ AND WRITE:
C   DENPRO,DENIGN... DENSITY OF PROP,IGN (KG/M3)
C
  READ(3,*) DENPRO, DENIGN

C
C   READ AND WRITE:
C   MASSP,MASSI... MASS OF PROP,IGN (KG)
C   VOLBOM..... VOLUME OF BOMB (M3)
C
  READ(3,*)MASSP,MASSI,VOLBOM
435  WRITE(5,130)MASSP,MASSI,DENPRO,DENIGN,VOLBOM
130  FORMAT(1H , 'MASS PROP KG',F6.4,28X, 'MASS IGN KG' ,F6.4,
1  /, ' DEN PROP KG/M3',F8.2,23X, 'DEN IGN KG/M3',F8.2/
2  ' VOL BOMB M3',E12.6)

C
C   READ AND WRITE:
C   PERFDP,GRDP... PERF DIAMETER OF PROP,GRAIN DIAMETER PROP (M)
C   GLP,SW... GRAIN LENGTH PROP (M), SLOT WIDTH
C   IFF... INDICATOR FOR FORM FUNCTION (0=CORD,1=1 PERF,7=7 PERF,
C   19=19 PERF CY,15=19 PERF HEX,11= SLOTTED GRAIN,2=SPHERICAL,12=SLAB)
C
  READ(3,*)PERFDP,GRDP,GLP,SW,IFF
  WRITE(5,473)PERFDP,GRDP,GLP,SW,IFF
473  FORMAT('PERF DIA ',
1  ' GRAIN DIA   GRAIN LENGTH   SLOT WIDTH '
2  ' INDICATOR FOR FORM FUNCTION ',/ ' M ',10X,'M'
3  ,12X,'M',13X,'M'/F8.6,F11.6,2X,F12.6,4X,F11.8,15X,I3)

C
C   READ AND WRITE:
C   HTLOSI... INITIAL HEAT LOSS (J)
C   PMAX,SQUIBP..... ACTUAL MAXIMUM PRESSURE,SQUIB PRESSURE (PA)
C   PRTDT... PRINT TIME STEP (SEC)
C
  READ(3,*)HTLOSI,PMAX,SQUIBP,PRTDT

C
C   READ FIRST NUMBER -- PDT IN SECONDS
C
  READ(6,*)PDT
  READ(6,*)NPT
  READ(6,*)PMAHX
  IF (PMAX.LE.0.) PMAX=PMAHX
  WRITE(5,190)HTLOSI,PMAX,SQUIBP, PRTDT,PDT

```

```

190  FORMAT(1X,'INITIAL HEAT LOSS J',E12.6,16X,'MAX PRESSURE PA',E12.6/
1    ' SQUIB PRESSURE PA',E12.6,13X,'PRINT INCREMENT S',E12.6/
2    ' CALCULATED DELTA TIME S',E12.6)
C
C    COVOLUME OF AIR
C
C    COVAIR = 30.*16.387/453.6*.001
C
C    MASS OF AIR IN CLOSED BOMB
C
C    PA=101353.
C    MASAIR = PA*(VOLBOM-MASSP/DENPRO-MASSI/DENIGN)/(300.*8315./29.)
C    P = SQUIBP
C
C    INITIAL FREE VOLUME
C
C    VOL=VOLBOM-MASSI/DENIGN-MASSP/DENPRO-MASAIR*COVAIR
C
C    CALCULATE THE EXTRA MASS OF IGNITER THAT WOULD NEED TO BE
C    BURNED TO GIVE THE SQUIB PRESSURE AND ADD TO MASS OF IGNITER
C
C    THIS IS AN ESTIMATE TO ACCOUNT FOR THE PRESENCE OF THE
C    INITIATOR/SQUIB USED TO SET OFF THE IGNITER
C
C    AA11=RHIV*CVIV*FTIV
C    BB11=300.*RHIV*MASAIR*CVA+(8315./29)*MASAIR*CVIV*FTIV-SQUIBP*
1 VOL*CVIV
C    CC11=300.*(8315./29)*CVA*MASAIR**2-SQUIBP*VOL*CVA*MASAIR
C    BB1=BB11/AA11
C    CC1=CC11/AA11
C    EXIGN=(-BB1+SQRT(BB1**2-4.*CC1))/2.0
C    MASSI = MASSI+EXIGN
C
C    CALCULATE THE THEORETICAL MAXIMUM PRESSURE FROM BURNING
C    UPDATED MASS OF IGNITER AND PROPELLANT, WITH NO HEAT LOSS
C
C    TEMPG=MASSP*CVPV*FTPV+MASSI*CVIV*FTIV+CVA*MASAIR*300.
C    TEMPG=TEMPG/(MASSP*CVPV+MASSI*CVIV+MASAIR*CVA)
C    VOL=VOLBOM-MASSP*COVPV-MASSI*COVIV-MASAIR*COVAIR
C    RHG=MASAIR*8315./29.+MASSI*RHIV+MASSP*RHPV
C    P=RHG*TEMPG/VOL
C
C    CALCULATE ENERGY LOSS (J) REQUIRED TO GET FROM
C    THEORETICAL MAXIMUM PRESSURE DOWN TO ACTUAL PMAX
C
C    RHG=RHG/(MASSP+MASSI+MASAIR)
C    CV=(CVPV*MASSP+CVIV*MASSI+CVA*MASAIR)/(MASSP+MASSI+MASAIR)
C    HEATLS=CV*VOL*(P-PMAX)/RHG
C
C    CALCULATE AND PRINT K8 (ENERGY LOST PER PA IN A LINEAR
C    MANNER (J/PA)) SIMPLE HEAT LOSS ASSUMPTION
C
C    K8=(HEATLS-HTLOSI)/(PMAX)
C    WRITE(5,30)K8
30  FORMAT(/,4X,'HEAT LOSS FACTOR =',G12.6,' J/PA',/)
C    TIME = 0.0
C    FRACI=1.0

```

```

PIGN=0.
HTLOLD=0.
C
C CALCULATE PRESSURE FROM BURNING ALL OF THE IGNITER AND
C SET SWITCHES FOR IGNITER HAVING ALL BEEN BURNT
C
ITER=0
426 PIGNO=PIGN
ITER=ITER + 1
VOL = VOLBOM-MASSP/DENPRO-MASAIR*COVAIR-MASSI*COVIV
RHG=MASAIR*8315./29. + MASSI*RHIV
TEMPG=(MASSI*CVIV*FTIV+CVA*MASAIR*300.-HTLOSI-HTLOLD) /
1 (MASSI*CVIV+MASAIR*CVA)
P = RHG*TEMPG/VOL
IGNBSW=0
PIGN=P
HTLOLD=PIGN*K8
IF (ITER.GT.20) GO TO 427
IF (ABS (PIGN-PIGNO) .LT.0.00001*PIGN)GO TO 427
GO TO 426
427 WRITE (5,422)PIGN
422 FORMAT(1X,' IGNITION PRESSURE IS ',F10.2,' PA')
C
C INITIALIZE CALL TO FORM FUNCTION
C
519 CALL FORMFN (PERFDP,GRDP,GLP,SW,IFF,0.0,FRACP,VOL2,SURFP,DSDX)
C
C INITIALIZE VARIABLES
C
HTLOSS=0.
DXDTO=0.
I2=1
DXO=0.
TMPO=0.
TMASPO=0.0
PRTT=0.
DT1=0.
PIT=0.
DHDT=0.
POLD=0.
BD=0.
PNEW=0.
TXP=0.0
TMASP=0.0
MUG1=0
P1=P
TIMEPR=0.0
STMASP=-0.000001*MASSP
A1=0.0
TIME=0.0
TIMEO=TIME
KHOLD=0
BRMAX=0.0
PRMAX=0.0
DX=0.0000001
READ(6,*)P
TIME=C
MUG2=1

```



```

P1 = PIGN
PRTT = TIME
TIMEO = TIME

C
C READ P,T POINTS UNTIL PRESSURE IS GREATER THAN
C ALL-BURNT IGNITER PRESSURE
C
303 READ (6,*)P
MUG2=MUG2+1
TIME=TIME+PDT
IF(P.GT.PIGN+.00001*PIGN) GO TO 3332
PRTT = TIME
TIMEO = TIME
GO TO 303

C
C READ P,T POINT UNTIL PRESSURE IS GREATER THAN ZERO OR
C GREATER THAN THE LAST USED PRESSURE POINT
202 READ (6,*)P
MUG2=MUG2+1
TIME=TIME+PDT
3332 DT1=TIME-TIMEO
IF(P.LT.0.0) GO TO 202
333 IF(P.LE.P1+1) GO TO 202
C
C MASS OF IGNITER BURNT (TMASI) (IN THIS CASE ALWAYS 100%)
C
208 TMASI=MASSI*FRACI
C
C CALCULATE HEAT LOSS UP TO NOW
C
DHDT=K8*(P-P1)
HTLOSS=HTLOLD+DHDT+HTLOSI

C
C CALCULATE THE TOTAL MASS OF PROPELLANT BURNT UP TO
C NOW (TMASP), FROM PRESSURE AND COVOLUME EQUATION OF STATE
C WITH THERMODYNAMIC DATA
C
B1=P*(1./DENPRO-COVV)*CVPV-RHPV*CVPV*FTPV
B2=(TMASI*CVIV+MASAIR*CVA)*P*(1./DENPRO-COVV)
1 +CVPV*P*(VOLBOM-MASSP/DENPRO-MASSI/DENIGN+TMASI*(1./DENIGN-COVIV)
2 -MASAIR*COVAIR)
B2=B2-CVPV*FTPV*(TMASI*RHIV+MASAIR*8315./29.)
1 -RHPV*(TMASI*CVIV*FTIV+MASAIR*CVA*300.-HTLOSS)
B3=(TMASI*(1./DENIGN-COVIV)+VOLBOM-MASSP/DENPRO-MASSI/DENIGN
1 -MASAIR*COVAIR)*P*(TMASI*CVIV+MASAIR*CVA)
B3=B3-(TMASI*RHIV+MASAIR*8315./29.)*(TMASI*CVIV*FTIV+MASAIR*CVA*
1 300.-HTLOSS)
TMASP=(-B2-SQRT(B2*B2-4.*B1*B3))/2./B1

C
C PRINT OUT PROPELLANT IGNITION (IN THIS CASE IT WILL BE
C ACCESSED ONLY ON FIRST PRESSURE POINT GREATER THAN
C PRESSURE FROM BURNING THE IGNITER)
C
220 FORMAT(30H PROPELLANT IGNITION AT TIME = ,F7.5,' AND',
1 ' PRESSURE = 'F10.2,/)
240 FORMAT(1X,' BURN RATE',6X,'PRESSURE',7X,'TIME'
1 ,6X,'DIST BURN',8X,'MASS PROP'/6X,'M/SEC',11X,

```

```

2         'PA',10X,'MSEC',10X,'M',16X,'KG')
241      IF(IGNBSW.NE.0)GO TO 529
          WRITE(5,220) TIME,P
          WRITE(5,240)
          IGNBSW=1
C
C      CHECK IF MASS OF PROPELLANT BURNED IS LESS THAN ZERO
C      IF IT IS TRY NEXT HIGHER PRESSURE
C
529      IF(TMASP.LT.0.0) WRITE(5,15) TMASP,TMASI
          IF(TMASP.LT.0.0) GO TO 202
C
C      ITERATE TO FIND THE INCREMENTAL DISTANCE (DX) WHICH THE
C      GRAIN MUST HAVE BURNED TO GIVE THE CALCULATED AMOUNT OF
C      MASS FRACTION BURNT ACCORDING TO THE FORM FUNCTION (PRF017)
C
C      DXX = TOTAL DISTANCE BURNT
C
C      PROPELLANT BURNT (TMASP) USING A NEWTON-RAPHSON TECHNIQUE
          TMP=0.0
          DXO=0.
217      DXX=BD+DX
          CALL FORMFN(PERFDP,GRDP,GLP,SW,IFF,DXX,FRACP,VOL2,SURFP,DSDX)
          TMP=MASSP*FRACP
          IF(SURFP.LE.0..OR.FRACP.GT..9999) GO TO 216
          GO TO 214
216      KHOLD=1
214      CONTINUE
          IF(TMP.EQ.0.0) GO TO 1202
          IF(ABS((TMASP-TMP)/TMASP).LT..00001) GO TO 218
          IF(ABS((TMPO-TMP)/TMP).LE.1.E-10)GO TO 218
          DXDM=- (DXO-DX) / (TMPO-TMP)
          DXO=DX
          TMPO=TMP
          DX=DX- (TMASP-TMP) *DXDM
          A1=A1+1
          IF(A1.GT.50) GO TO 218
          TMP=0.
          GO TO 217
C
C      CALCULATE DX/DT
C
218      DXDT=DX / (TIME-TIMEO)
C
C      CHECK FOR REASONABLE VALUES OF DX/DT
C
          IF(DXDT.LE.0.0) WRITE(5,15) TMASP,TMASI,DXDT,DX,A1
          IF(DXDT.LE.0.0) GO TO 1202
C
C      WRITE PRESSURE,BURNING RATE POINTS TO FILE SIMPCB.OUT
C
          MUG1=MUG1+1
          WRITE(4,100) P,DXDT
          IF(I2.GT.7)GOTO 6346

```

```

IF (P.GE.PP(I2).AND.P1.LT.PP(I2)) THEN
PABR(I2) = DXDT0+(DXDT-DXDT0)/(P-P1)*(PP(I2)-P1)
I2=I2+1
ENDIF
6346 IF(MUG1.GT.5000)GO TO 504
HBR(MUG1)=DXDT
HP(MUG1)=P
IF(DXDT.GT.BRMAX)BRMAX=DXDT
IF(P.GT.PRMAX)PRMAX=P
504 CONTINUE
100 FORMAT (2G20.8)
C
C SET UP FOR NEXT POINT
C
TIME0=TIME
HTLOLD=HTLOLD+DHDT
DXDT0=DXDT
P1=P
IF(KHOLD.NE.0) GO TO 1202
BD=BD+DX
A1=0.
15 FORMAT(1X, 'NEGATIVE DERIVATIVE --'/6G14.8//)
C
C PRINT OUT RESULTS AT INTERVALS SPECIFIED BY PRDIT
C
TIMEMS = TIME*1000.
IF(TIME.LT.PRTT-.00001) GO TO 1041
WRITE(5,230) DXDT,P,TIMEMS,BD,TMASP
PRTT=PRTT+PRDIT
1041 CONTINUE
230 FORMAT(F11.5,F16.0,F11.2,F15.7,F16.6)
C IF(P.GT.PMAX-.9999.OR.FRACP.GE..99999) GO TO 1202
IF(MUG2.EQ.NPT)GO TO 1202
C
C GO TO NEXT PRESSURE, TIME POINT
C
GO TO 202
1030 FORMAT(/10X,4HR = ,F10.8,4H P** ,F9.6,10X
1 12H CORR COEF =,F10.7,///)
C
C HAVE FINISHED CALCULATIONS OF DXDT
C
C NOW CALCULATE LEAST SQUARES FIT OF  $DXDT=A \cdot P^N$ 
C OVER PRESSURE RANGE PLOW TO PHIGH FOR AS MANY
C RANGES AS REQUIRED
C
1202 WRITE(5,401) ALABEL
WRITE(5,1204)
1204 FORMAT(' ',8X,'RANGE'/7X,'PLOW PHIGH',9X,'COEF',12X,
1 'EXP',8X,'CORR COEF'/8X,'MPA',4X,'MPA',7X,'M/S-MPA^EXP',
2 9X,'-',13X,'-'/)
GO TO 12021
357 WRITE(*,3571)
3571 FORMAT(' DO YOU WANT TO USE A DIFFERENT PRESSURE RANGE',
1 ' FOR BURN RATE CALCULATION? (1 FOR YES, 0 FOR NO)')
READ(*,253) ICYN
253 FORMAT(I1)
IF(ICYN.EQ.0)GO TO 3580

```

```

WRITE(*,3572)
3572  FORMAT(' ENTER LOW AND HIGH PRESSURES: (MPA) ')
      READ(*,*)PLOW,PHIGH
12021 PLOW=PLOW*1.E6
      PHIGH=PHIGH*1.E6
      CLOSE(4)
      OPEN(4,FILE='SCRATCH',STATUS='OLD')
      REWIND 4
3573  READ(4,100) P,DXDT
      IF(P.LT.PLOW)GO TO 3573
      A7=0.
      A8=0.
      A9=0.
      H5=0.
      H8=0.
      H9=0.
      I=1
      RLN=0.
      PLN=0.
3575  P=P*1.E-6
      A7=A7+ALOG10(P)
      A8=A8+ALOG10(P)*ALOG10(P)
      A9=A9+ALOG10(P)*ALOG10(DXDT)
      H5=H5+ALOG10(DXDT)
      H8=H8+ALOG10(DXDT)*ALOG10(DXDT)
      H9=H9+1
C     RLN=RLN + ALOG(DXDT)
C     PLN=PLN + ALOG(P)
      READ(4,100) P,DXDT
      IF(P.LT.PHIGH)GO TO 3575
      B5=(A8*H5-A7*A9)/(H9*A8-A7*A7)
      B6=(H9*A9-A7*H5)/(H9*A8-A7*A7)
      B5=10.**B5
      R6=(H9*A9-H5*A7)/SQRT((H9*A8-A7*A7)*(H9*H8-H5*H5))
C     RLN = RLN/H9
C     PLN = PLN/H9
      PLOW=PLOW*1.E-6
      PHIGH=PHIGH*1.E-6
      WRITE(5,1205) PLOW,PHIGH,B5,B6,R6
1205  FORMAT(4X,F7.0,1X,F7.0,5X,E12.6,5X,F9.6,5X,F9.6,5X,
1 //1PE14.6,5X,E12.6)
3574  FORMAT(5X,2F14.4)
      GO TO 357
3580  CONTINUE
      WRITE(5,4932) (PP(I),PABR(I),I=1,7)
4932  FORMAT(1X,E12.6,5X,E15.8)
C     STRIN='          BR PLOT OF '//BDFILE
C     STRIN2='PRESSURE (PA) '
C     STRIN3='BURNING RATE (M\S)'
C     CALL PLOT(HP,HBR,MUG1,STRIN2,STRIN3,STRIN)
      END

```

APPENDIX F:
PROGRAM LISTING FOR FORMFN

INTENTIONALLY LEFT BLANK.

```

$STORAGE:2
  subroutine formfn(pd,gd,gl,sw,iff,x,frac,vol,surf,dsdx)
    pi=3.141592654
    sqrt3=sqrt(3.)
c The analytic derivation for the 7 perf,19 perf,and the 19 perf hex was
c based on unpublished work of Jim Kudzal, Naval Ordnance Station,
c Indianhead Maryland.
c Goes to the subroutine for a right circular cylindrical grain type.
  if(iff.eq.0) go to 1000
c Goes to the subroutine for a one perforated right circular cylindrical
c grain type.
  if(iff.eq.1) go to 2000
c Goes to the subroutine for a seven perforated circular cylindrical
c grain type.
  if(iff.eq.7) go to 3000
c Goes to the subroutine for a nineteen perforated right circular
c cylindrical grain type.
  if(iff.eq.19) go to 4000
c Goes to the subroutine for a nineteen perforated hexagonal with
c rounded corners grain type.
  if(iff.eq.15) go to 5000
c Goes to the subroutine for a spherical grain type.
  if(iff.eq.2) go to 6000
c Goes to the subroutine for a right rectangular grain type.
  if(iff.eq.12) go to 7000
c Goes to the subroutine for a single perforated right circular
c cylindrical slotted grain type.
  if(iff.eq.11) go to 8000
  write(5,30)
  90 format(1X,'UNACCEPTABLE INDICATOR FOR THE FORM FUNCTION !')
  stop

c
c Below is the subroutine for a right circular cylindrical grain type
c where x is the distance burned.
c
c INPUT
c   pd=perforation diameter
c   gd=grain diameter
c   gl=grain length
c   iff=indicator for the form function
c   x= distance burned
c
c OUTPUT
c   vol= the volume of the grain remaining.
c   frac=the mass fraction of the the propellant burned.
c   surf=the surface area per grain.
c   dsdx=the rate of change of the surface area with respect to distance.
c
1000 if(gd-2.*x.le.0.0.or.2.*x.gt.gl) go to 2001
    vo=pi*gd*gd/4.*gl
    vol=pi*(gd-2.*x)**2/4.*(gl-2.*x)
    frac=1.-vol/vo
    surf=pi/2.*(gd-2.*x)**2+pi*(gd-2.*x)*(gl-2.*x)
    dsdx=-2.*pi*(2*gd+gl-6.*x)
    return

```

```

c All burned out.
  2001 surf=0.
      frac=1.0
      vol=0.
      dsdx=0.
      return

c
c Below is the subroutine for a one perforated right circular cylindrical
c grain type with equal web and perforation where x is the distance burned.
c
  2000 if(gd-pd-4.*x.le.0.0.or.2.*x.gt.gl) go to 3001
      vo=pi/4.*(gd*gd-pd*pd)*gl
      vol=pi/4.*((gd-2.*x)**2-(pd+2.*x)**2)*(gl-2.*x)
      frac=1.-vol/vo
      surf=pi/2.*((gd-2.*x)**2-(pd+2.*x)**2)
      surf=surf+pi*(gd-2.*x)*(gl-2.*x)
      surf=surf+pi*(pd+2.*x)*(gl-2.*x)
      dsdx=-4.*pi*(gd+pd)
      return
c ALL BURNED OUT.
  3001 vol=0.
      frac=1.0
      surf=0.
      dsdx=0.
      return

c
c Below is the subroutine for a seven perforated right circular cylindrical
c grain type with equal webs and perforations where x is the distance burned.
c
c   INPUT
c   pd=perforation diameter
c   gd=grain diameter
c   gl=grain length
c   iff=indicator for the form function
c   x= distance burned
c
c   OUTPUT
c   vol= the volume of the grain remaining.
c   frac=the mass fraction of the the propellant burned.
c   surf=the surface area per grain.
c   dsdx=the rate of change of the surface area with respect to distance.
c
c   CALCULATED VARIABLES
c   web=the distance between perforation edges.
c       -the distance between outside perf and edge of grain.
c   x1= the distance to inner sliver burnout.
c   x2= the distance to outer sliver burnout (frac=1).
c
  3000 web=(gd-3.*pd)/4.
      d=web+pd
      sqr3=sqrt(3.)
      x1=d/sqr3-pd/2.
      x2=(14.-3.*sqr3)*d/13.-pd/2.

```



```

      abo=amin1(x2,.5*gl)
      vo=pi/4.*gl*(gd*gd-7.*pd*pd)
      if(x.gt.abo) go to 30
      so=2.*vo/gl+pi*gl*(gd+7.*pd)
      if (x.gt.web/2+.0000001) goto 20
      vol=pi/4.*(gl-2.*x)*((gd-2.*x)**2-7.*(pd+2.*x)**2)
      frac=1.-vol/vo
      surf=2.*vol/(gl-2.*x)+pi*(gl-2.*x)*((gd-2.*x)+
& 7.*(pd+2.*x))
      dsdx=-4*pi*(gd+7.*pd-3.*gl+18.*x)
      return
20 if(x.ge.x2) go to 30
c THE SLIVERING PHASE.
      s1=0.
      s2=0.
      v1=0.
      v2=0.
      y=sqrt((pd+2.*x)**2-d*d)
      theta=atan(y/d)
      a1=theta/4.*(pd+2.*x)**2-d/4.*y
      if(x.ge.x1) go to 25
c THE INNER SLIVERS.
      v1=3./4.*(gl-2.*x)
      v1=v1*(2.*sqr3*d*d-pi*(pd+2.*x)**2+24.*a1)
      s1=2.*v1/(gl-2.*x)
      s1=s1+3.*(gl-2.*x)*(pi-6.*theta)*(pd+2.*x)
c THE OUTER SLIVERS.
25 y1=sqrt((gd-2.*x)**2-(5.*d-2.*(pd+2.*x))**2)
      chi=atan(y1/(5.*d-2.*(pd+2.*x)))
      y2=sqrt((pd+2.*x)**2-(3.*d-2.*(pd+2.*x))**2)
      phi=atan(y2/(3.*d-2.*(pd+2.*x)))
      a2=phi*(pd+2.*x)**2-chi*(gd-2.*x)**2
      a2=(a2+2.*sqr3*d*sqrt((3.*d-pd-2.*x)*(3.*d-gd+2.*x)))/8.
      v2=pi*(gd-2.*x)**2-6.*sqr3*d*d-4.*pi*(pd+2.*x)**2
      v2=(v2+24.*(a1+2.*a2))*(gl-2.*x)/4.
      s2=2.*v2/(gl-2.*x)
      s2=s2+(gl-2.*x)*((pi-6.*chi)*(gd-2.*x)+2.*(2.*pi-3.*phi-3.*theta
& )*(pd+2.*x))
      vol=v1+v2
      frac=1.-vol/vo
      surf=s1+s2
c THE APPROXIMATE DSDX.
      dsdx=-surf/(x2-x)
      return
c ALL BURNED OUT.
30 vol=0.
      frac=1.
      surf=0.
      dsdx=0.
      return

```

c
c Below is the subroutine for a nineteen perforated right circular
c cylindrical grain type with equal webs and perforations where x
c is the distance burned.

c
c INPUT
c p=perforation diameter

```

c      d=grain diameter
c      gl=grain length
c      x=distance burned
c      iff=indicator for the form function
c
c      OUTPUT
c      vol=the volume of one grain at x.
c      frac=the fraction of grain burned at x.
c      surf=the surface area of one grain at x.
c      dsdx=the rate of change of the surface area with respect to distance.
c
c      CALCULATED VARIABLES
c      w=web
c      w1=secondary web
c      dbc=distance between perforation centers
c      Assumes burnout does not occur in longitudinal direction
c      x1=distance to inner sliver burnout
c      x2=distance to outer sliver burnout (frac=1.)
c
4000 p=pd
      d=gd
      w=(d-5.*p)/6.
      sqrt3=sqrt(3.)
      sqrt5=sqrt(5.)
      sqrt6=sqrt(6.)
      sqrt10=sqrt(10.)
c Initial volume and the surface area.
      vo=pi/4.*gl*(d*d-19.*p*p)
      so=2.*vo/gl+pi*gl*(d+19.*p)
      dbc=w+p
      w1=0.5*(d-p-2.*sqrt3*dbc)
      x1=dbc/sqrt3-p/2.
      x2=0.25*(dbc*(6.-sqrt10)-2.*p)
      abo=amin1(x2,gl/2.)
      if(x.gt.abo) go to 130
      if(x.gt.w/2.) go to 110
c Not Slivered yet
      vol=pi/4.*(gl-2.*x)*((d-2.*x)**2-19.*(p+2.*x)**2)
      frac=1.-vol/vo
      surf=2.*vol/(gl-2.*x)+pi*(gl-2.*x)*(d-2.*x+19.*(p+2.*x))
      dsdx=pi*(-4*d+36.*gl-76.*p-216.*x)
      return
110 v1=0.
      v2=0.
      s1=0.
      s2=0.
      delta=0.
      chi=0.
      a3=0.
      if(x.ge.x2) go to 130
c THE INNER SLIVERS.
      theta=acos(dbc/(p+2.*x))
      a1=theta/4.*(p+2.*x)**2-dbc/4.*sqrt((p+2.*x)**2-dbc*dbc)
      if(x.gt.x1) go to 120
      v1=3.*(gl-2.*x)*(2.*sqrt3*dbc*dbc-pi*(p+2.*x)**2+24*a1)
      s1=2.*v1/(gl-2.*x)+12.*(gl-2.*x)*(pi-6.*theta)*(p+2.*x)
c THE OUTER SLIVERS.
120 phi=acos((5.*d-13.*p-36.*x)/(12.*(p+2.*x)))

```

```

      xi=acos((13.*d-5.*p-36.*x)/(12.*(d-2.*x)))
      if(x.le.w1/2.) go to 125
      delta=acos((2.*d-p-6.*x)/(sqrt3*(d-2.*x)))
      chi=acos((d-2.*p-6.*x)/(sqrt3*(p+2.*x)))
      a3=.125*(chi*(p+2.*x)**2-delta*(d-2.*x)**2
&+2.*sqrt6*dbc*sqrt(6.*dbc*(p+2.*x-dbc)-(p+2.*x)**2))
125 a2=.125*(phi*(p+2.*x)**2-xi*(d-2.*x)**2
&+2.*sqrt5*dbc*sqrt((5.*dbc-p-2.*x)*(5.*dbc-d+2.*x)))
      v2=.25*(gl-2.*x)*(pi*(d-2.*x)**2-7.*pi*(p+2.*x)**2
&-24.*sqrt3*dbc*dbc+48.*(a1+a2+a3))
      s2=2.*v2/(gl-2.*x)+(gl-2.*x)*((d-2.*x)*(pi-6.*(xi+delta))
&+(p+2.*x)*(7.*pi-6.*(2.*theta+chi+phi)))
      vol=v1+v2
      frac=1.-vol/v0
      surf=s1+s2
      dsdx=-surf/(x2-x)
      return
c ALL BURNED OUT.
130 vol=0.
      frac=1.
      surf=0.
      dsdx=0.
      return
c
c Below is the subroutine for a nineteen perforated hexongonal grain
c type with rounded corners, equal webs, and perforations where x is
c the distance burned.
c
c INPUT
c   p= perforation diameter
c   d= grain diameter
c   gl=grain length
c   x= distance burned
c
c OUTPUT
c   vol= volume of one grain at x.
c   frac=mass fraction of the grain burnt at x.
c   surf=surface area of one grain at x.
c   dsdx=the rate of change of the surface area with respect to
c         distance.
c
c CALCULATED VARIABLES
c   w=web
c   dpc=distance between perforation centers.
c   f=distance between flats of the grain.
c   x1=distance to burnout of the inner slivers.
c   x2=distance to burnout of the the outer slivers (frac=1.)
5000 p=pd
      d=gd
      w=(d-5.*p)/6.
      dpc=p+w
      f=2.*(sqrt3*dpc+p/2.+w)
      x1=dpc/sqrt3-p/2.
      x2=0.125*(5.*dpc-4.*p)
      abo=amin1(x2,gl/2.)
      if(x.gt.abo) go to 4001
c To calculate the initial volume.
      a=sqrt3/3.*((w+p/2.)**2)-pi/6.*((w+p/2.)**2)
      vs=gl/4.*(2.*sqrt3*f**2-19.*pi*p**2)
      vr=6.*a*gl
      vo=vs-vr
c To calculate the initial surface area.
      ss=2.*vs/gl+gl*(2.*sqrt3*f+19.*pi*p)

```

```

    sr=12.*a+gl*(w+p/2.)*(4.*sqrt3-2.*pi)
    so=ss-sr
c BEFORE SLIVERING.
    if(0.le.x.and.x.le.w/2.) then
        a=sqrt3/3.*(w-2.*x+(p+2.*x)/2.)**2-pi/6.*
        &(w-2.*x+(p+2.*x)/2.)**2
c To calculate the volume.
        vr=6.*a*(gl-2.*x)
        vn=.25*(gl-2.*x)*(2.*sqrt3*(f-2.*x)**2.
        &-19.*pi*(p+2.*x)**2.)
        v=vn-vr
c To calculate the surface area.
        sr=12.*a+(gl-2.*x)*(w-2.*x+(p+2.*x)/2.)*(4.*sqrt3-2.*pi)
        sn=2.*v/(gl-2.*x)+(gl-2.*x)*(2.*sqrt3*(f-2.*x)+
        &19.*pi*(p+2.*x))
        s=sn-sr
        vol=v
        frac=1.-v/vo
        surf=s
        dsdx=-8.*sqrt3*(f-2.0*x)-76.0*pi*(p+2.*x)+(gl-2.0*x)*(-4.*sqrt3
        &+38.0*pi)+16.*sqrt3*(w+p/2.-x)-8.0*pi*(w+p/2.-x)+(gl-2.*x)*(4.*
        &sqrt3-2.*pi)
        return
    endif
    if(x.le.x1) then
c THE INNER SLIVERS.
c To calculate the area.
        a=sqrt3/3.*(w-2.*x+(p+2.*x)/2.)**2-pi/6.*
        &(w-2.*x+(p+2.*x)/2.)**2
        theta=acos(dpc/(p+2.*x))
        al=theta/4.*(p+2.*x)**2-dpc/4.*sqrt((p+2.*x)**2-dpc**2)
        omega=acos(2.*dpc/(p+2.*x)-1.)
        a2=0.125*(p+2.*x)*((p+2.*x)*(omega+sin(omega))-2.*dpc*sin(omega))
c To calculate the volume.
        v1=3.*(gl-2.*x)*(2.*sqrt3*dpc**2-pi*(p+2.*x)**2+24.*a1)
        v2=6.*(gl-2.*x)*(2.*dpc**2-dpc*(p+2.*x)-pi/4.*(p+2.*x)**2
        &+2.*a1+4.*a2)
c To calculate the surface area.
        s1=2.*v1/(gl-2.*x)+12.*(gl-2.*x)*(pi-6.*theta)*(p+2.*x)
        s2=2.*v2/(gl-2.*x)+12.*(gl-2.*x)*(dpc+(p+2.*x)*(pi/2.-omega
        &-theta-sin(omega)))
c To calculate the total volume and total surface area.
        vf=v1+v2
        sf=s1+s2
        vol=vf
        frac=1.-vf/vo
        surf=sf
c THE APPROXIMATED DSDX.
        dsdx=-surf/(x2-x)
        return
    endif
    if(x.lt.x2) then

```

```

c THE OUTER SLIVERS.
c To calculate the area.
  a=sqrt3/3.*(w-2.*x+(p+2.*x)/2.)**2-pi/6.*
  &(w-2.*x+(p+2.*x)/2.)**2
  theta=acos(dpc/(p+2.*x))
  a1=theta/4.*(p+2.*x)**2-dpc/4.*sqrt((p+2.*x)**2-dpc**2)
  omega=acos(2.*dpc/(p+2.*x)-1.)
  a2=0.125*(p+2.*x)*((p+2.*x)*(omega+sin(omega))-2.*dpc*sin(omega))
c To calculate the volume.
  v2=6.*(g1-2.*x)*(2.*dpc**2-dpc*(p+2.*x)-pi/4.*(p+2.*x)**2
  &+2.*a1+4.*a2)
c To calculate the surface area.
  s2=2.*v2/(g1-2.*x)+12.*(g1-2.*x)*(dpc+(p+2.*x)*(pi/2.-omega
  &-theta-sin(omega)))
c To calculate the volume and the surface area.
  vf=v2
  sf=s2
  vol=vf
  frac=1-vf/vo
  surf=sf
c THE APPROXIMATE DSDX.
  dsdx=-surf/(x2-x)
  return
endif
c ALL BURNED OUT.
4001 frac=1.
  surf=0.
  vol=0.
  dsdx=0.
  return

c
c Below is the subroutine for a spherical grain type where x is the
c distance burned.
c
c   INPUT
c     d=grain diameter
c     x=distance burned
c
c   OUTPUT
c     vol= volume of one grain at x.
c     frac= mass fraction of the grain burnt at x.
c     surf= surface area of the one grain at x.
c     dsdx= the change of the surface area with respect to distance.
c
6000 d=gd
  x1=d/2.
c To calculate the initial volume.
  vo=4./3.*pi*(d/2.)**3
c To calculate the initial surface area.
  so=4.*pi*(d/2.)**2
  if (x.lt.x1) then
    v=4./3.*pi*(d/2.-x)**3
    s=4.*pi*(d/2.-x)**2
    vol=v
    frac=1.-v/vo
    surf=s
    dsdx= -8.0*pi*(d/2.-x)
  
```

```

        endif
    return
    if (x.ge.x1) then
        vol=0.
        frac=1.
        surf=0.
        dsdx=0.
    endif
    return
c
c Below is the subroutine for a right rectangular grain type where
c x is the distance burned.
c
c     INPUTS
c     h=grain height
c     w=grain width
c     gl=grain length
c     x=distance burned
c
c     OUTPUT
c     vol= volume of one grain at x.
c     frac=mass fraction of the grain burnt at x.
c     surf=surface area of the one grain at x.
c     dsdx=the change over the surface area over the change of
c           distance.
c
c 7000 h=pd
c       w=gd
c
c To calculate the distance burned.
c   x1=amin1(w,h,gl)
c To calculate the initial volume of the slab propellant.
c   vo=w*h*gl
c To calculate the initial surface area.
c   so=2.*w*h+2.*h*gl+2.*w*gl
c   if (x.lt.x1/2.) then
c     v=(w-2.*x)*(h-2.*x)*(gl-2.*x)
c     s=2.*((w-2.*x)*(h-2.*x))+2.*((h-2.*x)*(gl-2.*x))+
c     & 2.*((w-2.*x)*(gl-2.*x))
c     vol=v
c     frac=1.-v/vo
c     surf=s
c     dsdx=2.*(-4*w+8*x)+2.*(-4*h+8*x)+2.*(-4*gl+8*x)
c     return
c   endif
c   if (x.ge.x1/2.) then
c     vol=0.
c     frac=1.
c     surf=0.
c     dsdx=0.
c     return
c   endif
c
c Below is the subroutine for a single perforated right circular
c cylindrical slotted grain type where x is the distance burned.
c
c     INPUT
c     p= perf diameter
c     d= grain diameter
c     gl=grain length
c     sw=slot width
c     x= distance burned
c

```

```

c      OUTPUT
c      vol= volume of one grain at x.
c      frac=mass fraction of the grain burnt at x.
c      surf=surface area of one grain at x.
c      dsdx=the rate of change of the surface area with respect to
c          distance.
8000 p=pd
      d=gd
      ro=d/2.
      ri=p/2.
      theta=asin(.5*sw/ro)
      alpha=asin(.5*sw/ri)
c To calculate the initial volume of the slotted propellant.
      vo=gl*((pi-theta)*ro**2-(pi-alpha)*ri**2-(.5*sw*ro*cos(theta)-
&.5*sw*ri*cos(alpha)))
c
      if(sw.ge.p) then
          write(5,45)
45 format(1x,'ERROR!!!! The slot width can not be greater than or
& equal to the perforation diameter.')
      endif
c To calculate the distance to burn out.
      x1=(d-p)/4.
      abo=amin1(x1,gl/2.)
      if(x.lt.x1-.1e-8.and.x.lt.abo)then
c To calculate the angles for the slotted propellant.
      theta=asin((.5*sw+x)/(d/2.-x))
      dtheta=2.*(d+sw)/(d-2.*x)**2/sqrt(1-((sw+2.*x)/(d-2.*x))**2)
      alpha=asin((.5*sw+x)/(p/2.+x))
      dalpha=2.*(p-sw)/(p+2.*x)**2/sqrt(1-((sw+2.*x)/(p+2.*x))**2)
      ro=(d-2*x)/2.
      ri=(p+2.*x)/2.
c To calculate the volume of the slotted propellant.
      v=(gl-2.*x)*((pi-theta)*ro**2-(pi-alpha)*ri**2-(.5*(sw+2.*x)*ro
&*cos(theta)-.5*(sw+2.*x)*ri*cos(alpha)))
      s1=2.*(gl-2*x)*((pi-alpha)*ri+ro*cos(theta)-ri*cos(alpha))
      s2=2*((pi-theta)*ro**2-(pi-alpha)*ri**2-(.5*(sw+2*x)*ro*cos
&(theta)-.5*(sw+2.*x)*ri*cos(alpha)))
      s3=2*(gl-2.*x)*(pi-theta)*ro
      vol=v
      frac=1.-v/vo
      surf=s1+s2+s3
      dsdx1=-4.*((pi-alpha)*ri+ro*cos(theta)-ri*cos(alpha))+
&2.*(gl-2.*x)*((pi-alpha)+ri*(-dalpha)+(-cos(theta))+ro*
&(-sin(theta))*dtheta-cos(alpha)-ri*(-sin(alpha))*dalpha)
      dsdx2=-2.*dtheta*ro**2-4.*(pi-theta)*ro+2.*dalpha*ri**2
&-4.*(pi-alpha)*ri-2.*ro*cos(theta)+(sw+2.*x)*cos(theta)+
&(sw+2.*x)*ro*sin(theta)*dtheta+2.*ri*cos(alpha)+(sw+2.*x)*
&cos(alpha)-(sw+2.*x)*ri*sin(alpha)*dalpha
      dsdx3=-4.*(pi-theta)*ro+2.*(gl-2.*x)*(-dtheta)*ro+
&(-2.)*(gl-2.*x)*(pi-theta)
      dsdx=dsdx1+dsdx2+dsdx3
      return
      else
c ALL BURNED OUT.
      vol=0.
      frac=1.
      surf=0.
      dsdx=0.
      return
      endif
      end

```

INTENTIONALLY LEFT BLANK.

LIST OF SYMBOLS

<u>Symbols</u>	<u>Definition</u>	<u>Units</u>
C_{va}	heat capacity at constant volume of air	J/kg/K
C_{vi}	heat capacity at constant volume of igniter gases	J/kg/K
C_{vp}	heat capacity at constant volume of propellant gases	J/kg/K
d_i	density of solid igniter	kg/m ³
d_p	density of solid propellant	kg/m ³
DH	energy lost up to time t	cal
DT	difference in temperature between P_{THEO} and P_{max}	K
k	energy loss per unit change in pressure	J/Pa
L	energy loss	J
m_a	mass of air	kg
m_i	mass of igniter	kg
m_p	mass of propellant gas	kg
m	total mass of gas ($m_a+m_i+m_p$)	kg
m_{po}	initial mass of solid propellant	kg
mw_a	molecular weight of air	kg/kg mole
mw_i	molecular weight of igniter gases	kg/kg mole
mw_p	molecular weight of propellant gases	kg/kg mole
n_a	covolume of air	m ³ /kg
n_i	covolume of igniter gases	m ³ /kg
n_p	covolume of propellant gases	m ³ /kg
P	mean pressure	Pa
P_t	pressure at time t	Pa
P_{to}	pressure at the start of the calculation (usually taken as pressure at which all of the igniter has burned)	Pa
P_{max}	observed maximum pressure	Pa
P_{THEO}	theoretical maximum pressure with no energy loss	Pa
R	universal gas constant	J/kg mole/K

<u>Symbols</u>	<u>Definition</u>	<u>Units</u>
R_a	R/mw_a	J/kg/K
R_i	R/mw_i	J/kg/K
R_p	R/mw_p	J/kg/K
R_h	$(m_p R_p + m_i R_i + m_a R_a)/m$	J/kg/K
sp	squib pressure	Pa
t	time	s
T	temperature of gas mixture	K
T_a	ambient temperature of air	K
FT_i	flame temperature of igniter gases	K
FT_p	flame temperature of propellant gases	K
V_o	empty closed bomb volume	m^3

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
2	Administrator Defense Technical Info Center ATTN: DTIC-DDA Cameron Station Alexandria, VA 22304-6145	1	Commander U.S. Army Missile Command ATTN: AMSMI-RD-CS-R (DOC) Redstone Arsenal, AL 35898-5010
1	Commander U.S. Army Materiel Command ATTN: AMCAM 5001 Eisenhower Ave. Alexandria, VA 22333-0001	1	Commander U.S. Army Tank-Automotive Command ATTN: ASQNC-TAC-DIT (Technical Information Center) Warren, MI 48397-5000
1	Director U.S. Army Research Laboratory ATTN: AMSRL-D 2800 Powder Mill Rd. Adelphi, MD 20783-1145	1	Director U.S. Army TRADOC Analysis Command ATTN: ATRC-WSR White Sands Missile Range, NM 88002-5502
1	Director U.S. Army Research Laboratory ATTN: AMSRL-OP-CI-AD, Tech Publishing 2800 Powder Mill Rd. Adelphi, MD 20783-1145	1	Commandant U.S. Army Field Artillery School ATTN: ATSF-CSI Ft. Sill, OK 73503-5000
2	Commander U.S. Army Armament Research, Development, and Engineering Center ATTN: SMCAR-IMI-I Picatinny Arsenal, NJ 07806-5000	(Class. only)†	Commandant U.S. Army Infantry School ATTN: ATSH-CD (Security Mgr.) Fort Benning, GA 31905-5660
2	Commander U.S. Army Armament Research, Development, and Engineering Center ATTN: SMCAR-TDC Picatinny Arsenal, NJ 07806-5000	(Unclass. only)†	Commandant U.S. Army Infantry School ATTN: ATSH-CD-CSO-OR Fort Benning, GA 31905-5660
1	Director Benet Weapons Laboratory U.S. Army Armament Research, Development, and Engineering Center ATTN: SMCAR-CCB-TL Watervliet, NY 12189-4050	1	WL/MNOI Eglin AFB, FL 32542-5000
(Unclass. only)†	Commander U.S. Army Rock Island Arsenal ATTN: SMCRI-IMC-RT/Technical Library Rock Island, IL 61299-5000		<u>Aberdeen Proving Ground</u>
1	Director U.S. Army Aviation Research and Technology Activity ATTN: SAVRT-R (Library) M/S 219-3 Ames Research Center Moffett Field, CA 94035-1000	2	Dir, USAMSAA ATTN: AMXSY-D AMXSY-MP, H. Cohen
		1	Cdr, USATECOM ATTN: AMSTE-TC
		1	Dir, ERDEC ATTN: SCBRD-RT
		1	Cdr, CBDA ATTN: AMSCB-CI
		1	Dir, USARL ATTN: AMSRL-SL-I
		10	Dir, USARL ATTN: AMSRL-OP-CI-B (Tech Lib)

No. of Copies Organization

1 Chairman
DOD Explosives Safety Board
Room 856-C
Huffman Bldg. 1
2461 Eisenhower Avenue
Alexandria, VA 22331-0600

1 Headquarters
U.S. Army Materiel Command
ATTN: AMCICP-AD, M. Fisetto
5001 Eisenhower Ave.
Alexandria, VA 22333-0001

1 U.S. Army Ballistic Missile
Defense Systems Command
Advanced Technology Center
P.O. Box 1500
Huntsville, AL 35807-3801

1 Department of the Army
Office of the Product Manager
155mm Howitzer, M109A6,
Paladin
ATTN: SFAE-AR-HIP-IP,
Mr. R. De Kleine
Picatinny Arsenal, NJ 07806-5000

3 Project Manager
Advanced Field Artillery System
ATTN: SFAE-ASM-AF-E
LTC D. Ellis
T. Kuriata
J. Shields
Picatinny Arsenal, NJ 07801-5000

1 Project Manager
Advanced Field Artillery System
ATTN: SFAE-ASM-AF-Q, W. Warren
Picatinny Arsenal, NJ 07801-5000

2 Commander
Production Base Modernization
Agency
U.S. Army Armament Research,
Development, and
Engineering Center
ATTN: AMSMC-PBM, A. Siklosi
AMSMC-PBM-E, L. Laibson
Picatinny Arsenal, NJ 07806-5000

No. of Copies Organization

4 PEO-Armaments
Project Manager
Tank Main Armament System
ATTN: AMCPM-TMA
AMCPM-TMA-105
AMCPM-TMA-120
AMCPM-TMA-AS, H. Yuen
Picatinny Arsenal, NJ 07806-5000

5 Commander
U.S. Army Armament Research,
Development, and
Engineering Center
ATTN: SMCAR-CCD, D. Spring
SMCAR-CCH-V, C. Mandala
E. Fennell
SMCAR-CCH-T, L. Rosendorf
SMCAR-CCS
Picatinny Arsenal, NJ 07806-5000

19 Commander
U.S. Army Armament Research,
Development, and Engineering
Center
ATTN: SMCAR-AEE, J. Lannon
SMCAR-AEE-B,
A. Beardell
D. Downs
S. Einstein
S. Westley
S. Bernstein
J. Rutkowski
B. Brodman
P. O'Reilly
R. Cirincione
A. Grabowsky
P. Hui
J. O'Reilly
SMCAR-AEE-WW,
M. Mezger
J. Pinto
D. Wiegand
P. Lu
C. Hu
SMCAR-AES, S. Kaplowitz
Picatinny Arsenal, NJ 07806-5000

1 Commander
U.S. Army Armament Research,
Development and Engineering
Center
ATTN: SMCAR-HFM, E. Barrieres
Picatinny Arsenal, NJ 07806-5000

No. of
Copies Organization

9 Commander
U.S. Army Armament Research,
Development and Engineering
Center
ATTN: SMCAR-FSA-T, M. Salsbury
SMCAR-FSA-F, LTC R. Riddle
SMCAR-FSC, G. Ferdinand
SMCAR-FS, T. Gora
SMCAR-FS-DH, J. Feneck
SMCAR-FSS-A, R. Kopman
B. Machek
L. Pinder
SMCAR-FSN-N, K. Chung
Picatinny Arsenal, NJ 07806-5000

3 Director
Benet Weapons Laboratories
ATTN: SMCAR-CCB-RA,
G.P. O'Hara
G.A. Pflegl
SMCAR-CCB-S, F. Heiser
Watervliet, NY 12189-4050

2 Commander
U.S. Army Research Office
ATTN: Technical Library
D. Mann
P.O. Box 12211
Research Triangle Park, NC
27709-2211

1 Commander, USACECOM
R&D Technical Library
ATTN: ASQNC-ELC-IS-L-R,
Myer Center
Fort Monmouth, NJ 07703-5301

1 Commander
U.S. Army Harry Diamond Laboratory
ATTN: SLCHD-TA-L
2800 Powder Mill Rd.
Adelphi, MD 20783-1145

1 Commandant
U.S. Army Aviation School
ATTN: Aviation Agency
Fort Rucker, AL 36360

1 Program Manager
U.S. Tank-Automotive Command
ATTN: AMCPM-ABMS, T. Dean
Warren, MI 48092-2498

No. of
Copies Organization

1 Project Manager
U.S. Tank-Automotive Command
Fighting Vehicle Systems
ATTN: SFAE-ASM-BV
Warren, MI 48397-5000

1 Project Manager, Abrams Tank
System
ATTN: SFAE-ASM-AB
Warren, MI 48397-5000

1 Director
HQ, TRAC RPD
ATTN: ATCD-MA
Fort Monroe, VA 23651-5143

2 Director
U.S. Army Materials Technology
Laboratory
ATTN: SLCMT-ATL (2 cps)
Watertown, MA 02172-0001

1 Commander
U.S. Army Belvoir Research and
Development Center
ATTN: STRBE-WC
Fort Belvoir, VA 22060-5006

1 Director
U.S. Army TRAC-Ft. Lee
ATTN: ATRC-L, Mr. Cameron
Fort Lee, VA 23801-6140

1 Commandant
U.S. Army Command and General
Staff College
Fort Leavenworth, KS 66027

1 Commandant
U.S. Army Special Warfare School
ATTN: Rev and Trng Lit Div
Fort Bragg, NC 28307

1 Commander
Radford Army Ammunition Plant
ATTN: SMCAR-QAHI LIB
Radford, VA 24141-0298

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
1	Commander U.S. Army Foreign Science and Technology Center ATTN: AMXST-MC-3 220 Seventh Street, NE Charlottesville, VA 22901-5396	4	Commander Naval Surface Warfare Center ATTN: Code 730 Code R-13, R. Bernecker H. Sandusky Silver Spring, MD 20903-5000
2	Commandant U.S. Army Field Artillery Center and School ATTN: ATSF-CO-MW, E. Dublisky ATSF-CN, P. Gross Ft. Sill, OK 73503-5600	7	Commander Naval Surface Warfare Center ATTN: T.C. Smith K. Rice S. Mitchell S. Peters J. Consaga C. Gotzmer Technical Library Indian Head, MD 20640-5000
1	Commandant U.S. Army Armor School ATTN: ATZK-CD-MS, M. Falkovitch Armor Agency Fort Knox, KY 40121-5215	5	Commander Naval Surface Warfare Center ATTN: Code G30, Code G32, Code G33, J.L. East T. Doran Code E23 Technical Library Dahlgren, VA 22448-5000
2	Commander Naval Sea Systems Command ATTN: SEA 62R SEA 64 Washington, DC 20362-5101	5	Commander Naval Air Warfare Center ATTN: Code 388, C.F. Price T. Boggs Code 3895, T. Parr R. Derr Information Science Division China Lake, CA 93555-6001
1	Commander Naval Air Systems Command ATTN: AIR-954-Tech Library Washington, DC 20360	2	Commanding Officer Naval Underwater Systems Center ATTN: Code 5B331, R.S. Lazar Technical Library Newport, RI 02840
4	Commander Naval Research Laboratory ATTN: Technical Library Code 4410, K. Kailasanate J. Boris E. Oran Washington, DC 20375-5000	1	AFOSR/NA ATTN: J. Tishkoff Bolling AFB, D.C. 20332-6448
1	Office of Naval Research ATTN: Code 473, R.S. Miller 800 N. Quincy Street Arlington, VA 22217-9999	1	OLAC PL/TSTL ATTN: D. Shiplett Edwards AFB, CA 93523-5000
1	Office of Naval Technology ATTN: ONT-213, D. Siegel 800 N. Quincy St. Arlington, VA 22217-5000		

<u>No. of Copies</u>	<u>Organization</u>	<u>No. of Copies</u>	<u>Organization</u>
3	AL/LSCF ATTN: J. Levine L. Quinn T. Edwards Edwards AFB, CA 93523-5000	1	Director Sandia National Laboratories Energetic Materials & Fluid Mechanics Department, 1512 ATTN: M. Baer P.O. Box 5800 Albuquerque, NM 87185
1	WL/MNAA ATTN: B. Simpson Eglin AFB, FL 32542-5434	1	Director Sandia National Laboratories Combustion Research Facility ATTN: R. Carling Livermore, CA 94551-0469
1	WL/MNME Energetic Materials Branch 2306 Perimeter Rd. STE 9 Eglin AFB, FL 32542-5910	4	Director Lawrence Livermore National Laboratory ATTN: L-355, A. Buckingham G. Benedetti M. Finger L-324, M. Constantino P.O. Box 808 Livermore, CA 94550-0622
1	WL/MNSH ATTN: R. Drabczuk Eglin AFB, FL 32542-5434	2	Director Los Alamos Scientific Lab ATTN: T3/D. Butler M. Division/B. Craig P.O. Box 1663 Los Alamos, NM 87544
2	NASA Langley Research Center ATTN: M.S. 408, W. Scallion D. Witcofski Hampton, VA 23605	3	Battelle Columbus Laboratories ATTN: TACTEC Library, J.N. Huggins V. Levin 505 King Avenue Columbus, OH 43201-2693
1	Central Intelligence Agency Office of the Central References Dissemination Branch Room GE-47, HQS Washington, DC 20502	1	Battelle PNL ATTN: Mr. Mark Garnich P.O. Box 999 Richland, WA 99352
1	Central Intelligence Agency ATTN: J. Backofen NHB, Room 5N01 Washington, DC 20505	1	Institute of Gas Technology ATTN: D. Gidaspow 3424 S. State Street Chicago, IL 60616-3896
1	SDIO/TNI ATTN: L.H. Caveny Pentagon Washington, DC 20301-7100		
1	SDIO/DA ATTN: E. Gerry Pentagon Washington, DC 21301-7100		
2	HQ DNA ATTN: D. Lewis A. Fahey 6801 Telegraph Rd. Alexandria, VA 22310-3398		

**No. of
Copies Organization**

- 1 Institute for Advanced Technology
ATTN: T.M. Krehne
The University of Texas at Austin
4030-2 W. Braker Lane
Austin, TX 78759-5329
- 2 CPIA - JHU
ATTN: Hary J. Hoffman
T. Christian
10630 Little Patuxent Parkway
Suite 202
Columbia, MD 21044-3200
- 1 Brigham Young University
Department of Chemical Engineering
ATTN: M. Beckstead
Provo, UT 84601
- 1 Jet Propulsion Laboratory
California Institute of Technology
ATTN: L.D. Strand, MS 125/224
4800 Oak Grove Drive
Pasadena, CA 91109
- 1 California Institute of Technology
204 Karman Lab
Main Stop 301-46
ATTN: F.E.C. Culick
1201 E. California Street
Pasadena, CA 91109
- 3 Georgia Institute of Technology
School of Aerospace Engineering
ATTN: B.T. Zim
E. Price
W.C. Strahle
Atlanta, GA 30332
- 1 Massachusetts Institute of Technology
Department of Mechanical Engineering
ATTN: T. Toong
77 Massachusetts Avenue
Cambridge, MA 02139-4307
- 2 University of Illinois
Department of Mechanical/Industry
Engineering
ATTN: H. Krier
R. Beddini
144 MEB; 1206 N. Green St.
Urbana, IL 61801-2978

**No. of
Copies Organization**

- 1 University of Maryland
ATTN: Dr. J.D. Anderson
College Park, MD 20740
- 1 University of Massachusetts
Department of Mechanical Engineering
ATTN: K. Jakus
Amherst, MA 01002-0014
- 1 University of Minnesota
Department of Mechanical Engineering
ATTN: E. Fletcher
Minneapolis, MN 55414-3368
- 3 Pennsylvania State University
Department of Mechanical Engineering
ATTN: V. Yang
K. Kuo
C. Merkle
University Park, PA 16802-7501
- 1 Rensselaer Polytechnic Institute
Department of Mathematics
Troy, NY 12181
- 1 Stevens Institute of Technology
Davidson Laboratory
ATTN: R. McAlevy III
Castle Point Station
Hoboken, NJ 07030-5907
- 1 Rutgers University
Department of Mechanical and
Aerospace Engineering
ATTN: S. Temkin
University Heights Campus
New Brunswick, NJ 08903
- 1 University of Southern California
Mechanical Engineering Department
ATTN: OHE200, M. Gerstein
Los Angeles, CA 90089-5199
- 1 University of Utah
Department of Chemical Engineering
ATTN: A. Baer
Salt Lake City, UT 84112-1194
- 1 Washington State University
Department of Mechanical Engineering
ATTN: C.T. Crowe
Pullman, WA 99163-5201

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
1	AFELM, The Rand Corporation ATTN: Library D 1700 Main Street Santa Monica, CA 90401-3297	2	Hercules, Inc. Allegheny Ballistics Laboratory ATTN: William B. Walkup Thomas F. Farabaugh P.O. Box 210 Rocket Center, WV 26726
1	Arrow Technology Associates, Inc. ATTN: W. Hathaway P.O. Box 4218 South Burlington, VT 05401-0042	1	Hercules, Inc. Aerospace ATTN: R. Cartwright 100 Howard Blvd. Kenville, NJ 07847
3	AAI Corporation ATTN: J. Hebert J. Frankle D. Cleveland P.O. Box 126 Hunt Valley, MD 21030-0126	1	Hercules, Inc. Hercules Plaza ATTN: B.M. Riggleman Wilmington, DE 19894
2	Alliant Techsystems, Inc. ATTN: R.E. Tompkins J. Kennedy 7225 Northland Dr. Brooklyn Park, MN 55428	1	MBR Research Inc. ATTN: Dr. Moshe Ben-Reuven 601 Ewing St., Suite C-22 Princeton, NJ 08540
1	AVCO Everett Research Laboratory ATTN: D. Stickler 2385 Revere Beach Parkway Everett, MA 02149-5936	1	Olin Corporation Badger Army Ammunition Plant ATTN: F.E. Wolf Baraboo, WI 53913
1	General Applied Sciences Lab ATTN: J. Erdos 77 Raynor Ave. Ronkonkama, NY 11779-6649	3	Olin Ordnance ATTN: E.J. Kirschke A.F. Gonzalez D.W. Worthington P.O. Box 222 St. Marks, FL 32355-0222
1	General Electric Company Tactical System Department ATTN: J. Mandzy 100 Plastics Ave. Pittsfield, MA 01201-3698	1	Olin Ordnance ATTN: H.A. McElroy 10101 9th Street, North St. Petersburg, FL 33716
1	IITRI ATTN: M.J. Klein 10 W. 35th Street Chicago, IL 60616-3799	1	Paul Gough Associates, Inc. ATTN: P.S. Gough 1048 South St. Portsmouth, NH 03801-5423
4	Hercules, Inc. Radford Army Ammunition Plant ATTN: L. Gizzi D.A. Worrell W.J. Worrell C. Chandler Radford, VA 24141-0299	1	Physics International Library ATTN: H. Wayne Wampler P.O. Box 5010 San Leandro, CA 94577-0599

<u>No. of</u>	<u>Organization</u>
2	Princeton Combustion Research Laboratories, Inc. ATTN: N. Mer N.A. Messina Princeton Corporate Plaza 11 Deerpark Dr., Bldg IV, Suite 119 Monmouth Junction, NJ 08852
3	Rockwell International Rocketdyne Division ATTN: BA08, J. Flanagan J. Gray R.B. Edelman 6633 Canoga Avenue Canoga Park, CA 91303-2703
2	Rockwell International Science Center ATTN: Dr. S. Chakravarthy Dr. S. Palaniswamy 1049 Camino Dos Rios P.O. Box 1085 Thousand Oaks, CA 91360
1	Southwest Research Institute ATTN: J.P. Riegel 6220 Culebra Road P.O. Drawer 28510 San Antonio, TX 78228-0510
1	Sverdrup Technology, Inc. ATTN: Dr. John Deur 2001 Aerospace Parkway Brook Park, OH 44142
3	Thiokol Corporation Elkton Division ATTN: R. Willer R. Biddle Tech Library P.O. Box 241 Elkton, MD 21921-0241
1	Veritay Technology, Inc. ATTN: E. Fisher 4845 Millersport Hwy. East Amherst, NY 14501-0305
1	Universal Propulsion Company ATTN: H.J. McSpadden 25401 North Central Ave. Phoenix, AZ 85027-7837

<u>No. of</u>	<u>Organization</u>
1	SRI International Propulsion Sciences Division ATTN: Tech Library 333 Ravenwood Avenue Menlo Park, CA 94025-3493 <u>Aberdeen Proving Ground</u>
1	Cdr, USACSTA ATTN: STECS-PO/R. Hendricksen

USER EVALUATION SHEET/CHANGE OF ADDRESS

This Laboratory undertakes a continuing effort to improve the quality of the reports it publishes. Your comments/answers to the items/questions below will aid us in our efforts.

1. ARL Report Number ARL-TR-83 Date of Report March 1993
2. Date Report Received _____
3. Does this report satisfy a need? (Comment on purpose, related project, or other area of interest for which the report will be used.) _____

4. Specifically, how is the report being used? (Information source, design data, procedure, source of ideas, etc.) _____

5. Has the information in this report led to any quantitative savings as far as man-hours or dollars saved, operating costs avoided, or efficiencies achieved, etc? If so, please elaborate. _____

6. General Comments. What do you think should be changed to improve future reports? (Indicate changes to organization, technical content, format, etc.) _____

CURRENT
ADDRESS

Organization

Name

Street or P.O. Box No.

City, State, Zip Code

7. If indicating a Change of Address or Address Correction, please provide the Current or Correct address above and the Old or Incorrect address below.

OLD
ADDRESS

Organization

Name

Street or P.O. Box No.

City, State, Zip Code

(Remove this sheet, fold as indicated, staple or tape closed, and mail.)