

AD-A276 083



2

ARMY RESEARCH LABORATORY




# A Methodology for Battle Damage Repair (BDR) Analysis

Lisa K. Roach

ARL-TR-330

January 1994

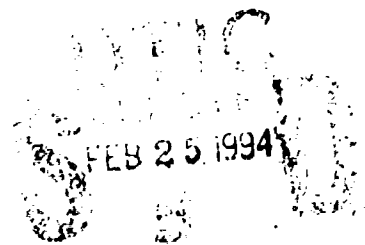

APPROVED FOR PUBLIC RELEASE. DISTRIBUTION IS UNLIMITED

94-06056



**Best  
Available  
Copy**

## NOTICES

Destroy this report when it is no longer needed. DO NOT return it to the originator.

Additional copies of this report may be obtained from the National Technical Information Service, U.S. Department of Commerce, 5285 Port Royal Road, Springfield, VA 22161.

The findings of this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

The use of trade names or manufacturers' names in this report does not constitute indorsement of any commercial product.

# REPORT DOCUMENTATION PAGE

Form Approved  
OMB No. 0704-0186

This report is the property of the U.S. Government and is loaned to your organization; it and its contents are not to be distributed outside your organization. This report is not to be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording, or by any information storage and retrieval system, without the express written permission of the U.S. Government.

1. AGENCY USE ONLY (Leave blank)	2. REPORT DATE <b>January 1994</b>	3. REPORT TYPE AND DATES COVERED <b>Final, May 1992 - August 1993</b>
----------------------------------	---------------------------------------	--

4. TITLE AND SUBTITLE  <b>A Methodology for Battle Damage Repair (BDR) Analysis</b>	5. FUNDING NUMBERS  <b>PR: 1L162618AH80</b>
---	---

6. AUTHOR(S)  <b>Lisa K. Roach</b>	
--	--

7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES)  <b>U.S. Army Research Laboratory ATTN: AMSRL-SL-BA Aberdeen Proving Ground, MD 21005-5068</b>	8. PERFORMING ORGANIZATION REPORT NUMBER
---	--

9. SPONSORING / MONITORING AGENCY NAME(S) AND ADDRESS(ES)  <b>U.S. Army Research Laboratory ATTN: AMSRL-OP-CI-B (Tech Lib) Aberdeen Proving Ground, MD 21005-5066</b>	10. SPONSORING / MONITORING AGENCY REPORT NUMBER  <b>ARL-TR-330</b>
---	---

11. SUPPLEMENTARY NOTES
-------------------------

12a. DISTRIBUTION AVAILABILITY STATEMENT  <b>Approved for public release; distribution is unlimited.</b>	12b. DISTRIBUTION CODE
--	------------------------

<p>13. ABSTRACT (Maximum 200 words)</p> <p>With the down-sizing of the military services and the emphasis on maintaining current systems, the area of battle damage repair (BDR) is receiving renewed focus at all levels. Evidence of this is the inclusion of maintainability/BDR requirements in the Department of Defense (DoD) Directive 5000.1, and DoD Instruction 5000.2. Unfortunately, methodologies to assess the impact of BDR on individual system performance or to perform BDR trade-off analyses are not well developed or documented.</p> <p>As an extension of the general vulnerability/lethality (V/L) process structure, the Ballistic Vulnerability/Lethality Division (BVLD) of the U.S. Army Research Laboratory (ARL) has developed a methodology to perform analyses of the effects of BDR on an individual system's performance. Furthermore, a separate undertaking by BVLD will permit the inclusion of BDR analysis in force-level models such as JANUS and CASTFOREM.</p>
--

14. SUBJECT TERMS  <b>battle damage repair, BDR, BDAR, process structure, degraded states, vulnerability methodology, DSVM, V/L process structure, statistical analysis, methodology</b>	15. NUMBER OF PAGES <b>23</b>
	16. PRICE CODE

17. SECURITY CLASSIFICATION OF REPORT <b>UNCLASSIFIED</b>	18. SECURITY CLASSIFICATION OF THIS PAGE <b>UNCLASSIFIED</b>	19. SECURITY CLASSIFICATION OF ABSTRACT <b>UNCLASSIFIED</b>	20. LIMITATION OF ABSTRACT <b>UL</b>
--	---	--	---

INTENTIONALLY LEFT BLANK.



INTENTIONALLY LEFT BLANK.

## **1. Introduction**

With the build-down of the military services and the emphasis on maintaining current systems, the area of battle damage repair (BDR) is receiving renewed focus at all levels. Evidence of this is the inclusion of maintainability/BDR requirements in the Department of Defense (DoD) Directive 5000.1 and DoD Instruction 5000.2. Unfortunately, methodologies to assess the impact of BDR on individual system performance or to perform BDR tradeoff analyses are not well developed or documented. Additionally, there is no uniform treatment of repair across the services, or even across mission areas within the U.S. Army. Consequently, a standard accounting of the consequences of various levels of repair is not currently possible.

As an extension of the general Vulnerability/Lethality (V/L) Process Structure, the Ballistic Vulnerability/Lethality Division (BVLD) of the U.S. Army Research Laboratory (ARL) has developed a methodology to perform analyses of the effects of BDR on an individual system's performance. Furthermore, a separate undertaking by the BVLD will permit the inclusion of BDR analysis in force-level models such as JANUS.

## **II. Background**

### **1. The V/L Process Structure (Taxonomy)**

To understand the BDR methodology, one must first understand the V/L Process Structure, first defined by Deitz (1989) and refined by Walbert and Roach (1993), and the Degraded States Vulnerability Methodology (Abell, Roach, Starks 1989), (Abell, Burdeshaw, Rickter 1991). A brief discussion is provided here.

The basis for the taxonomy of V/L Spaces comes from the recognition that V/L analyses pass through distinct levels of information in a precise order. These levels are:

Level 1: Threat-Target Interaction, or Initial Configuration  
(including Initial Conditions).

Level 2: Target Component Damage States.

Level 3: Target Capability States, and

Level 4: Target Combat Utility.

From the Target Capability States can be derived the various mission-oriented losses of function such as "Firepower Loss of Function (LOF)" and "Mobility LOF".



The mappings by which one passes from one level to the next are dependent on different kinds of information at each level. For example, going from Level 1 to Level 2 (threat-target initial configuration to target damage) essentially involves physics; going from Level 2 to Level 3 (target damage to capability) requires engineering measurement. The process is shown pictorially in Figure 1.

It is important at the outset to differentiate between "Levels", which are composed only of states of existence, and the "mappings", operators -- with the data and algorithms to which they have access -- which relate a state at one level to a state at another.

A *Level* contains all the information required to define the state of the system at the associated stage of a V/L analysis/experiment. At each level, one can define a space of points, each point being a vector whose elements correspond to the status of a particular entity related to the target. For example, in Space 2 (Damage States), each element may refer to the status of a particular component/subsystem. The spaces thus defined are the "V/L Spaces", and represent, at each level, the state of the target system.

A *Mapping* represents all of the information (physics, engineering, etc.), known or unknown, required to associate a point in a space at one level with a point in a space at the next level. Mappings have access to information such as: fundamental data (penetration parameters [Level 1 to Level 2], leakage rates [Level 2 to Level 3], etc.); intermediate data generated by the mapping (line-of-sight thicknesses [1 to 2], temperature rise in an uncooled engine [2 to 3]); and algorithms (depth of penetration [1 to 2], fault trees [2 to 3] or [3 to 4]).

The V/L experimental and analytical processes can then be expressed as a series of mappings which relate a state vector in one space (the domain) to a resultant state vector in a next higher-level space (the range).

Note that at each transition to the next level, some detail about the target system may be lost: a broken bolt in Level 2 may be the cause of degraded mobility influencing mission effectiveness, but at Level 3, the bolt is no longer recognized as an entity. It is now widely acknowledged that skipping over levels (such as inferring remaining combat utility directly from the size of the hole in the armor) loses so significant an amount of information that continuity and auditability are lost.

# The Vulnerability Process

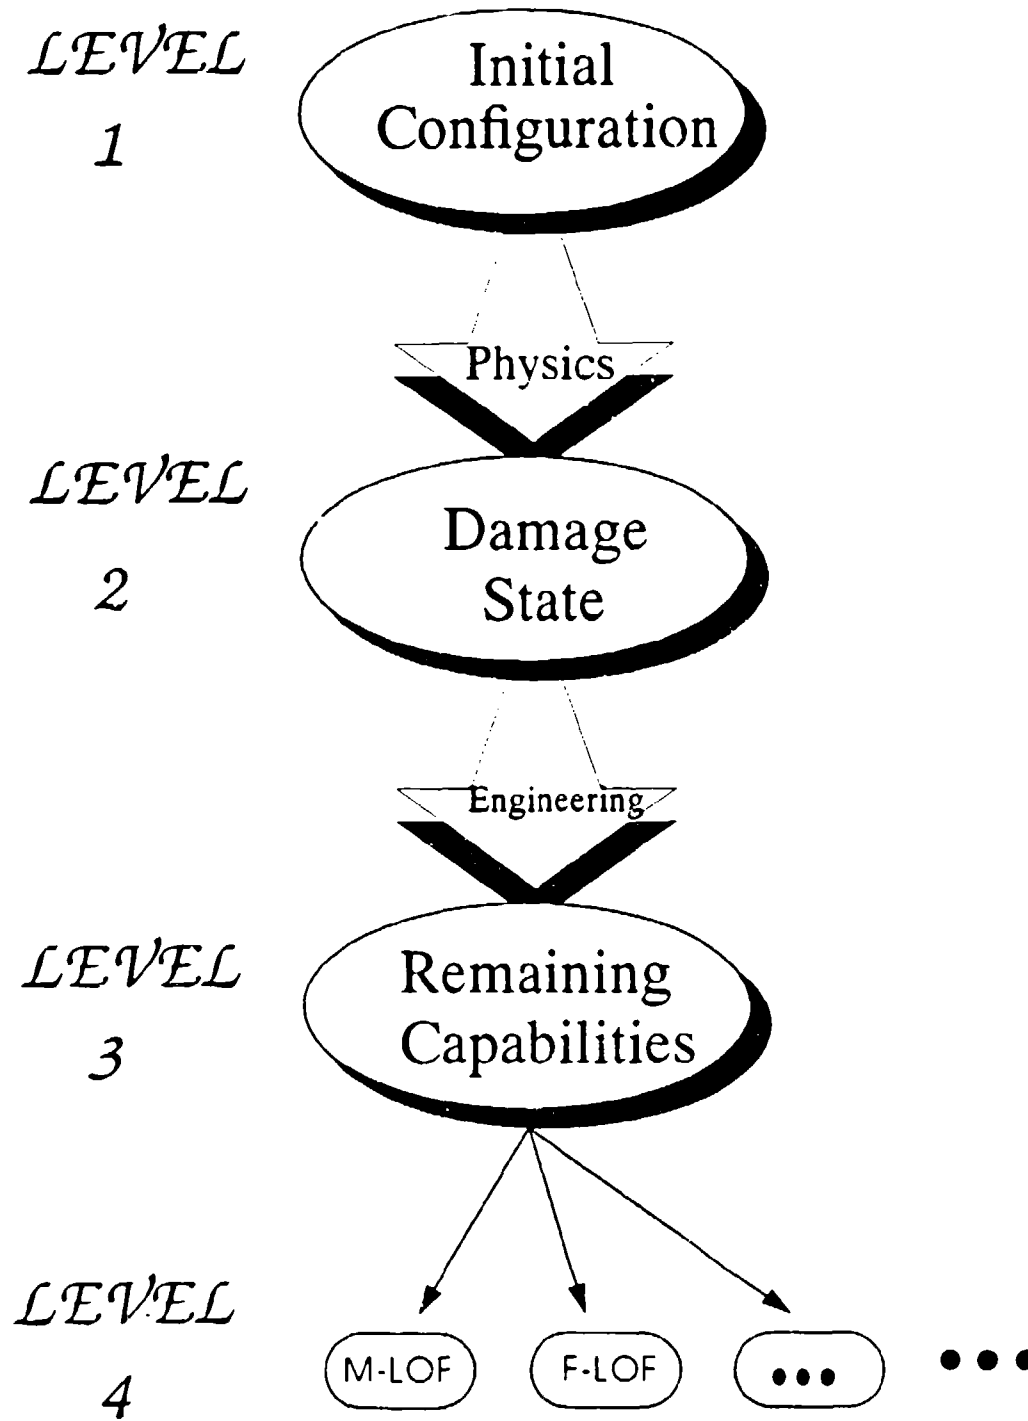


Figure 1. The Vulnerability/Lethality Process Structure

## 2. Degraded States Vulnerability Methodology (DSVM)

The DSVM is an O2.3 methodology which maps the target damage state into its remaining capability state; it is this methodology, and the damaged component information at Level 2, which allows the development of the BDR methodology. As an example of the DSVM, an armored fighting vehicle's required capabilities could be described in terms of a six-element vector (Mobility, Firepower, Acquisition, Crew, Communications, Ammunition). Conventional Degraded States (DS) terminology refers to these elements as "capability categories"; each DS capability category is further divided into capability levels which define a particular performance degradation (i.e. reduced speed, reduced accuracy, etc.). Included within a capability category are all possible combinations of capability levels that could occur simultaneously and a "no damage" capability level. These two properties of the capability category make the capability levels within a category both mutually exclusive and exhaustive. For any set of components, one and only one capability level will be satisfied for each capability category. This combination of capability levels, one from each category, represents the degraded state of the vehicle.

Mathematical fault trees are developed to represent the components and/or subsystems which contribute to the capability levels in each capability category (or element of the VL3 vector). These fault trees consist of a list of critical vehicle components that, if killed, result in that particular capability level being satisfied. For a particular capability category, a capability level achieved when no uninterrupted path can be traced from top to bottom in the fault tree. The fault tree path configurations can be described as having components arranged in series or in parallel or as some combination of the two. If listed in series, the loss of any component causes an interruption in the path whereas those components listed in parallel must all be killed to interrupt the path. The components listed in the fault trees can represent either a single critical component or a system of critical components. The systems of components are usually developed into fault tree configurations during the criticality analysis. [Note, a criticality analysis is a process where a fully functional combat system is analyzed system by system to determine which ones contribute directly to mission functions. Each system is described via a fault tree and, as indicated, is basically the determination of 1) which components, if lost, might result in a reduction of system capability, and 2) the structuring of these "critical" components into a fault tree format.]

## III. BDR Methodology

Figure 2 depicts the structure behind the BDR methodology, laid out in terms of the V/L taxonomy. Battle damage repair, or any kind of repair, can be modeled using the V/L Process Structure approach in the following manner. Given an initial set of component damage at Level 2, a mapping can be performed (using the DSVM) to determine the remaining capabilities of the system

at Level 3. This represents the capability of the system given no repair is performed. If one can establish repair priorities and required repair times, one can perform a sensitivity analysis to determine the usefulness of repairs by attempting to do whatever repairs are possible in the allotted time. This provides a second set of damaged components, one which is (possibly) a subset of the original set. Using this new damage component vector (Level 2), a mapping is performed again to determine the remaining capabilities of the system given the affected repairs. After a comparison is made between the original set of remaining capabilities and the new set resulting from repair, an assessment can be made of the usefulness of the repairs, i.e., what did it gain the system in terms of capabilities.

A series of repairs can be identified, and sensitivity analyses performed, to determine what capabilities the system gains as a result of varying amounts of repair time and parts stockage. These analyses can indicate what repairs are necessary in terms of system performance, what types of spare parts need to be stocked and what the critical path is in terms of needed repair. It should be noted that when the repairs are attempted a system may remain at the same damage point as the one before repairs were affected, i.e., not enough time was allocated. Conversely, a system may be returned to fully functional if all the damaged components were repaired. In addition, the sensitivity analyses may indicate whether or not the system can continue a certain mission, given the capabilities required are available.

Another way to view the BDR methodology is to start at Level 4 and ask the question, what is the system's mission and what capabilities are needed to accomplish it? This returns the system to Level 3 to determine whether or not the capabilities are available. If not, the path is traced back to Level 2 to determine what components are needed to permit the functioning of the capabilities required to accomplish the mission; this gives an indication of what components need to be repaired.

#### **IV. A Simple Application of the BDR Methodology**

To further illustrate, a simple example is provided. Information available from previous DSVM analyses of the M1A1 Abrams tank will be used (Abell, Roach, Starks, 1989). (Abell, Burdeshaw, Rickter, 1991). The capability categories and levels defined for the M1A1 DSVM analyses are provided in Table 1 while the fault trees representing these levels can be found in Appendix A. Assume the following components on the vehicle have been rendered non-functional, either due to combat damage or reliability failure: throttle steering housing, parking brake lock, laser rangefinder, and the breech mechanism assembly. The effect of these components, in terms of DSVM capability levels, is contained in Table 2 while the associated repair time for each component is listed in Table 3.

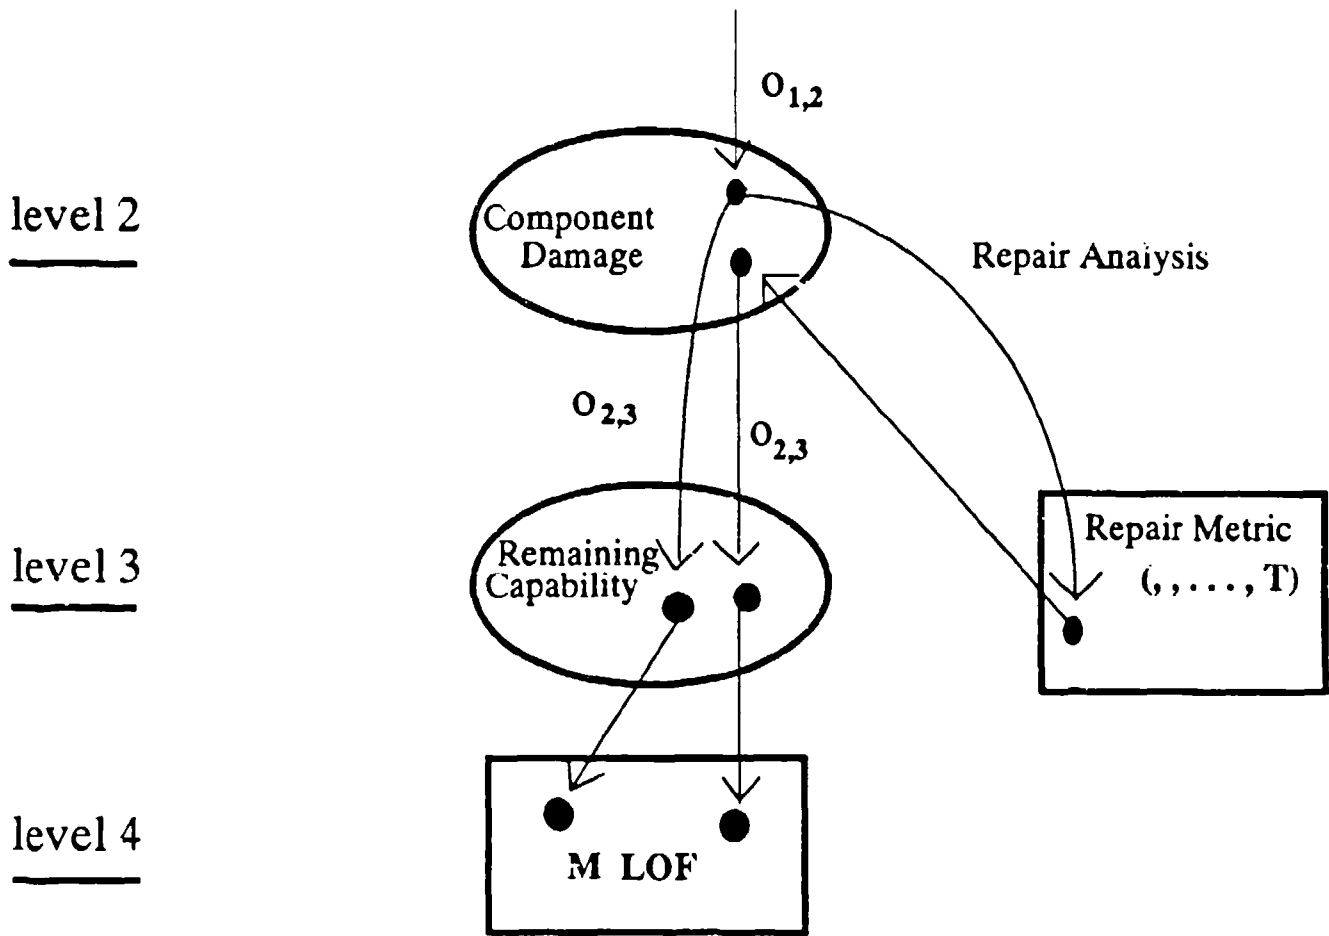


Figure 2. Proposed BDR Methodology

**Table 1. M1A1 Degraded States Capability Categories and Levels**

**Mobility Capability Category**

- M0--> No mobility damage
- M1--> Reduced speed (slight)
- M2--> Reduced speed (significant)
- M3--> Total immobilization

**Firepower Capability Category**

- F0--> No firepower damage
- F1--> Loss of main armament
- F2--> Unable to fire on the move
- F3--> Increased time to fire
- F4--> Reduced delivery accuracy
- F5--> Loss of secondary armament
- F6--> F2 and F3
- F7--> F2 and F4
- F8--> F3 and F4
- F9--> F2 and F3 and F4
- F10--> F2 and F5
- F11--> F3 and F5
- F12--> F4 and F5
- F13--> F2 and F3 and F4 and F5
- F14--> F2 and F3 and F5
- F15--> F2 and F4 and F5
- F16--> F3 and F4 and F5
- F17--> F1 and F5 (total loss of firepower)

**Acquisition Capability Category**

- A0--> No acquisition damage
- A1--> Reduced acquisition capability
- A2--> Unable to acquire while moving
- A3--> A1 and A2

**Crew Capability Category**

- C0--> No crew casualties
- C1--> Commander
- C2--> Gunner
- C3--> Loader
- C4--> Driver
- C5--> C1 and C2
- C6--> C1 and C3
- C7--> 1 and C4
- C8--> C2 and C3
- C9--> C2 and C4
- C10--> C3 and C4
- C11--> C1 and C2 and C3
- C12--> C1 and C2 and C4
- C13--> C2 and C3 and C4
- C14--> C1 and C3 and C4
- C15--> C1 and C2 and C3 and C4

**Communications Capability Category**

- X0--> No communication damage
- X1--> No internal communication
- X2--> No external communication > 300 ft
- X3--> No external communication
- X4--> X1 and X2
- X5--> X1 and X3

**Ammo Capability Category**

- K0--> No ammo lost
- K1--> Bustle ammo lost
- K2--> Hull ammo lost
- K3--> K1 and K2
- K4--> K-kill

**TABLE 2.** Damaged Components Effects in Terms of DSVM Capability Levels

COMPONENT	CAPABILITY LEVEL
Throttle Steering Housing	M2 - Significant reduction in speed M3 - Total Immobilization
Parking Brake Lock	M2 - Significant reduction in speed
Laser Rangefinder	F1 - Loss of main armament F2 - Unable to fire on the move F3 - Increased time to fire F4 - Reduced delivery accuracy
Breech Mechanism Assembly	A2 - Unable to acquire while moving F1 - Loss of Main Armament

**TABLE 3.** Component Repair Times (in manhours)\*

Component	Repair Time
Throttle Steering Housing	0.7
Parking Brake Lock	3.0
Laser Rangefinder	0.4
Breech Mechanism Assembly	1.2

\*Technical Manual, Maintenance Allocation Chart - Tank, Combat, Full-Track: 120-MM Gun, M1A1 General Abrams, TM 9-2350-264-MAC, Headquarters, Department of the Army, February 1986.

### 1. Initial BDR Analysis

For the purposes of this example, it is assumed that all required spare parts are available and that the tank's organizational repair unit is nearby and can begin repairs immediately (thus, no time is lost awaiting repair personnel and spare parts). It is also assumed that the repairs will be performed sequentially, from shortest to longest time period. Since the laser rangefinder only requires 0.4 manhours, it is repaired first. Recall from Table 2, that the loss of this component causes the loss of most firepower capabilities, and some acquisition capabilities, of the tank. With repair, the F2, F3, F4, and A2 capabilities are

restored. However, the main armament (F1) is not as the breech mechanism assembly has yet to be repaired. After approximately 24 minutes, the tank has most of its firepower and acquisition capabilities restored but still does not have the use of its main armament or its mobility capability. Repairing the throttle steering housing next, after 0.7 manhours, the tank is no longer totally immobilized but still has significant speed loss until the parking brake lock is repaired. Based on the repair times, the breech mechanism assembly is repaired next, restoring full firepower capability to the system. Finally, requiring 3.0 manhours of repair time, the parking brake lock is repaired, restoring the vehicle to full capability. Thus, if sequential repair is done, the tank is fully functional again after 5.3 manhours.

## **2. Additional BDR Sensitivity Analyses**

If the assumptions are changed, then additional analyses may be conducted to give further insight into the problem. For example, if the repairs are done concurrently, it would require 3.0 manhours to restore the vehicle to full capability though some capabilities (such as the firepower and acquisition) would be restored earlier. One may also wish to examine only a subset of the needed repairs - those which would enable the system to continue its current mission. For example, suppose our example tank was in an overwatch position, where mobility was not required. In this case, the repair of the parking brake lock and the throttle steering housing could be by-passed in favor of repairing the breech mechanism assembly and the laser rangefinder. These components would enable the tank to continue with its assigned mission in less than 1.5 hours, assuming the time until mission continuance was reasonable. Of course, those components not repaired may affect the tank's ability to do other missions. If, for example, the tank must subsequently move, the parking brake lock and the throttle steering housing must first be repaired. This factor could also be considered.

Another area which lends itself to these types of analyses is spare parts requirements and stockage. With the O12 mapping, a series of damage vectors can be computed to infer a distribution for the likelihood of component damage. This information can then be used to determine wartime spare parts stockage for the different components. Additional analyses can be conducted comparing these wartime requirements with those currently computed for peacetime. Insights can be gained as to whether or not the wartime and peacetime requirements are similar and what types of components, and in what quantities, need to be stocked. If the system's capabilities are considered, one can concentrate on the components most likely needed for anticipated missions.

Finally, a more detailed application of this methodology will be discussed in a forthcoming ARL technical report. Under support of the U.S. Army Training and Doctrine Command (TRADOC)'s Ordnance Center and School Battle Damage Assessment and Repair (BDAR) office, the approach promulgated in this report was applied to existing damaged component information on the M1A1 tank and the usefulness of the methodology discussed.



## V. Consistency with Other Analyses

An important side benefit to this approach is its comparability with other analyses performed in support of the acquisition process, namely, vulnerability/lethality (V/L) and reliability, availability, and maintainability (RAM). As stated above, the BDR approach is an extension of the general V/L process structure. Using the same structure for these analyses provides a common basis for comparison. All three analyses are concerned with non-functional components and their affect on system performance. The V/L process structure approach provides explicit information on the functionality of components (Level 2); it is immaterial how the component was rendered non-functional. This information is then directly related to system performance via the O2,3, mapping with remaining capability reported at Level 3. One can use this approach to study vulnerability or vulnerability reduction concerns, RAM requirements, and the affect of various repair considerations. By using the same approach for the three types of analyses discussed, a basis for comparison is provided throughout the acquisition cycle. The analyses are performed using the same methodology and the results are reported in the same metrics. This facilitates comparisons among these concerns at all junctures throughout the acquisition cycle.

## VI. Use in Force-Level Models

Finally the introduction of DSVM metrics in force-level models will permit explicit consideration of BDR (and RAM) in these models. A current effort between the BVLD and the Training and Doctrine Command (TRADOC) Analysis Center at White Sands Missile Range (TRAC-WSMR) will enable the inclusion of BDR concerns in force-level models such as JANUS and CASTFOREM. Specifically, the BVLD and TRAC-WSMR are modifying the JANUS and CASTFOREM models to accept the DSVM metrics as well as store the damaged component vectors available from the O12 mapping. This work could be expanded to allow specific modeling of repair strategies and repair times.

The inclusion of the DSVM metrics and component information in these models will allow BDR to be played directly in the models and its affect on the systems and battle outcome to be measured directly. Specifically, the battle could be played several times employing various repair strategies, i.e., no repair, complete repair, and intermediate levels. The overall affect on battle outcome can

then be quantified and the usefulness of the various strategies measured. Suppose, using our example M1 tank again, we devise the following possible repair strategies:

1. No repair;
2. Repair breech mechanism assembly (1.2 hrs) and the throttle steering housing (0.7);
3. Repair breech mechanism assembly (1.2 hrs), throttle steering housing (0.7 hrs) and the laser rangefinder (0.4 hrs);
4. Complete repair.

The force-level model then could be run four times, playing these four strategies. Information could be gleaned on the affect of the repair on overall battle outcome, the timeliness of the repair, i.e., was it repaired in time to have an affect on the outcome, and which strategy made the most sense given mission of the tank. Further analyses could be performed using information on wartime parts stockage; one could examine spare parts availability given the selected repair strategy.

Note, the BVLD/TRAC-WSMR effort provides the groundwork for eventually performing these kinds of repair analyses. Additional work on JANUS and CASTFOREM, beyond the current undertaken, would be required to make repair analyses a reality within these force-level models.

## VII. Summary

Currently, there is no uniform treatment of repair across the tri-services or even across combat arms within the Army. The BDR methodology presented in this report solves the problem and provides auditability and consistency of results. It also provides an approach whereby a standard accounting of consequences, in terms of performance and cost, of various levels of repair can be determined; this permits uniform comparisons across the mission areas.

As this report indicates, there are a number of analyses that can be performed. One can investigate concurrent versus sequential repair priorities and organizational versus crew repairs; one might also investigate expedient repairs that may enable the vehicle to continue more quickly its current mission. Additionally, the problem of peacetime versus wartime spare parts stockage requirements can be addressed in detailed. Furthermore, analyses can be performed investigating the full gamut of repairs, or concentrating only on those repairs which will allow continuation of a given mission.

**INTENTIONALLY LEFT BLANK.**

### List of References

Abell, J.M., L.K. Roach, and M.W. Starks. "Degraded States Vulnerability Analysis." BRL-TR-3010, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD, June 1989.

Abell, J.M., M.D. Burdeshaw, and B.A. Rickter. "Degraded States Vulnerability Analysis: Phase II." BRL-TR-3161, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD, October 1990.

Deitz, P.H., and A. Ozolins. "Computer Simulations of the Abrams Live-Fire Testing." BRL-MR-3755, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD, May 1989.

INTENTIONALLY LEFT BLANK.

No. of Copies	<u>Organization</u>	No. of Copies	<u>Organization</u>
2	Administrator Defense Technical Info Center ATTN: DTIC-DDA Cameron Station Alexandria, VA 22304-6145	1	Commander U.S. Army Missile Command ATTN: AMSMI-RD-CS-R (DOC) Redstone Arsenal, AL 35898-5010
1	Commander U.S. Army Materiel Command ATTN: AMCAM 5001 Eisenhower Ave. Alexandria, VA 22333-0001	1	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-JSK (Armor Eng. Br.) Warren, MI 48397-5000
1	Director U.S. Army Research Laboratory ATTN: AMSRL-OP-CI-AD, Tech Publishing 2800 Powder Mill Rd. Adelphi, MD 20783-1145	1	Director U.S. Army TRADOC Analysis Command ATTN: ATRC-WSR White Sands Missile Range, NM 88002-5502
1	Director U.S. Army Research Laboratory ATTN: AMSRL-OP-CI-AD, Records Management 2800 Powder Mill Rd. Adelphi, MD 20783-1145	(Class. only) 1	Commandant U.S. Army Infantry School ATTN: ATSH-CD (Security Mgr.) Fort Benning, GA 31905-5660
2	Commander U.S. Army Armament Research, Development, and Engineering Center ATTN: SMCAR-IMI-I Picatinny Arsenal, NJ 07806-5000	(Unclass. only) 1	Commandant U.S. Army Infantry School ATTN: ATSH-WCB-O Fort Benning, GA 31905-5000
2	Commander U.S. Army Armament Research, Development, and Engineering Center ATTN: SMCAR-TDC Picatinny Arsenal, NJ 07806-5000	1	WL/MNO1 Eglin AFB, FL 32542-5000  <u>Aberdeen Proving Ground</u>
1	Director Benet Weapons Laboratory U.S. Army Armament Research, Development, and Engineering Center ATTN: SMCAR-CCB-TL Watervliet, NY 12189-4050	2	Dir, USAMSAA ATTN: AMXSY-D AMXSY-MP, H. Cohen
1	Director U.S. Army Advanced Systems Research and Analysis Office (ATCOM) ATTN: AMSAT-R-NR, M/S 219-1 Ames Research Center Moffett Field, CA 94035-1000	1	Cdr, USATE COM ATTN: AMSTE-TC
		1	Dir, USAERDEC ATTN: SCBRD-RT
		1	Cdr, USACBDCOM ATTN: AMSCB-CII
		1	Dir, USARL ATTN: AMSRL-SL-I
		5	Dir, USARL ATTN: AMSRL-OP-CI-B (Tech Lib)

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
1	HQDA OUSDA(A), DDRE(T&E) ATTN: COL Bernard (Chip) B. Ferguson The Pentagon WASH DC 20301-3110	1	Defense Advanced Research Projects Agency ATTN: Mr. B. Bandy 3701 North Fairfax Dr. Arlington, VA 22203-1714
2	HQDA OUSDA(A), DDRE(R&AT-ET) ATTN: Mr. Rick L. Menz The Pentagon, Rm 3D1089 WASH DC 20301-3080	1	Department of the Navy ATTN: RADM Charles R. McGrail, Jr. The Pentagon, Room 4E536 Washington, DC 20350-2000
1	Office of the Assistant Secretary of the Army Research, Development, and Acquisition ATTN: LTG Cianciolo, Military Deputy Washington, DC 20310-0100	1	Commander U.S. Army Materiel Command ATTN: AMCDE-PI, Dan Marks 5001 Eisenhower Ave. Alexandria, VA 22333-0001
1	Office of the Secretary of the Army Research, Development, and Acquisition ATTN: Deputy for Systems Management, MG Beltson Washington, DC 20310-0103	1	Headquarters U.S. Army Materiel Command ATTN: AMCSCI, R. Chait 5001 Eisenhower Ave. Alexandria, VA 22333-0001
1	Deputy Under Secretary of the Army for Operations Research ATTN: SAUS-OR, Hon Walt Hollis The Pentagon, Room 2E660 Washington, DC 20310-0102	1	Commander U.S. Army Materiel Command ATTN: AMCPD, Darold Griffin 5001 Eisenhower Ave. Alexandria, VA 22333-0001
1	Office of the Deputy Director of Defense, R&E ATTN: Dr. William Snowden The Pentagon, Room 3D359 Washington, DC 20301	1	Commandant U.S. Army Logistics Management College ATTN: AMXMC-LS-S, Fort Lee, VA 23801
1	OUSDA(A), DDT&E ATTN: James O'Bryon The Pentagon, Room 3D1084 Washington, DC 20301-3110	1	Director Combat Development U.S. Army Transportation School ATTN: COL Elijah Toney Ft. Eustis, VA 23604
2	OUSDA(A), DDT&E ATTN: A. Rainis The Pentagon, Room 3E1081 Washington, DC 20301-3110	2	Director U.S. Army Research Office ATTN: SLCRO-MA, Dr. J. Chandra P.O. Box 12211 Research Triangle Park, NC 27709-2211
1	OUSDA(A), DDT&E,(LFT) Attn: Joel Bloom The Pentagon, Room 3E1084 Washington, DC 20301	1	Commander U.S. Army Armament Research, Development, and Engineering Center ATTN: SMCAR-TD, Jim Killen Picatinny Arsenal, NJ 07806-5000
1	SAF/AQT (Mr. George Warren) The Pentagon, Rm BE939 Washington, DC 20330-1000		

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
1	Commander Belvoir Research, Development, and Engineering Center ATTN: STRBE-FC, Ash Patil Fort Belvoir, VA 22060-5606	1	Commander U.S. Army Tank-Automotive Command ATTN: AMCPM-BLK-III, COL Don Derrah Warren, MI 48397-5000
1	Commander Belvoir Research, Development, and Engineering Center ATTN: STRBE-JDA, Melvin Goss Fort Belvoir, VA 22060-5606	1	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-CK, M. Erickson Warren, MI 48090
1	Commander, USACECOM R&D Technical Library ATTN: ASQNC-ELC-IS-L-R, Myer Center Fort Monmouth, NJ 07703-5000	1	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-CR, Mr. Wheelock Warren, MI 48397-5000
2	Director Center for Night Vision and Electro-Optics ATTN: AMSEL-RD-NV-V, John Palmer AMSEL-RD-NV-D, Dr. R. Buser Fort Belvoir, VA 22060-5677	1	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-CV, COL Becking Warren, MI 48397-5000
1	Commander U.S. Army Missile Command ATTN: AMSMI-RD, J. Bradas Redstone Arsenal, AL 35898-5000	2	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-NKS, D. Cyaye J. Rowe Warren, MI 48397-5000
1	Commander U.S. Army Missile Command ATTN: AMSMI-YTSD, Glenn Allison Redstone Arsenal, AL 35898-5070	2	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-RG, R. Munt R. McClelland Warren, MI 48397-5000
1	Commander U.S. Army Missile Command ATTN: AMSMI-REX, W. Pittman Redstone Arsenal, AL 35898-5500	3	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-RSC, John Bennett Wally Mick Warren, MI 48397-5000
1	Director U.S. Army Missile and Space Intelligence Center ATTN: AIMS-RT, Pat Jordan Redstone Arsenal, AL 35898-5500	1	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-RSK, Sam Goodman Warren, MI 48090-5000
1	Director U.S. Army Missile and Space Intelligence Center ATTN: AIMS-YLD, Vernon L. Stallcup Redstone Arsenal, AL 35898-5500	1	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-RY, Ron Beck Warren, MI 48397-5000



<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
2	Commander U.S. Army Tank-Automotive Command ATTN: AMSTA-ZE, R. Asoklis AMSTA-ZS, D. Rees Warren, MI 48397-5000	1	Director U.S. Army Model Improvement and Study Management Agency ATTN: SFUS-MIS, Eugene P. Visco 1900 Half Street, SW, Rm L101 Washington, DC 20324
1	Office of the PEO, Armored Sys Mod ATTN: SFAE-ASM-CV, Brian Bonkosky Warren, MI 48397-5000	2	Director U.S. Army Industrial Base Engineering Activity ATTN: AMXIB-MT AMXIB-PS, Steve McGlone Rock Island, IL 61299-7260
1	Commander HQ, TRADOC ATTN: Assistant Deputy Chief of Staff for Combat Operations Fort Monroe, VA 23651-5000	1	Director U.S. Army Research Laboratory ATTN: AMSRL-SL-E (COL George P Lasche) White Sands Missile Range, NM 88002-5513
1	Commander TRADOC ATTN: ATAN-AP, Mark W. Murray Fort Monroe, VA 23651-5143	1	Commander Carderock Division Naval Surface Warfare Center ATTN: Code 1740.2, Mr. F. Fisch Bethesda, MD 20084-5000
1	Commander U.S. Army Operational Test and Evaluation Agency ATTN: MG Stephenson 4501 Ford Ave. Alexandria, VA 22302-1458	1	Commander U.S. Naval Air Systems Command JTCG, AS Central Office ATTN: 5164J, J. Jolley Washington, DC 20361
1	Commander U.S. Army Operational Test and Evaluation Agency ATTN: LTC Gordon Crupper 4501 Ford Ave., #870 Alexandria, VA 22302-1435	1	Commander U.S. Naval Air Systems Command Code AIR-516J (LTC Exum) Washington, DC 20361
1	Director TRAC-WSMR ATTN: ATRC-WEC, P. Shugart White Sands Missile Range, NM 88002-5502	1	Commander ADR Program Manager CODE AIR-41112I ATTN: Tom Furlough U.S. Naval Air Systems Command Washington, DC 20361-4110
1	Director U.S. Army Research Laboratory ATTN: AMSRL-SL-E, Mr. Gilberto Mares White Sands Missile Range, NM 88002-5513	3	Commander U.S. Naval Weapons Center ATTN: David H. Hall, Code 3181 Melvin H. Keith, Code 35104 Tim Horton, Code 3386 China Lake, CA 93555-6001

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
1	Naval Postgraduate School Department of Aeronautics and Astronautics ATTN: Professor Robert E. Ball Monterey, CA 93943	1	Director U.S. Army TRADOC Analysis Command ATTN: ATRC White Sands Missile Range, NM 88002-5502
1	Commander Naval Air Systems Command ATTN: Philip Weinberg JTCCG/AS5 AIR-516J5 Washington, DC 20361-5160	1	Director U.S. Army TRADOC Analysis Command ATTN: ATRC-LS, Mr. Greenhill Fort Lee, VA 23801-6140
1	Commander GSM-ALC/TIED (CPT O'Connell) McClellan AFB, CA 95652	1	Commander U.S. Army Combined Arms Combat Development Activity ATTN: ATZL-CAI-S, Fort Leavenworth, KS 66027-5300
1	Commander ASB/XRM ATTN: Gerald Bennett Martin Lentz Wright-Patterson AFB, OH 45433	1	Commander U.S. Army Combined Arms Training Activity ATTN: ATZL-TAS-P, MAJ Smith Fort Leavenworth, KS 66027-7000
1	Commander FTD/SDMBU ATTN: Kevin Nelson Wright-Patterson AFB, OH 45433	1	Commandant U.S. Army Air Defense Artillery School ATTN: ATSA-DTN-SY Fort Bliss, TX 79916-7090
1	Commander FTD ATTN: Tom Reinhardt Wright-Patterson AFB, OH 45433	1	Commandant U.S. Army Air Defense Artillery School ATTN: ATSA-CDC Fort Bliss, TX 79916-7090
1	Commander FTD/SDAEA ATTN: Joe Sugrue Wright-Patterson AFB, OH 45433	1	Commandant U.S. Army Armor School ATTN: ATSB-CD Fort Knox, KY 40121-5215
1	Commander AFWAL/AARA ATTN: Vincent Velten Wright-Patterson AFB, OH 45433	1	Commandant U.S. Army Chemical School ATTN: ATZN Ft. McClellan, AL 30205-5020
1	Commander WL/FIVS, D. Voys Wright-Patterson AFB, OH 45433	1	Commandant U.S. Army Field Artillery School ATTN: ATSF Fort Sill, OK 73503-5600
1	Commander Air Force Armament Laboratory ATTN: AFATL/DLY, James B. Flint Eglin AFB, FL 32542-5000		

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
1	Commandant U.S. Army Ordnance Missile and Munitions Center and School ATTN: ATSK-CD Redstone Arsenal, AL 35897-6500	1	ADPA ATTN: Donna R. Alexander Two Colonial Place, Suite 400 2101 Wilson Blvd. Arlington, VA 22201-3061
1	Commander U.S. Army Signal Center and Fort Gordon ATTN: ATZH-CDC Fort Gordon, GA 30905-5000	1	Dale Atkinson 7703 Carrleight Parkway Springfield, VA 22152
1	Assistant Commandant U.S. Army Transportation School ATTN: ATSP-CDC Fort Eustis, VA 23601-5393	1	AFELM, The Rand Corporation ATTN: Library-D 1700 Main St. Santa Monica, CA 90406
1	Commander HQ U.S. Army Aviation Center and Fort Rucker ATTN: ATZQ-CDC Fort Rucker, AL 36362-5000	2	Air Force Wright Aeronautical Labs ATTN: CDJ, CPT Jost Joseph Faison Wright-Patterson AFB, OH 45433-6523
1	Commander HQ U.S. Army Aviation Center and Fort Rucker ATTN: ATZQ-TDS-SM Fort Rucker, AL 36362-5000	1	Armored Vehicle Technologies ATTN: Coda M. Edwards P.O. Box 2057 Warren, MI 48090
1	Director U.S. Army Concepts Analysis Agency 8120 Woodmont Ave. Bethesda, MD 20814-2797	1	ASI Systems, International ATTN: Dr. Michael Stamatelatos 3319 Lone Jack Road Encinitas, CA 92024
1	Institute for Defense Analyses (IDA) ATTN: Mr. Irwin A. Kaufman 1801 N. Beauregard St. Alexandria, VA 22311	1	Battelle Research Laboratory ATTN: TACTEC Library, J. N. Huggins 505 King Ave. Columbus, OH 43201-2693
1	Institute for Defense Analyses ATTN: Carl F. Kossack 1005 Athens Way Sun City, FL 33570	1	Battelle Research Laboratory Defense and Space Systems Analysis ATTN: Dr. Richard K. Thatcher 505 King Ave. Columbus, OH 43201-2693
1	Institute for Defense Analyses ATTN: Dr. Natarajan Subramonian 14309 Hollyhock Way Burtonsville, MD 20866	1	Battelle Edgewood Operations ATTN: Roy Golly 2113 Emmorton Park Road Edgewood, MD 21040

<u>No. of Copies</u>	<u>Organization</u>	<u>No. of Copies</u>	<u>Organization</u>
1	The BDM Corporation ATTN: Edwin J. Dorchak 7915 Jones Branch Drive McLean, VA 22102-3396	1	Commander Carderock Division Naval Surface Warfare Center ATTN: Code 1210, Seymour N. Goldstein Bethesda, MD 20084-5000
1	Bell Helicopter, Textron ATTN: Jack R. Johnson P.O. Box 482 Fort Worth, TX 76101	1	Denver Research Institute BW 228 ATTN: Lawrence G. Ulliyau 2050 E. Iliff Ave. Denver, CO 80208
3	BMY, Division of Harsco ATTN: William J. Wagner, Jr. Ronald W. Jenkins Ed Magalski P.O. Box 1512 York, PA 17404	1	FMC Corporation ATTN: Sidney Kraus 1105 Coleman Ave., Box 1201 San Jose, CA 95108
1	Board on Army Science and Technology National Research Council Room MH 280 2101 Constitution Ave., NW Washington, DC 20418	1	FMC Corporation ATTN: Ronald S. Beck 881 Martin Ave. Santa Clara, CA 95052
1	Booz-Allen and Hamilton, Inc. ATTN: Dr. Richard B. Benjamin Suite 131, 4141 Colonel Glenn Highway Dayton, OH 45431	1	BDM International ATTN: Mr. Steve Church, FX2B307 7915 Jones Branch Drive McLean, VA 22102-3396
1	Booz-Allen and Hamilton, Inc. ATTN: Lee F. Mallett 1300 N. 17th St., Suite 1610 Rosslyn, VA 22209	1	BDM International ATTN: Mr. Tom Hooker, FF2B304 7915 Jones Branch Drive McLean, VA 22102-3396
2	Booz-Allen and Hamilton, Inc. ATTN: John M. Vice WRDC/FIVS/SURVIAC Bldg 45, Area B Wright-Patterson AFB, OH 45433-6553	1	General Dynamics Land Systems ATTN: MZ-4362055, Gary Jackman P.O. Box 2074 Warren, MI 48317
1	Commander Combined Arms Combat Development ATTN: ATZL-CAP, LTC Morrison Director, Surv Task Force Fort Leavenworth, KS 66027-5300	1	General Dynamics Corporation ATTN: MZ-2650, Dave Bergman P.O. Box 748 Fort Worth, TX 76101-0748
1	Commander Combined Arms Combat Development ATTN: ATZL-HFM, Dwain Skelton Fort Leavenworth, KS 66027-5300	1	California Institute of Technology Jet Propulsion Laboratory ATTN: D. Lewis 4800 Oak Grove Drive Pasadena, CA 91109

<u>No. of</u> <u>Copies</u>	<u>Organization</u>	<u>No. of</u> <u>Copies</u>	<u>Organization</u>
1	Kaman Sciences Corporation ATTN: Timothy S. Pendergrass 600 Boulevard South, Suite 208 Huntsville, AL 35802	1	Mr. Abraham Golub, DA Consultant 203 Yoakum Parkway, Apt. 607 Alexandria, VA 22304
1	Ketron, Inc. ATTN: Robert S. Bennett 901 Duianey Valley Road, Suite 220 Baltimore, MD 21204-2600	1	Mr. Dave Hardison, ASB Consultant 3807 Bent Branch Road Falls Church, VA 22041
1	Logistics Management Institute ATTN: Jerry Wallick 6400 Goldsboro Road Bethesda, MD 20817-5886	1	LTGEN Howard W. Leaf USAF (Retired) 8504 Brook Road McLean, VA 22101
1	Oklahoma State University College of Engineering, Architecture and Technology ATTN: Thomas M. Browder, Jr. P.O. Box 1925 Eglin AFB, FL 32542	1	Dr. Roy A. Lucht Group M-B, MS-1960 Los Alamos, NM 87545
1	Southwest Research Institute ATTN: Martin Goland P.O. Drawer 28255 San Antonio, TX 78228-0255	1	Coleman Research Corporation ATTN: GEN Glenn Ous USA (Ret) 5950 Lakehurst Dr. Orlando, FL 32819
1	Sparta, Inc. ATTN: David M. McKinley 4901 Corporate Drive Huntsville, AL 35805-6201	1	MG Peter G. Olenchuk (USA Ret), BAST Consultant 6801 Baron Road McLean, VA 22101
1	SRI International ATTN: Donald R. Curran 333 Ravenswood Ave. Menlo Park, CA 94025	1	Harry Reed, Sr., Bauelle Consultant 138 Edmund St. Aberdeen, MD 21001
1	TASC ATTN: Richard E. Kinsler 1992 Lewis Turner Boulevard Fort Walton Beach, FL 32548-1255	1	Mr. Arthur Stein, BAST Consultant 30 Chapel Woods Court Williamsville, NY 14221-1816
1	SURVICE Engineering ATTN: Jim Foulk Suite 103 1003 Old Philadelphia Road Aberdeen, MD 21001		

No. of  
Copies Organization

Aberdeen Proving Ground

- 5 Dir, USAMSAA  
ATTN: AMXSY-A, W. Clifford  
AMXSY-G, J. Kramar  
AMXSY-J, A. LaGrange  
AMXSY-L, J. McCarthy  
AMXSY-L, M. K. Steiner
- 5 Cdr, USATECOM  
ATTN: AMSTE-CG  
AMSTE-TA-L,  
N. Harrington
- 6 Cdr, USAOC&S  
ATTN: ATSL-DES  
ATSL-DTD-CM  
ATSL-CD-TE  
ATSL-CD-BDAR (Hoy) (3 cp)
- 25 Dir, USARL  
ATTN: AMSRL-SL-B,  
Dr. Paul H. Deitz (4 cp)(328)  
AMSRL-SL-BA,  
Dr. James N. Walbert (1065)  
Mr. Ronald Bowers (1065)  
Mr. Mark Burdeshaw (1065)  
Mr. Stephen Polyak (1065)  
Ms. Lisa K. Roach (3 cp)(1065)  
Mr. Robert Walther (1065)  
Mr. Wilbur Warfield (1065)  
Mr. Earl Weaver (1065)  
AMSRL-SL-BG,  
Mr. John Abell (238)  
Mr. Daniel Kirk (238)  
AMSRL-SL-BL,  
Mr. Dennis Bely (328)  
Ms. Stephanie Juarascio (328)  
AMSRL-SL-BS,  
Mr. Rick Grote (328)  
Mr. John Jacobson (328)  
AMSRL-SL-I,  
Dr. Michael W. Starks (328)  
AMSRL-SL-BV,  
Mr. Ed Davisson (247)  
Ms. Jill H. Smith (247)  
AMSRL-SL-N,  
Mr. William Hughes (2 cp)(E3331-EA)

INTENTIONALLY LEFT BLANK.

USER EVALUATION SHEET/CHANGE OF ADDRESS

This Laboratory undertakes a continuing effort to improve the quality of the reports it publishes. Your comments/answers to the items/questions below will aid us in our efforts.

1. ARL Report Number ARL-TR-330 Date of Report January 1993

2. Date Report Received \_\_\_\_\_

3. Does this report satisfy a need? (Comment on purpose, related project, or other area of interest for which the report will be used.) \_\_\_\_\_

4. Specifically, how is the report being used? (Information source, design data, procedure, source of ideas, etc.) \_\_\_\_\_

5. Has the information in this report led to any quantitative savings as far as man-hours or dollars saved, operating costs avoided, or efficiencies achieved, etc? If so, please elaborate. \_\_\_\_\_

6. General Comments. What do you think should be changed to improve future reports? (Indicate changes to organization, technical content, format, etc.) \_\_\_\_\_

CURRENT ADDRESS Organization  
Name  
Street or P.O. Box No.  
City, State, Zip Code

7. If indicating a Change of Address or Address Correction, please provide the Current or Correct address above and the Old or Incorrect address below.

OLD ADDRESS Organization  
Name  
Street or P.O. Box No.  
City, State, Zip Code

(Remove this sheet, fold as indicated, tape closed, and mail.)  
(DO NOT STAPLE)



---

DEPARTMENT OF THE ARMY




OFFICIAL BUSINESS

**BUSINESS REPLY MAIL**  
FIRST CLASS PERMIT No 0001, APS, MD

Postage will be paid by addressee

NO POSTAGE  
NECESSARY  
IF MAILED  
IN THE  
UNITED STATES

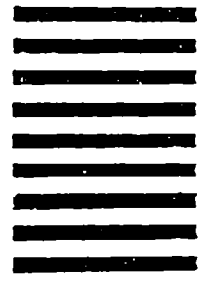

Director  
U.S. Army Research Laboratory  
ATTN: AMSRL-OP-CI-B (Tech Lib)  
Aberdeen Proving Ground, MD 21005-5066

---