ARMY RESEARCH LABORATORY



## Effect of Solventless Bore Cleaning Device (SBCD) on Surface Finish and Contamination Transport in the M256 Gun Barrel

by Mark Bundy, James Garner, Gerald Garcia, Robert Baylor, Terry Marrs, Julius Pitts, and Bob Vanina

**ARL-TR-3946** 

September 2006

Approved for public release; distribution is unlimited.

### NOTICES

### Disclaimers

The findings in this report are not to be construed as an official Department of the Army position unless so designated by other authorized documents.

Citation of manufacturer's or trade names does not constitute an official endorsement or approval of the use thereof.

Destroy this report when it is no longer needed. Do not return it to the originator.

# **Army Research Laboratory**

Aberdeen Proving Ground, MD 21005-5066

**ARL-TR-3946** 

September 2006

# Effect of Solventless Bore Cleaning Device (SBCD) on Surface Finish and Contamination Transport in the M256 Gun Barrel

Mark Bundy and James Garner Weapons and Materials Research Directorate, ARL

Gerald Garcia, Robert Baylor, Terry Marrs, and Julius Pitts U.S. Army Aberdeen Test Center, APG

> Bob Vanina ARDEC, Benet Laboratories, Watervliet, NY

Approved for public release; distribution is unlimited.

REPORT DOCUMENTATI			ION PAGE		Form Approved OMB No. 0704-0188
Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing the burden, to Department of Defense, Washington Headquarters Services, Directorate for Information Operations and Reports (0704-0188), 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to any penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number. <b>PLEASE DO NOT RETURN YOUR FORM TO THE ABOVE ADDRESS.</b>					
1. REPORT DATE (L	DD-MM-YYYY)	2. REPORT TYPE			3. DATES COVERED (From - To)
September 2006		Final			2006
4. TITLE AND SUBT	ITLE				5a. CONTRACT NUMBER
Effect of Solven	tless Bore Cleanin	ng Device (SBCD)	) on Surface Fini	sh and	
Contamination Transport in the M256 Gun Barrel					5b. GRANT NUMBER
					5c. PROGRAM ELEMENT NUMBER
6. AUTHOR(S)					5d. PROJECT NUMBER
Mark Bundy, Jar	mes Garner, <sup>*</sup> Gera	ald Garcia, <sup>*</sup> Rober	t Baylor, <sup>*</sup> Terry	Marrs, <sup>*</sup>	AH80
Julius Pitts, <sup>*</sup> and	l Bob Vanina <sup>†</sup>				5e. TASK NUMBER
					5f. WORK UNIT NUMBER
7. PERFORMING OF		S) AND ADDRESS(ES	)		8. PERFORMING ORGANIZATION
U.S. Army Rese			,		REPORT NUMBER
•	D-ARL-WM-BC				ARL-TR-3946
Aberdeen Provin	ng Ground, MD 2	21005-5066			
9. SPONSORING/M	ONITORING AGENCY	NAME(S) AND ADDRE	ESS(ES)		10. SPONSOR/MONITOR'S ACRONYM(S)
		, Aberdeen Provir		21005-5059	
		tervliet, NY 1218			11. SPONSOR/MONITOR'S REPORT
					NUMBER(S)
12. DISTRIBUTION/	AVAILABILITY STATE	MENT			
Approved for pu	iblic release; distr	ibution is unlimite	d.		
13. SUPPLEMENTA					
14. ABSTRACT					
	ss hore cleaning t	echnique markete	d by GI Industrie	is currently u	nder review by the U.S. Army Research
					shown that this new cleaning system is
					e wear. This report speaks to both the
					inish; but more importantly, it addresses
health and safety	y issues if the proc	cess is applied to b	arrels having fire	ed depleted urani	ium rounds. As reported herein, the surface
					diological survey of a contaminated barrel
					e evacuated cleaning dust. The broader
-		at depleted uraniu	m contamination	, when present,	lies within the barrel metal, which is not
removed in the cleaning process.					
15. SUBJECT TERMS					
gun, barrel, cleaning, DU radiation, contamination, surface finish					
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT	18. NUMBER OF PAGES	19a. NAME OF RESPONSIBLE PERSON
a. REPORT	b. ABSTRACT	c. THIS PAGE			Mark Bundy 19b. TELEPHONE NUMBER (Include area code)
UNCLASSIFIED	UNCLASSIFIED	UNCLASSIFIED	UL	14	410-278-3815
					Standard Form 298 (Rev. 8/98)

Prescribed by ANSI Std. Z39.18

## Contents

Lis	t of Figures	iv
Lis	t if Tables	iv
1.	Introduction and Background Studies	1
2.	Post-Cleaned SBCD Surface Finish	2
3.	Radiological Assessment of an SBCD-Cleaned DU-Contaminated Barrel	2
4.	Conclusions	5
Dis	tribution List	6

## List of Figures

0	GI industries bore cleaning (a) ball brush, (b) swab brush, (c) flexible steel drive (d) foot-peddle-controlled electric drive motor, (e) in operation	.1
U	Vacuum fixture designed to remove abraded brush and bore surface residue during ng.	.2
	Surface finish appearance after SBCD cleaning.	

## List if Tables

Table 1.	Surface finish measurements.	3
Table 2.	Radiation measurements	5

## 1. Introduction and Background Studies

The U.S. Army Research Laboratory (ARL) and Aberdeen Test Center (ATC) have designed and conducted bore cleaning studies<sup>1</sup> on a commercially sold (GI Industries Inc., Monroe, CT) solventless barrel cleaning device (SBCD) (figure 1). Bore cleaning takes place by manually guiding a spinning brush on the end of a flexible drive shaft up and down the bore for 15–20 min. The brush itself is made from ceramic (silicon carbide) impregnated organic resin matrix spheres or strands which abrade away, along with the bore residues, during the course of cleaning. The combined brush and bore residue can be collected using a vacuum attachment at the muzzle, as illustrated in figure 2.

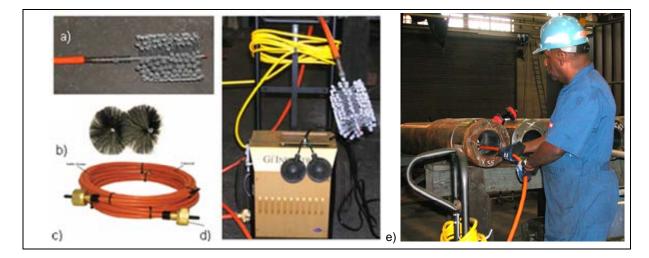


Figure 1. GI industries bore cleaning (a) ball brush, (b) swab brush, (c) flexible steel drive shaft, (d) foot-peddlecontrolled electric drive motor, (e) in operation.

Dimensional inspection of barrels cleaned with the SBCD showed no wear of the chrome or exposed steel substrate.<sup>1</sup> Furthermore, an elemental material analysis (using scanning electron microscopy with dispersive x-ray spectroscopy SEM/EDS) of the evacuated cleaning dust<sup>2</sup> did not reveal any chrome or substrate gun steel (from existing chrome chip sites) that could be attributed to brush-induced bore wear.

Although wear tests failed to show any measurable level of bore erosion, two additional wearrelated tests were conducted, and the results are reported in the following sections.

<sup>&</sup>lt;sup>1</sup>Bundy, M.; Pitts, J.; Baylor, R.; Doss, J.; Karschner, C. *Solventless Bore Cleaning System for M256 Tank Cannon*; ARL-TR-3650; U.S. Army Research Laboratory: Aberdeen Proving Ground, MD, September 2005.

<sup>&</sup>lt;sup>2</sup>Vanina, B. M256 Cleaning Residue. Memorandum from AMSRD-AAR-AEW-PC, Benet Laboratories: Watervliet, NY, May 2006.



Figure 2. Vacuum fixture designed to remove abraded brush and bore surface residue during cleaning.

## 2. Post-Cleaned SBCD Surface Finish

Though the surface finish may appear (figure 3) roughened by the SBCD cleaning process, a surface finish measurement (using a Handysurf E-21A surface texture analyzer, manufactured by Sheffield Measurement) indicates (table 1) the smoothness is on par with that of a new barrel.<sup>\*</sup> Hence the SBCD device does not measurably change the barrel's surface finish.

## 3. Radiological Assessment of an SBCD-Cleaned DU-Contaminated Barrel

Because of its high mass density, depleted uranium (DU) is often used as a component in tactical long-rod penetrator designs, such as the M829 family of 120-mm kinetic energy (KE) rounds. On rare occasions, it is possible for trace amounts of DU particles to be left behind in the gun

<sup>&</sup>lt;sup>\*</sup>The M256 barrel drawing allows a 1.6-µm finish on the chrome bore.



Figure 3. Surface finish appearance after SBCD cleaning.

M256 Barrel Condition and Serial No.	Surface Finish <sup>a</sup> (µm)
SBCD-cleaned 4247	0.31
New 11508	1.17
New 11512	1.60
New 11514	0.64
New 11515	0.31
New 11521	0.57

Table 1. Surface finish measurements.

<sup>a</sup>Higher surface finish numbers are synonymous with a rougher texture.

bore (though a discussion of how this transpires is outside the scope of this report). Precisely where the DU contamination resides is not universally agreed upon—is it located in the surface "glaze," which would be removed in SBDC cleaning, or, is it located within the subsurface metal, and therefore unlikely to be removed by the SBCD cleaning process? To shed some light on this issue and determine the level of hazard that may exist, if any, a known-to-be radioactive barrel (serial no. 10799) was cleaned with the SBCD and the dust collected in a High-Efficiency Particulate Air (HEPA) filtered vacuum system.

The survey of the gun tube and cleaning system consisted of a radiation level meter survey and swipe sampling of the gun tube before and after the cleaning procedure, as well as swipe sampling performed on the cleaning head, vacuum, and dust collection bag after the cleaning procedure was completed.

The field radiation detection system was a calibrated Ludlum Model 3 field portable beta/gamma survey meter (serial no. 18383).<sup>\*</sup> The Ludlum 3 is widely used in the radiation protection field to search for the presence of beta- and gamma-emitting radioactive contamination. DU emits both beta and gamma radiation, but is considered primarily a beta emitter. As such, the Ludlum 3 is well suited to field searches for the presence of DU contamination.

For all field surveys, ATC considers a radiation level of 0.05 millirem/hour (mR/hr) the threshold level to indicate a positive result for radioactive contamination of any item. A measured radiation level of 0.05 mR/hr represents twice the natural background radiation level which is typically in the range of 0.02–0.03 mR/hr. The twice-background level is a rule of thumb criteria commonly applied in environmental monitoring and analysis to indicate a true detection of a substance above a natural-background level.

Radiation can be fixed to, or removed from, an item. Removable contamination is considered potentially mobile in the environment, such as a dust that is coating an item that could be picked up by/transferred to anything that comes into contact with the item, including equipment/tools or personnel, thereby causing cross contamination. Fixed contamination means exactly that—the contamination is fixed or bonded to the source; it is a fundamental part of the item and is not available to be transferred to or cross contaminate another item.

To help determine if any contamination that may be present is fixed or removable, standard smear analysis was performed on the gun tube and cleaning equipment. In the swipe method, a cotton cloth smear is wiped over the surface of an item using moderate pressure. The swipe should come in contact with a total of  $100 \text{ cm}^2$  surface area of an item. The swipe then undergoes laboratory analysis to look for the presence of radioactive contamination.

The lab instrumentation used for swipe analysis was a Tennelec, low-background, alpha/beta counting system. The Tennelec system is widely used in the radiation protection field to detect low levels of radioactive contamination. The Tennelec system undergoes weekly and daily quality control checks to assure the reliability of the results of all analyses.

Field surveys of the gun tube with the Ludlum 3 showed similar maximum radioactive contamination levels of 0.2 mR/hr at the muzzle end both before and after cleaning. Thus, the cleaning process produced no detectable change in the radiation levels measured within the tube. This lends evidence to the assertion that DU contamination is not in the glaze, as that was removed from the bore surface by the cleaning process, but rather, in the substrate bore metal that is not removed by the cleaning process.

<sup>&</sup>lt;sup>\*</sup>Source checks/functionality tests are performed every day a field survey instrument is used. All field instruments are maintained yearly in a certified calibration program. Calibration records are maintained on file for several years after the expiration of the year-long period.

Radiation levels from the swipe analysis of the tube, cleaning head, vacuum, and dust collection bin are listed in table 2. Laboratory analysis of the dry swipes is indicative of the raw number of disintegrations detected in the swipes, expressed as disintegrations per minute (dpm, the fundamental scientific unit of measure that defines the radioactivity of an item or source). For reference, the swipe results values in table 2 can be compared against ATC's (internal) evaluation criteria of 30.0 dpm/100 cm<sup>2</sup> alpha, and 100 dpm/100 cm<sup>2</sup> beta for the presence of removable contamination. This criteria is very conservative and was originally found in a standard issued by the former DARCOM. For comparison, the Department of Transportation criteria for the presence of removable contamination is 220 dpm/100 cm<sup>2</sup> alpha, and 2000 dpm/100 cm<sup>2</sup> beta.

Item	Alpha (dpm)	Beta (dpm)
Cleaning head stones	$1.31 \pm 1.39$	$4.29\pm3.02$
Vacuum dust bag	$0.02 \pm 0.03$	$-0.91\pm2.03$
Tube before cleaning	$1.3 \pm 1.39$	$5.2 \pm 3.15$
Tube after cleaning	$15.15\pm4.61$	$4.52\pm3.49$

Table 2.	Radiation	measurements.
1 4010 2.	1 cadiation	measurements.

In no instance was the removable contamination found on the swiped items at, or even near, ATC's conservative evaluation criteria. This is consistent with the Ludlum 3 results, which showed the source of DU contamination was still in the gun tube.

Hence, both the field survey and the laboratory radiation testing support the conclusion that the DU contamination is affixed/bonded to the bore metal and not removed by the SBCD. Equivalently, the contamination does not appear to be associated with the combustion products that are removed during the cleaning process, and the cleaning process is not aggressive enough to remove metal from the bore surface. Thus, these results suggest that there is little hazard from a radiation perspective to personnel operating the SBCD.

### 4. Conclusions

An SBCD, previously shown to provide effective cleaning with no detectable wear on the M256 smoothbore tank cannon, was further examined here for its effect on surface finish and for its potential to remove DU from a contaminated barrel. Test results showed the surface finish of an SBCD-cleaned barrel was comparable to a new barrel. In addition, a radiological survey showed the radiation levels of the SBCD components and evacuated cleaning dust were not above normal after cleaning a DU-contaminated barrel. Conversely, the well-above background radiation levels in the contaminated barrel were unchanged by the SBCD cleaning, indicating the DU contamination is fixed within the bore metal.

NO. OF COPIES ORGANIZATION

- 1 DEFENSE TECHNICAL
- (PDF INFORMATION CTR ONLY) DTIC OCA 8725 JOHN J KINGMAN RD

STE 0944 FORT BELVOIR VA 22060-6218

- 1 US ARMY RSRCH DEV & ENGRG CMD SYSTEMS OF SYSTEMS INTEGRATION AMSRD SS T 6000 6TH ST STE 100 FORT BELVOIR VA 22060-5608
- 1 DIRECTOR US ARMY RESEARCH LAB IMNE ALC IMS 2800 POWDER MILL RD ADELPHI MD 20783-1197
- 3 DIRECTOR US ARMY RESEARCH LAB AMSRD ARL CI OK TL 2800 POWDER MILL RD ADELPHI MD 20783-1197

#### ABERDEEN PROVING GROUND

1 DIR USARL AMSRD ARL CI OK TP (BLDG 4600)

#### NO. OF COPIES ORGANIZATION

- 3 DIR BENET LAB AMSTA AR CCB EA R COOLEY AMSTA AR CCB EC R VANINA AMSTA AR CCB QAC M MIZENKO WATERVLIET NY 12189-4050
- 2 COMMANDER WATERVLIET ARSENAL SMAWV CA R FLISZAR S DIAGOSTINO WATERVLIET NY 12189-4050
- 1 ABRAMS TANK SYS PEO ARMORED SYS MODERNIZATION SFAE GCS AB SW A HAVRILLA WARREN MI 48397-5000
- 1 OPM MAS SFAE AMO MAS LC BLDG 354 C CORDING PICATINNY ARSENAL NJ 07806
- 1 DIRECTORATE OF TRAINING DOCTRINE AND COMBAT DEV ATZK TDD ORSA POMEY RM 219 WING A BLDG 1467 RD AVE FORT KNOX KY 40121-5000
- 2 COMANDER TACOM – ROCK ISLAND AMSTA LC CAW G BIERI K CROOKS BLDG 104 E WING 2ND FL ROCK ISLAND IL 61299-5000
- 1 GI INDUSTRIES INC B GOOD 525 FAN HILL RD MONROE CT 06468

#### NO. OF COPIES ORGANIZATION

#### ABERDEEN PROVING GROUND

17 DIR USARL AMSRD ARL WM BC M BUNDY (8 CPS) J GARNER B GUIDOS P PLOSTINS J NEWILL D LYON B BURNS E SCHMIDT R COATES S D WILKERSON INTENTIONALLY LEFT BLANK.