

AD A 043347



1

**DEPARTMENT OF DEFENCE**  
**DEFENCE SCIENCE AND TECHNOLOGY ORGANIZATION**  
**AERONAUTICAL RESEARCH LABORATORIES**  
**MELBOURNE VICTORIA**

**Structures Note 424**

**THE PERFORMANCE OF AIRCRAFT  
CONTROL CABLES  
UNDER SERVICE CONDITIONS**

by

**M. B. BENOY, R. A. FELL and P. H. TOWNSHEND**

DDC FILE COPY

© COMMONWEALTH OF AUSTRALIA 1977

REPRODUCED BY  
**NATIONAL TECHNICAL  
INFORMATION SERVICE**  
U. S. DEPARTMENT OF COMMERCE  
SPRINGFIELD, VA. 22161

**APRIL 1976**

# DOCUMENT CONTROL DATA

|                                                                                                                                                                                                                                     |                                                                                  |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------|
| 1. Security Grading/Release Limitation<br>(a) Document Content : Unclassified<br>(b) This Page : Unclassified                                                                                                                       | 2. Document Type/Number<br>Structures Note 424<br>3. Document Date<br>April 1976 |
| 4. Title and Sub-Title<br>The Performance of Aircraft Control Cables under Service Conditions                                                                                                                                       |                                                                                  |
| 5. Personal Authors: M.B. Benoy, R.A. Fell & P.H. Townshend<br>6. Corporate Author(s): AERONAUTICAL RESEARCH LABORATORIES                                                                                                           |                                                                                  |
| 7. Abstract<br><i>Investigations were conducted on the adverse effects of service conditions on the performance of flexible steel wire ropes used in aircraft control systems with particular reference to the Auster aircraft.</i> |                                                                                  |
| 8. Computer Program(s) -- Titles and Language                                                                                                                                                                                       |                                                                                  |
| 9. Descriptors<br>Aircraft<br>Control Equipment<br>Wire Ropes<br>Service Life                                                                                                                                                       | 11. Cosati Classifications<br>0103, 1402, 1106, 1309<br>RD 73 50-4               |
| 10. Library Distribution (Defence Group)<br>Central Library<br>STIB<br>JIO<br>ARL<br>CSE<br>MRL., Vic, NSW, South Aust.<br>WRE<br>Air Office, ARDU, AMTS<br>Army Office, EDE, Bridges Library                                       | 13. Sponsoring Agency Reference<br>14. Cost Code<br>26. 7100                     |
| 15. Imprint<br>MELBOURNE AERONAUTICAL RESEARCH LABORATORIES 1976                                                                                                                                                                    |                                                                                  |

**DEPARTMENT OF DEFENCE**  
**DEFENCE SCIENCE AND TECHNOLOGY ORGANIZATION**  
**AERONAUTICAL RESEARCH LABORATORIES**

STRUCTURES NOTE 424

**THE PERFORMANCE OF AIRCRAFT  
CONTROL CABLES  
UNDER SERVICE CONDITIONS**

by


M.B. BENOY, R.A. FELL and P.H. TOWNSHEND

SUMMARY

*After examination of aircraft control cables broken or worn in service together with mechanical tests and theoretical analysis the following factors were found to contribute to failure:*

- (a) *Abrasion of the cables on pulleys or fairleads causing a much more serious loss of strength than is apparent from surface wear.*
- (b) *"Brinelling" of the individual wires in the strands due to fluctuating cable tension inducing high contact stresses between helically wound wires. This causes strain-hardening followed by brittleness in the hard-drawn wires leading to the formation of surface cracks.*
- (c) *Fatigue of wires due to flexing around pulleys and fairleads.*
- (d) *Unobserved failure of the core strand due to the combined effects of (b) and (c).*

*Subsequent to the investigations a review was made of the published work on aircraft control cables and covers the development of standards and air-worthiness requirements. A bibliography, which includes wire ropes in general engineering has also been added.*

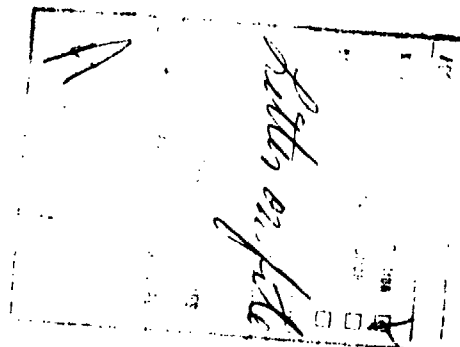

## CONTENTS

|                                                          | Page No. |
|----------------------------------------------------------|----------|
| 1. INTRODUCTION                                          | 3        |
| 2. INVESTIGATION OF SERVICE CONDITIONS AND CABLE DAMAGE  | 3        |
| 2.1 Examination of Cables Damaged in Service             | 3        |
| 2.2 Inspection of control cable installations            | 4        |
| 2.3 Measurement of cable loads in service                | 4        |
| 3. INVESTIGATION OF THE FACTORS AFFECTING CABLE STRENGTH | 5        |
| 3.1 Determination of the mechanical properties of cables | 5        |
| 3.2 Effect of cable wear on ultimate strength            | 5        |
| 3.3 Evaluation of nylon covered cable                    | 5        |
| 4. ANALYSIS OF CABLE STRESSES                            | 6        |
| 5. DISCUSSION                                            | 7        |
| 5.1 Historical                                           | 7        |
| 5.2 Cables                                               | 7        |
| 5.3 Pulleys                                              | 8        |
| 5.4 Cable Standards                                      | 8        |
| 6. CONCLUSIONS                                           | 9        |
| 6.1 Cables                                               | 9        |
| 6.2 Nylon covered cables                                 | 9        |
| 6.3 Pulleys                                              | 9        |
| 6.4 Rudder control circuit                               | 9        |
| 6.4.1 Rudder limit stop                                  | 9        |
| 6.4.2 Circuit tensioning                                 | 9        |
| 6.4.3 Fairleads                                          | 9        |
| 7. REVIEW OF STANDARDS AND RELATED INVESTIGATIONS        | 9        |
| 7.1 Cable Standards                                      | 10       |
| 7.1.1 Nylon covered cables                               | 11       |
| 7.2 Pulleys                                              | 11       |
| 7.2.1 Pulley groove profile                              | 11       |
| ACKNOWLEDGEMENTS                                         | 11       |
| REFERENCES                                               | 12       |
| APPENDIX I: Analysis of stresses in a 7 x 7 cable        |          |
| DISTRIBUTION                                             |          |
| DOCUMENT CONTROL DATA                                    |          |
| TABLES                                                   |          |
| FIGURES                                                  |          |
| BIBLIOGRAPHY                                             |          |

## 1. INTRODUCTION

Following the occurrence of service failures in rudder cables of Auster aircraft an investigation was undertaken at the request of D.C.A. as reported in Reference 1. As a result of this work the problem of progressive deterioration of aircraft control cables in service was considered to be of sufficient importance to warrant extending the A.R.L. investigations.

Examination of worn control cables from small civil and military aircraft and gliders indicated that a substantial reduction in strength could occur with little or no visible evidence of deterioration. An experimental programme, including some theoretical analysis, was therefore planned to investigate the factors contributing to the reduction of ultimate strength of control cables in service.

The following three types of cables were considered:

- (i) 7 x 7 aircraft cable (i.e. 7 strands of 7 wires) minimum breaking load 10 cwt., (4.98 kN) made to an Auster specification (Ref. 2)
- (ii) 7 x 14 aircraft cable (i.e. 7 strands of 14 wires) minimum breaking load 10 cwt., (4.98 kN) made to British Standard Specification W9. (Ref. 3).
- (iii) 7 x 19 aircraft cable (i.e. 7 strands of 19 wires) minimum breaking load 1760 lbf (7.83 kN) made to American Military Specification MIL-C-5424. (Ref. 4).

The layout of the wires in the cables is illustrated in Figs. 1 and 2.

Fatigue tests were also carried out on samples of galvanised steel cable (5 cwt. (2.49 kN) minimum breaking load, 7 x 7 construction to B.S.W.9) specially prepared with a nylon covering to resist abrasion.

It should be noted that this report is based on work which was carried out in the early 1960's and was the subject of two internal A.R.L. reports. Because of delays in vetting etc. due to higher priority tasks, it has only now been consolidated into one report with the addition of later developments.

The investigations, experimental work and results are as presented in the earlier reports but in the Discussion allusions are made to the influences of advances in cable design, current technology and standards. An up-to-date bibliography is included at the end of the report.

## 2. INVESTIGATION OF SERVICE CONDITIONS AND CABLE DAMAGE

In order to determine the factors that caused deterioration of control cables a number of cables damaged in service were examined and the control cable installation was inspected in a number of Auster aircraft.

### 2.1 Examination of Cables Damaged in service

A number of cables worn or broken in service was examined by microscope. The rudder cable failures from the Auster aircraft (reported in Ref. 1) are included. The aircraft have been given an arbitrary designation for the purposes of this report, i.e. VHA, VHB, VHC, VHE.

In the Auster rudder cables most of the worn and distorted sections of cable occurred at 254-305mm (10 - 12 inches) from the rudder pedal eye attachment and 356mm (14 inches) from the horn turnbuckle attachment (Fig. 3). The wear for the former condition was at a change of direction pulley and the latter where the cable rubbed on the fabric fairlead or emerged from the rear fuselage. It was at this latter location where some of the cables were corroded and the position where VHC had severe internal corrosion which was not detected by external visual inspection.

The wires of the 7 x 14 cable from VHA were heavily abraded, the abrasion marks being clearly visible and laying approximately at right angles to the cable. This abrasion had occurred on one side of the cable only (approximately half the circumference) and extended about 57 mm (2 1/4 inches) each side of the failure. The individual wires were each examined at the point of fracture by microscope and this revealed no clear evidence of fatigue failure but showed that most of the wires had failed by static-tensile load. A photograph of the failure showing the extent of abrasion is shown in Fig. 4.

In the 7 x 7 cable VHB the wires showed no marked external abrasion but were heavily damaged consistent with high pressure between wires. There was considerable deformation and in some strands the core wire had assumed a hexagonal cross-section under pressure, which was

probably combined with rubbing, from the surrounding wires. Fig. 5 shows a photo of the failure in which the damage to the wires can be clearly seen.

The difficulty of detecting internal wire damage was emphasised when the operator of VHE removed both 7 x 14 rudder cables two flying hours after a Certificate of Airworthiness because of a broken wire found in one of the cables. These cables were examined in the laboratory and one was found to have a completely broken core strand, each side of the fracture was corroded a distance of about 12.7 mm ( $\frac{1}{2}$  inch) and indications were that failure had existed for some time prior to the inspection.

The 7 x 7 cable from VHC had worn approximately 0.051 mm (0.002 inch) where it had rubbed on the fabric but had no other abnormal change in appearance. However, extremely close inspection revealed a slight discolouration at the point of the strands. Cutting of the cable and subsequent inspection with a microscope showed that a considerable area of the strand in contact with the core strand had corroded and brinelling of the wires of adjacent strands had also occurred. This damage was attributed to the continual hammering and rubbing between the wires of the cable under fluctuating tension arising from cable vibration due to rudder buffeting from the propeller slipstream. However, the same state of corrosion and brinelling was found in a 7 x 14 cable removed from a glider where vibration could occur due to self excitation or running over uneven ground surfaces. It was interesting to note that this glider cable, while showing outer wear of approx. 0.051 mm (0.002 inch) had several core strand wires failed as shown in Fig. 7. In another glider cable wires in several strands had failed in fatigue at various locations but little or no wear was externally evident (Fig. 8). It was only after several inspections of the cable that these wires were observed because the fractures were of such a nature that the "cloth method" of detection (Ref. 6) did not indicate any failed wires.

## **2.2 Inspection of control cable installations**

There are four factors in control cable installations which can be recognized as contributing to cable damage. These are:

- (i) Cable vibration against pulleys and fairleads. This is particularly important in rudder cables on small propeller driven aircraft due to the effects of slipstream on the rudder.
- (ii) Cable bending stresses due to flexing of the cable around pulleys.
- (iii) Damage to unprotected cables.
- (iv) Corrosion, due to removal of protective coatings by rubbing of wires against each other.

The control circuit of the Auster is described in some detail as it is typical of small propeller driven aircraft and illustrates some of the adverse conditions in which cables operate.

In some of the Auster aircraft examined the cables were slack in the unloaded condition while in others they were tensioned to 2.27 kg (5 lb.) by bungee cord. The cable was linked directly to the rudder pedal, the load from which is subject to a lever ratio of 1.5 : 1. The cable is deflected through approx. 18" by a 31.8 mm (1.25 in.) diameter pulley situated at the forward lower corner of the cabin entry door. This is the only pulley on the port side, while on the starboard side there are two pulleys one of 31.8 mm (1.25 in.) diameter and one of 57.2 mm (2.25 in.) diameter, the larger pulley appearing to be provided to accommodate a larger angular deflection.

In the J.1. series aircraft the cable runs are unprotected throughout the cockpit area, while in the J.5 series shrouding is provided aft of the pulleys. However the pulleys are in all cases vulnerable to damage from personnel entering or leaving the cockpit and to contamination. From the pulley the cable runs aft via two block and two ring fairleads down the fuselage and emerges through a reinforced hole in the fabric in the side of the fuselage, the final 610 mm (24 in.) of the cable to the rudder being exposed. The cable was subject to about 3" deflection at the aft fairlead and the exit hole from the fuselage; at the former the fairlead was worn to about 30% of the cable diameter and slight wear and corrosion was evident at the exit hole. The adjustment and stop limiting rudder movement were located in the rudder horn.

## **2.3 Measurement of cable loads in service**

The majority of cables examined were from Auster J5 aircraft and to investigate the reasons for cable failures in service typical cable generating loads were measured.

A type J5G Auster was modified to enable the insertion of an A.R.L. loop transducer of 2.23 kN (500 lbf.) capacity. The aircraft was flown under various conditions, and the loads at the transducer were recorded automatically by a S.F.I.M. recorder. A series of ground manoeuvre loads were also recorded using this equipment. These conditions and results (shown in Tables I and II) where the manoeuvre of full "left" and "right" rudder at 80 knots straight and level produced a measured load of 0.98 kN (220 lbf\*), while a maximum load of 1.95 kN (440 lbf) was recorded for a ground manoeuvre when the instructor applied opposite rudder control to over-ride that being applied by the pupil (Ref. 5 relates to a cable failure during dual instruction).

The ultimate design load requirements for the various types of Auster aircraft are set out in Table III to give an indication of typical control forces that can be expected in small aircraft of this type.

### 3. INVESTIGATION OF THE FACTORS AFFECTING CABLE STRENGTH

A number of investigations were carried out to determine the causes of cable damage observed in Para. 2.

#### 3.1 Determination of the mechanical properties of cables

As previously stated some cables removed from service were found to have a broken core strand while the outer strands appeared intact. Tensile tests were therefore made on cables, core strands from the cable and wires from the core strand.

The specification and test data for the three types of cable are shown in Table IV. Tensile properties and dimensions of single wires from the cable are shown in Table V. Curves of direct tensile stress versus extension are shown in Fig. 9, for the centre wire and outer wire of the core strand of a 7 x 7 cable. Since the wires were preformed it was not possible to express the extension in terms of strain since a large part of the extension for an outer wire occurs in straightening of the helical twist. Slight crimping of the core wire may also be present due to the effect of the contact forces of the outer wires.

However, these graphs give the average tensile stress and an indication of the plastic elongation at failure. It is interesting to note that both the ultimate stress and the plastic deformation of the outer wire appear to be significantly less than the centre wire. It is possible that this effect is due to the superimposed bending stresses applied in straightening the preformed outer wire. In such very hard drawn wires these stresses are likely to be quite significant.

#### 3.2 Effect of cable wear on ultimate strength

To investigate the effect of wear in service, the minimum diameter of the worn cables taken from service was measured and the failing load determined in a tension test. New cables were also abraded using fine emery cloth and rubbing the cable by hand in a longitudinal direction over a length of three inches and around one third of the circumference. This corresponded to the extent of the worn area observed on cables from service. The failing load of the cable was then determined in a testing machine, the overall length of the cable being 610 mm (24 inches).

By microscopical examination of each cable tested the area of the failed section of each wire was measured to within an estimated 5%. This enabled the failing load to be plotted against percentage reduction of area in Fig. 10, and against reduction of cable diameter in Fig. 11. There is a considerable variation in results but curves have been drawn through average values. The percentage reduction of area was estimated by the microscopic examination of abraded cables that had failed in service and an estimate of the expected failing load could be obtained from Fig. 10.

#### 3.3 Evaluation of nylon covered cable

Wear and abrasion had been cited as one of the principle causes of cable failure, Ref. 1. Therefore, in conjunction with D.C.A. it was decided to carry out fatigue tests to evaluate the performance of nylon jacketed cable in comparison with standard cable.

Standard 5 cwt. (2.49kN) 7 x 7 cable to B.S.S. W9 covered with nylon was available in only limited quantity so only four test specimens were available. Two specimens of nylon covered cable

---

\*As the max. speed for this type of aircraft is 120 knots it was estimated that flight loads may exceed 1.11kN (250 lbf) for a similar manoeuvre.

and two specimens of standard cable were tested on hardened steel and 'Micarta' pulleys (at a temperature of 53°C (120°F). Although, as expected, the nylon jacketed cable on the steel pulley was far superior to the standard cable the results using a Micarta Pulley were inconclusive. The results of these tests are summarised in Table VI.

#### 4. ANALYSIS OF CABLE STRESSES

Some of the wires of the core strand under contact from the wires of the outer strands showed evidence of plastic deformation. Evidence of fretting was also present. In the tests to failure on new cables described in Para. 3.1 there was also evidence of the wires in the core strand having been indented by wires from the outer strands. In a cable the outer strands are arranged in a helix around the core strand. When tension is applied to the cable the outer strands close on the core strand resulting in pressure between adjacent strands in the rope. In a similar way contact forces occur between wires within the core strand. Forces at contact between strands also arise due to the cable passing around a pulley, the most heavily loaded strand being the inner strand bearing against the pulley.

A theoretical analysis of the contact forces between wires of a 7 x 7 cable was therefore carried out by applying the theory of Ref. 7.

The following equations for this case are derived in Appendix 1.

In a 7 wire strand the load in the strand is given by:

$$T = T_c (1 + 6 \cos^2 \beta_c) \quad \dots (1)$$

Where  $T_c$  is the tensile load in the core wire and  $\beta_c$  is the helix angle.

Similarly for the cable the axial load is given by:

$$P = P_c (1 + 6 \cos^2 \beta_c) \quad \dots (2)$$

Where  $P_c$  is the load in the core strand and  $\beta_c$  is the lay angle.

Considering now the radial force where the outer strands contact the core strand we have:

$$F_p = \frac{\pi T \cos^2 \beta_c \sin^2 \beta_c}{9(1 + 6 \cos^2 \beta_c)}$$

Applying the general equations in Ref. 8 for elastic contact stresses between two cylinders, an expression for contact stresses between the wires of adjoining strands has been obtained in Appendix 1. The contact stresses as a function of cable load have been calculated and the results are presented in Table VI.

Considering the core strand the radial loading on the core wire exerted by an outer wire is:

$$F_p = \frac{2 T_o \sin^2 \beta_c}{d} \text{ in the strand}$$

where  $d$  is the wire diameter and  $T_o$  the load in the outer wire

$$\text{and } F_p = \frac{2 P_o \sin^2 \beta_c}{D} \text{ in the cable}$$

where  $D$  is the strand diameter and  $P_o$  is the load in the outer strand with the assumptions of Appendix 1.

This leads to an expression for the contact stresses on the core wire of:

$$\sigma_c = \left( \frac{2 F_p}{\pi \Delta} \right)^{1/2}$$

where  $\Delta$  is a function of the wire diameter and contact angle and may be obtained graphically from Ref. 8.

The experimentally determined failing loads of a 7 wire strand have been compared with those predicted from the strength of a single wire using equation (1) which assumes that all wires behave elastically up to failure. In the same way the ultimate strength of each of two cables has been predicted from the measured failing load for a single strand. All these results are presented in Table VIIIa which shows that there is reasonable agreement between predicted and measured values of ultimate strength.

Tests were also conducted on cables in which the core strand had been cut. The predicted failing load in this case is:

$$P = 6 P_u \cos \beta_u$$

assuming that all the outer strands carry equal tensile loads. The test results are compared with the predicted values in Table VIIIb.

## 5. DISCUSSION

### 5.1 Historical

With the limited documentation available an attempt has been made to piece together the history of the Auster rudder control circuit.

The Auster was the product of Taylorcraft Aeroplanes (England) Ltd. a company formed about 1940 to manufacture the American Taylorcraft light cabin monoplane under licence. The aircraft was used during the war as a light utility and observation aeroplane. The company later became Auster Aircraft Ltd. It is presumed that the rudder control circuit was originally designed with an American cable to MIL-C-1511, probably a 2.38 mm (3/32 in.) diameter cable of 7 x 7 construction and an ultimate breaking strength of 4.09kN (920 lbf). (This was the cable the Belgian authorities used as a replacement for the British cable in 1949 and reported no further defects in 1961). The nearest British cable would have been the 10 cwt. (4.98kN) 7 x 14 cable of 3.05 (0.120 in.) diameter to B.S.S. W2 (not preformed: W9 did not appear till 1946).

In 1945 due to failure of cables then in use (presumably the 7 x 14 British cable) British Ropes carried out a series of tests using an oscillator to reproduce the hammering and consequent abrasion and fraying of the cable on pulleys. The hammering was due to the slipstream over the rudder. (para 2.2). The conclusions reached in these tests was that a 7 x 7 cable was more resistant to abrasion than the 7 x 14 due to the larger diameter of the wire. 7 x 7 cables were therefore adopted. In 1952 another "crop of troubles" was experienced resulting in a further series of tests by British Ropes, in this case comparative fatigue tests. The existing 7 x 7 cable was compared with "a comparable American cable" and a 7 x 7 cable "manufactured to a new technique". (probably preformed as in W9). The new 7 x 7 cable had a life 2<sup>1</sup>/<sub>2</sub> times the American cable and 5 times the existing 7 x 7 cable. This new 7 x 7 cable subsequently became Auster Standard JB 264 and was adopted for all Austers and is one of the cables which is the subject of this investigation.

One of the other cables investigated was of 7 x 14 construction and this would appear to be the result of D.C.A. Air Navigation Order which requested replacement of all 7 x 7 cables with 7 x 14 or 7 x 19 construction. (Ref. 9).

### 5.2 Cables

Cable of 7 x 14 construction is more flexible than 7 x 7 cable and hence has higher resistance to fatigue. It follows that the cable of 7 x 19 construction is superior to both the 7 x 14 and the 7 x 7 given similar conditions and materials. The 7 x 19 cable to MIL-C-5425 is 50% stronger (static tensile strength) for the same diameter as the 7 x 7 and 7 x 14 and is superior in fatigue to the cable made to British Standards (See Refs. 10 and 11).

The investigation revealed that the cable of 7 x 14 construction was an inherently unstable configuration: prone to internal abrasion and a tendency to ovality. Difficulty was experienced in service in checking the uniform diameter of the cable with a micrometer because of ovality of up to 0.15 mm (0.006 in.). The tendency to instability is well illustrated in Fig. 2, where a length of 7 x 14 cable has been set in Araldite and the ends of the cable polished to show the wire layout in the strands. The mobile four wire core is adequately illustrated leading to a variety of other than circular strand shapes. The comparatively orderly arrangement of 7 x 7 and 7 x 19 construction is shown in the sketches in Fig. 1.

It may be of interest to note that the draftsman who prepared these sketches was unable to find any illustration of 7 x 14 cable despite a thorough search of references and the literature on aircraft and commercial cables. There was also no mention of 7 x 14 cable except in the British Standards related to aircraft cables.

The comparative fatigue tests on standard and nylon covered cable (5 cwt. (2.49kN) capacity 7 x 7 construction) on steel pulleys demonstrated the superiority of the covered cable, 2.7 times the endurance of the standard cable. However, the results using an aircraft pulley (Micarta material)

were inconclusive due to the limited number of specimens available at that time. It was noted that the nylon jacket tended to interlock the broken strands of the cable and thus prevent total failure unless the failure was entirely at one cross section. One serious disadvantage of the nylon covered cable is the difficulty in detecting broken wires, an important aspect of maintenance inspection in service.

Other characteristics noted were the tendency to local bending of the cable at the site of cracks in the nylon cover and the increased resistance to bending caused by the nylon cover on small diameter cable.

### 5.3 Pulleys

The existing "sheave ratio" (Pulley diameter/cable diameter) for the Auster rudder circuit is 11.8 for the 31.75 mm (1.25 in.) diameter pulley and the 7 x 7 cable. If this pulley was the same diameter in the American design then the sheave ratio using the MIL-C-1511 cable of 2.38 mm (3/32 in.) diameter would have been 13.3. For a satisfactory fatigue performance for 7 x 19 galvanised cable loaded to 20% of its breaking strength Ref. 12 recommends a minimum sheave ratio of 16, and states "less than 16 rope diameters falls within a critical region in which cable life is relatively low". Reference 13 recommends a sheave ratio of 18 for 7 x 19 galvanised and stainless cables and a ratio of 28 for 7 x 7 cables.

In Ref. 14 F.T. Hill states "A minimum pulley diameter is suggested by the British Airworthiness Authorities as not less than 20 times the diameter of the cable".

It would seem that sufficient information was available at that time to enable reasonable sheave ratios to be specified, although the figure of 11.8 could possibly have been condoned on the basis of the small wrap angle of 18°. Again, in the elevator circuit a 57.15mm (2.25 in.) diameter pulley is fitted apparently to accommodate a larger wrap angle. There seems to be little justification for this as Ref. 15 finds there is no significant variation in fatigue life above a wrap angle of 20°.

### 5.4 Cable Standards

The relevant British Standards for aircraft cables at the time were:

- 6W2 (Sept. 1946) Steel wire rope and straining cords (not preformed)
- W9 (Sept. 1946) Preformed steel wire rope.
- W10 Non corrodible steel wire rope (not preformed)
- W11 (1946) Preformed non corrodible steel wire rope.

The American standards were:

- MIL-C-1511 (Nov. 1949) Cable: steel (carbon) flexible, preformed.
- MIL-C-5424 (Aug. 1948) Cable: steel (corrosion resisting) flexible preformed for aeronautical use).

The specification drawn up by Auster Aircraft for 10 cwt. (4.98 kN) cable called for wire in accordance with BSS W9.

In assessing the relative merits of the various cables it is difficult to make a direct comparison because of the differences of so-called equivalent cables. The British method of designation of the cable is by ultimate breaking load whereas the American system is by cable diameter. If the American and British cables happen to have the same breaking load then the construction may be different. For example Reference 10 finds that the cable to MIL-C-5424 is superior to the British cable but this finding is qualified by the fact that the tests were carried out over the same diameter pulleys for cables of different diameters, viz.: 3.18 mm (0.125 in.) and 3.64 mm (0.143 in.) and 15 cwt. (7.47 kN) capacity. Generally, the only obvious differences between the American and British specifications are:

- (i) The American specification calls for an endurance test.
- (ii) The American specification calls for lubrication of the cable during manufacture.

The Auster specification, incidentally, called for an endurance test of 2,400 cycles with the cable loaded to 1/3 of the breaking load and a sheave ratio of over 20.

If we now examine the Standards for cables in the Auster category we find the following comparison:

| Construction | Diameter<br>mm (inches) | Min.<br>Breaking Load kN (lb) | Specifications             |
|--------------|-------------------------|-------------------------------|----------------------------|
| 7 x 7        | 2.38<br>(0.094)         | 4.09 (920)                    | (MIL-C-1511<br>(MIL-C-5424 |
| 7 x 7        | 2.69<br>(0.106)         | 4.98 (1,120)                  | Auster JB 264              |
| *7 x 14      | 3.05<br>(0.120)         | 4.98 (1,120)                  | (BS W9<br>(BS W11          |
| 7 x 19       | 3.18<br>(0.125)         | 7.83 (1,760)                  | MIL-C-5424 (1957)          |
| 7 x 19       | (0.125)                 | 8.90 (2,000)                  | MIL-C-1511 (1948)          |
| *7 x 19      | 3.81<br>(0.150)         | 7.48 (1,680)                  | B.S.W9 - W11               |

\*Also available not preformed BS W2 and W10.

## 6. CONCLUSIONS

### 6.1 Cables

The performance of the 3.18 mm ( $\frac{1}{8}$  in.) diameter cable of 7 x 19 construction to MIL-C-1511 or MIL-C-5424 is superior to cables of 7 x 7 or 7 x 14 construction.

### 6.2 Nylon covered cables

No conclusion is possible on the performance of the nylon covered cable due to the limited number of specimens available. However, inspection for broken wires is likely to be a major problem for this type of cable.

### 6.3 Pulleys

Pulley diameters should be as large as practicable and at least 20 times the cable diameters.

### 6.4 Rudder control circuit

#### 6.4.1 Rudder limit stop

The rudder limit stop should be situated at the pedal rather than at the rudder horn. Many aircraft later than the Auster feature stops at the pedal as well as on the control surface itself.

#### 6.4.2 Circuit tensioning

The rudder control circuit needs to be "closed" and tensioned. (Ref. 16)

#### 6.4.3 Fairleads

More direct routing of the cable (particularly at the fuselage exit) is required to avoid abrasion due to fairleads. Protective covering over exposed cables in the cockpit area are desirable.

## 7. REVIEW OF STANDARDS AND RELATED INVESTIGATIONS

With the passage of time some of the findings and recommendations from this investigation have been overtaken by the updating of standards in the light of experience, increasing severity of operating conditions and improvements in manufacturing techniques. For example the International Organisation for Standardisation (ISO) has played an increasingly important role in the formulation of standards through Committee ISO/TC 20 (Aircraft and Space Vehicles).

In 1957 ISO/TC 20 had asked the Italian Member Body to draw up a proposal on the international standardization of pulleys for flight controls. This proposal was based on a revision of the American standards for pulleys at that time, AN 219, AN 220 and AN 221 (now MS 20219, MS 20220 and MS 20221) where it was permitted to use several cable diameters for a given pulley diameter and vice versa e.g. M.S. 20220 (Ref. 17) for cable diameters of 3.18 mm ( $\frac{1}{8}$  in.), 3.97 mm ( $\frac{5}{32}$  in.) and 4.76 mm ( $\frac{3}{16}$  in.) permits the use of pulley diameters 31.88 mm (1.255 in), 63.63

mm (2.505 in.), 95.38 mm (3.755 in.) and 127.13mm (5.005 in.). The design parameters are the pulley maximum operating loads and the cable maximum operating loads and no reference is made to the minimum sheave ratio. Thus it is possible to specify a pulley/cable combination with a sheave ratio of less than 10.

Meanwhile, in 1966, British Civil Airworthiness Requirements (Ref. 18) laid down rules for control system installations and gave recommendations for pulley sizes. This was presented in graphical form with the number of wires in the cable as abscissa and the sheave ratio as the ordinate and a family of curves with the sheave ratio increasing for a given cable according to the load (expressed as a percentage of the breaking strength) in the cable. Within practical limits this standard has set a sheave ratio of 20 or above.

In Reference 19 (1971) the U.K., commenting on the Italian proposals and other international investigations, pointed out that the U.S. were still discussing pulley standardisation and planned to conduct additional tests. The U.K. recommended that one cable should be used for two pulley sizes, one with a minimum sheave ratio of 25 to be used where space was limited and the other with an ideal sheave ratio of 40 for use wherever possible. The Italian Member Body was again invited to recommence a study of aeronautical pulleys and so far as can be ascertained no ISO standard has yet been agreed upon.

### 7.1 Cable Standards

Of the British Standards issued in 1946, viz. 6W2, W9, W10, and W11, 6WE and W10 were rendered obsolescent in 1964 because the S.B.A.C. indicated a preference for preformed cables. W9 was replaced by 2W9 in 1965 and 2W11 superseded W11 in 1967. These two specifications recognised that "there has been a marked increase in the severity of conditions under which flexible wire ropes operate in aircraft flying control systems", and introduced corresponding improvements. Lubrication during manufacture was introduced (U.S. practice), the wire from which the rope was made was more fully specified, dimensional tolerances and ranges of tensile strength were specified. The issue of British Standard W12 in 1968 showed the effects of I.S.O. with the introduction of the specification of the cable by diameter (U.S. practice) instead of by breaking strength. The cable of 7 x 14 construction was discontinued.

W12 was followed by W13 in 1973 specifying the corrosion resisting equivalent of W12. The situation can be well summarised by quoting from the Foreword to W13 viz.:

"This British Standard specifies the requirements for preformed corrosion-resisting steel wire rope to comply with ISO Recommendation R 564 'Designations, diameters and breaking strengths of preformed stranded steel cables for aircraft controls' and International Standard ISO 2020 'Technical Specification for flexible steel wire rope for aircraft controls'.

ISO/R 564 specifies the diameter, construction and minimum breaking strength of the rope, all of which are in accordance with Recommendation No. 3310 of l'Association Internationale des Constructeurs de Materiel Aerospatiale (A.I.C.M.A.) and with the United States Military Specification MIL-C-5424A. Sizes of rope, larger than 6.4 mm (1/4 in.) diameter, though included in MIL-C-5424A, are seldom used in modern aircraft, and have been omitted from this standard".

Recapitulating, it is interesting to note that in 1965 in 2W9 a sentence in the Foreword stated "An endurance test is being formulated and will be added to the specification by amendment as soon as possible". In 1973, eight years later, the same statement appears in the Foreword of W13. Evidently, some difficulty was being experienced in the formulation of an endurance test. Moreover, in 1969, at the ISO meeting, the U.K. and French delegates were charged with the responsibility of producing recommendations for an endurance test. Investigations on this matter had been in progress for some time and a test programme designed to compare the scatter of results between a proposed U.K. method and the U.S. MIL-Spec. method showed a considerable scatter between three nominally identical machines built to the MIL-Spec (Ref. 20).

The issue of the ISO Technical Specification for flexible steel wire ropes for aircraft controls ISO 2020 shows that the problem of the endurance test has still not been resolved. A footnote to the specification states:

"While awaiting the publication of an ISO test procedure — an endurance test can be carried out in accordance with a relevant national specification". The United States, incidentally, has expressed its disapproval of ISO 2020.

If we now turn to the American scene we find that the U.S. Military Specifications MIL-C-

1511 (1949 and MIL-C-5424 (1949) have continued through to 1973 with a few minor amendments such as specification of the chemical composition of the steel, wire tolerances and tensile strengths. In 1973 MIL-W-83420 was issued superseding MIL-C-1511 and 5424 and combining in one specification carbon steel and corrosion resisting steel cables and their nylon jacketed equivalents. This specification is now entitled "wire rope", flexible instead of "cable" — flexible.

#### 7.1.1 Nylon covered cables

Because of reports of excessive wear on control cables in F-5 and T-38 aircraft extensive tests on nylon covered cables were carried out by Wright Patterson Air Force Base in 1967-68. The nylon cover, or jacketing, is extruded over the cable to completely enclose the cable with a protective coating. The cables tested were nylon covered stainless steel cables to MIL-C-5424 and tests were made at normal temperature and at  $-40^{\circ}\text{C}$  ( $-40^{\circ}\text{F}$ ). (Ref. 21). The results of these tests showed that the life of the cables was significantly increased by the wear protection afforded by the nylon covering and in addition assisted in vibration damping, protection against sand, grit, fluids and other harmful elements. However Ref. 22, commenting on the tests, again emphasised the serious problem of cable wear detection on this nylon covered cable and states that, to date, no satisfactory solutions have been found to solve this problem. Reference 22 also indicates that in the U.S. carbon steel cables are being replaced by stainless steel cables. Results of endurance tests at low temperature show that the stainless steel cables are far superior to the carbon steel product. (Ref. 23).

#### 7.2 Pulleys

During the course of the ISO sponsored investigations already mentioned in Paras 7 and 7.1 other significant factors in cable wear have been discovered. (Ref. 23). One of these is the considerable wear sustained by a cable where it passes over a pulley, at a small wrap angle.\* (This is relevant to the Auster see paras. 2.2 and 5.3). There was a marked difference in the wire wear and failure at pulleys in which the angle of wrap was only  $15^{\circ}$  compared with those of a wrap angle of over  $90^{\circ}$ . It appears that the rope with the small wrap angle, due to the lack of support from the pulley groove, has a transverse scrubbing action imposed upon the wires in contact with the pulley which leads to abrasion and early fatigue failure. However these findings do not appear to agree with the investigations in Italy (Lab. Centre FIAT, Ref. 24) where it was found that cable life decreases with increase of wrap angle from  $0^{\circ}$  to  $45^{\circ}$ .

##### 7.2.1 Pulley groove profile

In 1971 the United Kingdom ISO Document (Ref. 19) still indicates some disagreement with ISO proposals on groove profiles and favours a groove to give maximum support to a cable and to provide for regular proportional increases in pulley groove dimensions as the cable size increases. Some U.S. investigations in this area are described in Ref. 26.

In conclusion it seems there is still much work to be done to arrive at agreement on standards and international acceptance of design criteria to ensure the satisfactory performance of aircraft control systems and cables.

#### ACKNOWLEDGEMENTS

The advice and assistance of Dr. A.O. Payne in the planning of the investigation and during compilation of the report is gratefully acknowledged.

The author wishes to express his appreciation for the willing co-operation of A.R.L. Library staff in the procurement of extensive reference material.

Thanks are also due to the Department of Transport, Air Transport Group (formerly Department of Civil Aviation) for discussions and assistance with reference material.

---

\*The angle subtended, at the pulley centre, by the arc of contact of the cable.

## REFERENCES

1. R.A. Fell,  
C.A. Patching and  
A.O. Payne Preliminary report on the failure of "Auster" rudder cables.  
Aero. Research Labs.  
Structures and Materials Tech. Memo 88 July 1960.
2. Specification for 7 x 7, 10 cwt. control cables 'X' type) AJB 264.  
Auster Aircraft Ltd.  
Rearsby Leicester, Jan. 1959
3. Preformed steel wire rope. British Standard Specification W9.  
British Standards Institution, Sept. 1946.
4. Cable: Steel (corrosion resisting). Flexible. Preformed (for  
aeronautical use). Military Specification MIL-C-5425 Amdt 1.  
1953.
5. Rudder Control Cable Failure.  
D.C.A. Aviation Safety Digest No. 12 Dec. 1957 p. 26.
6. Control Cable Inspection  
D.C.A. Aviation Safety Digest  
March 1962. P.24.
7. W.L. Starkey and  
H.A. Cress An Analysis of Critical Stresses and Mode of failure of wire rope.  
Trans. A.S.M.E. Nov. 1959 pp. 307 - 311.
8. F.B. Seeley and  
J.O. Smith Advanced Mechanics of Materials  
John Wiley & Sons Inc. New York, N.Y. 1952 p. 342 et seq.
9. Commonwealth of Australia. Department of Civil Aviation. Air  
Navigation Orders, Section 105.  
1. 3. 0. 1. 5.  
A.N.O. Part 105 21st August 1953.
10. G.R. Barratt Fatigue tests of aircraft control cables.  
Commonwealth Aircraft Corporation Pty. Ltd.  
Report AG 410 1961.
11. G.R. Barratt Long-term fatigue tests of control cables to Spec MIL-C-5424  
Commonwealth Aircraft Corporation P/L.  
Report AG 417 1961
12. "Data for aircraft control cables"  
American Chain and Cable Co.  
P.6 1942.
13. J.E. Hillsher "Wire Rope Assemblies"  
Machine Design Vol. 33 No. 16  
p. 88 1961.
14. F.I. Hill Materials of Aircraft Construction  
Pitman London 1st. Edition.  
p. 129 1933.
15. H.J. Godfrey  
A.H. Fleury  
Dartrey Lewis The corrosion fatigue of aircraft control cables. Fatigue tests  
under service loads.  
John A. Roebbling's Sons Company, for Office of Scientific  
Research and Development.  
OSRD 4543. NRC-15 M-439.
16. Letter to Civil Aviation Liaison Officer, Australia House from  
F. Watkin, Head of Design Dept., Auster Aircraft Ltd., Oct.  
1959.
17. Pulley, groove, flight control, aircraft U.S. Military Standard  
MS 20220 Mar. 1965.
18. British Civil Airworthiness Requirements Chapter D4-8.  
Appendix Sub Section D4 para. 5. Control System Installations  
Feb. 1966.

## BIBLIOGRAPHY

The preparation of this report has entailed a fairly extensive literature search and has revealed a number of publications which, while not directly associated with this investigation may, nevertheless, be of incidental interest to those involved with wire ropes.

This bibliography with the references cited and the references from this report should form the basis of a reasonably comprehensive information source on wire ropes.

1. Haigh, B.P.  
Wire Rope Problems. *S. Wales Institute of Engineers, Procs.*  
Vol. 52 No. 5. 1937 pp. 327 - 357.
2. Cables and Cable Terminals for Aircraft. American Chain and Cable Co. Conn. U.S.A. 1940.
3. Hruska, F.H. Calculation of stresses in wire ropes. *Wire and Wire Products*. Vol. 26 Sept. 1951 pp. 766 - 767 and 799 - 801.
4. Hruska, F.H. Radial forces in wire ropes. *Wire and Wire Products* Vol. 27 May 1952 pp. 459 - 463.
5. Hruska F.H. Tangential forces in wire ropes. *Wire and Wire Products* Vol. 28 May 1953 pp. 455 - 460.
6. Cole, A.G., Fell, R.A., and Johnstone W.W. Tensile and Endurance Tests on preformed stainless steel cables. Aero Research Labs. Melbourne. Structures and Materials Note 206 June 1953.
7. Aircraft Inspection and Repair AC43 - 13 - 1 Chapt. 4. Control cables and terminals Federal Aviation Agency 1965.
8. Dong, R.G. and Steidel, R.F. Contact Stresses in Stranded Cable. *Experimental Mechanics*. Vol. 5 May 1965 pp. 142 - 147.
9. Senior H.A. and Spear, J.A.N. Endurance tests on flexible wire rope for aircraft flying controls. Report AID D 000002 68 Part I.  
Aeronautical Inspection Directorate Ministry of Technology U.K. Jan. 1968.
10. Gambrell, S.C. Study low cycle fatigue of wire rope. *Wire and Wire Products* Oct. 1969 pp. 127 - 130 (Comments on effects of pulley material on fatigue life of cables).
11. Wood Herbert L., A survey of publications dealing with corrosion in wire rope. Report 71-3 I.O.S.E. The Catholic University of America Washing D.C. June 1971.  
(A collection of both journal and report literature dealing with corrosion and prevention of corrosion of wire ropes. Forty-one references are cited including other surveys).
12. Storr, D.J. Corrosion prevention and Control in Steel wire ropes in the mineral industry. *Australasian Corrosion Engineering* Nov. 1971 pp. 7 - 12.
13. Inspection of Control Cables. *Airworthiness Advisory Circular No. 61*. Dept. of Civil Aviation Australia Feb. 1972.
14. Becker, Karl. On the fatigue strength of steel wires. *Stahl and Eisen* Vol 18. August 1972 pp. 873 - 880 (In German).
15. Machida, S., and Durelli, A.J. Response of a strand to axial and torsional displacements. *Journal of Mechanical Engineering Science*. Vol. 15 No. 4 1973 pp. 241 - 251.
16. Wire rope lubrication and corrosion protection. *Industrial Lubrication and Tribology* Jan Feb. 1973 pp. 7 - 12.
17. Phillips, James W., and Costello, George A. Contact stresses in twisted wire cables. *Journal of Engineering Mechanics Division. Proc. of Amer. Soc. of C. Engrs.* April 1973 pp. 331 - 341.
18. Australian Wire Ropes. Australian Wire Industries Newcastle n.d. (A comprehensive and up to date handbook prepared by A.W.I. for the guidance of engineers, operators and rope users.)

19. Comments by the United Kingdom on Document 20 N 1276 -  
Control Pulleys  
ISO TC 20 (Secretariat 807) 1305 Nov. 1971.
20. H.A. Senior  
J.F. Stoddart A Technical Report covering the examination of three American  
type flexible steel wire cable testing machines.  
Report No. AWD-2 70 AQD  
Laboratory Ministry of Technology Mar. 1970.
21. Perry L. Smith Evaluation of nylon and polyolefin jacketed aircraft control  
cables  
Technical Report ASD-TR-68-30 W-P.A.F.B Ohio. August  
1968
22. Why control cables of stainless steel give American aircraft great  
reliability.  
Wire and Wire Products June 1969  
pp. 62-64
23. Perry L. Smith Breaking Strength and Endurance Testing of Aircraft control  
cables  
Technical Report SEG-TR-67-19  
SEFL Wright-Patterson A.F.B. Ohio May 1967.
24. H.A. Senior  
R. Everard Endurance tests on flexible wire ropes for aircraft flying controls  
Report No. AID DEV 92 66. Aeronautical Inspection  
Directorate, Ministry of Aviation August 1966.
25. Second Draft proposed by Italian Member Body for  
Standardisation of Aircraft Control Pulleys  
ISO TC 20 (Italy-16) 1276 Oct. 1971
26. Werner G. Kroggel Evaluation of Aircraft Pulley Groove Effects on Jacketed  
control cable life.  
Tech. Memo ASD ENFI-TM-74-1  
Wright-Patterson A.F.B. Ohio. August 1974.

Postal Address: Chief Superintendent,  
Aeronautical Research Laboratories,  
P.O. Box 4331,  
MELBOURNE, Victoria 3001

## APPENDIX I

by

Patricia Diamond & Sue Vanderborcht

### (i) Notation

|               |                                                                            |
|---------------|----------------------------------------------------------------------------|
| $\beta_s$     | Angle of lay of the axis of an outer wire of a strand to the core wire.    |
| $\beta_c$     | Angle of lay of the axis of an outer strand of a cable to the core strand. |
| $\nu$         | Angle between the line of contact of outer wire and axis of core wire      |
| $D, d$        | Diameter of strand and wire respectively, inches                           |
| $T_o, P_o$    | Load in outer wire and outer strand respectively, lb.                      |
| $T_c, P_c$    | Load in core wire and core strand respectively, lb.                        |
| $T, P$        | Load in strand and cable respectively, lb.                                 |
| $F_p$         | Radial loading between wires at parallel wire critical region lb/in.       |
| $F_c$         | Radial force between wires at crossed wire critical region, lb.            |
| $b$           | Semi minor axis of ellipse of contact.                                     |
| $x$           | Axial co-ordinate, inches.                                                 |
| $y$           | Tangential co-ordinate, inches                                             |
| $z$           | Co-ordinate radially inward from cylindrical surface, inches.              |
| $A, B$        | Terms dependent in geometry of contacting bodies.                          |
| $\Delta$      | Term dependent on material and geometry of contacting bodies.              |
| $E$           | Modulus of elasticity, p.s.i.                                              |
| $\mu$         | Poisson's ratio.                                                           |
| $\sigma_c$    | Normal stress in axial direction in core wire of strand, p.s.i.            |
| $\sigma_o$    | Normal stress in axial direction in outer wire of strand, p.s.i.           |
| $\sigma_{cr}$ | Critical normal stress, p.s.i.                                             |

### (ii) Analysis of stresses in a 7 x 7 cable

Consider six wires wound round a centre wire at helix angle  $\beta_s$  to form a strand and six strands wound round a core strand at a lay angle of  $\beta_c$ .

The load  $T$  in a strand is given by:

$$T = T_c + 6 T_o \cos \beta_s \quad \dots (1)$$

where  $T_c$  and  $T_o$  are tensile loads in core and outer wires respectively.

If wires are elastic, compatibility of strain gives:

$$T_c = \frac{T_o}{\cos^2 \beta_s} \quad \dots (2)$$

$$\therefore T_o = \frac{T \cos^2 \beta_s}{1 + 6 \cos^4 \beta_s} \quad \dots (3)$$

$$\text{and } T = T_c (1 + 6 \cos^4 \beta_s) \quad \dots (4)$$

Similarly the load in the outer strands of the cable is given by:

$$P_o = \frac{P \cos^2 \beta_c}{1 + 6 \cos^4 \beta_c} \quad \dots (5)$$

$$\text{and } P = P_c (1 + 6 \cos^4 \beta_c)$$

where  $P_c$  and  $P_o$  are loads in the core strand and outer strands respectively and  $P$  is the load in the cable.

There are two important critical regions of contact stress in a cable subjected to a tensile force. The first of these, called the parallel wire critical region is located at the line of contact between the wires of the strand. Whether the region is between an outer wire and core wire of a strand or between two outer wires is dependent on the diameter of the core wire. The critical stresses are higher when the contact is between the outer wire and core wire of a strand (Fig. 13 (a)). The second critical region, called the crossed wire critical region, is located between the wires of adjacent strands.

#### (a) Parallel wire critical region

The most serious case of an outer wire wrapped round the core wire results in a radial loading  $F_p$

$$F_p = 2 T_o \sin^2 \beta \quad \dots (7)$$

where  $\beta_s = \beta = \beta_c$  (Fig. 13 (b))

However the outer wire makes contact with the core wire at an angle  $\nu$  where  $\tan \nu = \frac{1}{2} \tan \beta$  (Fig. 13 (c))

Hence the contact loading per inch is given by:

$$F_p = 2 T_o \sin^2 \beta \cos (\beta - \nu) \quad \dots (8)$$

$$\therefore F_p = \frac{2T \cos^2 \beta \sin^2 \beta \cos (\beta - \nu)}{d (1 + 6 \cos^4 \beta)} \quad \dots (9)$$

where  $\nu = \arctan (\frac{1}{2} \tan \beta)$

#### Contact Stresses

From Ref. 8

$$\sigma_x = -2\mu \left\{ \left[ 1 + \left( \frac{z}{b} \right)^2 \right]^{1/2} - \frac{z}{b} \right\} \frac{b}{\Delta} \quad \dots (10)$$

$$\sigma_y = - \left[ \frac{\left[ 1 + \left( \frac{z}{b} \right)^2 \right]^{1/2} - \frac{z}{b}}{\left[ 1 + \left( \frac{z}{b} \right)^2 \right]^{3/2}} \right] \frac{b}{\Delta} \quad \dots (11)$$

$$\sigma_z = - \frac{\frac{b}{\Delta}}{\left[ 1 + \left( \frac{z}{b} \right)^2 \right]^{3/2}} \quad \dots (12)$$

where  $b$  is one half the width of the rectangle area of contact and  $\Delta$  is a function of the geometry of the contact region.

$$b = \sqrt{2 F_p \Delta} \pi \quad \dots (13)$$

$$\text{and } \Delta = \frac{d (1 - \mu^2)}{1} \quad \dots (14)$$

The principal stresses  $\sigma_x$ ,  $\sigma_y$ ,  $\sigma_z$  have their maximum values at  $z = 0$ , that is, at the surface of contact.

#### Critical Stresses

The critical normal stress,  $\sigma_{xx}$ , is given by substituting equations (9), (13) and (14) into equation (12).

$$\sigma_{xx} = -\frac{b}{\Delta} + = \left[ \frac{4TE \cos^2 \beta \sin^2 \beta \cos (\beta - \nu)}{\pi d^2 (1 + 6 \cos^4 \beta) (1 - \mu^2)} \right]^{1/2} \quad \dots (15)$$

#### (b) Crossed Wire Critical Region

The radial force,  $F_c$ , between two wires of adjacent strands is given by:

$$F_c = \frac{F_p d}{3 \tan \beta} = \frac{\pi T_o \sin^2 \beta}{9 \tan \beta} \quad \dots (16)$$

### Critical Stresses

The critical normal stress in the crossed wire critical region is given by:

$$\sigma_{cr} = -c_n \quad (b, \Delta) \quad \dots (17)$$

$$\text{where} \quad b = c_b \quad (F, \Delta)^{1/4} \quad (\text{Ref. 7}) \quad \dots (18)$$

where  $c_b$  and  $c_n$  are functions of the angle  $\beta$  and are presented graphically on pages 356 and 357 of Ref. 8, plotted against a quantity  $B/A$  where

$$B/A = \frac{(1 + \frac{\sin^2 \beta}{3}) + (1 - \frac{\sin^2 \beta}{3}) \cos 2\beta}{(1 + \frac{\sin^2 \beta}{3}) - (1 - \frac{\sin^2 \beta}{3}) \cos 2\beta} \quad \dots (19)$$

**TABLE I**  
**CABLE LOADS RESULTING FROM FLIGHT MANOEUVRES**

| Manoeuvre                               | Speed - Knots | Cable Load<br>kN (lb.) | Pedal<br>Force kN (lb.) |
|-----------------------------------------|---------------|------------------------|-------------------------|
| Straight &<br>Level                     |               |                        |                         |
| Full L. & R.                            | 50            | 0.712 (160)            | 0.472 (106)             |
| Rudder                                  | 60            | 0.890 (200)            | 0.592 (133)             |
| Rudder                                  | 70            | 0.935 (210)            | 0.623 (140)             |
| Rudder                                  | 80            | 0.979 (220)            | 0.654 (147)             |
| Estimated                               | 120           | 1.1 (250) <sup>a</sup> | 0.743 (167)             |
| Steep Turns<br>L. & R.                  | ---           | 0.312 ( 70)            | 0.209 ( 47)             |
| Side Slip R                             | ---           | 0.579 (130)            | 0.383 ( 86)             |
| L                                       | ---           | 0.668 (150)            | 0.445 (100)             |
| Level Medium<br>Turns                   | ---           | 0.312 ( 70)            | 0.209 ( 47)             |
| Taxying with<br>application<br>of brake | ---           | 0.445 (100)            | 0.298 ( 67)             |

<sup>a</sup>The load for the manoeuvre at the maximum design cruising speed of 120 knots was obtained by extrapolation.

**TABLE II**  
**CABLE LOADS RESULTING FROM STATIC GROUND MANOEUVRES**

| Manoeuvre                                               | "A"<br>kN (lb.) | "B"<br>kN (lb.) | Average        | Average Pedal<br>Force kN (lb.f) |
|---------------------------------------------------------|-----------------|-----------------|----------------|----------------------------------|
| *<br>Instructor applying<br>opposite rudder to<br>pupil | 1.56<br>(350)   | 1.96<br>(440)   | 1.70<br>(385)  | 1.099<br>(247)                   |
| Applying parking<br>brake                               | 0.445<br>(100)  | 0.623<br>(140)  | 0.534<br>(120) | 0.356<br>(80)                    |
| Releasing parking<br>brake                              | 0.579<br>(130)  | 0.623<br>(140)  | 0.600<br>(135) | 0.401<br>(90)                    |
| Shifting position<br>in seat                            | —               | 0.890<br>(200)  | —              | 0.592<br>(133)                   |
| Full rudder to<br>limit stop against<br>horn            | —               | 1.56<br>(350)   | —              | 1.037<br>233                     |

"A" and "B" were different combinations of "Instructor and Pupil"

\*For safety reasons this test was not made during flight.

**TABLE III**  
**AUSTER RUDDER CABLE DESIGN PROOF LOADS**

| Type                            | Pilot Effort<br>kN (lb.) | Cable Load<br>kN (lb.f) | Reserve<br>factor |
|---------------------------------|--------------------------|-------------------------|-------------------|
| J5F<br>J5K<br>J5L<br>All others | 1.335<br>(300)           | 1.962 (441)             | 1.9               |
| Incl. J5A<br>J5R                | 1.780 (400)              | 2.621 (589)             | 1.43              |

The above information was obtained from the Auster Type Record and assumes an ultimate load for the cable of 840 lb. based on a splice efficiency of 75% for the 10 cwt. cable.

TABLE IV  
CABLE DETAILS

| Cable Specification                           | Construction | Max. Load<br>kN (lbf.) | Specified<br>Min. load<br>kN (lbf.) | Measured Cable                             |                        |
|-----------------------------------------------|--------------|------------------------|-------------------------------------|--------------------------------------------|------------------------|
|                                               |              |                        |                                     | Spec.<br>Max. dia.                         | Ovality                |
| B.S.S. -W9 -5P                                | 7 x 14       | 6.23 (1400)            | 4.98<br>(1120)                      | 3.05mm (0.120 in.)<br>2.90mm (0.114 in.)   | 0.15 mm<br>(0.006 in.) |
| Alster<br>Spec AJB 264<br>(Wire to<br>BSS W9) | 7 x 7        | 5.96 (1340)            | 4.98<br>(1120)                      | 2.59 mm<br>(0.102 in.)                     | 0.05 mm<br>(0.002 in.) |
| MIL-C5424                                     | 7 x 19       | 8.23 (1850)            | 7.83<br>(1760)                      | 3.53 mm (0.139 in.)<br>3.35 mm (0.132 in.) | 0.08 mm<br>(0.003 in.) |

**TABLE V**  
**TENSILE PROPERTIES AND DIMENSIONS OF**  
**SINGLE WIRES**

| Cable  | Wire Location<br>in strand | Meas. Dia.<br>mm (inch) | Max. Load<br>kN (lbf) | Approx.<br>0.2% P.S<br>kPa (p.s.i.) | Max. Stress<br>kPa (p.s.i.) | Spec.<br>Wire<br>Dia. |
|--------|----------------------------|-------------------------|-----------------------|-------------------------------------|-----------------------------|-----------------------|
| 7 x 7  | Core of Centre             | 0.325 (0.0128)          | 0.167                 | 1,722,560                           | 2,039,440                   | 0.33 (0.013)          |
|        | Core of outer              | 0.300 (0.0118)          | (37.5)                | (250,000)                           | (296,000)                   | 0.305 (0.012)         |
|        | Outer of centre            | 0.305 (0.012)           | 0.125                 | 1,894,750                           | 2,032,550                   | 0.305 (0.12)          |
|        | Outer of outer             | 0.279 (0.011)           | (28.0)                | (275,000)                           | (295,000)                   | 0.285 (0.0112)        |
| 7 x 14 | Core of centre             | 0.216 (0.0085)          | 0.076                 | 1,722,500                           | 2,067,000                   | 0.203                 |
|        | Core of outer              | 0.216 (0.0085)          | (17.0)                | (250,000)                           | (300,000)                   | (0.008)               |
|        | Outer of centre            | 0.203 (0.008)           | 0.065                 | 1,825,850                           | 1,998,100                   | 0.229                 |
|        | Outer of outer             | 0.203 (0.008)           | (14.5)                | (265,000)                           | (290,000)                   | (0.009)               |
| 7 x 19 | Core of centre             | 0.295 (0.0116)          | 0.142                 | 1,791,400                           | 2,067,000                   | Not<br>Specified      |
|        | Core of outer              | 0.229 (0.009)           | (32.0)                | (260,000)                           | (300,000)                   |                       |
|        | 2nd row of centre          | 0.229 (0.009)           |                       |                                     |                             |                       |
|        | 2nd row of outer           | 0.216 (0.0085)          |                       |                                     |                             |                       |
|        | Outer of centre            | 0.216 (0.0085)          | 0.076                 | 2,135,900                           | 2,342,600                   |                       |
|        | Outer of outer             | 0.203 (0.0085)          | (17.0)                | (310,000)                           | (340,000)                   |                       |

TABLE VI  
ENDURANCE TEST RESULTS

| Specimen No. | Test Conditions                     | Cycles to first detected wire failure | Cycles to cable failure | Mean cycles to failure | Site of failure | (3)<br>(4) | Wear at fairlead mm (in.) | Period of wear. cycles | Wear per 10,000 cycles mm (in.) | Remarks                                                                                                                                                                          |
|--------------|-------------------------------------|---------------------------------------|-------------------------|------------------------|-----------------|------------|---------------------------|------------------------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| (1)          | (2)                                 | (3)                                   | (4)                     | (5)                    | (6)             | (7)        | (8)                       | (9)                    | (10)                            | (11)                                                                                                                                                                             |
| 1A           | Standard cable Steel pulley         | 6,000                                 | 7,309                   | 7,981                  | Pulley          | 82%        | 0                         | 6,000                  | 0                               | Initial wire failure took place on the inside of the bend where wires had been polished by contact with the pulley                                                               |
| 1B           |                                     | 6,000                                 | 8,653                   |                        | Pulley          | 69%        | 0.0102 (0.0004 in.)       | 6,000                  | 0.0178 (0.0007)                 |                                                                                                                                                                                  |
| 2A           | Nylon covered cable, steel pulley   | 20,000                                | 20,514                  | 21,650                 | Pulley          | 97%        | 0.0152 (0.0006 in.)       | 20,000                 | 0.0076 (0.0003)                 | Some nylon cracks existed but did not develop. Due to greater stiffness and low tension the cable did not follow the radius of the pulley completely.                            |
| 2B           |                                     | 18,000                                | 22,787                  |                        | Pulley          | 79%        | 0                         | 18,000                 | 0                               |                                                                                                                                                                                  |
| 3A           | Standard cable, micaarta pulley     | 12,000                                | 21,976                  | 23,425                 | Pulley          | 55%        | 0.0279 (0.0011)           | 10,000                 | 0.0279 (0.0011)                 | No polishing, but wire failure on inside of bend. Fan inoperative at 15,000 cycles. Failure @ 76° F. Oil was extruded during the test until 14,000 cycles. Removed periodically. |
| 3B           |                                     | 18,000                                | 24,865                  |                        | Pulley          | 72%        | 0.0025 (0.0001)           | 20,000                 | 0                               |                                                                                                                                                                                  |
| 4A           | Nylon covered cable Micaarta pulley |                                       | 12,670                  | 23,445                 | Pulley          | 100%       | 0                         | 12,000                 | 0                               | Failure occurred at 2 cracks in the nylon which were undeveloped at 8000 cycles.                                                                                                 |
| 4B           |                                     | 22,000                                | 34,220                  |                        | Pulley          | 64%        | 0                         | 24,250                 | 0                               |                                                                                                                                                                                  |

TABLE VII  
LOADS AND STRESSES  
(a) PARALLEL WIRE CRITICAL REGION

| $\sigma_{cr}$<br>Pascal (psi) | T<br>N. (lb)   | P<br>N (lb)   |
|-------------------------------|----------------|---------------|
| $-6.59 \times 10^3$           |                |               |
| $(-9.57 \times 10^3)$         | 962.0 (216.09) | 6008 (1350)   |
| $-1.52 \times 10^3$           |                |               |
| $(-2.2 \times 10^3)$          | 8.18 (1.8385)  | 51.1 (11.486) |
| $-1.65 \times 10^3$           |                |               |
| $(-2.4 \times 10^3)$          | 8.55 (1.9203)  | 53.4 (11.997) |

(b) CROSSED WIRE CRITICAL REGION

| $\sigma_{cr}$<br>Pascal (psi) | T<br>N (lb)  | P<br>N (lb)    |
|-------------------------------|--------------|----------------|
| $-1.79 \times 10^4$           |              |                |
| $(-2.6 \times 10^4)$          | 8793 (197.6) | 6008 (1350)    |
| $-1.52 \times 10^3$           |              |                |
| $(-2.2 \times 10^3)$          | 0.549 0.1233 | 3.748 (0.8423) |
| $-1.65 \times 10^3$           |              |                |
| $(-2.4 \times 10^3)$          | 0.713 0.1602 | 4.870 (1.0943) |



TABLE VIII  
COMPARISON OF PREDICTED AND MEASURED FAILING LOADS  
(a) CABLE LOADS

| Cable Type<br>(1) | Measured Load<br>kN (lbf)<br>(2) | Strand Load<br>kN (lbf)<br>(3) $P_c$ | Cable Lay<br>(4) | $(1 + 6 \cos^3 \alpha)$<br>(5) | Predicted Load<br>$P_c (1 + 6 \cos^3 \alpha)$<br>(6)<br>kN (lbf) |
|-------------------|----------------------------------|--------------------------------------|------------------|--------------------------------|------------------------------------------------------------------|
| 7 x 7             | 5.69 (1280)                      | 1.0 (225)                            | 16°              | 6.30                           | 6.27 (1410)                                                      |
| 7 x 14            | 5.96 (1340)                      | 1.06 (240)                           | 16°              | 6.30                           | 6.72 (1510)                                                      |
|                   | 5.78 (1300)                      | 1.02 (230)                           |                  |                                | 6.45 (1450)                                                      |
|                   | 6.23 (1400)                      | 1.06 (240)                           |                  |                                | 6.72 (1510)                                                      |


col (6) = col (3) x col (5)

(b) STRAND LOADS


| Strand Type<br>(1) | Measured Load<br>kN (lbf)<br>(2) | Wire Ult. Load<br>kN (lbf)<br>(3) $T_c$ | Strand Lay<br>$\alpha$<br>(4) | $1 + 6 \cos^3 \alpha$<br>(5) | Predicted Load<br>$T_c (1 + 6 \cos^3 \alpha)$<br>(6) |
|--------------------|----------------------------------|-----------------------------------------|-------------------------------|------------------------------|------------------------------------------------------|
| 7 wire             | 1.024 - 1.068<br>(230-240)       | 0.167 (37.5)                            | 16                            | 6.30                         | 1.055 kN (237 lbf)                                   |

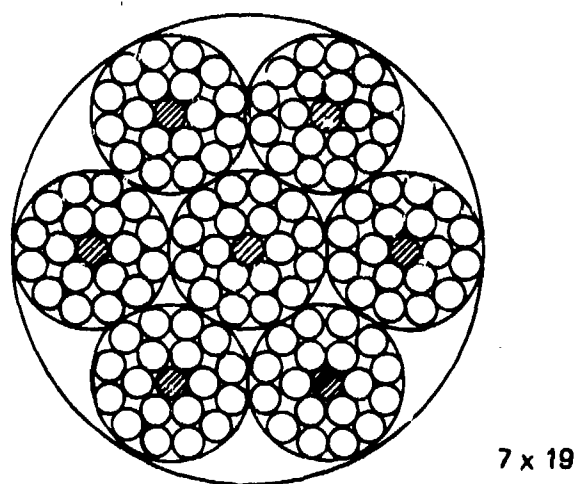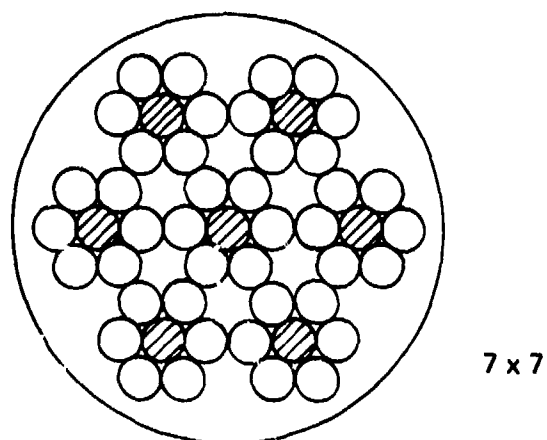

ARRANGEMENT OF WIRES IN 7 X 7 CABLE AND 7 X 19 CABLE

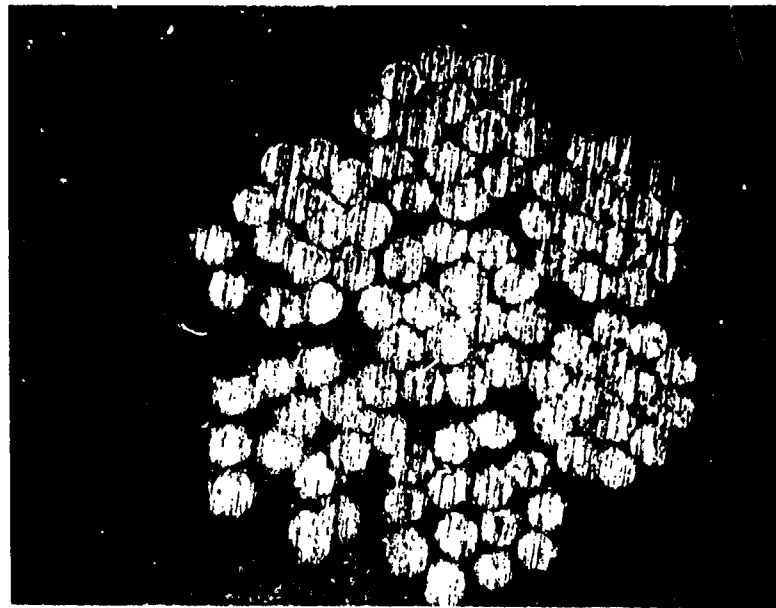


(a) As cut at one end

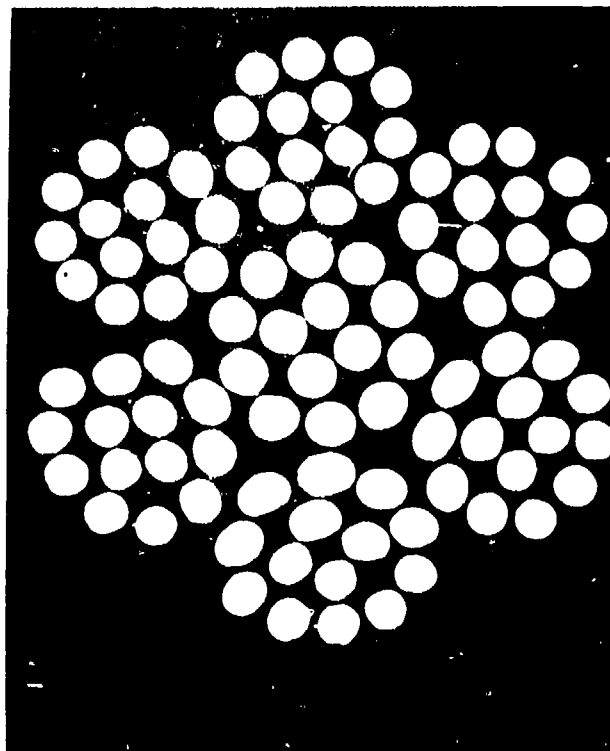


(b) Polished at the other end

ARRANGEMENT OF WIRES IN A 498 kN (10 CWT) 7 x 14 CABLE TO BSW 9  
(Set in araldite)


# Cable deformations

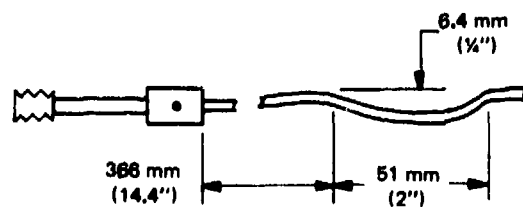

Stbd cable  
Horn . attachment end

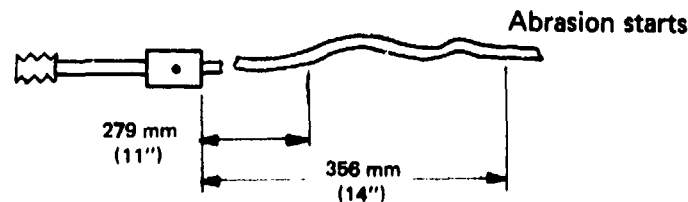


Cable JA 2393X  
Port cable  
Horn . attachment end

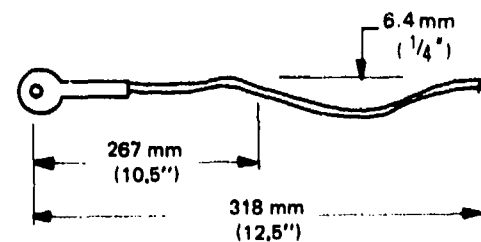


Port cable  
Rudder pedal attachment end


## CABLES ON VHD

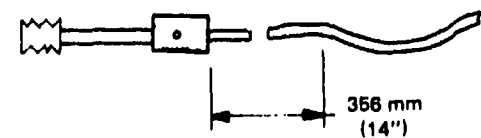

Corrosion 38 mm (1.5'') long.  
Cable JA 2393X

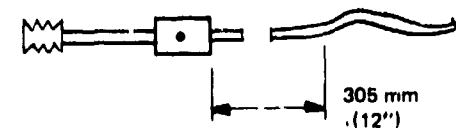

Corrosion 25.4 mm (1.0'') long  
Cable JA 2394X

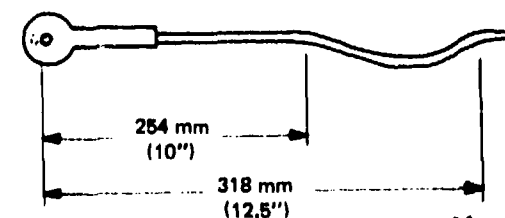

Max. abrasion measured 0.05 mm (0.002'') on dia.

## CABLES FROM VHC.


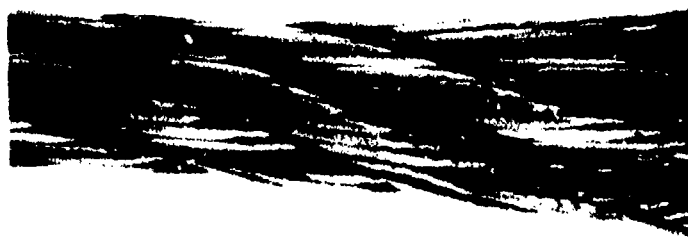


FIG. 4 CABLE FAILURE IN VHA SHOWING ABRASION OF STRANDS.



FIG. 5 STRAND FAILURE IN VHB SHOWING DAMAGE BETWEEN WIRES.

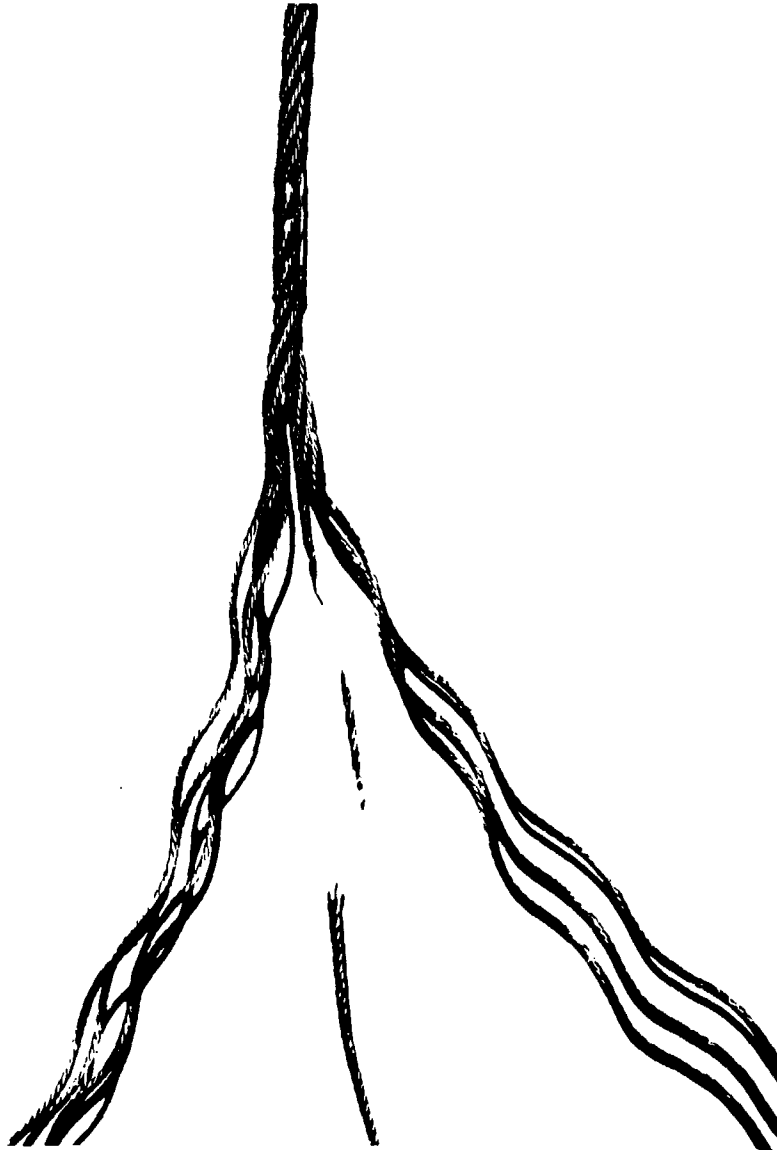

Neg. no. 5409

INTERNAL WIRE DAMAGE IN CORE STRAND VHE



FIG. 7 FAILURE OF CORE STRANDS AND WIRES.

(a)




(b)




Worn and fretted cable 7 x 14  
removed two flying hours after a C. of A. inspection

FIG. 8 (VISIBLE DAMAGED WIRES PRIOR TO UNRAVELLING)

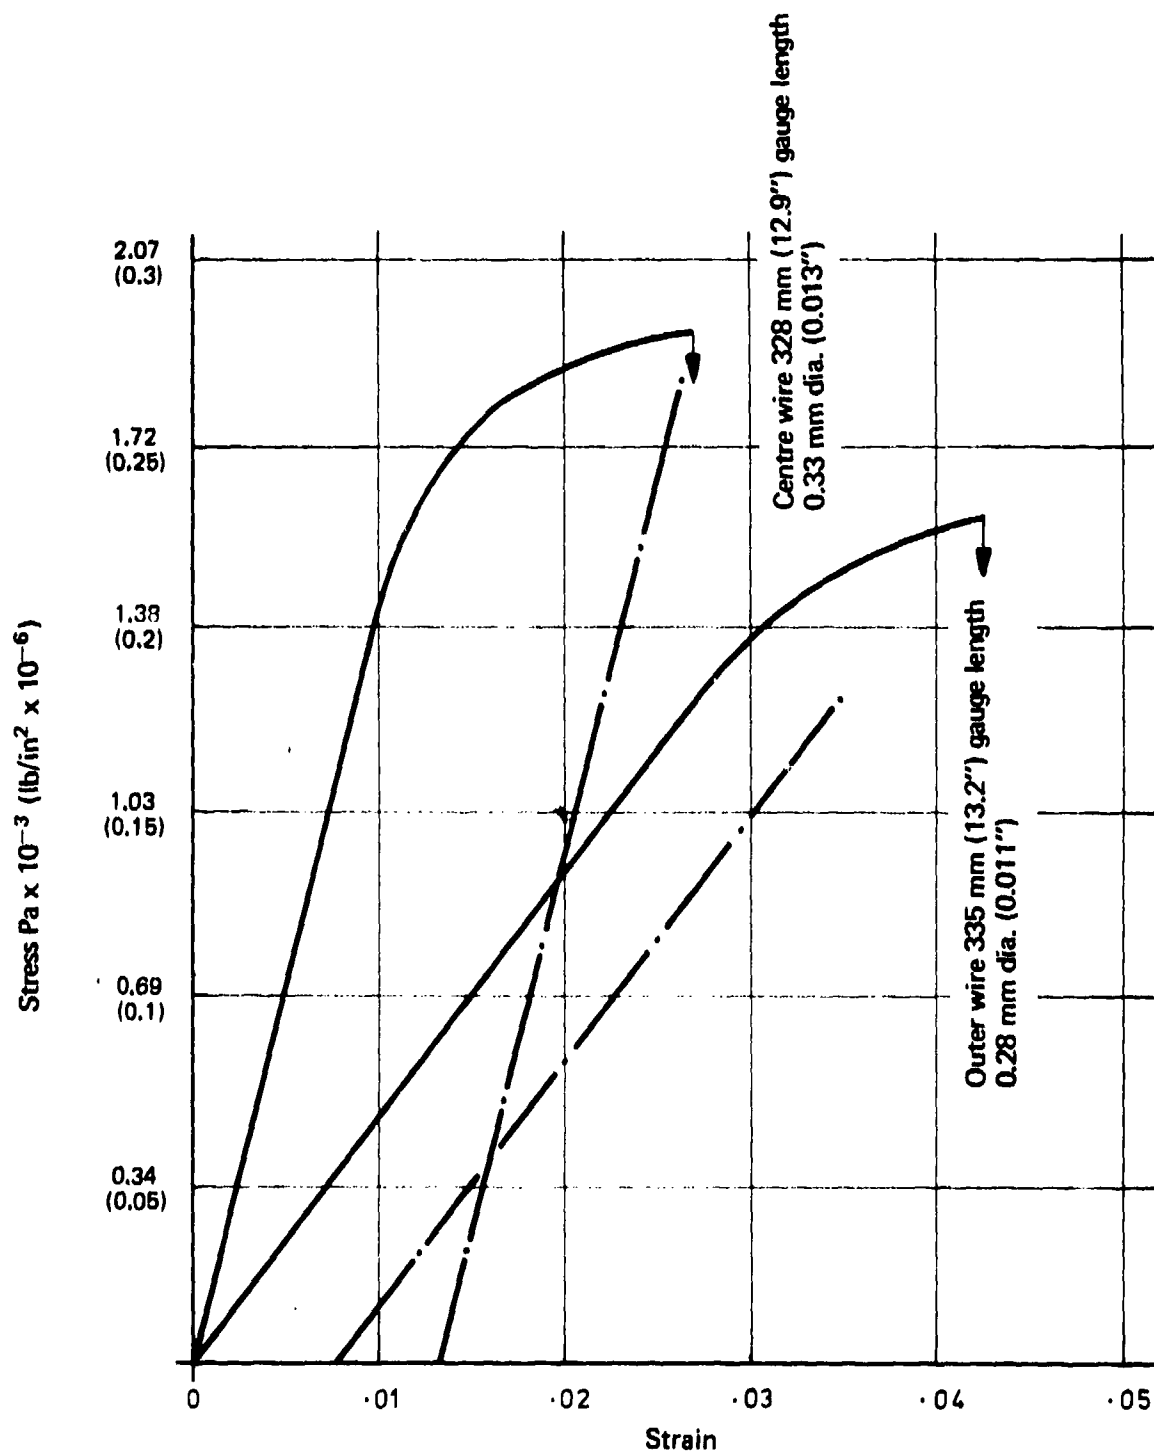


STRESS-STRAIN CURVES FOR TWO WIRES OF A 10 CWT (498 kN)  
7 X 7 GALVANIZED CABLE.

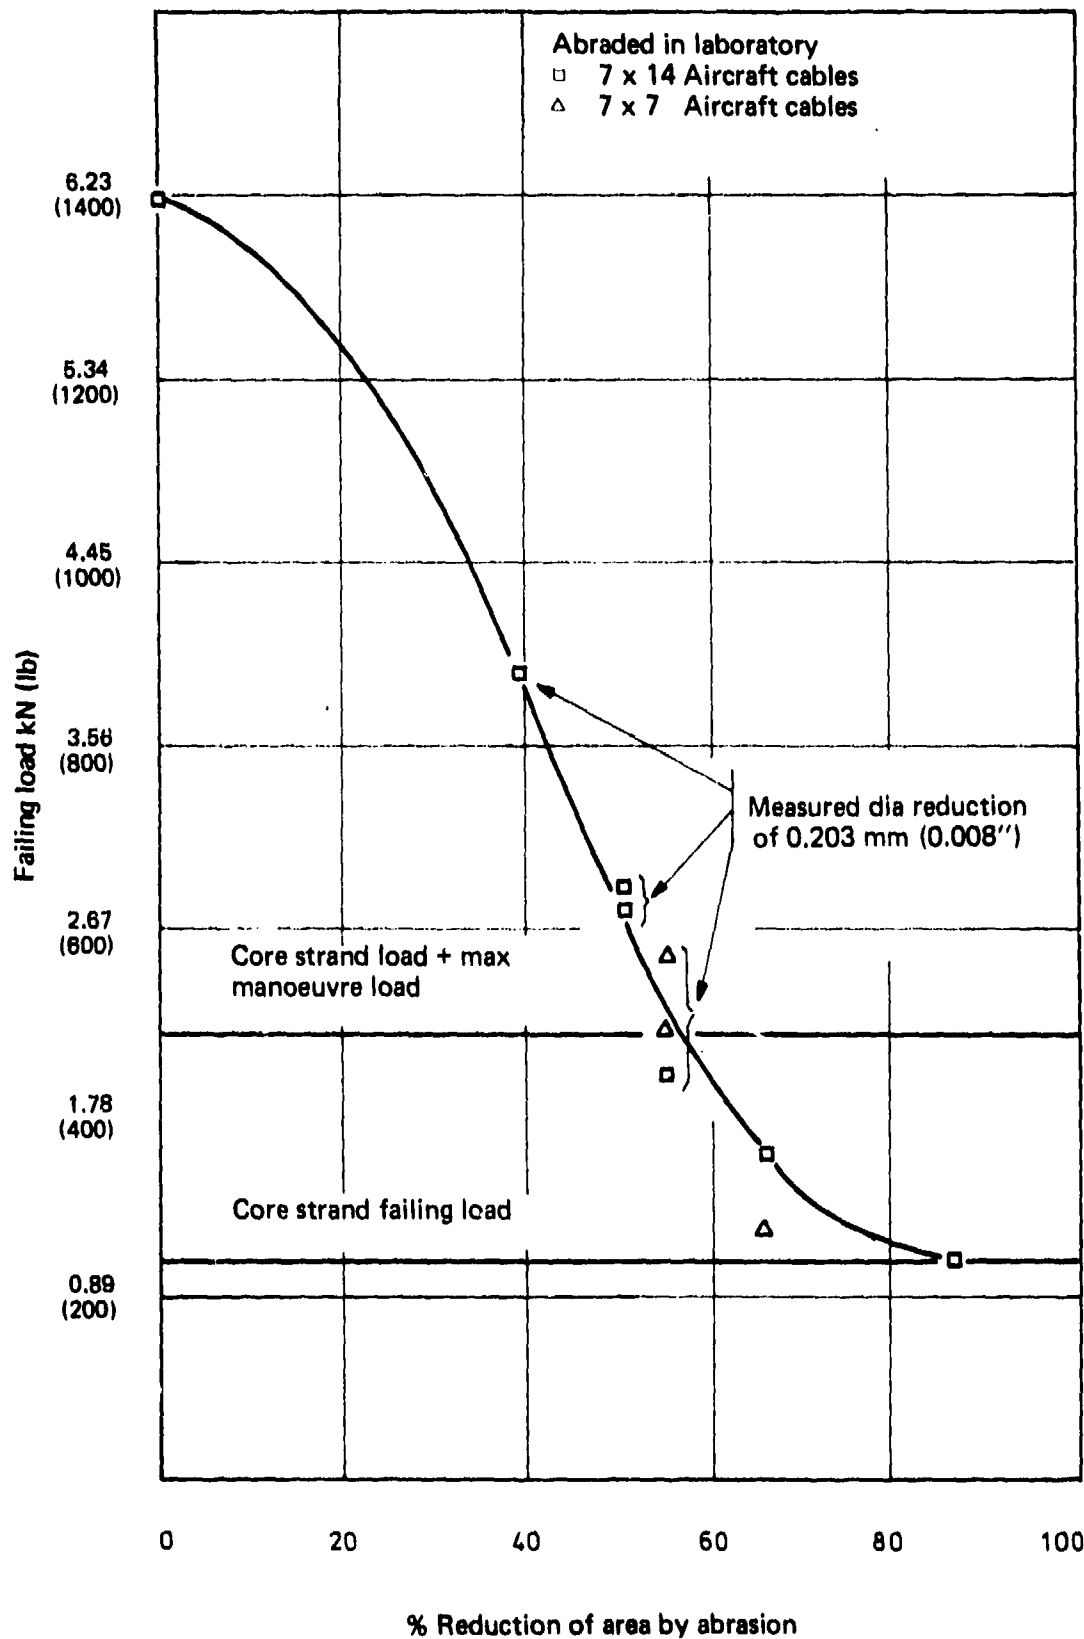


VARIATION OF FAILING LOAD WITH REDUCTION IN AREA OF CABLE.

(Extracted from ref.1)

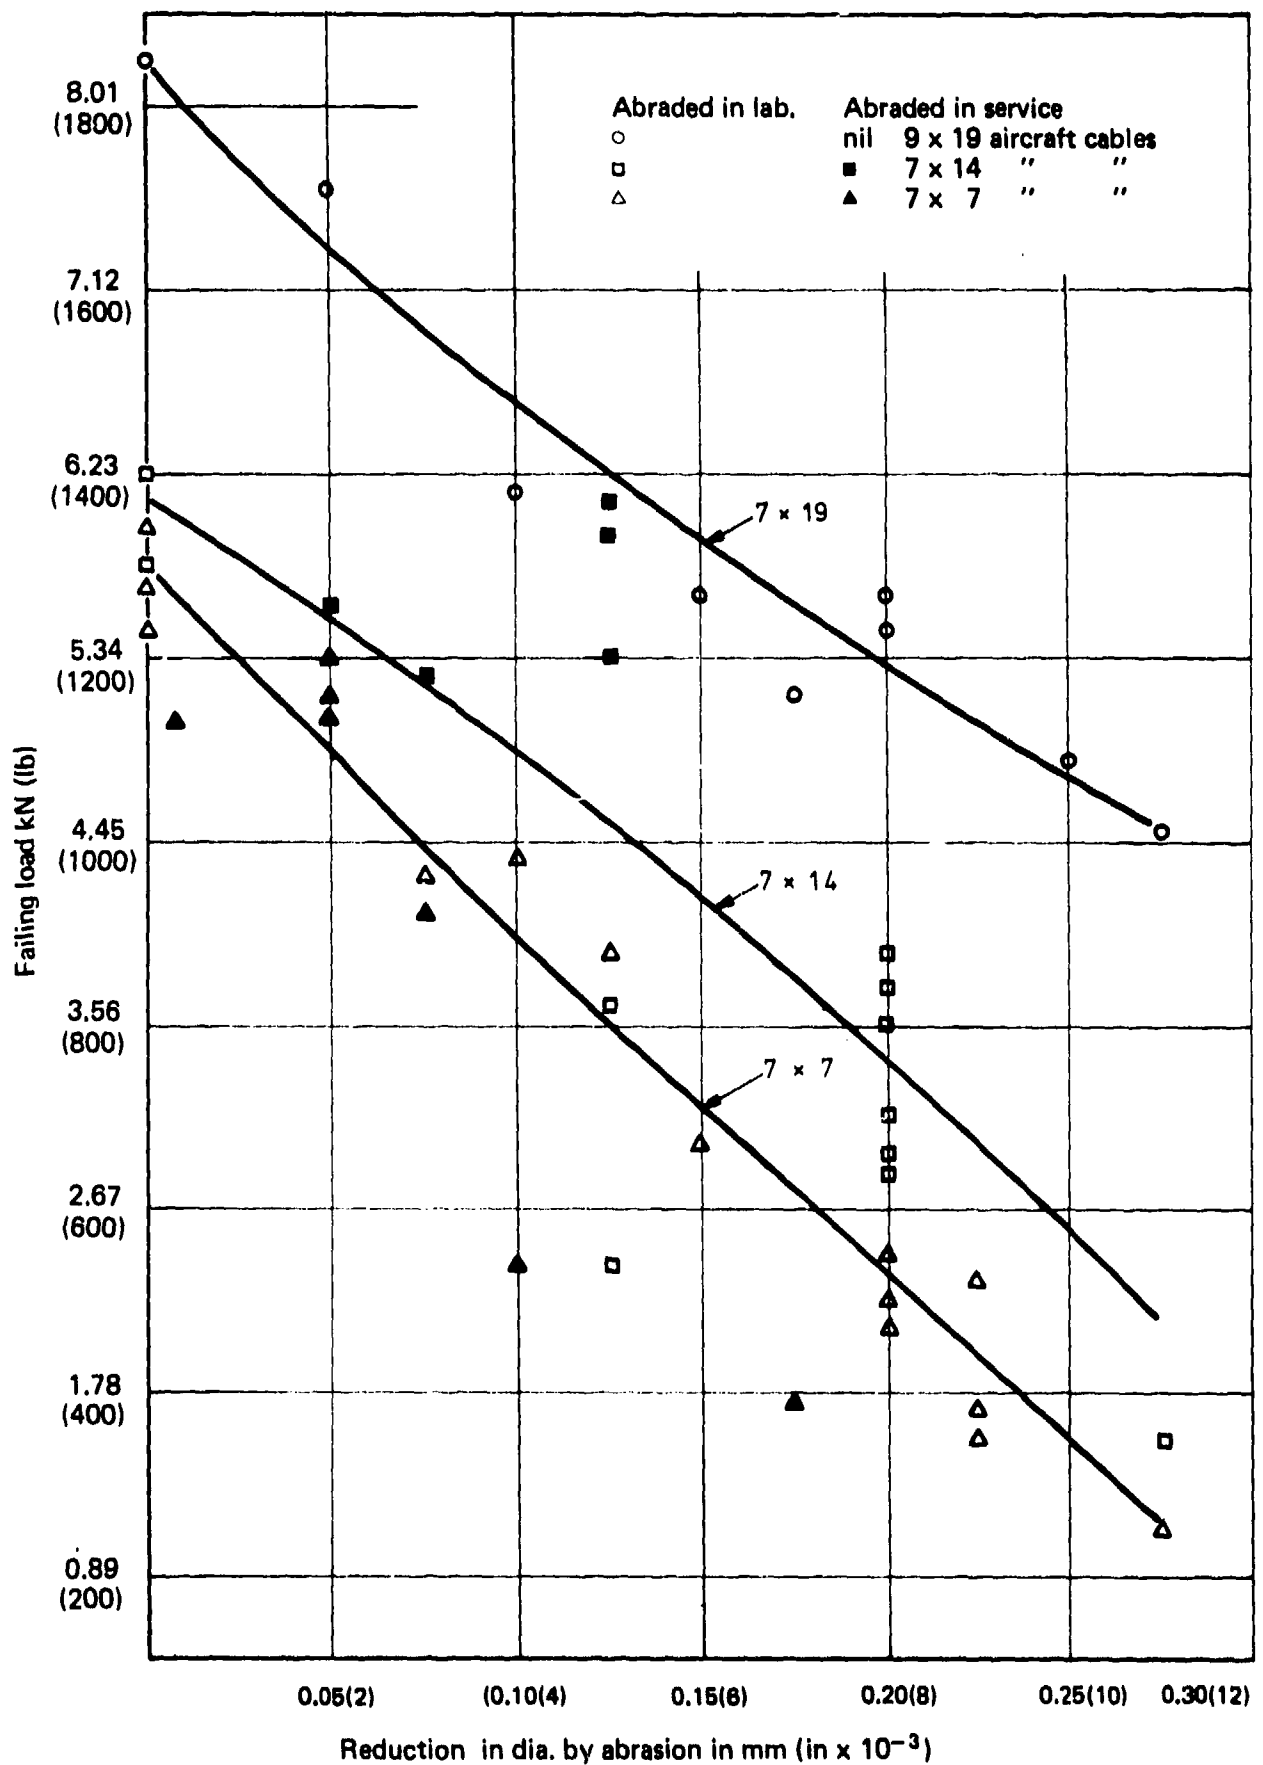

FAILING LOAD OF ABRAIDED CABLES ( Extracted from ref. 1.)


0.15 mm (0.006'') wear line

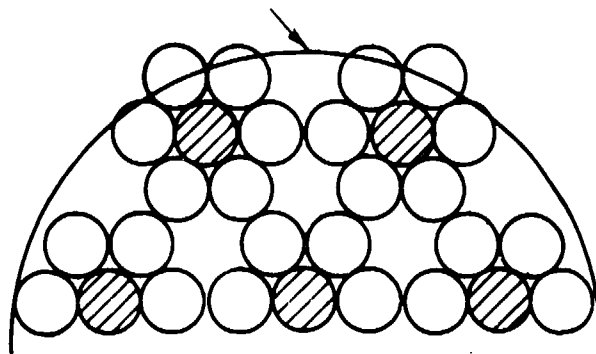

7 x 7

wire dia. 0.28 mm (0.011'')  
cable dia. 2.59 mm (0.102'')


0.15 mm (0.006'') wear line.

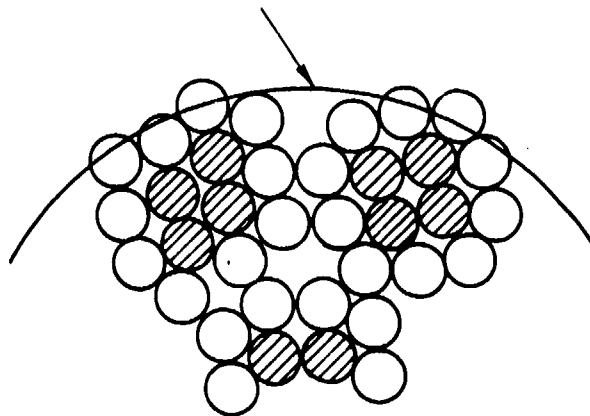

7 x 14

wire dia. 0.23 mm (0.009'')  
cable dia. 2.90 mm (0.114'')


0.15 mm (0.006'') wear line

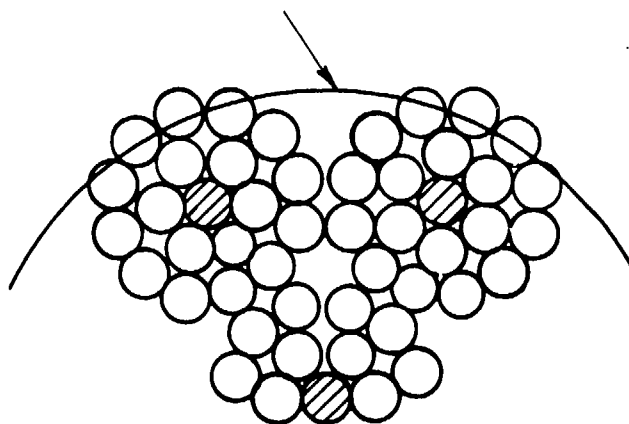

7 x 19

wire dia. 0.20 mm (0.008'')  
cable dia. 3.35 mm (0.132'')

WEAR ON INDIVIDUAL WIRES OF VARIOUS CABLES.

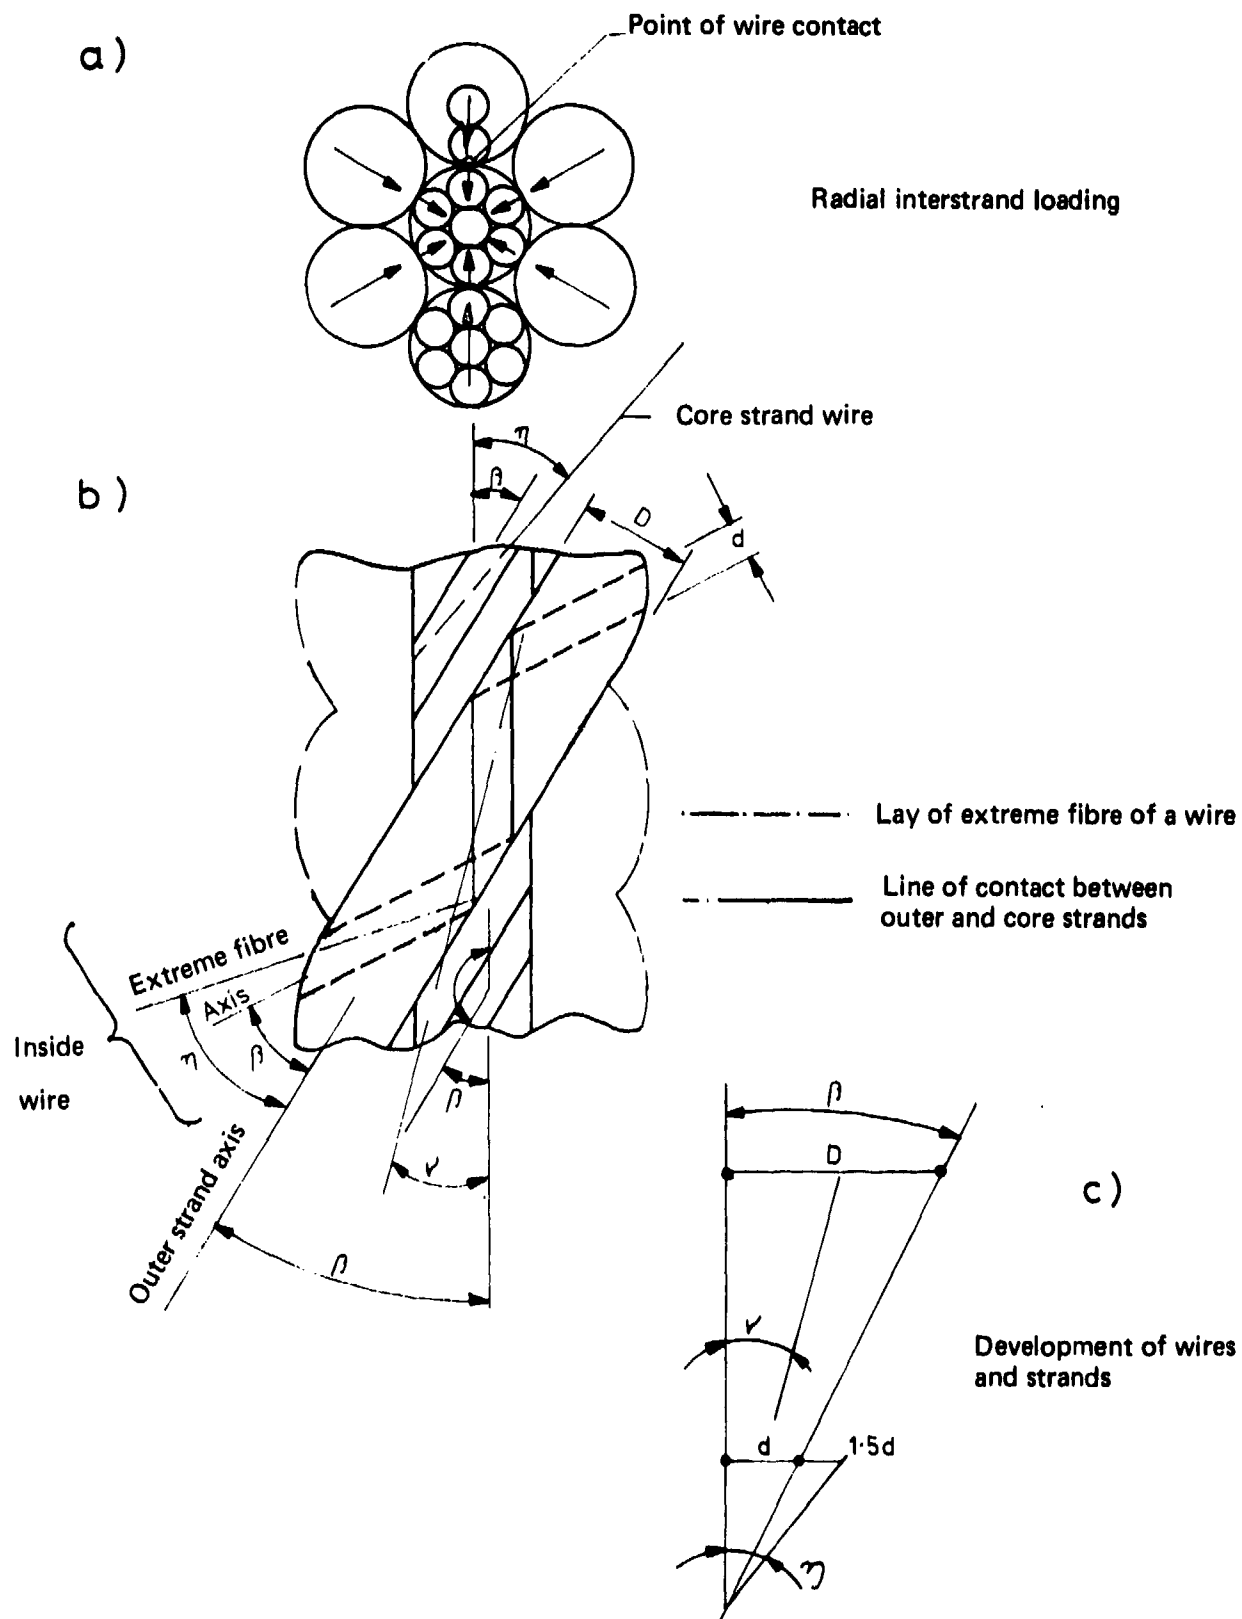

GEOMETRY OF 7 X 7 CABLE.

## DISTRIBUTION

Copy No.

### AUSTRALIA

#### DEPARTMENT OF DEFENCE

##### Central Office

|                                                                 |    |
|-----------------------------------------------------------------|----|
| Chief Defence Scientist                                         | 1  |
| Executive Controller ADSS                                       | 2  |
| Superintendent — Defence Science Administration                 | 3  |
| Superintendent — Assistant to Executive Controller ADSS         | 4  |
| Controller — Service Laboratories and Trials Division           | 5  |
| Controller — Military Studies and Operational Analysis Division | 6  |
| Controller — Programme Planning and Policy Division             | 7  |
| Central Library                                                 | 8  |
| S.T.I.B.                                                        | 9  |
| J.I.D.                                                          | 10 |

##### Aeronautical Research Laboratories

|                                      |    |
|--------------------------------------|----|
| Chief Superintendent                 | 11 |
| Superintendent — Structures Division | 12 |
| Structures Divisional File           | 13 |
| M.B. Benoy )                         | 14 |
| R.A. Fell ) Co-authors               | 15 |
| P.H. Townshend )                     | 16 |
| C.A. Patching                        | 17 |
| A.O. Payne                           | 18 |
| Library                              | 19 |

##### Central Studies Establishment

|         |    |
|---------|----|
| Library | 20 |
|---------|----|

##### Materials Research Laboratories

|                          |    |
|--------------------------|----|
| Library, Victoria        | 21 |
| Library, New South Wales | 22 |
| Library, South Australia | 23 |

##### Weapons Research Establishment

|         |    |
|---------|----|
| Library | 24 |
|---------|----|

##### Air Office

|                                      |       |
|--------------------------------------|-------|
| D. Air Eng                           | 25    |
| Air Force Scientific Adviser         | 26    |
| Library, Engineering (AMTS) Canberra | 27    |
| S.T.S.O., Support Command, H.Q.      | 28    |
| Library, A.R.D.U., Laverton          | 29    |
| SQN. LDR. Brock Bryce, Air Eng. 5B   | 30-40 |

##### Army Office

|                                                |    |
|------------------------------------------------|----|
| Army Scientific Adviser                        | 41 |
| Mr. Gardiner, Engineering Design Establishment | 42 |
| Library, Engineering Design Establishment      | 43 |
| The Bridges Library, Royal Military College    | 44 |
| U.S. Standardisation Group                     | 45 |

##### Navy Office

|                            |    |
|----------------------------|----|
| Naval Scientific Adviser   | 46 |
| Superintendent, R.A.N.R.L. | 47 |

## **DEPARTMENT OF MANUFACTURING INDUSTRY**

### **Government Aircraft Factory**

Library 48-49

## **DEPARTMENT OF TRANSPORT**

### **AIR TRANSPORT GROUP**

Director - General/ Library 50-80

Mr. P.S. Langford 81

### **QANTAS**

Library 82

### **TRANS-AUSTRALIA AIRLINES**

Library 83

### **ANSETT AIRLINES OF AUSTRALIA**

Library 84

### **GLIDING FEDERATION OF AUSTRALIA**

Essendon Airport 85-105

## **STATUTORY AUTHORITIES AND PRIVATE INDUSTRY**

Hawker de Havilland Pty. Ltd. 106-107

Hawker de Havilland Pty. Ltd. (Tech. Librarian) Bankstown 108

Hawker de Havilland Pty. Ltd. (Manager) Lidcombe 109

Commonwealth Aircraft Corporation 110

Commonwealth Aircraft Corporation (Manager) 111

Commonwealth Aircraft Corporation (Manager of Engineering) 112

Rolls-Royce of Australia Pty. Ltd. 113

Mr. Oliver 114

Library of New South Wales, 115

Acquisition Librarian 116

Edmund Schneider Ltd., South Australia 117

### **Universities**

Adelaide Barr Smith Library 118

Canberra Australian National Library 119

La Trobe Library 120

Melbourne Library, Engineering School 121

Monash Library 122

Newcastle Library 123

New England Library 124

New South Wales Library, School of Mechanical 125

Engineering 126

Queensland Library 127

James Cook (Qld.) Library 128

Sydney Professor G.A. Bird, Aeronautics 129

Tasmania Library, Engineering Department 130

West Australia Library 131

Royal Melbourne Institute of Technology 132

Library 133

## **CANADA**

National Research Council of Canada, Library 134

|                                                         |                                                     |         |
|---------------------------------------------------------|-----------------------------------------------------|---------|
| <b>Universities</b>                                     |                                                     |         |
| McGill                                                  | Library                                             | 130     |
| Toronto                                                 | Institute of Aerophysics                            | 131     |
| C.A.A.R.C.                                              | Co-ordinator Structures — Dr. G.R. Cowper           | 132     |
| <b>FRANCE</b>                                           |                                                     |         |
| A.G.A.R.D.                                              | Library                                             | 133     |
| O.N.E.R.A.                                              |                                                     | 134     |
| Service de Documentation et d'Information               |                                                     | 135     |
| <b>GERMANY</b>                                          |                                                     |         |
| Z.L.D.I.                                                |                                                     | 136-137 |
| <b>INDIA</b>                                            |                                                     |         |
| Ministry of Defence, Aero Development Est.              |                                                     | 138     |
| Department of Civil Aviation, Director                  |                                                     | 139     |
| Hindustan Aeronautics Ltd, Library                      |                                                     | 140     |
| Hindustan Aeronautics Ltd, Helicopter Factory, Library  |                                                     | 141     |
| Indian Institute of Science, Library                    |                                                     | 142     |
| Indian Institute of Technology, Library                 |                                                     | 143     |
| National Aeronautical Laboratory, Director              |                                                     | 144-145 |
| C.A.A.R.C.                                              | Co-ordinator Structures                             |         |
| Professor P.N. Murthy                                   |                                                     | 146-150 |
| C.A.R.C.                                                | Co-ordinator Materials                              |         |
| Dr. S. Ramaseshan                                       |                                                     | 151     |
| <b>ISRAEL</b>                                           |                                                     |         |
| Technion                                                | Israel Institute of Technology, Professor J. Singer | 152     |
| <b>ITALY</b>                                            |                                                     |         |
| Aerotechnica                                            | Editor                                              | 153     |
| <b>JAPAN</b>                                            |                                                     |         |
| National Aerospace Laboratory, Library                  |                                                     | 154     |
| <b>Universities</b>                                     |                                                     |         |
| Tohoku (Sendai)                                         | Library                                             | 155     |
| Tokyo                                                   | Institute of Space & Aero. Science                  | 156     |
| <b>NETHERLANDS</b>                                      |                                                     |         |
| N.L.R.                                                  | Director, Amsterdam                                 | 157     |
| Central Technical Institute, T.N.O.                     | Appledorn                                           | 158     |
| <b>NEW ZEALAND</b>                                      |                                                     |         |
| Air Department, R.N.Z.A.F. Aero. Documents Section      |                                                     | 159     |
| Department of Civil Aviation, Library                   |                                                     | 160     |
| University of Canterbury, Library                       |                                                     | 161     |
| <b>SWEDEN</b>                                           |                                                     |         |
| Aeronautical Research Institute                         |                                                     | 162     |
| Kung. Tekniska Hogskolans                               |                                                     | 163     |
| Library of Chalmers Institute of Technology, Gothenburg |                                                     | 163     |
| S.A.A.B. Linkoping, Library                             |                                                     | 165     |
| S.F.A.B. Trollbatten                                    |                                                     | 166     |

## UNITED KINGDOM

|                                                                |         |
|----------------------------------------------------------------|---------|
| Department of Manufacturing Industry,<br>Senior Representative | 167     |
| Defence Research Information Centre                            | 168-169 |
| Aeronautical Research Council, N.P.L., Secretary               | 170     |
| Royal Aircraft Establishment, Library, Farnborough             | 171-172 |
| Royal Aircraft Establishment, Library, Bedford                 | 173     |
| Aircraft & Armament Experimental Establishment                 | 174     |
| National Physical Labs., Aero. Divn. - Superintendent          | 175     |
| British Library, Science Reference Library<br>Holborn Divn.    | 176     |
| British Library, Lending Division, Boston Spa                  | 177     |
| C.A.A.R.C. Co-ordinator Structures<br>Mr. A.J. Sobey, R.A.E.   | 178     |

### Industry

|                                                                              |     |
|------------------------------------------------------------------------------|-----|
| Aircraft Research Association, Library, Bedford                              | 179 |
| Rolls Royce (1971) Ltd, Aero. Divn. Chief Librarian, Derby                   | 180 |
| Rolls Royce (1971) Ltd, Bristol Siddeley Div. T.R. & L.,<br>Library Services | 181 |

### Aircraft Companies

|                                                                          |     |
|--------------------------------------------------------------------------|-----|
| Hawker Siddeley Aviation Ltd., Brough                                    | 182 |
| Hawker Siddeley Aviation Ltd., Greengate                                 | 183 |
| Hawker Siddeley Aviation Ltd., Kingston Upon - Thames                    | 184 |
| Hawker Siddeley Aviation Ltd., Hatfield                                  | 185 |
| British Aircraft Corporation Ltd.<br>Commercial A/c. Divn. Filton        |     |
| British Aircraft Corporation Ltd.<br>Military A/c. Preston               | 186 |
| British Aircraft Corporation Ltd.<br>Commercial Aviation Divn. Weybridge | 187 |
| British Hovercraft Corporation Ltd., E. Cowes                            | 188 |
| Fairy Engineering Ltd, Hydraulic Divn. Heston                            | 189 |
| Short Bros. & Harland, Queens Island, Belfast                            | 190 |
| Westland Helicopters Ltd, Yeovil                                         | 200 |

### Universities

|             |                                                       |     |
|-------------|-------------------------------------------------------|-----|
| Bristol     | Engineering Department, Library                       | 201 |
| Cambridge   | Engineering Department, Library                       | 202 |
| Liverpool   | Fluid Mechanics Department,<br>Professor J.H. Preston | 203 |
| London      | Queens College, Professor A.D. Young                  | 204 |
| Manchester  | Professor of Applied Mathematics                      | 205 |
| Nottingham  | Library                                               | 206 |
| Sheffield   | Department of Fuel Technology,<br>Library             | 207 |
| Southampton | Library                                               | 208 |
| Strathclyde | Glasgow, Professor D.C. Pack                          | 209 |

|                                                 |         |
|-------------------------------------------------|---------|
| INTERNATIONAL COMMITTEE OF AERONAUTICAL FATIGUE | 210-232 |
|-------------------------------------------------|---------|

## UNITED STATES OF AMERICA

|                                                                |     |
|----------------------------------------------------------------|-----|
| Counsellor Defence Science                                     | —   |
| Aerospace Research Labs.,<br>Wright Patterson A.F.B. Ohio      | 233 |
| Airforce Flight Dynamics Lab.<br>Wright Patterson, A.F.B. Ohio | 234 |
| Arnold Engineering Development Center,                         |     |

|                                                                      |                |
|----------------------------------------------------------------------|----------------|
| Arnold Airforce Station, Tennessee                                   | 235            |
| National Technical Information Service,<br>Springfield               | 236            |
| Library of Congress, Gift & Exchange Dept.<br>Washington D.C.        | 237            |
| Library, National Bureau of Standards,<br>Washington D.C.            | 238            |
| N.A.S.A. Scientific & Information Facility,<br>College Park          | 239            |
| N.A.S.A. Research Center, Cleveland. Mr. S. Leiblein                 | 240            |
| American Institute of Aeronautics & Astronautics                     | 241            |
| Applied Mechanics Reviews                                            | 242            |
| Allis Chalmers Inc. Milwaukee, Director                              | 243            |
| Boeing Co. Seattle, Head Office                                      | 244            |
| Boeing Com Seattle, Industrial Production Division                   | 245            |
| Cessna Aircraft Co. Mr. D.W. Mallinee Executive Eng.                 | 246            |
| General Electric, West Lynn, Mass.<br>Aircraft Engine Group          | 247            |
| Lockheed Research Labs., Sunnyvale, Calif.<br>Palo Alto              | 248            |
| Lockheed Aircraft Co. Burbank, Calif. Director                       | 249            |
| McDonnell Douglas Corporation, St. Louis. Director                   | 250            |
| Pratt & Whitney Aircraft Div.<br>United Aircraft Corp. E. Hartford   | 251            |
| <b>Universities</b>                                                  |                |
| Arizona Department of Civil Eng.                                     | 252            |
| Brown Documents Division, Library                                    | 253            |
| California Documents Dept. General Library                           | 254            |
| Columbia Library                                                     | 255            |
| <b>Universities</b>                                                  |                |
| Cornell New York, Library, Aero. Labs.                               | 256            |
| Cornell Ithaca, Library                                              | 257            |
| Florida Documents Dept. Library                                      | 258            |
| Harvard Division of Eng. & Applied Maths.,<br>Professor A.F. Carrier | 259            |
| John Hopkins Library                                                 | 260            |
| Illinois Library                                                     | 261            |
| Iowa State Univ. of Sci. & Tech.,<br>G.K. Sekory                     | 262            |
| Massachusetts Library                                                | 263            |
| New York Library                                                     | 264            |
| Notre Dame Library                                                   | 265            |
| Princeton Library                                                    | 266            |
| Rhode Island Library                                                 | 267            |
| Stanford Department of Aeronautics, Library                          | 268            |
| Geo. Washington Professor Fruedenthal                                | 269            |
| Wisconsin Serials Department, Memorial<br>Library                    | 270            |
| <b>Institutes of Technology</b>                                      |                |
| Brooklyn Polytech. Aero. Labs., Library                              | 271            |
| California Guggenheim Aero. Labs., Library                           | 272            |
| Illinois (Memorial Inst.) Library                                    | 273            |
| Massachusetts Library                                                | 274            |
| <b>Spares</b>                                                        | <b>275-285</b> |