

REFERENCE COPY
DOES NOT CIRCULATE

ARMY RESEARCH LABORATORY



Battle Damage Assessment Telemeter (BDAT) System Impact Test

by Eugene M. Ferguson, John A. Condon,
and David N. Vazquez

ARL-MR-398

May 1998

The findings in this report are not to be construed as an official Department of the Army position unless so designated by other authorized documents.

Citation of manufacturer's or trade names does not constitute an official endorsement or approval of the use thereof.

Destroy this report when it is no longer needed. Do not return it to the originator.

Army Research Laboratory

Aberdeen Proving Ground, MD 21005-5066

ARL-MR-398

May 1998

Battle Damage Assessment Telemeter (BDAT) System Impact Test

Eugene M. Ferguson, John A. Condon, David N. Vazquez
Weapons and Materials Research Directorate, ARL

Approved for public release; distribution is unlimited.

Abstract

This report describes the live-fire testing (LFT) that was performed by the Advanced Munitions Concepts Branch (AMCB) of the U.S. Army Research Laboratory (ARL) and the Fuzes Technology Branch (WM/MNMF) at Eglin Air Force Base, FL, in support of the Battle Damage Assessment Telemeter (BDAT) project. In this testing, three aluminum canisters were instrumented with an ARL p-band telemetry system. Each canister was inserted into the aft end of a penetrator vehicle and launched from a gun into a 1-ft-thick concrete target 500 ft from the gun muzzle. The objective of this testing was to determine if the telemetry system would be able to operate during the high shock of impacting a concrete target. The data acquired from these tests were less than ideal. The amount of noise present in the data was a result of the weak RF link between the telemetry and receiving antennas and the broad-band noise near the transmitter frequency. Since the subcarrier oscillator was detected on all the canisters after impact, the telemetry components, other than the antenna that was damaged in each of the three tests, will survive multiple shocks caused by launch and impact.

Table of Contents

	<u>Page</u>
List of Figures	v
1. Introduction	1
2. Objective	1
3. Test Plan	1
4. Field Test	2
5. Results	6
6. Conclusion	6
Distribution List	9
Report Documentation Page	11

INTENTIONALLY LEFT BLANK.

List of Figures

<u>Figure</u>		<u>Page</u>
1.	Mechanical Drawing of the Telemetry Canister Inserted in the Projectile	3
2.	Insertion of Telemetry Canister Into Projectile	4
3.	Approximate Positions of the Gun, Target, and Antennas	5
4.	Canister No. 1 Reduced Subcarrier Data	7
5.	Canister No. 3 Reduced Subcarrier Data	8

INTENTIONALLY LEFT BLANK.

1. Introduction

This report describes the live-fire testing (LFT) performed by the Advanced Munitions Concepts Branch (AMCB), Weapons Concepts Division, Weapons and Materials Research Directorate, U.S. Army Research Laboratory (ARL), and support provided by the Fuzes Technology Branch, Wright Laboratory (WL)/MNMF, Eglin Air Force Base, FL, of the Battle Damage Assessment Telemeter (BDAT) project. Testing was done during the week of 13 October 1997 at Eglin Air Force Base.

2. Objective

The object of this test was to determine if the ARL p-band telemetry system would be able to operate during the high shock of impacting a concrete target.¹

3. Test Plan

Three aluminum canisters were instrumented with an ARL p-band telemetry system. The telemetry system utilized a nicad (nickel-cadmium) battery power supply, a signal-conditioning circuit (sensor input), a subcarrier oscillator, a transmitter, and an antenna. Each canister was to be screwed into the aft end of a penetrator vehicle and launched from a modified 155-mm howitzer (with a 170-mm smoothbore, 600–800-ft/s muzzle velocity, and 6–10-ksi breech pressure at launch) into a 1-ft-thick concrete target 500 ft from the gun muzzle. One canister had an Endevco 7072A accelerometer to sense shock. The other two had no accelerometer, but had the same electronic circuitry as the sensed canister. The sensor inputs in the two nonsensed canisters were wired to a constant reference voltage instead of an accelerometer. The telemetry receiving station would monitor and record data transmitted from the canisters. Data from the nonsensed units would

¹ Ferguson, E., and D. Vazquez. "Battle Damage Assessment Telemeter RF Link Characterization Test." ARL-MR-344, U.S. Army Research Laboratory, Aberdeen Proving Ground, MD, April 1997.

serve as a baseline, and the sensed unit would provide shock information during impact. Figures 1 and 2 show the telemetry canister and how it interfaces with the projectile. (Total canister/projectile mass at launch was approximately 50 lb_m.)

Anechoic chamber measurements taken after the canisters were assembled revealed that insufficient radio frequency (RF) power radiated from them when they were placed in the penetrator vehicle. This was contrary to the measurements taken prior to assembly. ARL designed and retrofit an antenna that would allow sufficient, albeit marginal, RF power to be radiated from the units. This new antenna configuration was shock tested and survived 21,000 g when inclined 10° off axis.

4. Field Test

The gun, target, and telemetry receiving antennas were positioned approximately as shown in Figure 3. A telemetry canister was turned on, fitted into a penetrator and placed at several points along the line of fire to check the RF link. The amount of activity in the band and the relatively low RF power radiating from the canister made it difficult but not impossible to tune to the test unit. An adequate link was achieved through the entire line of fire.

When a canister was about to be launched, it was first turned on near the receive antennas so that the telemetry receivers could be tuned to it more easily. The canister was then screwed into the penetrator and taken to the gun for loading. The gun shielded the RF energy from the receiving antennas when the penetrator was loaded. The RF link would be re-established once the penetrator left the gun muzzle.

The first canister launched, canister no. 1, did not have an accelerometer onboard. This unit fell short and bounced off the ground into the target. Although it hit the target, it did not penetrate it. Data were telemetered and received during its flight. When the unit was retrieved, it was apparent that about 1 inch of the rearward facing antenna tip had been broken off. The telemetry system, after

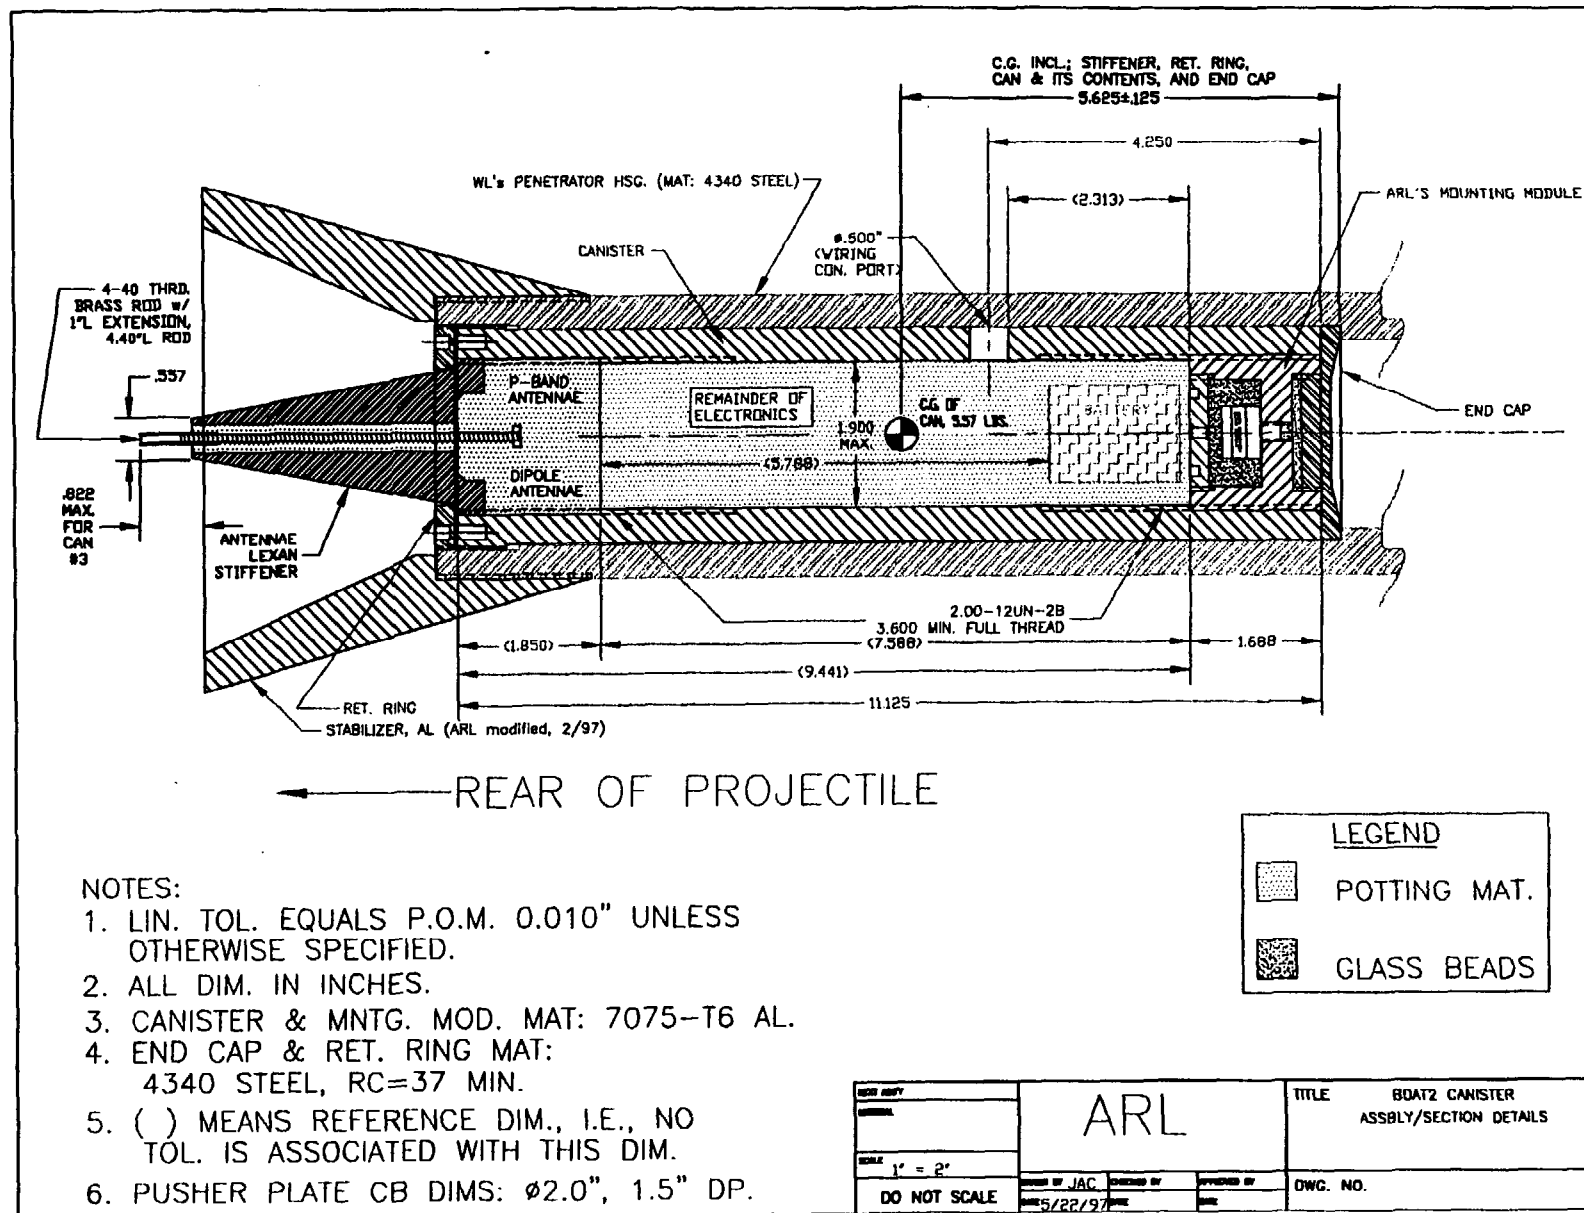


Figure 1. Mechanical Drawing of the Telemetry Canister Inserted in the Projectile.


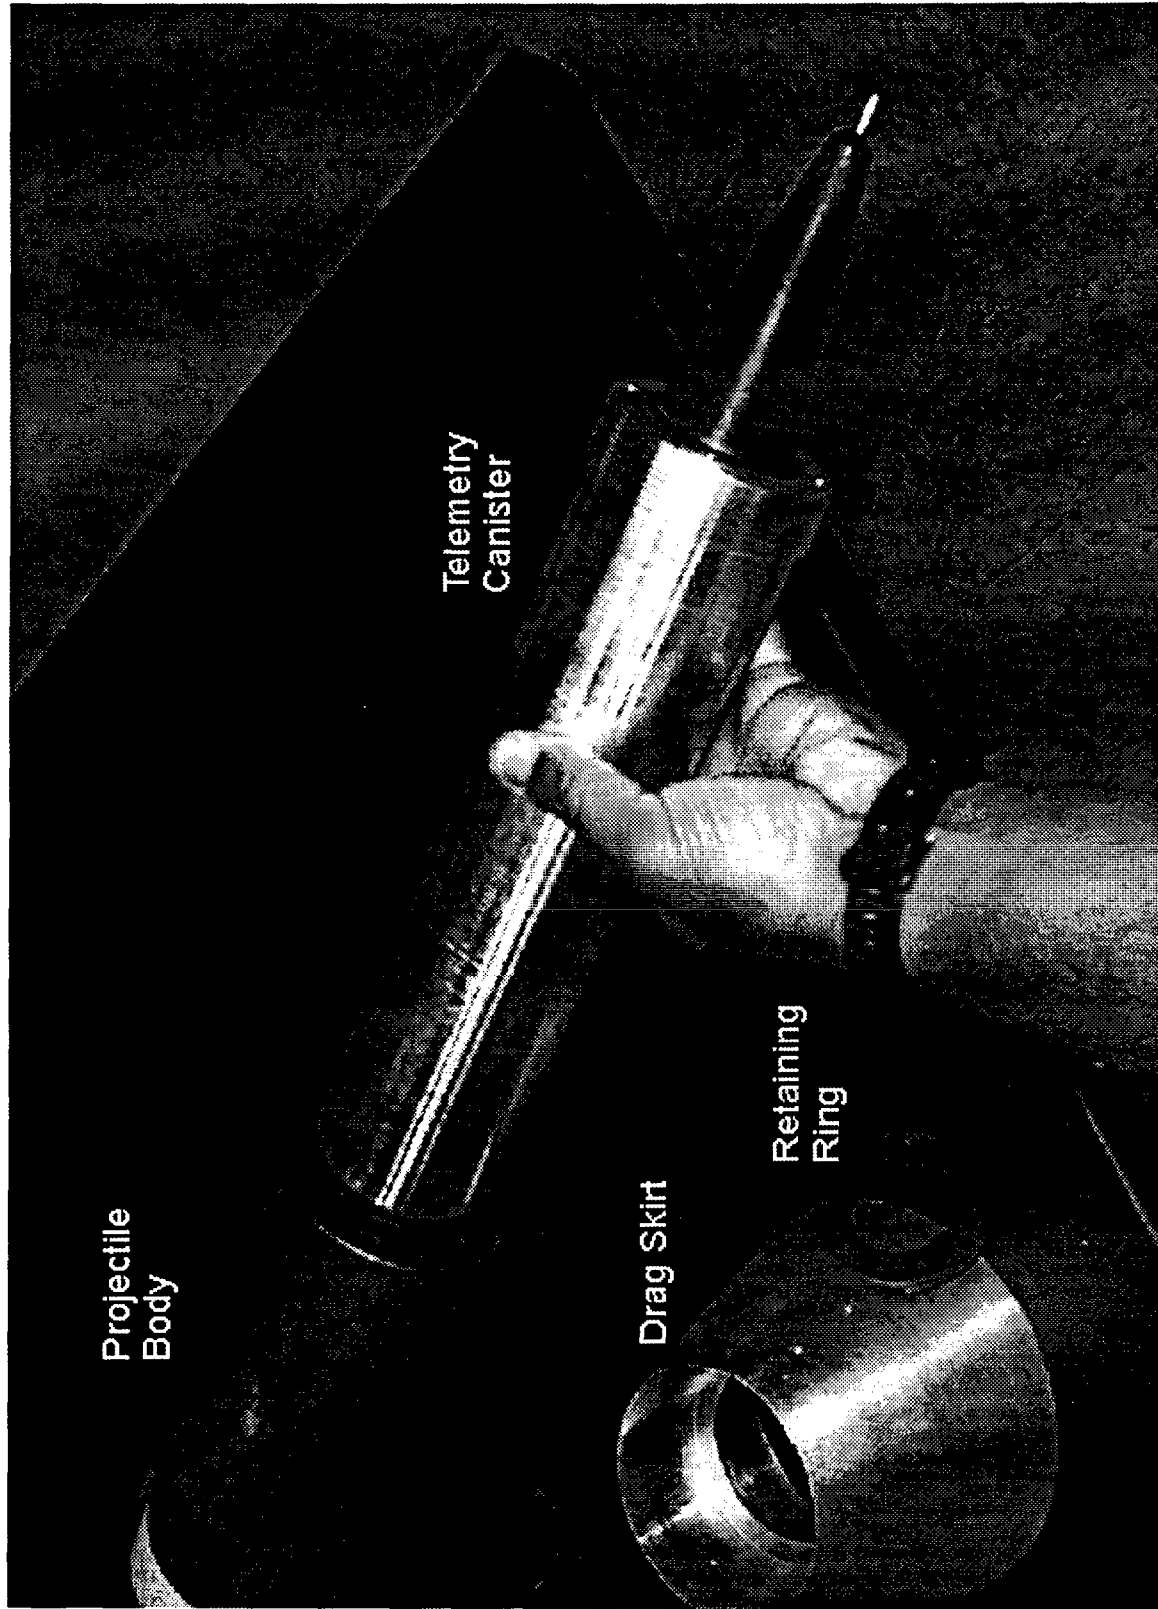


Figure 2. Insertion of Telemetry Canister Into Projectile.

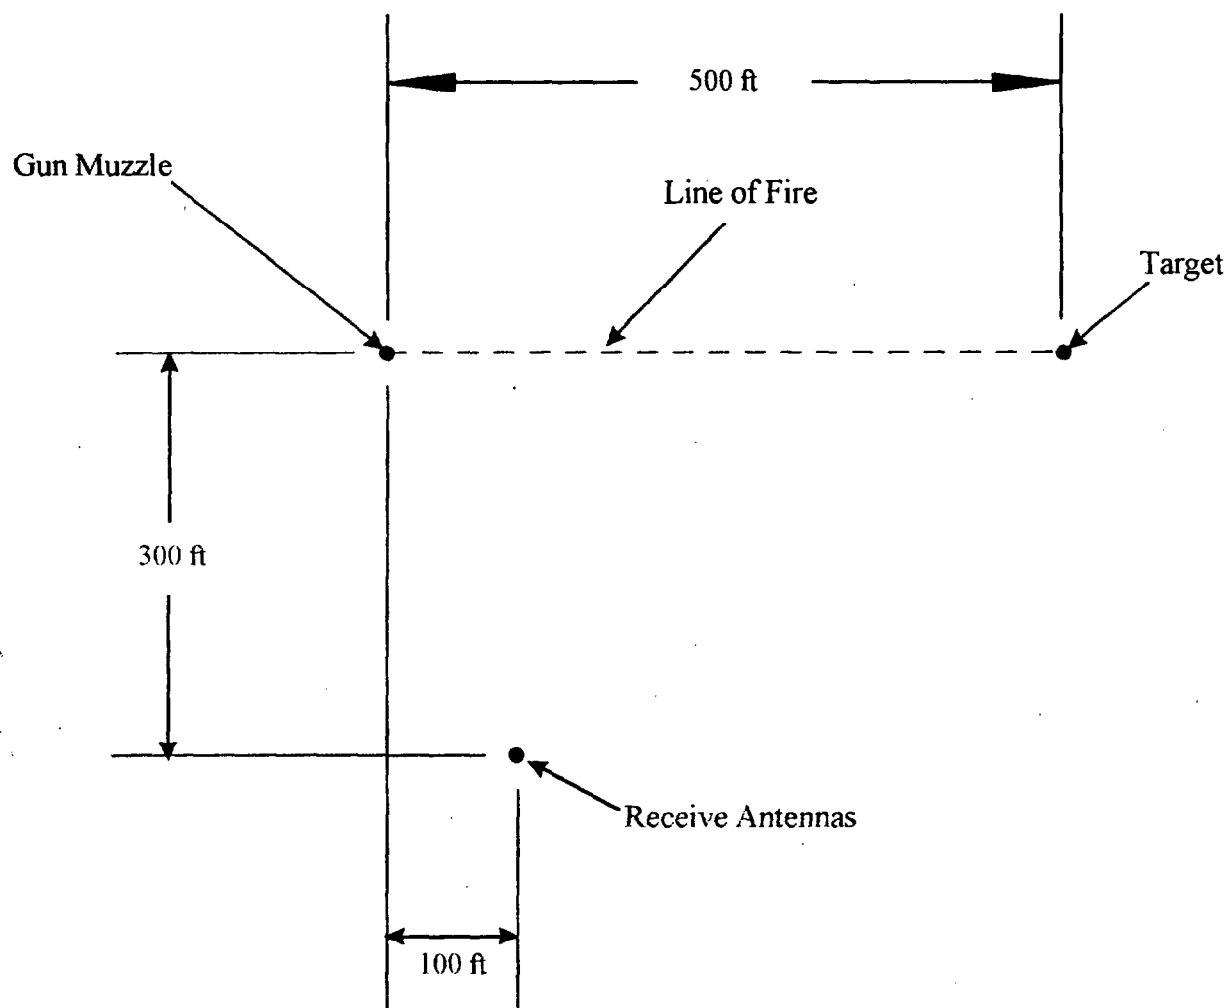

Not to scale

Figure 3. Approximate Positions of the Gun, Target, and Antennas.

recovery, still had enough RF power to be received when brought close to the receiving station, and the subcarrier oscillator was working.

Canister no. 2 was fired next. This unit had no accelerometer either, but it did hit and penetrate the target. Unfortunately, the receiving station was not able to acquire any data from this unit during its flight. The antenna tip had broken off just as it did on canister no. 1. The telemetry system was checked after retrieval, and it was still working.

The final unit, canister no. 3, had an accelerometer onboard. This unit hit and penetrated the target. Data were transmitted and received during its flight. As with the previous units, this one also had a broken antenna tip. The telemetry system was found to be working after impact as well.

5. Results

Data were acquired and analyzed for canisters no. 1 and no. 3 only. The received subcarrier oscillator data were processed to obtain the plots shown in Figures 4 and 5. Since data were acquired in-flight, it was inferred that the antenna tips broke during impact with the concrete target. The radar data were used to establish the time base, and it was assumed that the radar lost track at target impact. High-frequency pulses appear in the plots pre- and post-impact, but they are believed to be noise. Canister no. 3's lower frequency pulse at impact has characteristics different from the surrounding noise pulses and could contain the partial leading edge of the accelerometer pulse. If some accelerometer data were transmitted prior to antenna failure, as this may suggest, then evidence exists that the telemetry system was able to transmit data during the high-shock event.

6. Conclusion

The data acquired from this test were less than ideal. The amount of noise in the data is a result of the weak RF link between the telemetry and receiving antennas and the broad-band noise near the transmitter frequency. The transmitting antenna was designed and shock-table tested to withstand 21,000 g's of shock 10° off axis. Shock-table tests performed after the gun-launch test showed that the antenna could withstand over 28,000 g's of shock 10° off axis. Perhaps the actual shock levels exceeded the tested limits [in peak and/or duration] and caused the failure. The data presented here do not offer a definitive answer to the robustness of the telemetry components under high shock. The data are just too noisy, but those extracted near the time of impact do suggest that the telemetry system could transmit data during a high-shock event if the antenna could survive. Since the subcarrier oscillator was detected on all the canisters after impact, we now know that the telemetry components other than the antenna will survive multiple shocks caused by launch and impact.

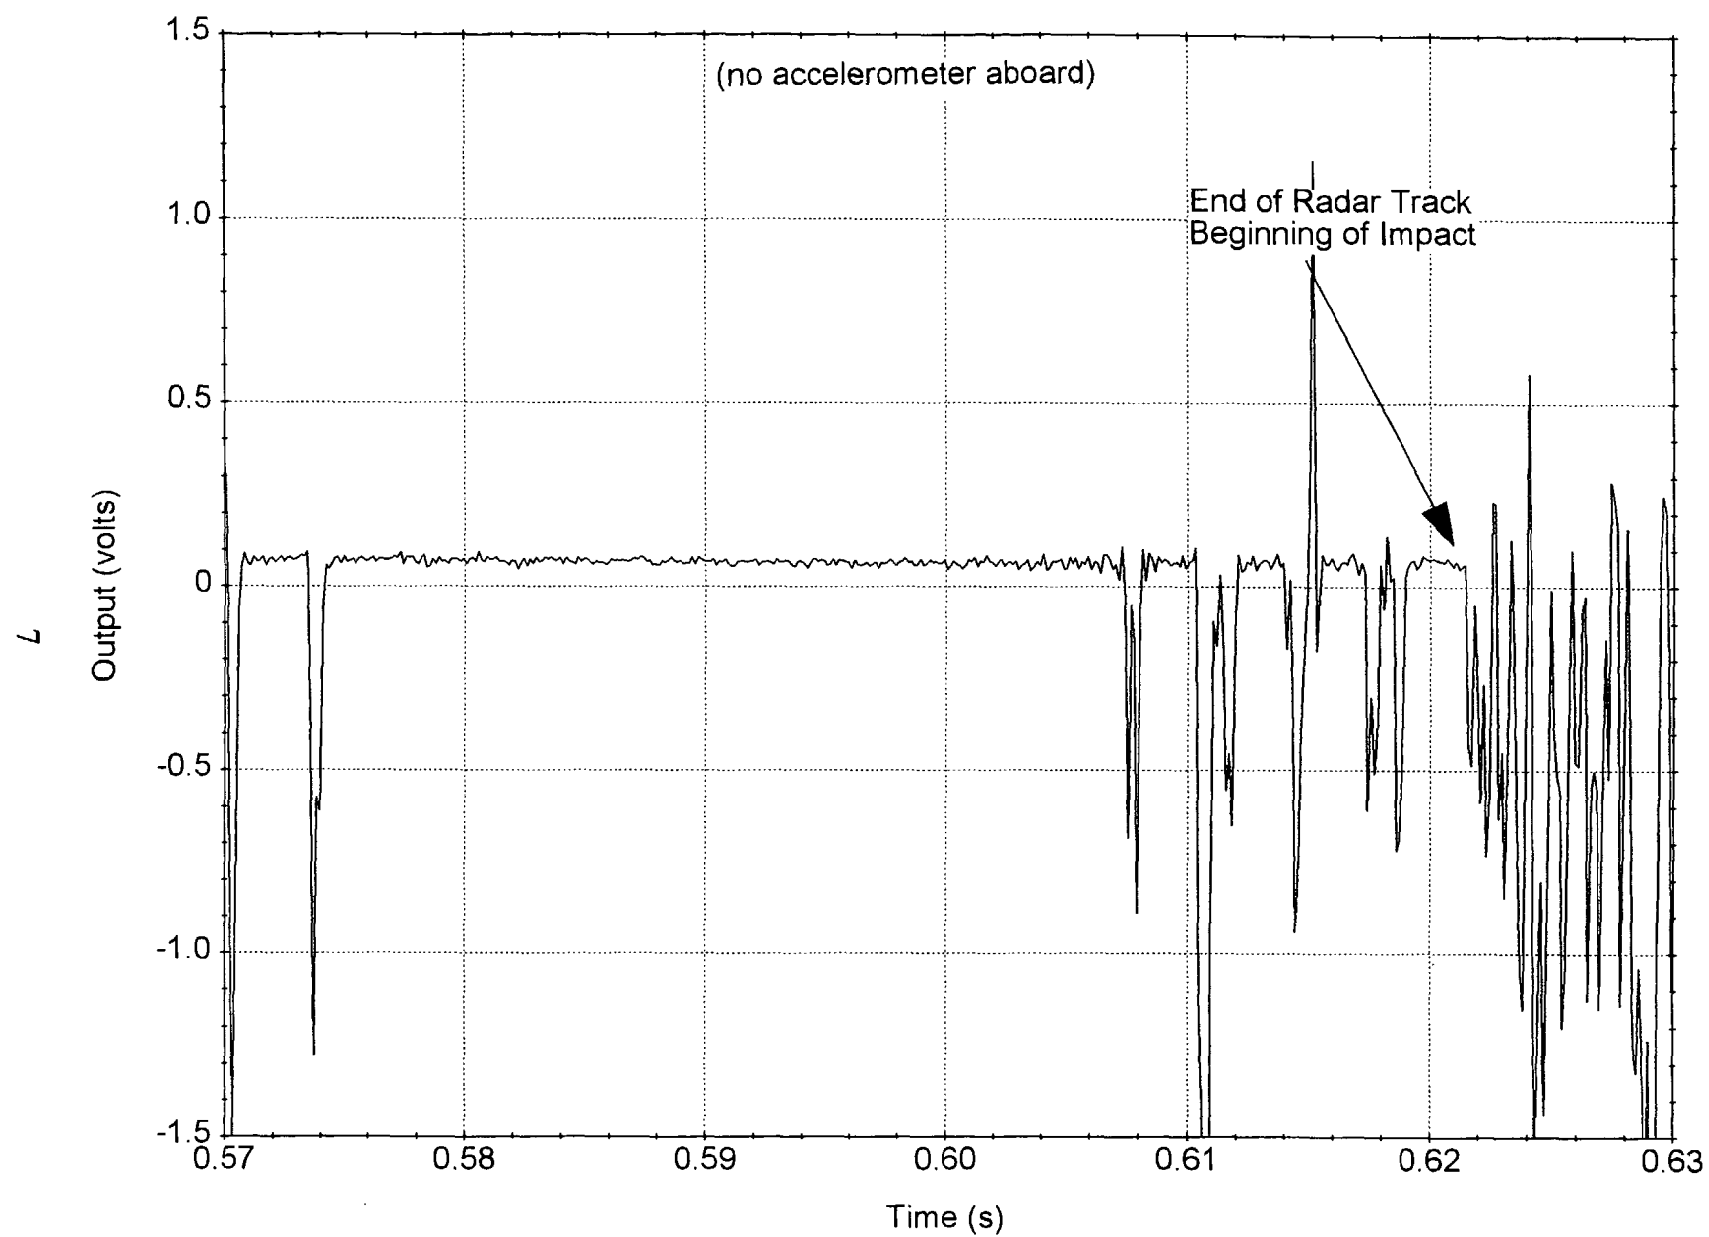


Figure 4. Canister No. 1 Reduced Subcarrier Data.

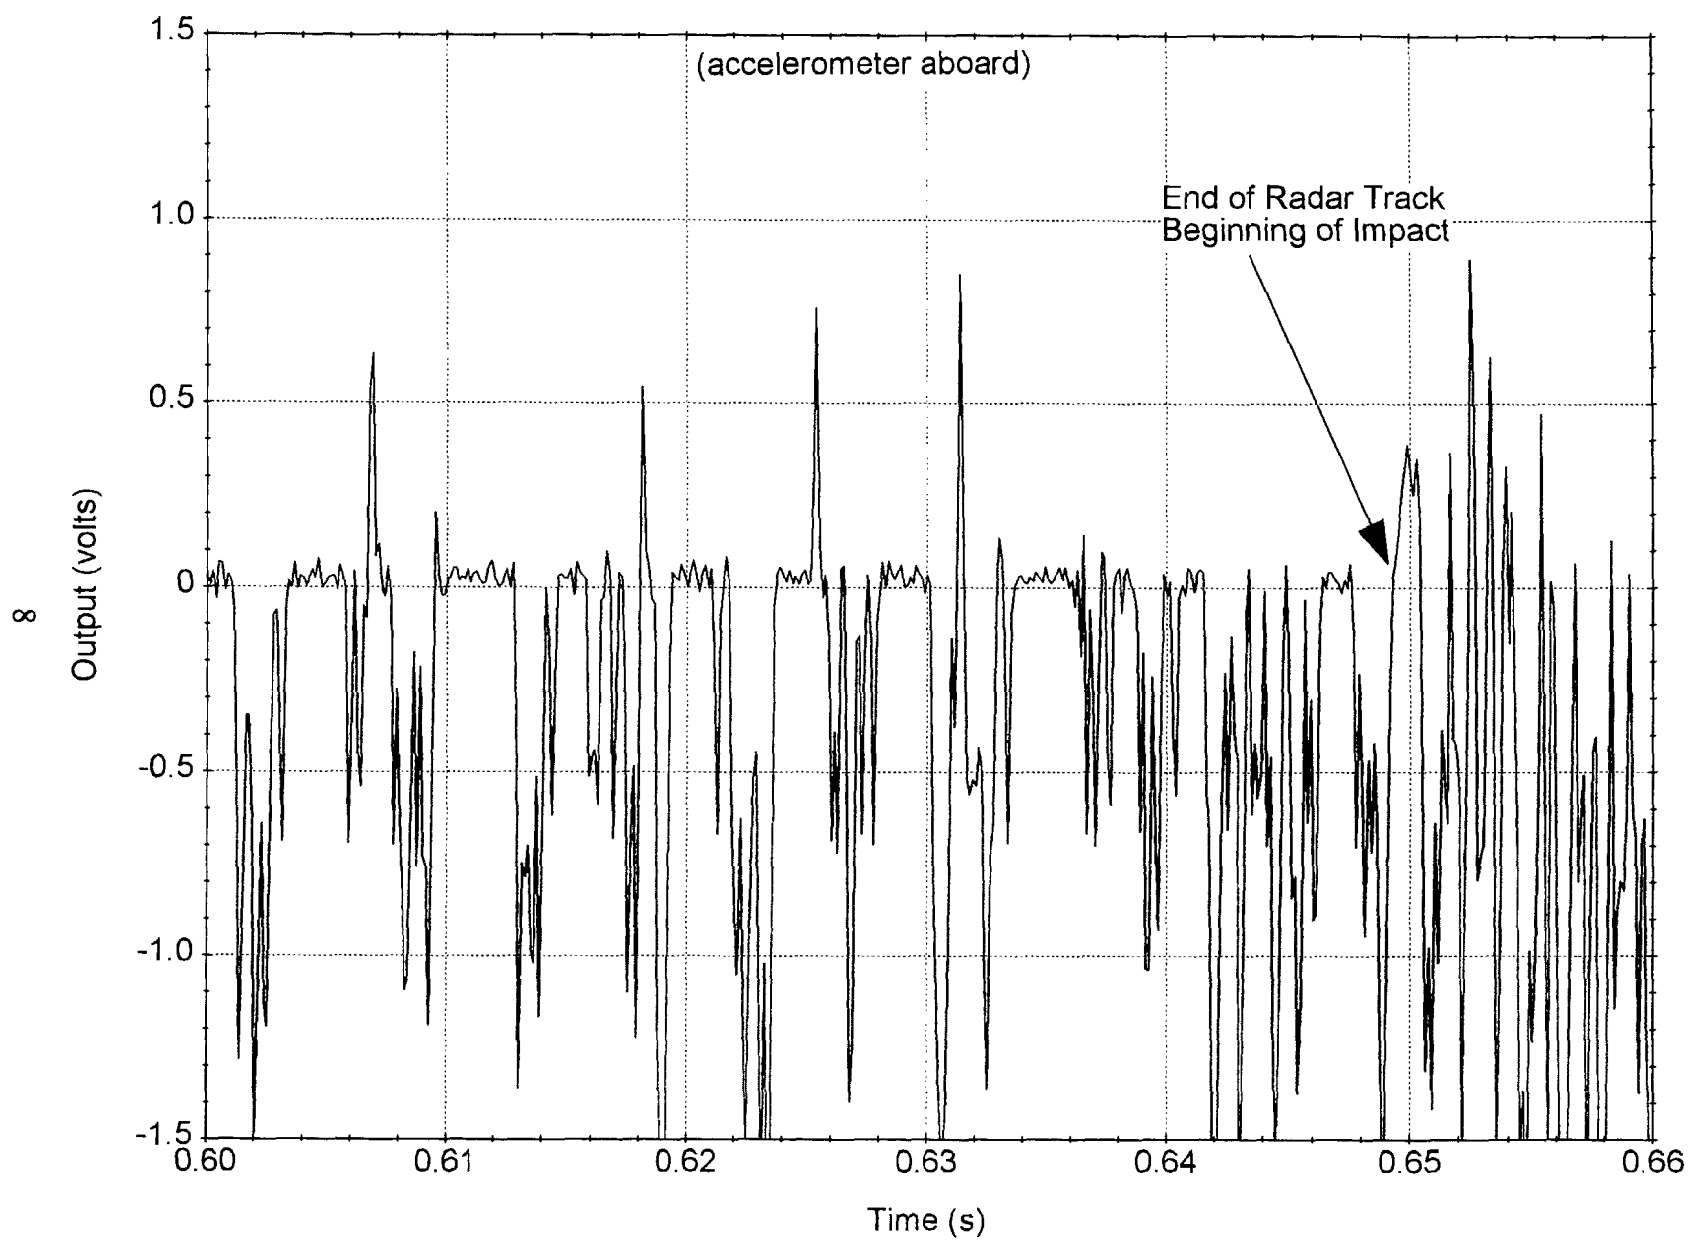


Figure 5. Canister No. 3 Reduced Subcarrier Data.

NO. OF
COPIES ORGANIZATION

2 DEFENSE TECHNICAL
INFORMATION CENTER
DTIC DDA
8725 JOHN J KINGMAN RD
STE 0944
FT BELVOIR VA 22060-6218

1 HQDA
DAMO FDQ
DENNIS SCHMIDT
400 ARMY PENTAGON
WASHINGTON DC 20310-0460

1 DPTY ASSIST SCY FOR R&T
SARD TT F MILTON
RM 3EA79 THE PENTAGON
WASHINGTON DC 20310-0103

1 OSD
OUSD(A&T)/ODDDR&E(R)
J LUPO
THE PENTAGON
WASHINGTON DC 20301-7100

1 CECOM
SP & TRRSTR L COMMCTN DIV
AMSEL RD ST MC M
H SOICHER
FT MONMOUTH NJ 07703-5203

1 PRIN DPTY FOR TCHNLGY HQ
US ARMY MATCOM
AMCDCG T
M FISETTE
5001 EISENHOWER AVE
ALEXANDRIA VA 22333-0001

1 DPTY CG FOR RDE HQ
US ARMY MATCOM
AMCRD
BG BEAUCHAMP
5001 EISENHOWER AVE
ALEXANDRIA VA 22333-0001

1 INST FOR ADVNCD TCHNLGY
THE UNIV OF TEXAS AT AUSTIN
PO BOX 202797
AUSTIN TX 78720-2797

NO. OF
COPIES ORGANIZATION

1 GPS JOINT PROG OFC DIR
COL J CLAY
2435 VELA WAY STE 1613
LOS ANGELES AFB CA 90245-5500

1 ELECTRONIC SYS DIV DIR
CECOM RDEC
J NIEMELA
FT MONMOUTH NJ 07703

3 DARPA
L STOTTS
J PENNELLA
B KASPAR
3701 N FAIRFAX DR
ARLINGTON VA 22203-1714

1 US MILITARY ACADEMY
MATH SCI CTR OF EXCELLENCE
DEPT OF MATHEMATICAL SCI
MDN A MAJ DON ENGEN
THAYER HALL
WEST POINT NY 10996-1786

1 DIRECTOR
US ARMY RESEARCH LAB
AMSRL CS AL TP
2800 POWDER MILL RD
ADELPHI MD 20783-1145

1 DIRECTOR
US ARMY RESEARCH LAB
AMSRL CS AL TA
2800 POWDER MILL RD
ADELPHI MD 20783-1145

3 DIRECTOR
US ARMY RESEARCH LAB
AMSRL CI LL
2800 POWDER MILL RD
ADELPHI MD 20783-1145

ABERDEEN PROVING GROUND

4 DIR USARL
AMSRL CI LP (305)

NO. OF
COPIES ORGANIZATION

3 USAF WL
MNMF FUZE BR
R MABRY
M LYNCH
LT R RATNESAR
101 W EGLIN BLVD
STE 219
EGLIN AFB FL
32542-6810

1 NSWG
BLDG 1470
M/S B06
M ABAIE
17320 DAHLGREN RD
DAHLGREN VA 22448

ABERDEEN PROVING GROUND

32 DIR USARL
AMSRL WM
I MAY
J ROCCHIO
AMSRL WM B
A HORST
H ROGERS
AMSRL WM BA
F BRANDON
T BROWN
L BURKE
J CONDON (5 CPS)
W DAMICO
B DAVIS
T HARKINS
D HEPNER
M HOLLIS
V LEITZKE
A THOMPSON
AMSRL WM BC
B GUIDOS
P PLOSTINS
D LYONS
AMSRL WM BD B FORCH
AMSRL WM BE G KELLER
AMSRL WB BF J LACETERA
AMSRL WM BG G HORLEY
AMSRL WM BB C SHOEMAKER
AMSRL WM IM R MCGEE
AMSRL IS EE R LOUCKS

NO. OF
COPIES ORGANIZATION

AMSRL WM TD
N GNIAZDOWSKI
F GREGORY
AMSRL WM TB R LOTTERO

REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.

1. AGENCY USE ONLY (Leave blank)		2. REPORT DATE May 1998	3. REPORT TYPE AND DATES COVERED Final, Jan - Nov 97	
4. TITLE AND SUBTITLE Battle Damage Assessment Telemeter (BDAT) System Impact Test			5. FUNDING NUMBERS 1L162618AH80	
6. AUTHOR(S) Eugene M. Ferguson, John A. Condon, and David N. Vazquez				
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) U.S. Army Research Laboratory ATTN: AMSRL-WM-BA Aberdeen Proving Ground, MD 21005-5069			8. PERFORMING ORGANIZATION REPORT NUMBER ARL-MR-398	
9. SPONSORING/MONITORING AGENCY NAMES(S) AND ADDRESS(ES)			10. SPONSORING/MONITORING AGENCY REPORT NUMBER	
11. SUPPLEMENTARY NOTES				
12a. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release; distribution is unlimited.			12b. DISTRIBUTION CODE	
13. ABSTRACT (Maximum 200 words) This report describes the live-fire testing (LFT) that was performed by the Advanced Munitions Concepts Branch (AMCB) of the U.S. Army Research Laboratory (ARL) and the Fuzes Technology Branch (WM/MNMF) at Eglin Air Force Base, FL, in support of the Battle Damage Assessment Telemeter (BDAT) project. In this testing, three aluminum canisters were instrumented with an ARL p-band telemetry system. Each canister was inserted into the aft end of a penetrator vehicle and launched from a gun into a 1-ft-thick concrete target 500 ft from the gun muzzle. The objective of this testing was to determine if the telemetry system would be able to operate during the high shock of impacting a concrete target. The data acquired from these tests were less than ideal. The amount of noise present in the data was a result of the weak RF link between the telemetry and receiving antennas and the broad-band noise near the transmitter frequency. Since the subcarrier oscillator was detected on all the canisters after impact, the telemetry components, other than the antenna that was damaged in each of the three tests, will survive multiple shocks caused by launch and impact.				
14. SUBJECT TERMS battle damage assessment telemeter (BDAT), telemetry, impact, high shock			15. NUMBER OF PAGES 13	
			16. PRICE CODE	
17. SECURITY CLASSIFICATION OF REPORT UNCLASSIFIED	18. SECURITY CLASSIFICATION OF THIS PAGE UNCLASSIFIED	19. SECURITY CLASSIFICATION OF ABSTRACT UNCLASSIFIED	20. LIMITATION OF ABSTRACT UL	

INTENTIONALLY LEFT BLANK.

USER EVALUATION SHEET/CHANGE OF ADDRESS

This Laboratory undertakes a continuing effort to improve the quality of the reports it publishes. Your comments/answers to the items/questions below will aid us in our efforts.

1. ARL Report Number/Author ARL-MR-398 (Ferguson) Date of Report May 1998

2. Date Report Received _____

3. Does this report satisfy a need? (Comment on purpose, related project, or other area of interest for which the report will be used.) _____

4. Specifically, how is the report being used? (Information source, design data, procedure, source of ideas, etc.) _____

5. Has the information in this report led to any quantitative savings as far as man-hours or dollars saved, operating costs avoided, or efficiencies achieved, etc? If so, please elaborate. _____

6. General Comments. What do you think should be changed to improve future reports? (Indicate changes to organization, technical content, format, etc.) _____

CURRENT
ADDRESS

Organization

Name

E-mail Name

Street or P.O. Box No.

City, State, Zip Code

7. If indicating a Change of Address or Address Correction, please provide the Current or Correct address above and the Old or Incorrect address below.

OLD
ADDRESS

Organization

Name

Street or P.O. Box No.

City, State, Zip Code

(Remove this sheet, fold as indicated, tape closed, and mail.)
(DO NOT STAPLE)

DEPARTMENT OF THE ARMY

OFFICIAL BUSINESS

BUSINESS REPLY MAIL

FIRST CLASS PERMIT NO 0001,APG,MD

POSTAGE WILL BE PAID BY ADDRESSEE

DIRECTOR
US ARMY RESEARCH LABORATORY
ATTN AMSRL WM BA
ABERDEEN PROVING GROUND MD 21005-5066



NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES

