

UNCLASSIFIED

AD NUMBER	
ADA800703	
CLASSIFICATION CHANGES	
TO:	unclassified
FROM:	restricted
LIMITATION CHANGES	
TO: Approved for public release; distribution is unlimited.	
FROM: Distribution authorized to DoD only; Foreign Government Information; JUL 1946. Other requests shall be referred to British Embassy, 3100 Massachusetts Avenue, NW, Washington, DC 20008.	
AUTHORITY	
DSTL, AVIA 6/14338, 19 Oct 2009; DSTL, AVIA 6/14338, 19 Oct 2009	

THIS PAGE IS UNCLASSIFIED

Reproduction Quality Notice

This document is part of the Air Technical Index [ATI] collection. The ATI collection is over 50 years old and was imaged from roll film. The collection has deteriorated over time and is in poor condition. DTIC has reproduced the best available copy utilizing the most current imaging technology. ATI documents that are partially legible have been included in the DTIC collection due to their historical value.

If you are dissatisfied with this document, please feel free to contact our Directorate of User Services at [703] 767-9066/9068 or DSN 427-9066/9068.

**Do Not Return This Document
To DTIC**

Reproduced by
AIR DOCUMENTS DIVISION



HEADQUARTERS AIR MATERIEL COMMAND

WRIGHT FIELD, DAYTON, OHIO

The
U.S. GOVERNMENT

IS ABSOLVED

FROM ANY LITIGATION WHICH MAY
ENSUE FROM THE CONTRACTORS IN -
FRINGING ON THE FOREIGN PATENT
RIGHTS WHICH MAY BE INVOLVED.

REEL - C

362

A.T.I.

9 2 4 6

RESTRICTED

RESTRICTED
TECHNICAL NOTE No: MET.41

ATI No.

BRITISH/U.S. RESTRICTED

ROYAL AIRCRAFT ESTABLISHMENT

Farnborough, Hants.

TESTS ON A FLUORIDE FLUX FOR WELDING MAGNESIUM ALLOYS

by

H. BROOKS, B.Sc., A.I.M.

and

F/LT. L. RAKOWSKI, Ing. Chem. (Warsaw)

Air Documents Division, T-2
AND, Bright Field
Microfilm No.

RC-362F9246

ATTENTION IS CALLED TO THE PENALTIES ATTACHING
TO ANY INFRINGEMENT OF THE OFFICIAL SECRETS ACT
THIS DOCUMENT IS THE PROPERTY OF H.M. GOVERNMENT

IT IS INTENDED FOR THE USE OF THE RECIPIENT ONLY, AND FOR COMMUNICATION TO SUCH OFFICERS UNDER
H.M. AS MAY REQUIRE TO BE ACQUAINTED WITH THE CONTENTS OF THE REPORT IN THE COURSE OF THEIR
DUTIES. THE OFFICERS EXERCISING THIS POWER OF COMMUNICATION WILL BE HELD RESPONSIBLE THAT SUCH
INFORMATION IS REPORTED WITH DUE CAUTION AND RESERVE.

ANY PERSON OTHER THAN THE AUTHORISED HOLDER, UPON OBTAINING POSSESSION OF THIS DOCUMENT, BY
FINDING OR OTHERWISE, SHOULD FORWARD IT, TOGETHER WITH HIS NAME AND ADDRESS, IN A CLOSED ENVELOPE
TO:-

THE SECRETARY, MINISTRY OF SUPPLY,
THAMES HOUSE, MILLBANK, LONDON S.W.1.

LETTER POSTAGE NEED NOT BE PREPAID OTHER POSTAGE WILL BE REFUSED.

ALL PERSONS ARE HEREBY WARNED THAT THE UNAUTHORISED RETENTION OR DESTRUCTION OF THIS
DOCUMENT IS AN OFFENCE AGAINST THE OFFICIAL SECRETS ACT 1911-1930.

NEQ

U-11482

ADVANCE INFORMATION ONLY.

BRITISH RESTRICTED Equals
UNITED STATES RESTRICTED
SUITABLE.

BRITISH/U.S. RESTRICTED

Restricted

U.D.C. No. 621.791.548 : 669.721.5

R.A.E. Technical Note No. Met.41

July, 1946

ROYAL AIRCRAFT ESTABLISHMENT, FARNBOROUGH

Tests on a fluoride flux for welding magnesium alloys

by

H. Brooks, B.Sc., A.I.M.
and

F/Lt. L. Rakowski, Ins.Chem. (Warsaw)

R.A.E. Ref: Mat.45/9683/HB/171

SUMMARY

Tests were made to determine the suitability of a flux for use in welding magnesium-base alloys by the oxyacetylene process. The flux consisted of a mixture of fluorides of lithium, magnesium, calcium and barium. Butt welds were made between pairs of 10G sheet or strip samples to specifications D.T.D.118, D.T.D.120A and D.T.D.259. The flux was not satisfactory for welding the magnesium-aluminium-zinc alloys to D.T.D.120A and D.T.D.259 but good welds could be made with it in the magnesium-manganese alloy to D.T.D.118. The flux residues caused practically no corrosion when uncleaned joints were exposed to a simulated inland tropical cycle, and joints cleaned by scrubbing and subsequently chromate treated showed no corrosion at all after exposure to these conditions for 28 days.

Introduction

The sample of flux which has been tested was brought from Germany by a B.I.O.B. investigating team who found that it had been used at I.G. Farbenindustrie Bitterfeld for oxyacetylene welding the magnesium-aluminium-zinc alloys, AZ1 and AZ 855. The flux, known as Elektronfluss IV, was stated to be non-corrosive and non-hygroscopic and to have the following composition:-

Lithium fluoride 22%

Magnesium fluoride 27%

Calcium fluoride 18%

Barium fluoride 33%

Welding tests were made with the flux and some of the joints were stored in a humid atmosphere and examined at intervals to ascertain whether the flux residues had any corrosive action.

Welding tests

These were first made on 10G magnesium-aluminium-zinc alloy sheet

and extruded strip supplied to specifications D.T.D.120A and 259 respectively and originally it was not intended to carry out tests on the magnesium-manganese alloy to D.T.D.118 since the flux was understood to be unsuitable for this alloy. Butt welds were made between pairs of 4" x 2" samples, strips cut from the parent metal being used as filler material. The flux was mixed with water to form a paste which was brushed on to the filler strip and the top and bottom edges of the joint. Because of the poor action of the flux welding was very difficult on both materials, and although several methods of joint preparation including bevelling were tried, satisfactory penetration could not be obtained. The ineffectiveness of the flux was believed to be partially attributable to its high melting point (stated to be 610°C) so that when welding the magnesium-aluminum-zinc alloys the flux is not completely melted and cannot therefore work efficiently. Since the melting point of the magnesium-manganese alloy is higher than that of the flux it seemed likely that the flux might actually work better on this alloy than on the magnesium-aluminum-zinc alloys which melt at lower temperatures. A few test joints were therefore made in sheet to specification D.T.D.118 and it was found that the flux worked quite well on this material.

Corrosion tests

Welds in materials to specifications D.T.D.120A and 259 were stored in the laboratory for 6 days and were then exposed to a simulated inland tropical cycle of humidity and temperature for 28 days together with similar welds made with a standard flux A which contains chlorides. Some of the specimens were exposed with the flux residues left untouched on the welds, others were scrubbed in water with a steel brush and then chromated in bath IV of D.T.D.911 before exposure but even this treatment did not completely remove the residues of the fluoride flux. The appearance of typical specimens at the end of these exposure tests is shown in the photographs (Figs.1 and 2) and observations made during the tests are given in Table I. No corrosion tests have been made on welds in D.T.D.118 material since these welds were not made until after the main tests were completed. However it is reasonable to suppose that the flux residues would be no more corrosive to this alloy than to those which have been tested.

Conclusions

The flux is considered unsuitable for welding magnesium-aluminum-zinc alloy sheet and strip in the thicknesses common in aircraft construction but it may be suitable for welding thicker gauges of this type of alloy on which manipulation of the welding rod might be used to assist in breaking up the oxide films. However the flux is suitable for welding thin gauge magnesium-manganese alloy sheet. Where it can be used, the flux possesses the valuable advantage of being practically non-corrosive.

Attached:

Table I
Figs. 1 and 2 (photographs)

R.A.E. Tech. Note No. Met. 41

Circulation:

A.D.R.D. Mat. (M)
D.R.D.T.
R.T.P./T.I.B.
D.D.R.A.E.
Library

Action copy + 2

20 + 1 for repro:

TABLE I. Humid atmosphere test on fluxes for magnesium alloys


Oxynoctylene butt welds, between pieces of 106 sheet or strip, prepared and treated as described below were exposed for 28 days to a 13 day simulated tropical cycle of humidity and temperature: First day: 140°F for 24 hours, relative humidity about 80%.

Each of next twelve days: 90°F and 95% R.H. for 8 hours; 80°F and saturation for 16 hours, with condensation on the specimens.

Specimen Nos.	Material Specification	Flux used in welding	Treatment applied after welding	Appearance after storage in laboratory for 6 days before exposure	Observations after exposure for the following periods	
					11 days	28 days
2	D.T.D. 120A	Elektroflux IV	None	Unchanged; welds covered with flux residues.	Spots of corrosion all over except on upper side of weld.	Spots of corrosion all over; considerable corrosion on underside of weld (this specimen was probably contaminated with chloride flux).
3				As Specimen 2.	Practically no corrosion on the weld; some spots of corrosion elsewhere.	Spots of corrosion all over.
4 and 5				Scrubbed in water with steel brush and chromated in bath IV of D.T.D. 911. Flux residues still left on welds.	Unchanged	Unchanged
6				As specimens 2 and 3.	No corrosion on the weld; some corrosion elsewhere.	Spots of corrosion all over.
7	D.T.D. 259			As specimens 2 and 3.	Unchanged	Unchanged
8	D.T.D. 120A	Standard flux A containing chlorides	None	Very considerable corrosion on and near the weld.	Considerably more corrosion.	Extremely severe corrosion on and near the weld.
1				Scrubbed in water with steel brush and chromated in bath IV of D.T.D. 911. weld.	Corrosion on weld increased.	Considerable corrosion on the weld.




SPEC. 3.
EXPOSED "AS WELDED"

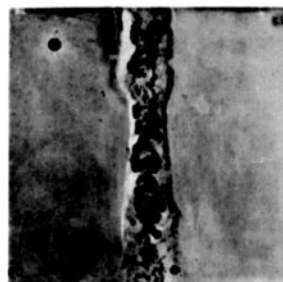


SPEC. 4.
EXPOSED AFTER SCRUBBING,
WASHING AND CHROMATING
IN BATH IV OF D.T.D. 911.

WELDED WITH NON-CORROSIVE FLUORIDE FLUX.

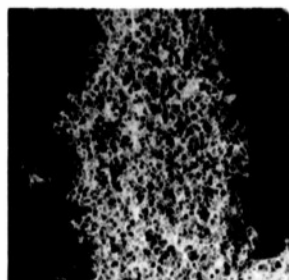

SPEC. 8.

WELDED WITH STANDARD FLUX A CONTAINING CHLORIDES.

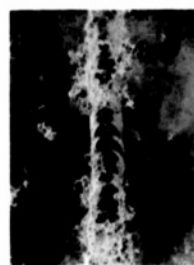


SPEC. 1.

APPEARANCE OF UPPER SIDE
OF WELDED D.T.D.120 / 10 S.W.G.
SPECIMENS AFTER EXPOSURE TO
HUMID ATMOSPHERE FOR 4 WEEKS

HUMID ATMOSPHERE TEST
ON FLUXES FOR MG-ALLOYS



SPEC. 3.
EXPOSED "AS WELDED"

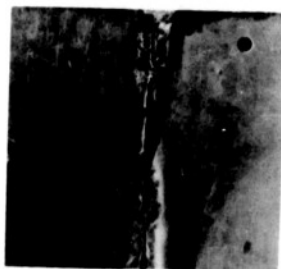


SPEC. 4.
EXPOSED AFTER SCRUBBING,
WASHING AND CHROMATING
IN BATH IV OF D.T.D. 911.

WELDED WITH NON-CORROSIVE FLUORIDE FLUX.



SPEC. 8.
WELDED WITH STANDARD FLUX A CONTAINING CHLORIDES.

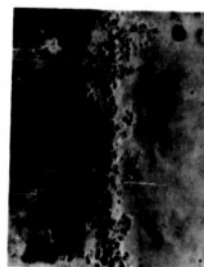

SPEC. 1.

APPEARANCE OF UNDER SIDE
OF WELDED D.T.D.120 /10 S.W.G.
SPECIMENS AFTER EXPOSURE TO
HUMID ATMOSPHERE FOR 4 WEEKS

HUMID ATMOSPHERE TEST
ON FLUXES FOR MG-ALLOYS

BAE NEG NO 71617 /4

REEL - C

362

A.T.I.

9 2 4 6

RESTRICTED

TITLE: Tests on a Fluoride Flux for Welding Magnesium Alloys

ATI- 9246

REVISION

(None)

AUTHOR(S) : Rakowski, L.; Brooks, H.

ORIG. AGENCY NO.

MET-41

ORIG. AGENCY : Royal Aircraft Establishment, Farnborough, Hants

PUBLISHING AGENCY NO.

(Same)

PUBLISHED BY : (Same)

DATE	DOC. CLASS.	COUNTRY	LANGUAGE	PAGES	ILLUSTRATIONS
July '46	Restr.	Gt. Brit.	English	6	photos, table

ABSTRACT:

Suitability of a flux for use in welding by oxyacetylene process was determined. Flux consisted of a mixture of fluorides of lithium, magnesium, calcium, and barium. Flux was not satisfactory for welding magnesium-aluminum-zinc alloys, but good welds could be made with it in magnesium-manganese alloy. Flux residues caused practically no corrosion when uncleaned joints were exposed to simulated inland tropical cycle. Joints were cleaned by scrubbing, and subsequently chromate treatment showed no corrosion at all.

DISTRIBUTION: Copies of this report obtainable from CADO.

DIVISION: Materials (8)

SECTION: Magnesium and Alloys (11)

SUBJECT HEADINGS: Magnesium Alloys - Welding (58427);
Fluxes, Welding (41725)

ATI SHEET NO.: R-8-11-27

Central Air Documents Office
Wright-Patterson Air Force Base, Dayton, Ohio

AIR TECHNICAL INDEX

RESTRICTED

TITLE: Tests on a Fluoride Flux for Welding Magnesium Alloys

AUTHOR(S) : Rakowski, L.; Brooks, H.

ORIG. AGENCY : Royal Aircraft Establishment, Farnborough, Hants

PUBLISHED BY : (Same)

ATI- 9246

REVISION

(None)

ORIG. AGENCY NO.

MET-41

PUBLISHING AGENCY NO.

(Same)

DATE	DOC. CLASS.	COUNTRY	LANGUAGE	PAGES	ILLUSTRATIONS
July '46	Restr.	Gt. Brit.	English	6	photos, table

ABSTRACT:

Suitability of a flux for use in welding by oxyacetylene process was determined. Flux consisted of a mixture of fluorides of lithium, magnesium, calcium, and barium. Flux was not satisfactory for welding magnesium-aluminum-zinc alloys, but good welds could be made with it in magnesium-manganese alloy. Flux residues caused practically no corrosion when uncleaned joints were exposed to simulated inland tropical cycle. Joints were cleaned by scrubbing, and subsequently chromate treatment showed no corrosion at all.

DISTRIBUTION: Copies of this report obtainable from CADO.

DIVISION: Materials (8)

SECTION: Magnesium and Alloys (11)

SUBJECT HEADINGS: Magnesium Alloys - Welding (58427);
Fluxes, Welding (41725)

ATI SHEET NO.: R-8-11-27

AIR TECHNICAL INDEX

Central Air Documents Office
Wright-Patterson Air Force Base, Dayton, Ohio

C

EO 10501 dd 5 NOV 1953



Information Center
Knowledge Services
[dstl] Dayton Division
Silsburg
Ohio
Spring
22060-6218
Tel: 01280611112
Fax: 01280611111

Defense Technical Information Center (DTIC)
8725 John J. Kingman Road, Suit 0944
Fort Belvoir, VA 22060-6218
U.S.A.

AD#: ADA800703

Date of Search: 19 Oct 2009

Record Summary: AVIA 6/14338

Title: Fluoride flux for welding magnesium alloys: tests
Availability Open Document, Open Description, Normal Closure before FOI Act: 30 years
Former reference (Department): TN Met 41
Held by The National Archives, Kew

This document is now available at the National Archives, Kew, Surrey, United Kingdom.

DTIC has checked the National Archives Catalogue website (<http://www.nationalarchives.gov.uk>) and found the document is available and releasable to the public.

Access to UK public records is governed by statute, namely the Public Records Act, 1958, and the Public Records Act, 1967. The document has been released under the 30 year rule. (The vast majority of records selected for permanent preservation are made available to the public when they are 30 years old. This is commonly referred to as the 30 year rule and was established by the Public Records Act of 1967).

This document may be treated as UNLIMITED.