

AD 608177

ULTRASONIC WELDING PROCESS AND EQUIPMENT FOR CONSTRUCTION OF ELECTRON-TUBE MOUNTS

Seventh Quarterly Progress Report
For the Period
January 1 through March 31, 1964

Contract No. DA-36-039-sc86741

Order No. 19063-PP-62-81-81

COPY	2	OF	3	each
HARD COPY		\$.	1.00	
MICROFORM		\$.	0.50	

Placed by
Industrial Preparedness Directorate
United States Army Electronics
Materiel Agency


19/8

REC'D
MAY 10 1964
ELECTRONICS
CSCIA

AEROPROJECTS INCORPORATED
West Chester, Pennsylvania

AD 608177

ab

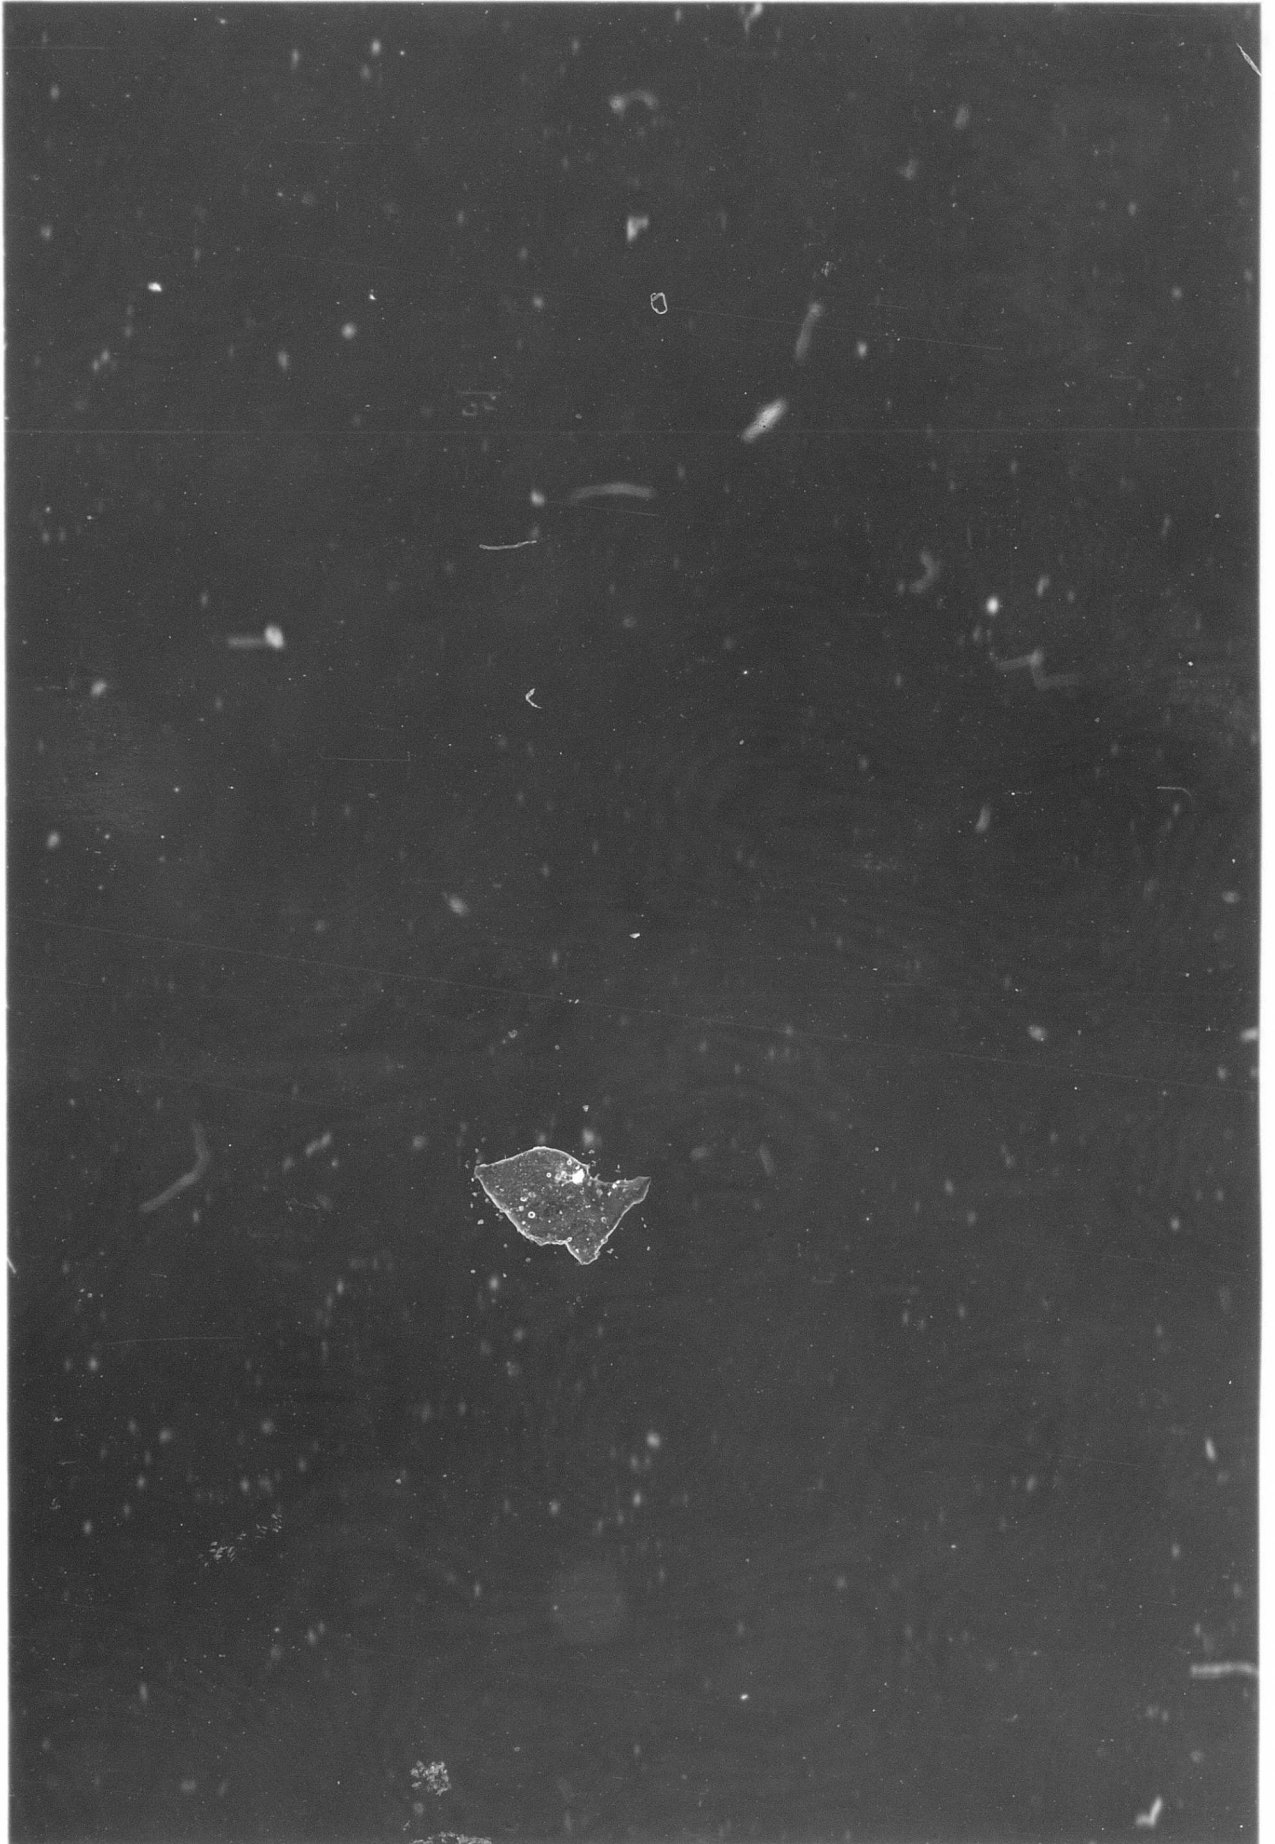

ULTRASONIC WELDING PROCESS AND EQUIPMENT
FOR CONSTRUCTION OF ELECTRON-TUBE MOUNTS

Seventh Quarterly Progress Report
For the Period
January 1 through March 31, 1964

The object of this program is to design and construct prototype welding equipments and their associated accessories to perform by ultrasonic techniques the welding operations required in the assembly of electron tubes under Specifications SCS-114A and SCIPPR-15.

Contract No. DA-36-039-sc86741
Order No. 19063-PP-62-81-81

Report Prepared by:



Report Approved by:



ABSTRACT

Ultrasonic welding of the Type 6080WB electron-tube mount was reviewed by Tung-Sol representatives, and details are presented. The use of ultrasonic energy in the successful assembling of electron-tube components with interference fits is described.

TABLE OF CONTENTS

	<u>Page</u>
ABSTRACT	ii
PURPOSES	1

NARRATIVE AND DATA

CONCLUSIONS	4
PROGRAM FOR NEXT REPORTING PERIOD	4
VISITS DURING THIS REPORT PERIOD	8
TECHNICAL MAN-HOURS EXPENDED DURING THIS REPORT PERIOD	9

LIST OF FIGURES

<u>Figure</u>		<u>Page</u>
1	Partial Schematic of Glass Stem Assembly Showing Area of Stem Lead Extension in Which Ultrasonic Weld Caused Glass Fracture	5
2	Modified Anvil Tip A2 Used in Welding Grid and Anode Eyelets and Connectors	6
3	Insertion Technique Used in Assembling Anode Support Rod Into Carbon Anode	7

PURPOSES

The objectives of this Production Engineering Measure (PEM) are to:

1. Demonstrate the capability limits of ultrasonic welding to join combinations of metallic materials of interest to the electron-tube industry. Devote major effort to making satisfactory joints in materials and geometries which might be difficult or impossible to join by other means.
2. Analyze the welding requirements for three specific electron tubes. The three tube types selected are the Type 6080WB, 5814WB and 6205. These were selected by the U. S. Army Electronics Command because they are widely used in military equipment, and have a record of failures due to improperly welded joints.
3. Prepare fixturing and tooling for the specific electron tubes, so that ultrasonic welding may be used in the manufacturing process.
4. Ultrasonically weld the parts required to assemble electron-tube mounts for the three tube types, and compare results obtained against similar sub-assemblies made by conventional joining methods. Tests will include strength and environmental tests.
5. Build production ultrasonic welding equipment which will enable an electron-tube manufacturer to make the welded connections in a broad range of electron-tube types.
6. Install the ultrasonic welding equipment in a production company, and produce on a pilot basis with that company's personnel, a limited lot size of each of the three tubes for subsequent evaluation in accordance with applicable military specifications.

NARRATIVE AND DATA

Messrs. B. F. Steiger and Norman Helmstetter of Tung-Sol Electric Inc.* visited Aeroprojects on January 8, 1964 to evaluate the ultrasonic welding and assembly sequences of the Type 6080WB electron-tube mount. Using tooling and welding procedures described in the Sixth Quarterly Progress Report, a complete electron-tube mount was assembled and welded on the "Sonoweld" ultrasonic welder, Model W-600-TSR. The Tung-Sol representatives expressed satisfaction with the quality of the welds, the ease with which they were effected, the simplicity of tool change, and the absence of spatter and oxidation resulting from the welding.

As discussed in the Sixth Quarterly Report, the glass had fractured in glass stem assemblies during the welding of connectors and stem leads. This problem had been solved satisfactorily by crimping of the stem leads prior to welding. Prior experience in welding leads of glass-metal assemblies indicated that the temper of the glass material had an affect on the ability to make satisfactory joints on the lead portion of the assembly without destroying the quality of the seal. It therefore seemed advisable to investigate the possible effect of several tempers of glass in the stem assemblies.

Accordingly, Tung-Sol supplied stem assemblies in three heat-treat conditions, designated in their terminology as neutral, low-compressive residual stress, and high-compressive residual stress. The low-compression temper is normally used in the production of the Type 6080WB electron-tube mount. The assemblies had 1-inch projections of wires past the glass seal, sufficiently long to permit forming and trimming into final prescribed length.

Ultrasonic welds were made between the connectors and the stem leads at the extremities of these wires in each temper of glass. Fracturing did not occur. Welds were then made progressively toward the glass seal. Each temper of glass fractured at approximately the same distance from the feed-through seal section as in the original production assemblies. Results of this work are tabulated in Figure 1. Since it appeared that the condition of the glass (temper) was not a contributing factor in fracturing, the stem lead extensions were crimped in the manner described in the Sixth Quarterly Progress Report, and satisfactory welds were made at any desired distance from the glass seal past the crimped area without breakage in each of the three types of glass condition.

* Functions of Chatham Electronics Division of Tung-Sol Electric Inc. as applied to this contract have been changed to Tung-Sol Electric Inc., Electron Tube Division.

Observation by Tung-Sol representatives indicated that some auxiliary steps in fixturing may assist the ultrasonic welder operator in locating components. Since these are uncomplicated, they can readily be added by Tung-Sol after receipt by them of the equipment and tooling. It was further observed that anvil tip A2 (Figure 4, Sixth Report) did not provide component clearance adequate for operator freedom and for avoidance of possible parts distortion during welding. As a result, an alternate anvil tip was designed, constructed, and tested. The modified tip is shown in Figure 2, along with the original anvil tip. Test welds performed with the new tip were of the same satisfactory quality as those obtained with the original design.

The carbon anodes of the Type 6080WB electron-tube mount broke frequently during the insertion or removal of the anode support rods. Anode breakage usually accounts for 25-65 percent of the total rejects during tube manufacture. These rods are 0.062-inch diameter nickel, forced into holes through the carbon anodes with an interference fit. It has been repeatedly demonstrated in the Aeroprojects' laboratories (unpublished) that vibratory energy is effective in reducing friction between contacting metal surfaces. Metal components such as concentric tubes with close-tolerance and even interference fits have been successfully assembled utilizing ultrasonic activation. Forces are reduced, as is the scoring of mating surfaces. This concept was applied to the assembly of anode support rods into the carbon anodes. A Sonobond Corporation "Sonosolder" Model S-O-HN (12-watt) ultrasonic tip was used as shown in Figure 3. A hole approximately equal to the diameter of the anode support rod was drilled in the end of the "Sonosolder" tip, and the rod was inserted therein (Figure 3A). Ultrasonic energy was applied, and the rod was inserted into the carbon anode as shown in Figure 3B. Very little force was required to successfully assemble the two parts. The problem of carbon anode breakage was eliminated.

Carbon anodes for the 6080WB electron tube are usually salvaged from otherwise defective tubes and reused because of their high cost relative to other tube components. Anode breakage frequently occurs during removal of the support rod. Attachment of the anode support rod to the ultrasonic unit can be accomplished by the use of a collet, or a clamping mechanism tightened by a set screw. This ultrasonic technique should allow the manufacturer to use lower tolerances in production of parts. Furthermore, the method is easily adaptable to production operations, and lends itself to multiple rod insertions simultaneously by appropriate fixturing.

It was also noted that the Alsimag (white) ceramic spacer components were considerably more fragile and subject to breakage during assembly than the Photoceram (blue) spacers. Since the Alsimag spacers are normally used in the production of the Type 6080WB electron-tube mounts, they will continue to be used in this program. Breakage occurred only in those cases where the grid wires were forced into the spacer holes, prestressing the ceramic spacer. Fracture was induced by allowing the spacer to contact


the active sonotrode in this prestressed condition. Breakage was eliminated by selecting component parts of good fit and protecting the ceramic spacer from accidental contact with the sonotrode. A rubber "bumper" affixed to the sonotrode achieved this result.

CONCLUSIONS

Work on the program has been completed pending approval by the USAECOM for the change in engineering effort which will be explained in the next report.

PROGRAM FOR NEXT REPORTING PERIOD

Approval by the USAECOM on the engineering effort modifications is expected at the beginning of the next report period. Under this revised program, some further tooling will be provided for welding the electron tube Type 6080WB and the equipment will be sent to Tung-Sol for production set up. The application of ultrasonic welding to the manufacture of molybdenum frame grids will be evaluated. The ultrasonic welding of 0.003-inch diameter tungsten-rhenium wire to tungsten, molybdenum, and nickel sheet will be investigated and evaluated.

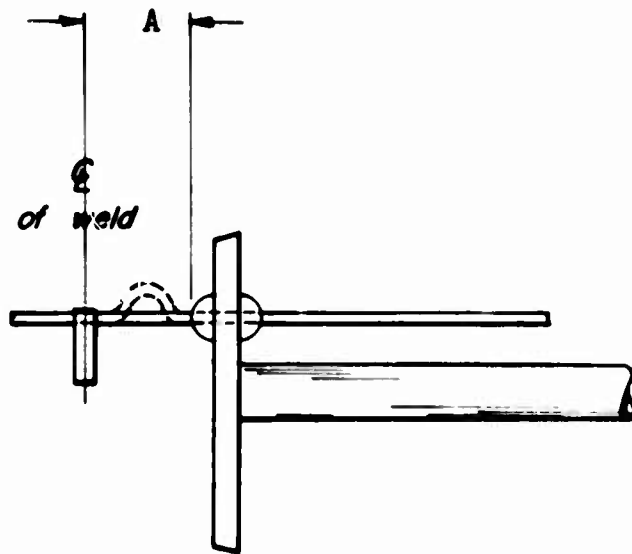

<u>GLASS CONDITION</u>	A
Neutral	7/16 inch
Low-compression temper	7/16 inch
High-compression temper	1/2 inch

Figure 1

PARTIAL SCHEMATIC OF GLASS STEM ASSEMBLY SHOWING AREA OF STEM LEAD EXTENSION IN WHICH ULTRASONIC WELD CAUSED GLASS FRACTURE. (Problem Resolved By Crimping)


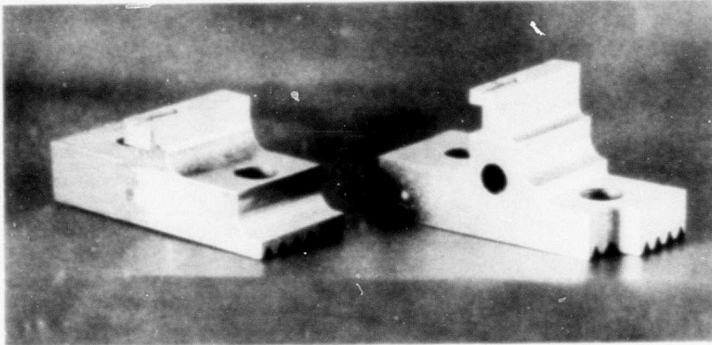



Figure 2

MODIFIED ANVIL TIP A2 USED IN WELDING
GRID AND ANODE EYELETS AND CONNECTORS

Modified anvil tip A2 at right shows redesign to afford greater component clearance. Anvil tip at left is original design, reported in the Sixth Quarterly Progress Report. Welds made with the modified anvil tip were of the same satisfactory quality as those originally obtained.

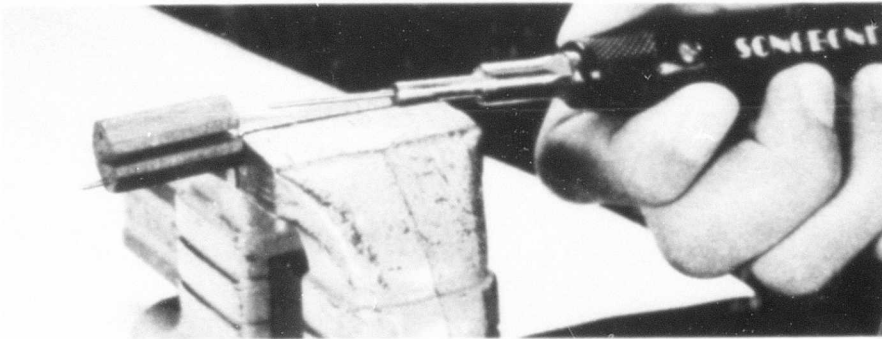

A

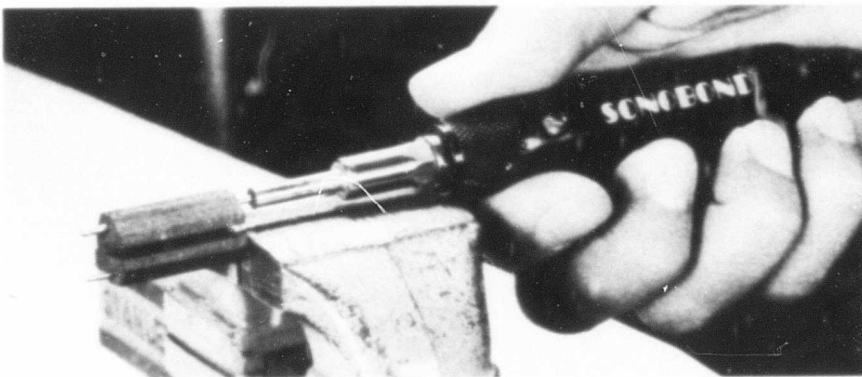

B

Figure 3

INSERTION TECHNIQUE USED IN ASSEMBLING
ANODE SUPPORT ROD INTO CARBON ANODE

Photograph A shows anode support rod inserted into a drilled Sonobond Corporation "Sonosolder" Model S-O-HN (12-watt) ultrasonic tip. Photograph B shows the rod fully inserted into the carbon anode after application of ultrasonic energy.

VISITS DURING THIS REPORT PERIOD

<u>Date</u>	<u>Visit</u>	<u>Purpose</u>
1/8/64	Messrs. B. F. Steiger and N. Helmstetter, Chatham Electronics, Bloomfield, New Jersey, visited Aeroprojects, West Chester, Pennsylvania	Observe assembly sequence and ultrasonic welding of junctions in the Type 6080WB electron-tube mount.
1/22/64	W. N. Rosenberg visited Mr. H. Shienbloom, U. S. Army Electronics Command, 225 South Eighteenth Street, Philadelphia, Pennsylvania	Review Progress Report drafts.
2/20/64	Messrs. T. Kyne, H. Shienbloom and C. Mogavero, USAECOM, visited Aeroprojects, West Chester, Pennsylvania	Inspect ultrasonic welding equipment and tooling procured under this contract, and observe equipment making typical junctions for the electron-tube industry.

TECHNICAL MAN-HOURSEXPENDED DURING THIS REPORT PERIOD

<u>Name</u>	<u>Project Position</u>	<u>Hours Expended This Report Period</u>
W. N. Rosenberg	Project Supervisor	23
J. G. Thomas	Metallurgist	37
W. B. Devine	Director of Publications	20
N. Maropis	Physicist	<u>2-1/2</u>
	Total	82-1/2

DISTRIBUTION LIST

<u>No. of Copies</u>		<u>No. of Copies</u>	
2	Advisory Group on Electron Devices 346 Broadway - 8th Floor New York, New York 10013	1	Chief, Bureau of Ships Department of the Navy Washington 25, D. C. Attn: 691A
1	Commander Aeronautical Systems Division Wright-Patterson Air Force Base Dayton, Ohio	1	Amperex Electronic Corporation 230 Duffy Avenue Hicksville, L. I., New York Attn: Mr. Alex Mitchell
3	Commanding General U. S. Army Electronics Command 225 South 18th Street Philadelphia 3, Pennsylvania Attn: SELMA-R2b	1	Bell Telephone Laboratories Technical Reports Center Whippany, New Jersey Attn: Miss Nan Farley
1	Commanding General U. S. Army Electronics Command Fort Monmouth, New Jersey 07703 Attn: AMSEL-PP-E-CMD-1	1	The Bendix Corporation Red Bank Division Eatontown, New Jersey Attn: Mr. Joseph F. Bozzelli
	Director U. S. Army Electronics Laboratories Fort Monmouth, New Jersey	1	Bomac Laboratories, Inc. Salem Road Beverly, Massachusetts Attn: Mr. Richard S. Briggs
1	Attn: AMSEL-RD-PR, Chief, Tube Techniques Branch		
1	Chief, General Tubes Branch	1	Burroughs Corporation Electronic Tube Division P. O. Box 1226 Plainfield, New Jersey Attn: Mr. Roger Wolfe
1	Chief, Gaseous Electronics Section, Bldg. S-53		
10	Commander Defense Documentation Center Cameron Station Alexandria, Virginia, 22314 Attn: TISIA-1	1	Allen B. DuMont Laboratories, Inc. 750 Bloomfield Avenue Clifton, New Jersey Attn: Mr. Robert Deutsch
1	Canadian Liaison Officer Army Materiel Command Tempo 7, Room 1067 Washington, D. C. 20315	1	Edgerton, Germeshausen & Grier, Inc. Crosby Drive Bedford 15, Massachusetts 01730 Attn: Mr. S. Goldberg
		1	Eitel-McCullough, Inc. 301 Industrial Way San Carlos, California Attn: Mr. H. M. Bailey

DISTRIBUTION LIST (Continued)

<u>No. of Copies</u>		<u>No. of Copies</u>	
1	Electronic Enterprises, Inc. 65-67 Seventh Avenue Newark 4, New Jersey Attn: Mr. Richard Bloemeke	1	Lionel Electronic Laboratories, Inc. 1226 Flushing Avenue Brooklyn 37, New York
1	Electronic Tube & Instrument Div. 1200 East Mermaid Lane Philadelphia, Pennsylvania 19119 Attn: Mr. S. Pearlman	1	Litton Engineering Laboratories P. O. Box 949 Grass Valley, California Attn: Mr. Charles V. Litton
1	Electrons, Inc. 127 Sussex Avenue Newark 3, New Jersey Attn: Mr. E. K. Smith	1	Litton Industries Electron Tube Division San Carlos, California Attn: Mr. James H. Weber
1	General Electric Company 316 East Ninth Street Owensboro, Kentucky Attn: Mr. W. T. Millis	1	Machlett Laboratories, Inc. 1063 Hope Street Springdale, Connecticut Attn: Dr. H. D. Doolittle
1	Gulton Industries, Inc. 212 Durham Avenue Metuchen, New Jersey Attn: Mr. Daniel Abrams	1	Metcom, Inc. 76 Lafayette Street Salem, Massachusetts Attn: Mr. Richard Broderick
1	Huggins Laboratories 999 East Argues Avenue Sunnyvale, California Attn: Mr. R. A. Huggins	1	Microwave Associates, Inc. South Street Burlington, Massachusetts Attn: Dr. L. Gould
1	Hughes Aircraft Vacuum Tube Products 2020 Short Street Oceanside, California Attn: Mr. James Sutherland	1	Microwave Electronics Corporation 4061 Transport Street Palo Alto, California Attn: Dr. Stanley Kaisal
1	International Telephone & Telegraph Corporation Electron Tube Division P. O. Box 100 Easton, Pennsylvania Attn: Mr. R. F. Mann	1	Ohio State University Department of Metallurgy Columbus, Ohio Attn: Mr. Frederick J. Fraikor
		1	PEK Laboratories, Inc. 4024 Transport Street Palo Alto, California Attn: Mr. H. H. Eaves

DISTRIBUTION LIST (Continued)

<u>No. of Copies</u>		<u>No. of Copies</u>	
1	Penta Laboratories, Inc. 312 North Nopal Street Santa Barbara, California Attn: Mr. R. L. Norton	1	Sperry Electronic Tube Division Sperry Rand Gainesville, Florida Attn: Mr. John Whitford
1	Philco Corporation Lansdale Division Church Road Attn: Mr. F. Mayock	1	Sylvania Electric Products, Inc. Emporium, Pennsylvania Attn: Mr. Vincent Frubbe
1	Polarad Electronics Corporation 43-20 Thirty-fourth Street Long Island City 1, New York Attn: Dr. D. L. Jaffe	1	Tucor, Inc. 59 Danbury Road Wilton, Connecticut Attn: Mr. R. White
1	Radio Corporation of America Electron Tube Division Lancaster, Pennsylvania Attn: Mr. Roy E. Nelson	1	Tung-Sol Electric, Inc. 200 Bloomfield Avenue Bloomfield, New Jersey Attn: Mr. Ben Steiger
1	Radio Corporation of America Electron Tube Division 415 South Fifth Street Harrison, New Jersey Attn: Mr. Clarence West	1	United Electronics Company 42 Spring Street Newark, New Jersey Attn: Dr. John Beers
1	Raytheon Company Industrial Components Division 55 Chapel Street Newton 58, Massachusetts Attn: Mr. Paul R. Keeler	1	Varian Associates 611 Hansen Way Palo Alto, California Attn: Dr. Richard Nelson
1	S.F.D. Laboratories, Inc. 800 Rahway Avenue Union, New Jersey Attn: Dr. Joseph Saloom	1	The Victoreen Instrument Company 5806 Hough Avenue Cleveland 3, Ohio Attn: Mr. Ben Olson
1	Sonotone Corporation Box 200 Elmsford, New York Attn: Dr. L. G. Hector	1	Watkins-Johnson Company 3333 Hillview Avenue Palo Alto, California Attn: Dr. Rolf Peter
		1	Westinghouse Electric Corporation Electronic Tube Division Box 284 Elmira, New York Attn: Mr. B. W. Sauter

DISTRIBUTION LIST (Continued)

<u>No. of Copies</u>		<u>No. of Copies</u>	
1	U. S. Army Ordnance Frankford Arsenal Bridge & Tacony Streets Philadelphia, Pennsylvania 19137 Attn: Mr. Frank Hussey Metal Joining Section 1323, 64-1	1	Raytheon Manufacturing Company Chelmsford Street Lowell, Massachusetts Attention: Mr. W. W. Robinson
		1	Sprague Electric Company 87 Marshall Street North Adams, Massachusetts Attention: Mr. W. Bell
1	Battelle Memorial Institute 505 King Avenue Columbus 1, Ohio Attn: Mr. C. M. Jackson	1	Texas Instruments, Inc. Semiconductor Components Division Post Office Box 5012 Dallas 22, Texas Attention: Semiconductor Library
1	Westinghouse Electric Corporation Youngwood, Pennsylvania Attention: Mr. Ozzie Jaeger		
1	Clevite Transistor A Division of Clevite Corporation 200 Smith Street Waltham 54, Massachusetts Attention: Mr. Sam Rubinovitz	1	Transitron Electronic Corporation 168-182 Albion Street Wakefield, Massachusetts Attention: Dr. D. Bakalar
1	Rome Air Development Center Griffiss Air Force Base, New York Attention: Mr. L. Gubbins, RASGR	2	Western Electric Company Marion and Vine Streets Laureldale, Pennsylvania Attention: Mr. Robert Moore
1	Hamilton Standard Division United Aircraft Corporation Windsor Locks, Connecticut Attn: Mr. John Dudenhofer Project Director	1	Delco Radio Division Kokomo, Indiana Attention: Dr. F. E. Jaumot, Jr.
1	Mr. C. W. Irish Marketing Section Lamp Metals & Components Dept. General Electric Company 21800 Tungsten Road Cleveland 17, Ohio	1	Bendix Corporation Semiconductor Division Holmdel, New Jersey Attention: Dr. Robert Meijer
		1	Motorola, Inc. 5005 East McDowell Road Phoenix, Arizona Attention: Mr. James LaRue
1	Radio Corporation of America Somerville, New Jersey Attention: Mr. R. Wicks	1	Pacific Semiconductors, Inc. 14520 S. Aviation Blvd. Lawndale, California Attention: Dr. H. Q. North

DISTRIBUTION LIST (Continued)

<u>No. of Copies</u>		<u>No. of Copies</u>	
1	General Electric Company Electronic Park Syracuse, New York Attention: Mr. T. F. Kendall Bldg. 7, Room 152	1	Sylvania Electric Products, Inc. Div. of General Telephone Corp. Sylvania Lighting Products Div. 60 Boston Street Salem, Massachusetts Attn: Mr. Rufus L. Briggs, Project Eng.-3C
1	Bureau of Weapons Department of the Navy Washington 25, D. C. Attention: Mr. Roy G. Gustafson RRMA-24, Materials Div.	1	ITT Industrial Laboratories 3700 East Pontiac Fort Wayne, Indiana Attn: M. F. Toohig Manager, Tubes and Sensors
1	The Rembar Company, Inc. 67 Main Street Dobbs Ferry, New York Attention: Mr. E. Dietz	1	Thermo Electron Engr. Corp. 85 First Avenue Waltham, Massachusetts Attn: Mr. T. Johnson
1	Fairchild Semiconductor Corp. 545 Whisman Road Mountain View, California Attention: Mr. Ralph Lee	1	Raytheon Company Second Avenue Waltham, Massachusetts Attn: Dr. Colin Bowness
1	Radio Corporation of America Electronic Components and Devices Lancaster, Pennsylvania Attn: Mr. Edward L. Romero	1	Raytheon Company Route .28 Burlington, Massachusetts Attn: Mr. George Freedman
1	General Electric Company Schenectady, New York Attn: Dr. Harold R. Day Building 5, Room 323	1	Ferrotec Company 217 California St. Newton, Massachusetts Attn: Mr. Paul Rutledge
1	Arinc Research Company 1700 'K' Street - NW Washington, D. C. - 20006 Attn: Mr. Robert Reed	1	IIT Research Institute 10 W. 35th Street Chicago 16, Illinois Attn: Mr. S. L. Blum

DISTRIBUTION LIST (Concluded)No. of
Copies

- 1 Electron Technology, Incorporated
626 Schuyler Avenue
Kearny, New Jersey
Attention: Mr. Stanley Kock
- 1 Eon Corporation
175 Pearl Street
Brooklyn, New York
Attention: Dr. Gustav Weinberg
- 1 National Aeronautics & Space Administration
Head, Operation Section
Scientific & Technical Information Division
(SAK/DL)
4833 Rugby Avenue
Bethesda, Maryland 20014
- 1 National Aeronautics & Space Administration
Lewis Research Center
21000 Brook Park Road
Cleveland, Ohio 44135
Attention: Mr. Davies
Mail Code: 500-309