

AD 673111

AD

CCL REPORT NO. 251

FINAL REPORT

STORAGE OF ETHYLENE GLYCOL ANTIFREEZE  
IN UNLINED TIN CONTAINERS

BY

JAMES H. CONLEY

JULY 1968

D D C  
RECEIVED  
AUG 16 1968  
RECEIVED  
C

DISTRIBUTION OF THIS DOCUMENT IS UNLIMITED

U. S. ARMY COATING & CHEMICAL LABORATORY

Aberdeen Proving Ground  
Maryland

Reproduced by the  
CLEARINGHOUSE  
for Federal Scientific & Technical  
Information Springfield Va. 22151

ACCESSION for	
CFSTI	WHITE SECTION <input checked="" type="checkbox"/>
DDC	BUFF SECTION <input type="checkbox"/>
UNANNOUNCED	<input type="checkbox"/>
JUSTIFICATION	
BY	
DISTRIBUTION/AVAILABILITY CODES	
DIST.	AVAIL. and or SPECIAL
/	

**DDC AVAILABILITY NOTICE**

Qualified requestors may obtain copies of this report from Defense Documentation Center, Cameron Station, Alexandria, Virginia 22314

THE FINDINGS IN THIS REPORT ARE NOT TO BE CONSTRUED AS AN OFFICIAL DEPARTMENT OF THE ARMY POSITION, UNLESS SO DESIGNATED BY OTHER AUTHORIZED DOCUMENTS.

DESTROY THIS REPORT WHEN IT IS NO LONGER NEEDED. DO NOT RETURN IT TO THE ORIGINATOR.

UNCLASSIFIED

CCL REPORT NO. 251

FINAL REPORT

STORAGE OF ETHYLENE GLYCOL ANTIFREEZE IN UNLINED TIN CONTAINERS

BY

JAMES H. CONLEY

JULY 1968

AMCMS CODE NO. 5025.11.80300

DEPARTMENT OF THE ARMY PROJECT NO.  
1G024401A109

U. S. ARMY COATING AND CHEMICAL LABORATORY  
ABERDEEN PROVING GROUND  
MARYLAND

DISTRIBUTION OF THIS DOCUMENT IS UNLIMITED

UNCLASSIFIED

### ABSTRACT

The object of this study was to investigate the effect of pH on the package stability of mercaptobenzothiozole-borax inhibited ethylene glycol antifreeze compounds. The antifreeze compounds were packaged in unlined tin plated containers for a two-year period.

Results show that antifreeze compounds with pH values below 10.3 caused corrosion in less than six months. Containers filled with compounds having pH values above 10.3 showed some corrosion in one year and were generally unsatisfactory after two years storage. Most of the attack was at the junction of the bottom and side seams of the containers.

TABLE OF CONTENTS

	<u>Page No.</u>
TITLE PAGE .....	i
ABSTRACT .....	ii
INTRODUCTION .....	1
DETAILS OF TEST .....	2
RESULTS OF TEST .....	2
DISCUSSION AND CONCLUSIONS .....	3
RECOMMENDATIONS .....	3
REFERENCES .....	3 - 4
APPENDIX A .....	5
Tables I - V .....	5 - 9
APPENDIX B .....	10
Photograph 1 .....	11
DISTRIBUTION LIST .....	12 - 14
DD FORM 1473 .....	15

## 1. INTRODUCTION

Aberdeen Proving Ground, Maryland, was directed by AMC program directive AMCMS Code No. 5025.11.80300 dated 22 September 1967 to investigate improved antifreeze compounds.

A large number of commercial antifreeze compounds in use today contain combinations of borate type inhibitors and mercaptobenzothiazole (MBT) or alkali metal salts of mercaptobenzothiazole. These compounds are usually packaged in tin containers, some of which have organic liners. They contain less than 0.05% MBT and are packaged at pH values of about 9.5. This is less than the desired amount of MBT needed for good service performance.

Corrosion difficulties have been encountered in the packaging of ethylene glycol antifreezes, especially if large amounts of MBT are present in the inhibitor system. MBT caused some corrosion in tin plated containers around the soldered side seam and considerably more at the point of junction of the side and bottom seams.

Undiluted ethylene glycol containing borax as an inhibitor composes Federal Specification O-A-548, Type 1, antifreeze. This material is specified for Army use by TB-ORD-651. It has an acidic pH (below 7.0) and tends to cause corrosion of tin containers in storage. Chemically, MBT is an acid. However, in diluted glycol mixtures in which the pH is buffered above 7.0, the presence of MBT greatly enhances the inhibitive properties of borax. Therefore, it is one of the constituents of Federal Specification O-1-490a, Inhibitor, Corrosion, Liquid Cooling System. This material is used in conjunction with O-A-548, Type 1, antifreeze and is specified for Army use by TB-ORD-651.

Preliminary data in CCL Reports No. 86 and No. 100 showed that tin panels immersed in undiluted ethylene glycol containing borax and 0.25% MBT were unsatisfactory after 8 months storage. Test solution pH values were below 7.0. Tin panels in solutions with pH values of 10.5 and containing 3% water were satisfactory after 8 months storage. Data also showed that tin panels in solutions containing 0.5% NACAP and 3% water were unsatisfactory both at low pH values and at pH values up to 10.5.

The present study was initiated to determine if an antifreeze compound containing enough MBT to give satisfactory service performance could be stored in unlined tin plated containers for a two year period by increasing the packaged pH value.

#### IV. DISCUSSION AND CONCLUSIONS

The data clearly shows that antifreeze compounds containing mercaptobenzothiazole packaged in unlined tin plated containers at pH values below 10.3 caused corrosion in six months. Antifreeze compounds with pH values above 10.3 caused corrosion at the junction of the side and bottom seams in two years.

Data in CCL Report No. 210 showed that antifreeze compounds having pH values above 8.5 are deleterious to both solder and aluminum radiator components during vehicle operation. If these metals are used, the most desirable pH values are in the range of from 7.5 to 8.2. Therefore, the problem of packaging antifreeze compounds becomes a function of the pH versus the type of container. The military have overcome this problem by specifying separate containers for the coolant and the inhibitor combination. This is not the most desirable solution from the logistics standpoint and causes some confusion in the field. It would be much better if a single package could be used.

#### V. RECOMMENDATIONS

It is recommended that a study of the storage of antifreeze in polyolefin containers be conducted. This will eliminate metal attack, will eliminate dual packaging of the coolant and inhibitor, simplify procurement and assure the use of the specified amount of inhibitor in the field. At the present time commercial antifreeze suppliers are in the process of switching to polyolefin containers.

#### VI. REFERENCES

1. Authority - AMC program directive AMCMS Code No. 5025.11.80300 dated 22 September 1967.
2. TB-ORD-651, Use of Antifreeze Solutions in Engine Cooling Systems, dated 10 April 1964.
3. Federal Specification O-A-548a, Antifreeze, Ethylene Glycol, Inhibited, Type I, dated 30 December 1958.
4. Federal Specification O-I-490a, Inhibitor, Corrosion, Liquid Cooling System, dated 26 April 1965.
5. Federal Specification PPP-C-96, Cans, Metal, 28 Gage and Lighter, dated 29 March 1955.
6. CCL Report No. 86, Study of a Newly Developed Inhibitor for Ethylene Glycol in Storage, dated December 1959.
7. CCL Report No. 100, Storage of Ethylene Glycol With Various Inhibitors, dated March 1961.

3. CCL Report No. 210, Effect of Coolants on Various Types of Aluminum Alloys, dated October 1966.



APPENDIX A

TABLE I

Composition of Test Solutions - Percent by Weight

	<u>Series A</u>				
	<u>1</u>	<u>2</u>	<u>3</u>	<u>4</u>	<u>5</u>
Ethylene Glycol	90.85	90.85	90.85	90.85	90.85
Distilled Water	4.85	4.85	4.85	4.85	4.85
Borax	4.00	4.00	4.00	4.00	4.00
Sodium Mercaptobenzothiazole (NACAP)	0.30	0.30	0.30	0.30	0.30
Added Sodium Hydroxide	0.84	0.85	0.86	0.87	0.90

	<u>Series B</u>				
	<u>1</u>	<u>2</u>	<u>3</u>	<u>4</u>	<u>5</u>
Ethylene Glycol	90.90	90.90	90.90	90.90	90.90
Distilled Water	4.90	4.90	4.90	4.90	4.90
Borax	4.00	4.00	4.00	4.00	4.00
Sodium Mercaptobenzothiazole (NACAP)	0.20	0.20	0.20	0.20	0.20
Added Sodium Hydroxide	0.84	0.85	0.86	0.87	0.90

	<u>Series C</u>				
	<u>1</u>	<u>2</u>	<u>3</u>	<u>4</u>	<u>5</u>
Ethylene Glycol	90.95	90.95	90.95	90.95	90.95
Distilled Water	4.95	4.95	4.95	4.95	4.95
Borax	4.00	4.00	4.00	4.00	4.00
Sodium Mercaptobenzothiazole (NACAP)	0.10	0.10	0.10	0.10	0.10
Added Sodium Hydroxide	0.84	0.85	0.86	0.87	0.90

TABLE II

Initial pH Values of Test Solutions

	<u>Pkg pH</u>	<u>50% pH</u>	<u>30% pH</u>
1 - A	8.30	9.50	9.85
2 - A	8.58	9.62	9.85
3 - A	8.80	9.82	10.05
4 - A	10.32	10.42	10.49
5 - A	10.80	11.02	11.08
1 - B	8.23	9.47	9.82
2 - B	8.38	9.62	9.93
3 - B	8.55	9.75	10.02
4 - B	8.88	9.93	10.20
5 - B	10.65	10.82	10.85
1 - C	8.12	9.42	9.72
2 - C	8.25	9.50	9.85
3 - C	8.55	9.75	10.05
4 - C	9.30	10.13	10.32
5 - C	10.65	10.85	10.89

TABLE III

Inspection of Containers After Six Months Storage

	<u>pH</u>	<u>Can Appearance Filled</u>	<u>Can Appearance Empty</u>
1 - A	8.50	Black over most surfaces	Surface dark and pitted
2 - A	8.65	Mod. sediment at seam joint	V. sl. pitting at seam joints
3 - A	8.88	Sl. - Mod. sediment at seam joint	V. sl. pitting at seam joint
4 - A	10.08	V. sl. sediment	V. sl. pitting at seam joint
5 - A	11.52	O.K.	O.K.
1 - B	8.30	Rusty sed. at bottom joint	V. sl. pitting at seam joint
2 - B	8.42	Rusty sed. at bottom joint	Sl. pitting at seam joint
3 - B	8.58	V. sl. sed. at bottom joint	V. sl. pitting at seam joint
4 - B	8.92	Sl. sed. at bottom joint	V. sl. pitting at seam joint
5 - B	11.12	V. sl. rusting at bottom joint	V. sl. pitting at seam joint
1 - C	8.15	V. sl. sed. at bottom joint	V. sl. pitting at seam joint
2 - C	8.32	V. sl. sed. at bottom joint	V. sl. pitting at seam joint
3 - C	8.55	V. sl. sed. at bottom joint	V. sl. pitting at seam joint
4 - C	9.02	Mod. sed. at bottom joint	Mod. pitting at seam joint
5 - C	11.08	O.K.	O.K.

TABLE IV

Inspection of Containers After One Year's Storage

	<u>pH</u>	<u>Can Appearance Filled</u>	<u>Can Appearance Empty</u>
1 - A	8.58	Black over entire surface	Surface dark & pitted, heavy corr. on seam
2 - A	8.72	Heavy sed. at seam joint, vapor phase corrosion	Sl. pitting at seam joint
3 - A	8.99	Mod. - Heavy sed., vapor phase corrosion	Sl. pitting at seam joint, 2 heavy spots
4 - A	10.53	Light sed. at seam joint	Sl. pitting at seam joint
5 - A	11.49	O.K.	V. sl. pitting on side seam near bottom
1 - B	8.25	Rusty sed. at seam joint, vapor phase corrosion	Sl. pitting at seam joint
2 - B	8.42	Rusty sed. at seam joint	Pitted over 1/2 bottom seam, spots on seam side
3 - B	8.52	Light sed. at seam joint, vapor phase corrosion	Sl. pitting at seam joint, scattered spots
4 - B	8.82	Mod. sed. at seam joint	Sl. pitting at seam joint & all over side seam
5 - B	11.20	O.K.	V. sl. pitting at seam joint
1 - C	8.18	Light rusty sed. at seam joint	Sl. pitting at seam joint, spots on side seam
2 - C	8.30	Light rusty sed. at seam joint, vapor phase corrosion	Sl. pitting at seam joint, spots on side seam
3 - C	8.60	Light rusty sed. at seam joint	Sl. pitting at seam joint, spots on side seam
4 - C	8.87	Heavy rusty sed.	Pitting over 1/2 of bottom seam & side seam
5 - C	11.22	O.K.	Sl. pitting at seam joint, spots on side seam


TABLE V

Inspection of Containers After Two Year's Storage

	pH	Can Appearance Filled	Can Appearance Empty
1-A	8.35	Mod. sed. mod-heavy pitting on side and bottom joint	Mod.-heavy pitting on side, sl. pitting at bottom joint
2-A	8.68	Mod. sed. at joint, pitting on side seam and along bottom seam with scattered spots	Scattered spot corrosion, sl.-mod. pitting at bottom seam joint
3-A	8.78	Mod. sed. at joint, corrosion all along side seam, vapor phase corrosion	Scattered spot corrosion, sl.-mod. pitting on side seam, sl. pitting at bottom joint
4-A	10.50	V. sl. sed. pitting on side seam	Sl. pitting on side seam and bottom joint
5-A	11.43	Soln. clear, spot corrosion & pitting on side seam, vapor phase corrosion	Mod.-heavy pitting on side seam, v. sl. pitting at bottom joint
1-B	8.22	Mod. sed., sl. pitting on side seam	Sl. pitting on side seam & bottom joint
2-B	8.37	Mod. sed., sl.-mod. pitting on side & bottom seam, vapor phase corrosion	Sl.-mod. pitting on side seam, sl. pitting at bottom joint
3-B	8.52	Mod. sed., sl. pitting on side seam	Sl. pitting on side seam, sl.-mod. pitting at bottom joint
4-B	8.93	Mod. sed., sl.-mod. pitting on side seam, vapor phase corrosion	Sl. pitting on side seam and bottom joint
5-B	11.10	Soln. clear, sl. pitting on side seam and bottom joint	V. sl. pitting on side and bottom seam joint
1-C	8.12	Mod. sed., mod. pitting on side seam	Sl.-mod. pitting on side seam and bottom joint
2-C	8.28	Sl. sed., sl. pitting on side seam	Sl. pitting on side seam and at bottom joint
3-C	8.42	Sl. sed., sl. pitting on side seam, vapor phase corrosion	Sl. pitting on side seam and at bottom joint
4-C	9.00	Sl. sed., sl. pitting on side seam	Sl. pitting on side seam, mod. pitting at bottom joint
5-C	11.18	Soln. clean, v. sl. sed. at bottom joint	Sl. pitting on side seam and at bottom joint

**APPENDIX B**

CORROSION OF TIN CONTAINERS  
AFTER TWO YEARS STORAGE—  
ETHYLENE GLYCOL ANTIFREEZE

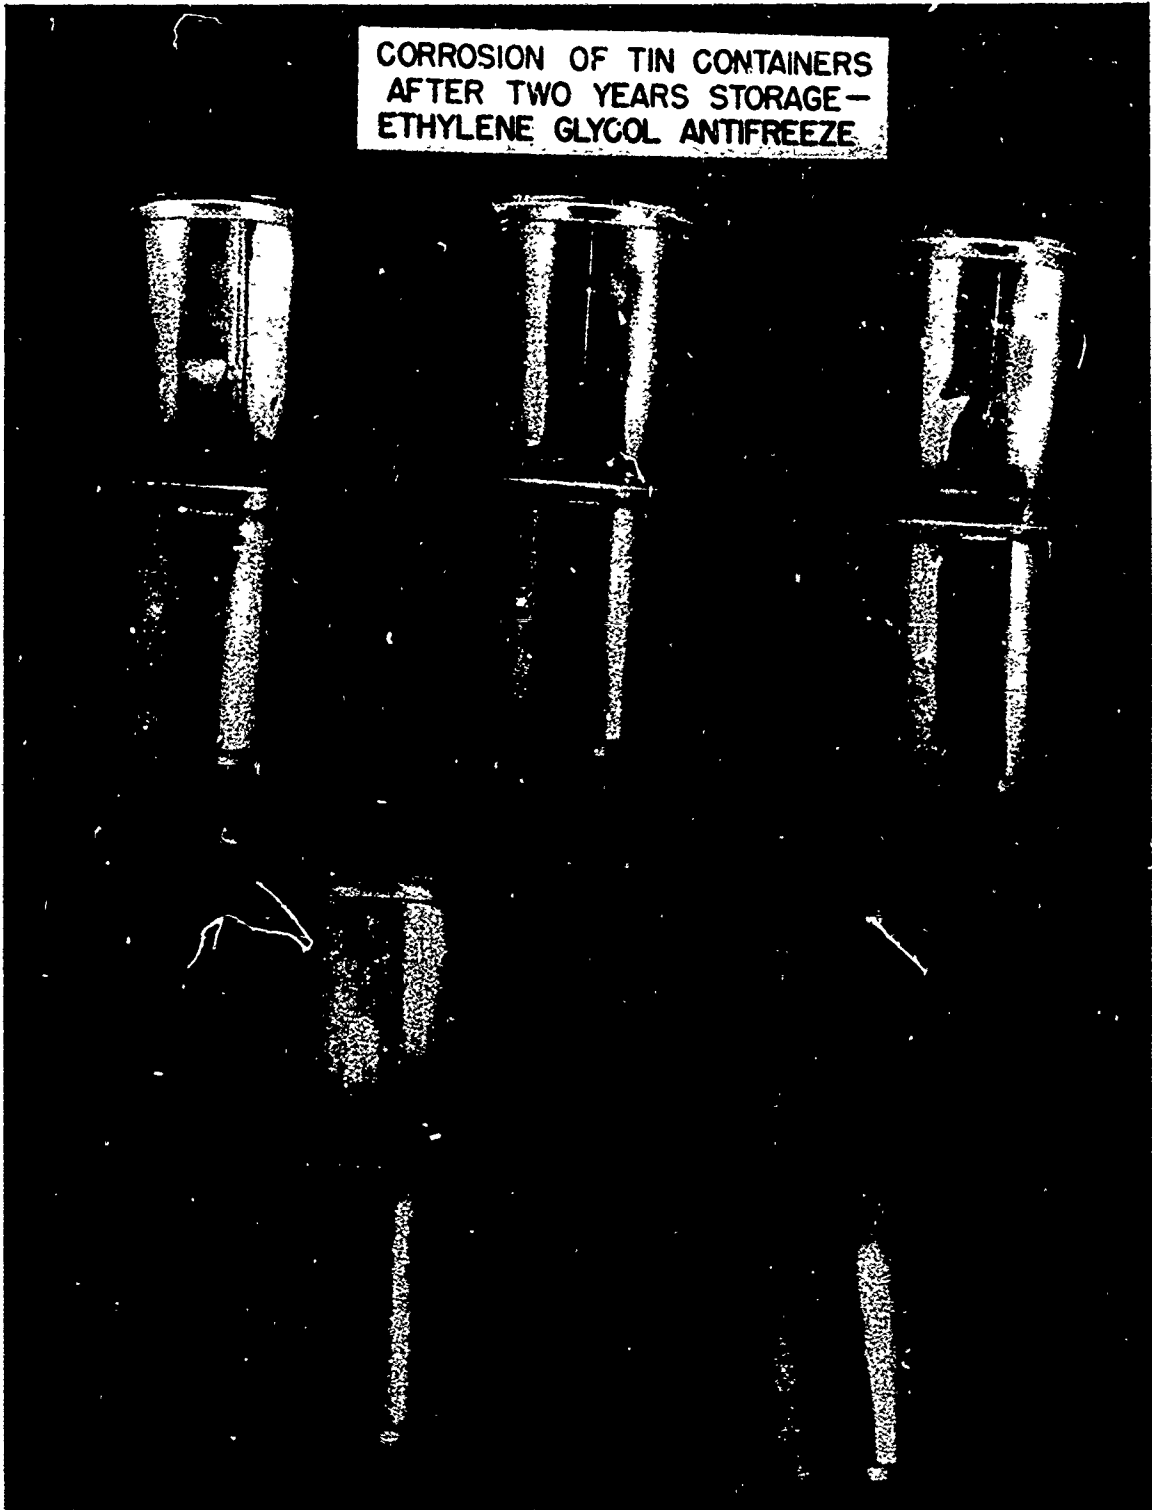

Unclassified

Security Classification

DOCUMENT CONTROL DATA - R&D		
<i>(Security classification of title, body of abstract and indexing annotation must be entered when the overall report is classified)</i>		
1. ORIGINATING ACTIVITY (Corporate author) U. S. Army Coating & Chemical Laboratory Aberdeen Proving Ground, Maryland 21005		2a. REPORT SECURITY CLASSIFICATION Unclassified
		2b. GROUP
3. REPORT TITLE STORAGE OF ETHYLENE GLYCOL ANTIFREEZE IN UNLINED TIN CONTAINERS		
4. DESCRIPTIVE NOTES (Type of report and inclusive dates) Final Report		
5. AUTHOR(S) (Last name, first name, initial) CONLEY, JAMES H.		
6. REPORT DATE July 1968	7a. TOTAL NO. OF PAGES	7b. NO. OF REFS 8
8a. CONTRACT OR GRANT NO. AMCMS Code No. 5025.11.80300	9a. ORIGINATOR'S REPORT NUMBER(S) CCL #251	
b. PROJECT NO. 1G024401A109	9b. OTHER REPORT NO(S) (Any other numbers that may be assigned this report)	
c.		
d.		
10. AVAILABILITY/LIMITATION NOTICES Qualified Requestors may obtain copies of this report from Defense Documentation Center. Distribution of this document is unlimited.		
11. SUPPLEMENTARY NOTES	12. SPONSORING MILITARY ACTIVITY U. S. Army Materiel Command Washington, D. C.	
13. ABSTRACT <p>&gt; The object of this study was to investigate the effect of pH on the package stability of mercaptobenzothiazole-borax inhibited ethylene glycol antifreeze compounds. The antifreeze compounds were packaged in unlined tin plated containers for a two-year period.</p> <p>Results show that antifreeze compounds with pH values below 10.3 caused corrosion in less than six months. Containers filled with compounds having pH values above 10.3 showed some corrosion in one year and were generally unsatisfactory after two years storage. Most of the attack was at the junction of the bottom and side seams of the containers.</p>		

DD FORM 1473  
1 JAN 64

Unclassified

Security Classification



14 KEY WORDS  Antifreeze Tin containers Mercaptobenzothiazole Storage	LINK A		LINK B		LINK C	
	ROLE	WT	ROLE	WT	ROLE	WT

INSTRUCTIONS

1. **ORIGINATING ACTIVITY:** Enter the name and address of the contractor, subcontractor, grantee, Department of Defense activity or other organization (*corporate author*) issuing the report.

2a. **REPORT SECURITY CLASSIFICATION:** Enter the overall security classification of the report. Indicate whether "Restricted Data" is included. Marking is to be in accordance with appropriate security regulations.

2b. **GROUP:** Automatic downgrading is specified in DoD Directive 5200.10 and Armed Forces Industrial Manual. Enter the group number. Also, when applicable, show that optional markings have been used for Group 3 and Group 4 as authorized.

3. **REPORT TITLE:** Enter the complete report title in all capital letters. Titles in all cases should be unclassified. If a meaningful title cannot be selected without classification, show title classification in all capitals in parenthesis immediately following the title.

4. **DESCRIPTIVE NOTES:** If appropriate, enter the type of report, e.g., interim, progress, summary, annual, or final. Give the inclusive dates when a specific reporting period is covered.

5. **AUTHOR(S):** Enter the name(s) of author(s) as shown on or in the report. Enter last name, first name, middle initial. If military, show rank and branch of service. The name of the principal author is an absolute minimum requirement.

6. **REPORT DATE:** Enter the date of the report as day, month, year, or month, year. If more than one date appears on the report, use date of publication.

7a. **TOTAL NUMBER OF PAGES:** The total page count should follow normal pagination procedures, i.e., enter the number of pages containing information.

7b. **NUMBER OF REFERENCES:** Enter the total number of references cited in the report.

8a. **CONTRACT OR GRANT NUMBER:** If appropriate, enter the applicable number of the contract or grant under which the report was written.

8b, 8c, & 8d. **PROJECT NUMBER:** Enter the appropriate military department identification, such as project number, subproject number, system numbers, task number, etc.

9a. **ORIGINATOR'S REPORT NUMBER(S):** Enter the official report number by which the document will be identified and controlled by the originating activity. This number must be unique to this report.

9b. **OTHER REPORT NUMBER(S):** If the report has been assigned any other report numbers (*either by the originator or by the sponsor*), also enter this number(s).

10. **AVAILABILITY/LIMITATION NOTICES:** Enter any limitations on further dissemination of the report, other than those imposed by security classification, using standard statements such as:

- (1) "Qualified requesters may obtain copies of this report from DDC."
- (2) "Foreign announcement and dissemination of this report by DDC is not authorized."
- (3) "U. S. Government agencies may obtain copies of this report directly from DDC. Other qualified DDC users shall request through \_\_\_\_\_."
- (4) "U. S. military agencies may obtain copies of this report directly from DDC. Other qualified users shall request through \_\_\_\_\_."
- (5) "All distribution of this report is controlled. Qualified DDC users shall request through \_\_\_\_\_."

If the report has been furnished to the Office of Technical Services, Department of Commerce, for sale to the public, indicate this fact and enter the price, if known.

11. **SUPPLEMENTARY NOTES:** Use for additional explanatory notes.

12. **SPONSORING MILITARY ACTIVITY:** Enter the name of the departmental project office or laboratory sponsoring (*paying for*) the research and development. Include address.

13. **ABSTRACT:** Enter an abstract giving a brief and factual summary of the document indicative of the report, even though it may also appear elsewhere in the body of the technical report. If additional space is required, a continuation sheet shall be attached.

It is highly desirable that the abstract of classified reports be unclassified. Each paragraph of the abstract shall end with an indication of the military security classification of the information in the paragraph, represented as (TS), (S), (C), or (U).

There is no limitation on the length of the abstract. However, the suggested length is from 150 to 225 words.

14. **KEY WORDS:** Key words are technically meaningful terms or short phrases that characterize a report and may be used as index entries for cataloging the report. Key words must be selected so that no security classification is required. Identifiers, such as equipment model designation, trade name, military project code name, geographic location, may be used as key words but will be followed by an indication of technical context. The assignment of links, rules, and weights is optional.