


ARMY RESEARCH LABORATORY

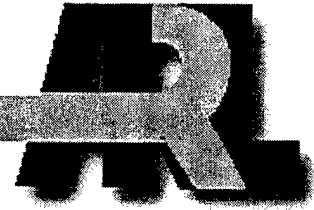

Reducing the Effective Slipperiness of  
Chemical-Biological Protective Shelter  
(CBPS) Flooring: Commercial Non-skid  
Shoe Covers and Alternative Materials

M. R. Fletcher

ARL-TR-2639

MARCH 2002

20020528 069

Chemlam-X22® is a registered trademark of Chemfab Corporation.

Kevlar® and Teflon® are registered trademarks of E.I. DuPont de Nemours & Co., Inc.

Kraton® is a registered trademark of Polymers Incorporated.

Skid-Safe® is a registered trademark of New Dimensions Solutions, LLC.

The findings in this report are not to be construed as an official Department of the Army position  
unless so designated by other authorized documents.

Citation of manufacturer's or trade names does not constitute an official endorsement or approval  
of the use thereof.

Destroy this report when it is no longer needed. Do not return it to the originator.

# Army Research Laboratory

Aberdeen Proving Ground, MD 21005-5425

---

---

ARL-TR-2639

March 2002

---

## Reducing the Effective Slipperiness of Chemical-Biological Protective Shelter (CBPS) Flooring: Commercial Non-skid Shoe Covers and Alternative Materials

M.R. Fletcher  
Human Research & Engineering Directorate, ARL

---

Approved for public release; distribution is unlimited.

---

---

---

## Abstract

---

Teflon<sup>®</sup>-coated floorings (Chemlam-X22<sup>®</sup>[A] and X22[B]) of the chemical-biological protective shelter (CBPS) tent system are necessary for decontaminability but are slippery under foot. Under normal walking conditions, soldiers who wore ordinary combat boots reported a slipping hazard; under wet conditions with fast-paced movement, footing is expected to become even more precarious. Commercially available non-skid shoe covers were evaluated in the laboratory as a means of reducing the risk of slipping but did not prove to confer any non-slip advantage. Some alternate materials were identified that can be applied as tread to disposable shoe covers and would provide greater wet and dry slip resistance on the CBPS flooring than uncovered combat boot soles.

## ACKNOWLEDGMENTS

I would like to thank Mr. Philip Brandler, Director of the U.S. Army Soldier Systems Center at the Soldier Biological and Chemical Command, Natick, Massachusetts, site, for supporting this study through the Continuous Product Improvement program. I would also like to thank those at Natick who assisted by supplying materials, equipment, and critical readings of the manuscript, and Dr. Edward Hirsch, Ergonomics Team Leader, who provided space and facilities for the work.

INTENTIONALLY LEFT BLANK

---

## Contents

---

<b>1.</b>	<b>Introduction</b> .....	<b>1</b>
<b>2.</b>	<b>Procedure</b> .....	<b>2</b>
<b>3.</b>	<b>Results</b> .....	<b>5</b>
<b>4.</b>	<b>Discussion</b> .....	<b>8</b>
	4.1 Gasket .....	9
	4.2 Commercial Soling Materials .....	9
	4.3 Custom Materials .....	10
	4.4 Matting .....	10
	4.5 Other Materials .....	11
	4.6 Shoe Covers for the CBPS .....	11
<b>5.</b>	<b>Conclusions</b> .....	<b>12</b>
	<b>References</b> .....	<b>13</b>
	<b>Distribution List</b> .....	<b>15</b>
	<b>Report Documentation Page</b> .....	<b>21</b>
	<b>Figure</b>	
1.	Apparatus and Setup for Measuring Slip Index .....	3
2.	Apparatus With Specimens of Shoe Covers in Place on Rubber Feet ..	4
3.	Slip Index Values for Shoe Covers, "Old Combat Boot Sole" and Gasket on Chemlam-X22 <sup>®</sup> (A) .....	7
4.	Slip Index Values for Shoe Covers, Boot Soles, and Other Materials on Chemlam-X22 <sup>®</sup> (B) .....	7
5.	Slip Index Increase With Increasing Static Contact Time, Gasket on Chemlam-X22 <sup>®</sup> (A) .....	8
6.	Proposed Pattern for Combining Different Materials on Shoe Cover Textile to Provide Tread for Both Wet and Dry Traction on Chemlam <sup>®</sup> Flooring .....	12
	<b>Tables</b>	
1.	Materials Evaluated Against Chemlam-X22 <sup>®</sup> (A) .....	4
2.	Materials Evaluated Against Chemlam-X22 <sup>®</sup> (B) .....	5
3.	Results of Experiments, This Study .....	6

INTENTIONALLY LEFT BLANK



REDUCING THE EFFECTIVE SLIPPERINESS OF CHEMICAL-  
BIOLOGICAL PROTECTIVE SHELTER (CBPS) FLOORING:  
COMMERCIAL NON-SKID SHOE COVERS  
AND ALTERNATIVE MATERIALS

---

## 1. Introduction

---

The chemical-biological protective shelter (CBPS) tent system, currently being developed, is intended as a battalion aid station to be used by Echelon I and II medical treatment teams. As such, it may be required to operate under chemical-biological warfare contaminated conditions and therefore must be cleanable and decontaminable. To this end, the Kevlar<sup>®</sup> fabric flooring is coated with Teflon<sup>®</sup>. The slipperiness of the Teflon<sup>®</sup>-coated flooring was identified as a safety hazard in early human use trials (Hanson & Drummond, 1992). Soldiers walking at ordinary speeds and under normal conditions on the material found it slippery. The likelihood is high that in actual use, the material would become wet with water or other fluids and become even more slippery. The rapid tempo of emergency medical work within the tent will exacerbate the hazard. In these circumstances, slip-and-fall accidents could result in compromised medical care and in additional injuries to medical personnel.

Because the flooring material must retain its resistance to chemical-biological agents and must retain its decontaminability, composition and texture changes of the material's surface are not an option. Attention therefore shifted to altering the properties of the footwear that will contact the floor. Modified combat boot soles or entirely new, dedicated footwear would not be cost effective to develop or convenient to employ, so disposable shoe covers that can be worn directly over any normal footwear appeared to be the best approach.

At an Integrated Process Team meeting at the Soldier Biological and Chemical Command (SBCCOM), Natick, Massachusetts, in July 1998, I volunteered to investigate increasing the coefficient of friction between footwear and the tent floor. Technical representatives of DuPont, the manufacturer of Teflon<sup>®</sup>, knew of no studies that addressed ways to maximize friction between Teflon<sup>®</sup> and other materials (D. Farelly, DuPont, personal communication, September 1998). In the spring of 2000, the Soldier Systems Center at Natick directed Continuous Product Improvement funding toward investigating the usability of existing commercial shoe covers with non-skid soles.

Disposable shoe covers used in hospitals and clean rooms generally consist of loose booties with elasticized tops that can be slipped easily over regular footwear. These items are available to cover the shoe only or to cover the entire

lower leg and are usually made of synthetic non-woven textiles of polypropylene, olefin, or polyethylene. To combat the slipperiness of these textiles on polished floors, manufacturers frequently offer one or more versions of non-skid shoe covers. The non-skid properties are obtained by (a) applying other, less slippery polymers as treads on the bottoms of the shoe covers by painting, dripping, or screen printing or (b) fabricating the soles of the shoe covers from materials embossed with a physical tread pattern.

Several different samples of non-skid shoe covers were acquired and evaluated against two versions of the CBPS flooring. For comparison purposes, later evaluation also included combat boot soles and some commercial and developmental sole materials and other products that might impart skid resistance.

---

## 2. Procedure

---

Two Teflon<sup>®</sup>-coated Kevlar<sup>®</sup> fabric materials were evaluated. The manufacturer designates the more flexible material as "Chemlam-X22," and the thicker, stiffer material is called "Chemlam-X22<sup>®</sup> floor"; in this study, they are termed A and B, respectively. Slip-resistance experiments using American Society for Testing Materials (ASTM) F 609 (ASTM, 1979; see Figure 1) were performed on commercially available non-skid shoe covers, combat boot sole materials, and other materials that might be applied to commercial shoe covers as non-skid treads. ASTM F 609 is generally not the test of choice today (English, 2001) since the equipment is no longer commercially available and the procedure is not specifically designed for use under wet conditions. In fact, there is currently no established standard for maximum floor slipperiness despite the fact that the Americans With Disabilities Act (U.S. Congress, 1991) suggests a coefficient of friction value of 0.5. Although the actual mechanisms of slip-and-fall accidents are much more complicated than this experiment suggests, ASTM F 609 was selected because it is a simple test that lends itself to preliminary materials screening, and it had already been used in earlier work with the CBPS system. Using the same test allowed comparisons among materials. The manufacturer's information included with the apparatus indicates that mean slip index (MSI) values of 6 or more are termed "relatively non-slippery," 5 to 6 as "generally acceptable," and 5 or less as "relatively slippery." The relationship of MSI values to coefficients of friction or established public standards is undefined.

Samples of bulk materials were cut from sheets or soles (0.25 to 0.375 inch thick) with a circular metal punch, resulting in plugs 0.5 inch in diameter. The plugs were then secured in the sample holders with rubber cement, and the sample holders were inserted into the apparatus (see Figure 2). Samples of shoe covers were cut from the tread portion of the item and attached to the bottoms of a

spare set of plugs with double-sided adhesive tape. The trials were all performed across or along the fabric, not on the bias, under both dry and water-wet conditions. The experiments consisted of measuring the slip resistance at 10 different locations on the flooring sample for each MSI value reported. The flooring was wiped clean between sets of measurements, and the slip meter was calibrated after every two or three sample sets. For the wet condition, approximately 50 ml of tap water were poured on the flooring and spread as well as possible, given the "unwetable" nature of the material. The sample materials mounted on the instrument were thoroughly wetted before wet measurements began, and the slip meter was positioned each time so that the feet contacted new wet areas of the flooring. The first set of trials (see Table 1) against the original flooring material (Chemlam-X22®[A]) included the shoe covers, older combat boot sole samples, and the material labeled "gasket". The second set of trials, with the newer flooring (Chemlam®-X22[B]), included the same samples as the first set plus new combat boot sole materials, commercial special application non-skid sole materials, and coatings applied to shoe cover textiles (see Table 2).



Figure 1. Apparatus and Setup for Measuring Slip Index.

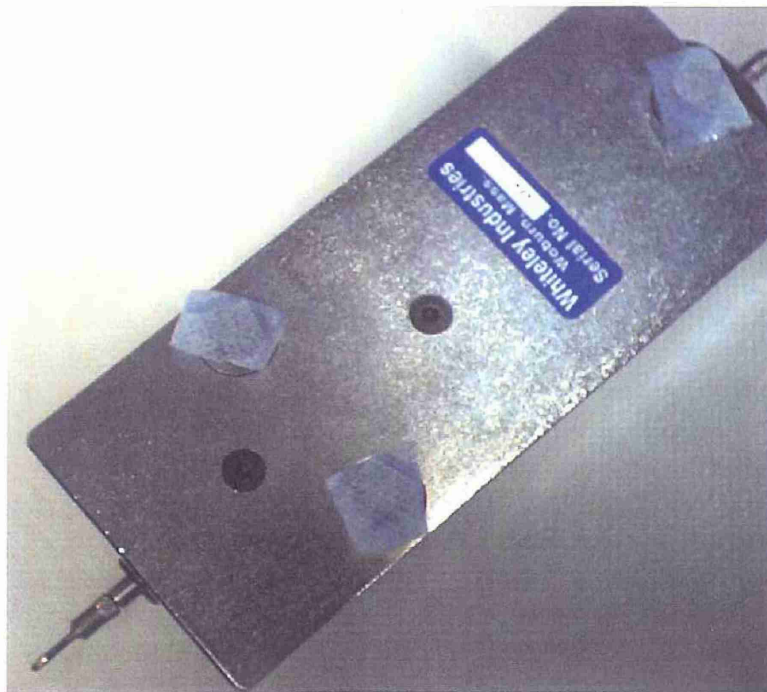


Figure 2. Apparatus With Specimens of Shoe Covers in Place on Rubber Feet.

Table 1. Materials Evaluated Against Chemlam-X22<sup>®</sup>(A)

Sample	Description	Source	Comments
091-4500	Shoe cover: Chevron-shaped white printed tread on blue non-woven textile	3S (Scientific, Supply Source)	"Non-skid"
1086WB	Shoe cover: 1- to 2-mm wide stripes of tread parallel to long axis of foot, 3 to 5 mm apart, on blue non-woven textile	Gepco (General Econopak), 1725 N. 6th St., Philadelphia PA 19122	
1184TGL	Shoe cover: Narrow closely spaced gray stripes on white non-woven textile	Gepco	"Anti-skid, fluid proof"
1286W	Shoe cover: two bands of clear slightly tacky tread "drizzled" on white non-woven textile	Gepco	
Gasket	Re-enterable splice case sealant (product # 125D)	General Sealants Inc., PO Box 3855, City of Industry CA 91744	
Old boot sole	Identified as "combat boot sole" in instrument set; used in previous evaluation	U.S. Army	Textured surface in contact with flooring

Table 2. Materials Evaluated Against Chemlam-X22<sup>®</sup>(B)

Sample	Description	Source	Comments
#344	Nitrile PVC combat-boot sole	Quabaug Corporation, 18 School St., N. Brookfield MA 01535	Conforms to U.S. Army CRF/PD 97-03B and 99-09
#3389	Styrene-butadiene rubber combat boot sole	Quabaug Corporation	Conforms to U.S. Army CRF/PD 97-03B and 99-09
TC-1	Styrene-butadiene rubber with natural rubber	Quabaug Corporation	Sticky to touch
"Grip"	Modified butyl rubber sole	Quabaug Corporation	
Matting	"Mighty Mat": One side scored rubber, other side embedded abrasive granules	Shoes For Crews, 1400 Centrepark Blvd., Suite 310, W. Palm Beach FL 33401	Compositions not available. \$81 for 3-ft by 5-ft mat
SS-1	Skid-Safe <sup>®</sup> emulsion applied as coating on non-woven textile (three coats)	New Dimensions, 1551 37th Ave., San Francisco, CA 94122	"Highly slip resistant," water based
RC-1	Common rubber cement applied as coating on non-woven textile (three coats)	U.S. Army	

PVC = polyvinyl chloride CRFD<sup>1</sup> purchase description

### 3. Results

Table 3 and Figures 3 and 4 show that, in terms of this experiment, not only were the shoe covers no improvement over combat boot soles, but they generally resulted in increased slipperiness, wet or dry. The generally low MSI means and small standard deviations indicated that statistical methods were unnecessary to show that the shoe covers did not offer material improvement in slip resistance. All the actual sole materials investigated, as well as the gasketing and matting, performed better than the nominally skid-resistant shoe covers. The Skid-Safe<sup>®</sup> and rubber cement coatings did not perform well. In order to provide comparisons among materials, measurements on the high-performing materials are provided even though their magnitudes exceed 8, which is the maximum reliable reading from the slip meter. The useful limit of this method with the soft, tacky rubbers is related to the weight of the meter assembly as well as to the

<sup>1</sup> Not an acronym

coefficient of friction between the specimen and the flooring. At readings of about 9 or above on the slip meter, the trailing edge of the assembly begins to lift off the surface, and the materials being evaluated sometimes deform rather than actually slipping. The meter readings of these experiments did not show a clear point where slippage began but continued to rise even after the assembly began to move. With the gasketing, material smeared off the samples and remained on the flooring, although it did not bond tightly and could be removed by rubbing with a dry cloth. This gasketing, when left in contact with the flooring without moving, developed a tack that might result in problems in lifting the foot after one has stood still for long periods (see Figure 5). The shoe sole materials did not show this effect.

Table 3. Results of Experiments, This Study  
(10 replications each)

Sample	MSI(dry)	SD (dry)	MSI (wet)	SD (wet)
Against Chemlam-X22 <sup>®</sup> (A)				
091-4500 (shoe cover)	2.5	0.4	2.1	0.2
1086WB (shoe cover)	3.5	0.3	3.5	0.1
1184TGL (shoe cover)	3.4	0.2	3.7	0.3
1286W (shoe cover)	5.1	0.3	4.4	0.4
Gasket	10.1	0.6	9.1	0.5
Old boot sole	5.0	0.2	4.2	0.1
Against Chemlam-X22 <sup>®</sup> (B)				
091-4500 (shoe cover)	2.6	0.2	2.3	0.3
1086WB (shoe cover)	2.5	0.3	2.3	0.3
1184TGL (shoe cover)	3.5	0.2	3.3	0.2
1286W (shoe cover)	3.2	0.2	3.4	0.2
Gasket	11.3	0.5	9.4	0.3
Old boot sole	5.0	0.3	5.1	0.2
#344 (nitrile PVC boot sole)	5.6	0.3	5.2	0.4
#3389 (styrene-butadiene boot sole)	6.5	0.2	8.4	0.3
TC-1 (styrene-butadiene+natural rubber)	7.4	0.4	10.8	0.3
"Grip" (modified butyl rubber)	9.5	0.5	9.4	0.3
Matting	5.3	0.3	5.1	0.3
SS-1 (Skid-Safe <sup>®</sup> )	1.8	0.1	1.7	0.1
RC-1 (rubber cement)	3.2	0.2	2.8	0.1

SD = Standard deviation

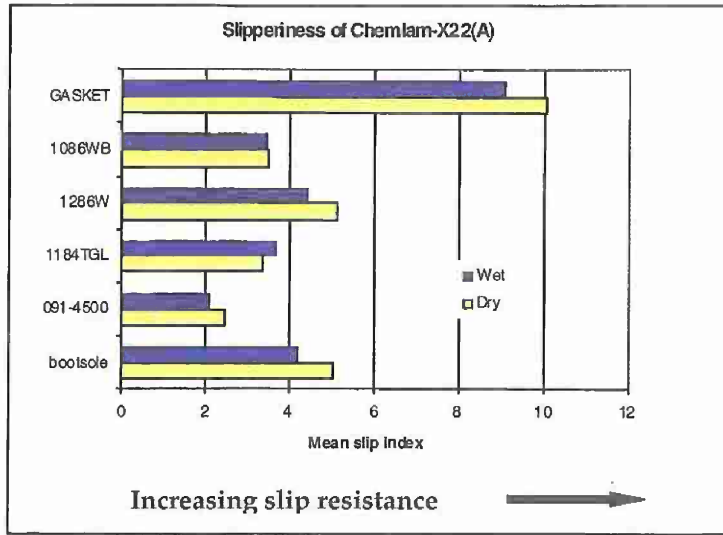


Figure 3. Slip Index Values for Shoe Covers, "Old Combat Boot Sole" and Gasket on Chemlam-X22®(A) (10 readings/mean value).

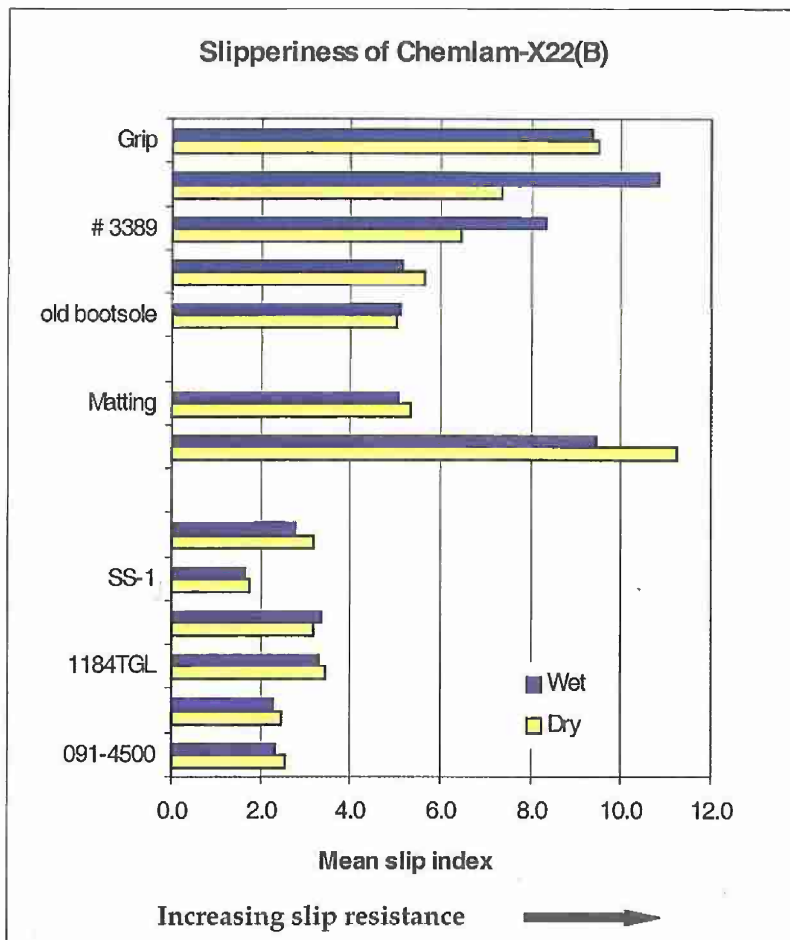


Figure 4. Slip Index Values for Shoe Covers, Boot Soles, and Other Materials on Chemlam-X22(B) (10 readings/mean value).

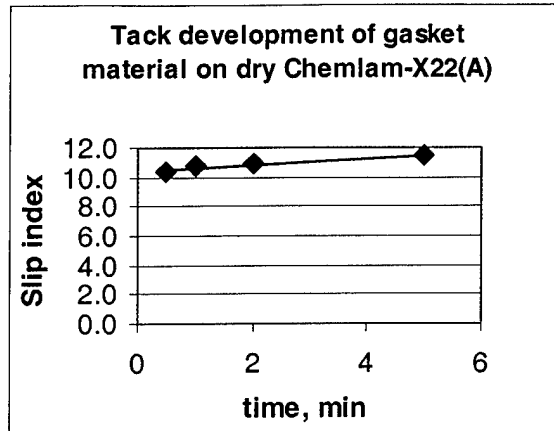


Figure 5. Slip Index Increase With Increasing Static Contact Time, Gasket on Chemlam-X22<sup>®</sup>(A).

---

#### 4. Discussion

---

The insurance and safety industries have long been interested in preventing slip-and-fall accidents (Brungraber, 1976), and research into flooring and shoe sole materials as well as the mechanics of evaluation are ongoing (Manning & Jones, 2001; Gronqvist & Hirvonen, 1999; Chang, 1999). The safety of pedestrians in public areas and of industrial workers where the footing may be contaminated with water or oil, forms the major thrust of most of this work because of the economics of law suits and workers' compensation and lost productivity costs. Thus, no investigations into slipping on Teflon<sup>®</sup>-coated surfaces exist because in the normal course of events, no one would consider using it as flooring.

Earlier tests of the "old combat boot sole" against Chemlam-X22<sup>®</sup>(A) (P. Stewardson, SBCCOM, personal communication, January 1999) gave slip indices of 3.0 to 5.25 (six individual measurements). These numbers are in line with those found in the current study. However, one of the newer combat boot sole materials obtained from the manufacturer gave higher MSIs for both dry and wet conditions. This suggests that some existing combat boots would provide better traction on the CBPS floor than would others. If it can be determined that boots with certain sole materials provide better slip resistance, it might be worthwhile to ensure that these boots are issued to medical and support personnel assigned to work with the CBPS system.

During the course of this study, materials have been identified that may produce a good non-skid contact with the Chemlam<sup>®</sup> floorings if they are applied to shoe covers as tread. Some of the more promising materials are discussed at length in the following section. In addition, a non-slip anti-fatigue matting was investigated.



## 4.1 Gasket

The material termed "gasket" is a black, soft, tacky surfaced material designed for sealing electrical splice boxes and is supplied in tape, cord, and sheet forms. It was first encountered during an ensuing test and evaluation of the Chemically Protected Deployable Medical System disc-clamp seal at the Regional Training Site-Medical (formerly Ft. Devens) in Ayer, Massachusetts, in August 1998 (Woods, 1998), where its tendency to stick to the tentage material suggested that it might prove useful in the present study. The gaskets were supplied as pre-cut disks about 3 inches in diameter and 0.25 inch thick. A new disk was the source of the material used in the present study. The excellent performance of this material in slip experiments prompted discussion with the manufacturer, who termed it a "partially cured polyethylene synthetic rubber" (D. Carringer, General Sealants, personal communication, March 1999). No further information was given about its composition. Because the material was quite tacky in contact with the Chemlam<sup>®</sup> floorings, the possibility exists that too much adhesion would develop if a large area of the gasketing remained in contact with the flooring for any length of time, and a full sole made of the gasketing would probably not be suitable. When the manufacturer was approached about the possibility of modifying the composition or production methods to allow a pattern of small nubs or dots to be printed on disposable non-woven material that could then be made into shoe covers, he expressed no interest in investigating the material for this application, given its supposed small profit margin. However, a good skid-proof sole for disposable shoe covers might find a very wide market, since discussions with manufacturers of the commercial varieties and with medical and dental personnel revealed that the current offerings are considered to have unsatisfactory slip resistance.

## 4.2 Commercial Soling Materials

Commercial polymeric and rubber shoe sole compositions, including those for combat boots, are frequently designed with wear resistance in mind; tread patterns provide slip resistance. Between otherwise identical shoe soles, differences in small-scale roughness (about 3 to 60  $\mu\text{m}$  resin transfer molded), "stickiness" (tack), and backing rigidity may control slip resistance on water-wet surfaces, as shown in an extensive study of commercial soling materials (Manning & Jones, 2001). In that study, the soles with the highest measured surface roughness generally showed the highest slip resistance when studied in contact with water-wet surfaces. The best performer overall, however, was a rock-climbing boot sole, with a shear strength so low that it smeared during polishing. The rather sticky rubbers used in the soles of climbing boots may have properties similar to those of the gasket material evaluated in this study. While such materials are not particularly durable, this is not a problem with disposable shoe covers.

Army combat boots are subject to performance specifications rather than materials requirements (T. Meehan [Defense Supply Center, Philadelphia],

personal communication; June 2001). The specifications address abrasion and tear resistance, chemical resistance to fuel oils, and tendency to rub off on or "mark" floors; none of the performance specifications address the coefficient of friction (e.g., U.S. Army, 2000a and 2000b). Quabaug manufactures two common combat boot out-sole materials currently in use and considered in this study: a nitrile polyvinyl chloride (PVC) and a styrene-butadiene rubber (corresponding to compounds 344 and 3389 made by Quabaug-Vibram; T. Miner, personal communication, June 2001), selected largely for wear resistance. Quabaug also manufactures the two materials used in rock-climbing footwear that are evaluated in this study: a butyl rubber ("Grip") and a styrene-butadiene-based compound that contains natural rubber as well (TC-1). The butyl rubber provided the highest dry MSI of any of the actual sole materials evaluated in this study, exceeded only by that of the gasket material. However, the compound containing natural rubber provided the highest wet MSI of any material evaluated in this work.

### 4.3 Custom Materials

Many commercially available polymers are used in the manufacture of materials for specific applications, including shoe soles, and much of the following information no doubt applies to several manufacturers. As an example, Kraton<sup>®</sup>, a series of polymers manufactured by Polymers Incorporated (formerly Shell Chemicals), possesses highly tailorable properties in terms of strength, deformation, and tack. Some of the Kraton<sup>®</sup> formulations possess better wet traction than the PVC rubbers commonly used for footwear soles (D. St. Clair, Polymers, Inc., personal communication, June 2001).

Depending on specific compositions, most of these polymers can be processed as "hot melts" or solvent-based solutions via extrusion, coating, or injection molding. Liquid formulations can be screen printed or painted onto a fabric backing; hot melts can be extruded through a pattern of nozzles to make a discontinuous tread. While the solvent-based approach is probably easier in terms of manufacturing equipment, the necessary solvents (e.g., toluene, heptane, hexane, isopropyl acetate) are hazardous and would result in safety and disposal or recycling considerations. The cost effectiveness of the two processing methods is competitive. The Kraton<sup>®</sup> polymers and additives themselves currently cost from \$1.00 to \$2.50 per pound, which is in the price range of other commonly used polymeric shoe sole materials.

### 4.4 Matting

"Shoes for Crews," a company specializing in industrial footwear, manufactures the non-slip matting evaluated in this study. The matting consists of a 0.375-inch thick layer of black rubber (unidentified), which is scored at intervals of approximately 0.375 inch on one side and covered with coarse abrasive granules (unidentified; probably silicon carbide) on the other. The abrasive side clearly

could not be used in contact with the CBPS floor, so evaluation was done on the rubber side. Product literature indicates that the rubber used in the matting is the same compound that is used in the company's shoe soles.

#### 4.5 Other Materials

Skid-Safe<sup>®</sup> is a water-based paint-type floor coating containing acrylic copolymers, butoxyethanol, and ethylene glycol. While it is designed for essentially rigid flooring materials, product literature recommends it for use on flexible rubber flooring as well. A sample was obtained and three coats were applied to non-woven shoe cover material (obtained from parts of commercial shoe covers – sample SS-1). Similar samples were made by the application of three coats of common rubber cement to the same textile, as an example of a polymeric coating readily and cheaply available (Sample RC-1). Results obtained from these materials do not warrant further investigation here.

#### 4.6 Shoe Covers for the CBPS

A small, discontinuous tread pattern of dots or lines that protrudes from the surface of the shoe cover provides better traction on water-wet flooring than does a continuous sole surface, because the nubs will penetrate the water film rather than just push it ahead of the descending foot. Pushing the liquid forward uniformly could result in hydroplaning and a slip accident. Thus, the challenge is to find materials with acceptable traction properties combined with suitable processing requirements that can be applied to shoe cover textiles.

Without our recommending any particular product, the results obtained in this study indicate that materials do exist that are effective and processable in the manufacture of shoe covers with high traction in contact with the CBPS flooring; that is, they lend themselves to screen printing or extrusion patterning onto the non-woven synthetic fabrics normally used in shoe covers. The gasket material, TC-1, and "Grip" all performed markedly better in at least one condition (wet or dry) than any of the combat boot soles evaluated. While the gasket manufacturer did not feel that his material was suitable for application to textiles, the other materials probably can be adapted to such processing (T. Miner, Quabaug Corp., personal communication, June 2001), which suggests that similar materials would be generally useful in shoe cover fabrication.

Because no single material proved superior to others in both wet and dry conditions, two different materials can be combined, as shown in Figure 6. Such an approach, using two separate operations to lay the tread pattern, would accommodate even materials that are chemically incompatible and would provide the cross-sectional tread profile desirable on water-wet surfaces. The materials evaluated cost about \$1.00 per pound, and therefore, this approach would be competitive with custom-developed polymers.

---

## 5. Conclusions

---

The commercial shoe covers investigated are unsatisfactory for slipperiness reduction in the CBPS system, since none of them demonstrate any improvement over the combat boot sole. Some of the alternate materials evaluated performed well under wet and dry conditions, and some of these high performers are amenable to processing as tread on disposable shoe covers. Custom shoe covers could be made that incorporate the materials that demonstrably reduce slipping during anticipated use conditions, or disposable non-slip mats might be considered.

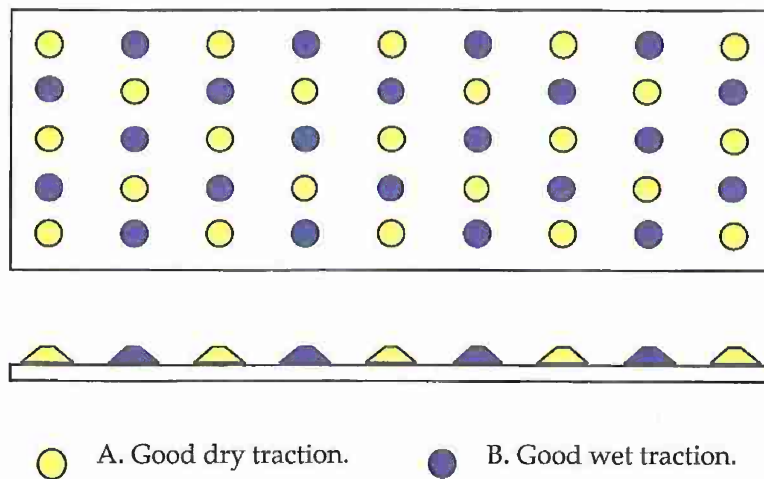


Figure 6. Proposed Pattern for Combining Different Materials on Shoe Cover Textile to Provide Tread for Both Wet and Dry Traction on Chemlam® Flooring (plan view and cross section).

---

## References

---

- American Society for Testing Materials (1979). *Static Slip Resistance of Footwear Sole, Heel, or Related Materials by Horizontal Pull Slip Meter* (ASTM F 609).
- Brungraber, R.J. (1976). *An overview of floor slip-resistance research with annotated bibliography* (NBS Technical Note 895). Washington, DC: U.S. Department of Commerce, National Bureau of Standards.
- Chang, W-R. (1999). The effect of surface roughness on the measurement of slip resistance. *International Journal of Industrial Ergonomics*, 24, 299-313.
- English, W. (2001). Current slip resistance testing standards. Web site <http://www.englishxl.com/stds.htm>.
- Gronqvist, R., & Hirvonen, M. (1995). Slipperiness of footwear and mechanisms of walking friction on icy surfaces. *International Journal of Industrial Ergonomics*, 16, 191-200.
- Hanson, D.W., & Drummond, C.J. (1992). *Final test report for the preproduction qualification test (PPQT) of the chemically and biologically protected shelter (CBPS)* (Project No. 8-ES-975-CBS-007). Ft. Greeley, AK: U.S. Army Cold Regions Test Center.
- Manning, D.P. & Jones, C. (2001). The effect of roughness, floor polish, water, oil, and ice on underfoot friction: current safety footwear solings are less slip resistant than microcellular polyurethane. *Applied Ergonomics*, 32, 185-196.
- U.S. Army (2000a, 16 June). Purchase Description: Boots, Combat, Infantry (CRFD/PD 97-03B). Philadelphia, PA: Defense Personnel Support Center.
- U.S. Army (2000b, 19 April). Purchase Description: Boots, Combat, Infantry (CRFD/PD 99-09). Philadelphia, PA: Defense Personnel Support Center.
- U.S. Congress (20 July 1991). Americans with disabilities act of 1990 (as amended). *Federal Register* 68(144).
- Woods, D. (1998). *Efficacy of the disc clamps connectors and stepladder usage for the Chemically Protected Deployable Medical System (CP-DEPMEDS)* (Internal report). Natick, MA: Soldier Biological and Chemical Command.

INTENTIONALLY LEFT BLANK

NO. OF  
COPIES ORGANIZATION

1 ADMINISTRATOR  
DEFENSE TECHNICAL INFO CTR  
ATTN DTIC OCA  
8725 JOHN J KINGMAN RD STE 0944  
FT BELVOIR VA 22060-6218

1 DIRECTOR  
US ARMY RSCH LABORATORY  
ATTN AMSRL CI AIR REC MGMT  
2800 POWDER MILL RD  
ADELPHI MD 20783-1197

1 DIRECTOR  
US ARMY RSCH LABORATORY  
ATTN AMSRL CI LL TECH LIB  
2800 POWDER MILL RD  
ADELPHI MD 20783-1197

1 DIRECTOR  
US ARMY RSCH LABORATORY  
ATTN AMSRL D D SMITH  
2800 POWDER MILL RD  
ADELPHI MD 20783-1197

1 DIR FOR PERS TECHNOLOGIES  
DPY CHIEF OF STAFF PERS  
300 ARMY PENTAGON 2C733  
WASHINGTON DC 20310-0300

1 DIR ARMY AUDIOLOGY  
& SPEECH CTR  
WALTER REED ARMY MED CTR  
WASHINGTON DC 20307-5001

1 OUSD(A)/DDDR&E(R&A)/E&LS  
PENTAGON ROOM 3D129  
WASHINGTON DC 20301-3080

1 CODE 1142PS  
OFC OF NAVAL RSCH  
800 N QUINCY STREET  
ARLINGTON VA 22217-5000

1 WALTER REED INST OF RSCH  
ATTN SGRD UWIC  
COL REDMOND  
WASHINGTON DC 20307-5100

1 CDR  
US ARMY RSCH INST  
ATTN PERI ZT DR E M JOHNSON  
5001 EISENHOWER AVENUE  
ALEXANDRIA VA 22333-5600

NO. OF  
COPIES ORGANIZATION

1 DEF LOGISTICS STUDIES  
INFORMATION EXCHANGE  
ATTN DIR DLSIE ATSZ DL  
BLDG 12500  
2401 QUARTERS ROAD  
FORT LEE VA 23801-1705

1 HEADQUARTERS USATRADO  
ATTN ATCD SP  
FORT MONROE VA 23651

1 CDR  
USATRADO  
COMMAND SAFETY OFC  
ATTN ATOS PESSAGNO/LYNE  
FORT MONROE VA 23651-5000

1 DIRECTOR TDAD DCST  
ATTN ATTG C  
BLDG 161  
FORT MONROE VA 23651-5000

1 HQ USAMRDC  
ATTN SGRD PLC  
FORT DETRICK MD 21701

1 CDR  
USA AEROMEDICAL RSCH LAB  
ATTN LIBRARY  
FORT RUCKER AL 36362-5292

1 US ARMY SAFETY CTR  
ATTN CSSC SE  
FORT RUCKER AL 36362

1 CHIEF  
ARMY RSCH INST  
AVIATION R&D ACTIVITY  
ATTN PERI IR  
FORT RUCKER AL 36362-5354

1 AIR FORCE FLIGHT DYNAMICS LAB  
ATTN AFWAL/FIES/SURVIAC  
WRIGHT PATTERSON AFB OH 45433

1 US ARMY TROOP SUPPORT CMD  
NATICK RD&E CTR  
ATTN BEHAVIORAL SCI DIV SSD  
NATICK MA 01760-5020

1 US ARMY TROOP SUPPORT CMD  
NATICK RD&E CTR  
ATTN TECH LIB (STRNC MIL)  
NATICK MA 01760-5040

NO. OF  
COPIES ORGANIZATION

1 DR RICHARD JOHNSON  
HEALTH & PERFORMANCE DIV  
US ARIEM  
NATICK MA 01760-5007

1 PROGRAM MANAGER RAH-66  
ATTN SFAE AV RAH  
BLDG 5681 WOOD RD  
REDSTONE ARSENAL AL 35898

1 NAVAL SUB MED RSCH LAB  
MEDICAL LIB BLDG 148  
BOX 900 SUBMARINE BASE  
NEW LONDON  
GROTON CT 06340

1 USAF ARMSTRONG LAB/CFTO  
ATTN DR F W BAUMGARDNER  
SUSTAINED OPERATIONS BR  
BROOKS AFB TX 78235-5000

1 CDR  
USAMC LOGISTICS SUP ACTIVITY  
ATTN AMXLS AE  
REDSTONE ARSENAL AL  
35898-7466

1 ARI FIELD UNIT FT KNOX  
BLDG 2423 PERI IK  
FORT KNOX KY 40121-5620

1 CDR  
WHITE SANDS MISSILE RANGE  
ATTN STEWS TE RE  
WSMR NM 88002

1 STRICOM  
12350 RSCH PARKWAY  
ORLANDO FL 32826-3276

1 PURDUE UNIVERSITY  
SERIALS UNIT  
CDM KARDEX  
1535 STEWART CTR  
WEST LAFAYETTE IN  
47907-1535

1 GOVT PUBLICATIONS LIB  
409 WILSON M  
UNIVERSITY OF MINNESOTA  
MINNEAPOLIS MN 55455

NO. OF  
COPIES ORGANIZATION

1 DR RICHARD PEW  
BBN SYSTEMS &TECH CORP  
10 MOULTON STREET  
CAMBRIDGE MA 02138

1 DR HARVEY A TAUB  
RSCH SECTION PSYCH SECTION  
VETERANS ADMIN HOSPITAL  
IRVING AVE & UNIVERSITY PLACE  
SYRACUSE NY 13210

1 DR ROBERT C SUGARMAN  
132 SEABROOK DRIVE  
BUFFALO NY 14221

1 DR ANTHONY DEBONS  
IDIS UNIV OF PITTSBURGH  
PITTSBURGH PA 15260

1 MR R BEGGS  
BOEING-HELICOPTER CO  
P30-18  
PO BOX 16858  
PHILADELPHIA PA 19142

1 DR ROBERT KENNEDY  
ESSEX CORPORATION STE 227  
1040 WOODCOCK ROAD  
ORLANDO FL 32803

1 LAWRENCE C PERLMUTER PHD  
UNIV OF HEALTH SCIENCES  
THE CHICAGO MEDICAL SCHOOL  
DEPT OF PSYCHOLOGY  
3333 GREEN BAY ROAD  
NORTH CHICAGO IL 60064

1 GENERAL DYNAMICS  
LAND SYSTEMS DIV LIBRARY  
PO BOX 1901  
WARREN MI 48090

1 DR MM AYOUB DIRECTOR  
INST FOR ERGONOMICS RSCH  
TEXAS TECH UNIVERSITY  
LUBBOCK TX 79409

1 DELCO DEF SYS OPERATIONS  
ATTN RACHEL GONZALES B204  
7410 HOLLISTER AVE  
GOLETA CA 93117-2583



NO. OF  
COPIES ORGANIZATION

1 MR WALT TRUSZKOWSKI  
NASA/GODDARD SPACE  
FLIGHT CTR  
CODE 588.0  
GREENBELT MD 20771

1 US ARMY  
ATTN AVA GEDDES  
MS YA:219-1  
MOFFETT FIELD CA 94035-1000

1 DR NORMAN BADLER  
DEPT OF COMPUTER & INFO  
SCIENCE  
UNIV OF PENNSYLVANIA  
PHILADELPHIA PA 19104-6389

1 CDR  
US ARMY RSCH INST OF  
ENVIRONMNTL MEDICINE  
NATICK MA 01760-5007

1 HQDA (DAPE ZXO)  
ATTN DR FISCHL  
WASHINGTON DC 20310-0300

1 HUMAN FACTORS ENG PROGRAM  
DEPT OF BIOMEDICAL ENGG  
COLLEGE OF ENGINEERING &  
COMPUTER SCIENCE  
WRIGHT STATE UNIVERSITY  
DAYTON OH 45435

1 CDR  
USA MEDICAL R&D COMMAND  
ATTN SGRD PLC LTC K FRIEDL  
FORT DETRICK MD 21701-5012

1 PEO ARMOR SYS MODERNIATION  
US ARMY TANK-AUTOMOTIVE CMD  
ATTN SFAE ASM S  
WARREN MI 48397-5000

1 PEO COMMUNICATIONS  
ATTN SFAE CM RE  
FT MONMOUTH NJ 07703-5000

1 PEO AIR DEF  
ATTN SFAE AD S  
US ARMY MISSILE COMMAND  
REDSTONE ARSENAL AL  
35898-5750

NO. OF  
COPIES ORGANIZATION

1 PEO STRATEGIC DEF  
PO BOX 15280 ATTN DASD ZA  
US ARMY STRATEGIC DEF CMD  
ARLINGTON VA 22215-0280

1 PROGRAM MANAGER RAH-66  
ATTN SFAE AV RAH  
BLDG 5681 WOOD RD  
REDSTONE ARSENAL AL 35898

1 JON TATRO  
HUMAN FACTORS SYS DESIGN  
BELL HELICOPTER TEXTRON INC  
PO BOX 482 MAIL STOP 6  
FT WORTH TX 76101

1 CHIEF CREW SYS INTEGRATION  
SIKORSKY AIRCRAFT M/S S3258  
NORTH MAIN STREET  
STRATFORD CT 06602

1 GENERAL ELECTRIC COMPANY  
ARMAMENT SYS DEPT RM 1309  
ATTN HF/MANPRINT R C MCLANE  
LAKESIDE AVENUE  
BURLINGTON VT 05401-4985

1 JOHN B SHAFER  
250 MAIN STREET  
OWEGO NY 13827

1 OASD (FM&P)  
WASHINGTON DC 20301-4000

1 COMMANDANT  
US ARMY ARMOR SCHOOL  
ATTN ATSB CDS  
FT KNOX KY 40121-5215

1 CDR  
US ARMY AVIATION CTR  
ATTN ATZQ CDM S  
FT RUCKER AL 36362-5163

1 CDR  
US ARMY SIGNAL CTR &  
FT GORDON  
ATTN ATZH CDM  
FT GORDON GA 30905-5090

1 DIR US ARMY AEROFLIGHT  
DYNAMICS DIR  
MAIL STOP 239-9  
NASA AMES RSCH CTR  
MOFFETT FIELD CA 94035-1000

NO. OF COPIES	<u>ORGANIZATION</u>	NO. OF COPIES	<u>ORGANIZATION</u>
1	CDR MARINE CORPS SYSTEMS CMD ATTN CBGT QUANTICO VA 22134-5080	1	HQ 7TH ARMY TRAINING CMD UNIT #28130 AMC FAST SCIENCE ADVISER ATTN AETT SA APO AE 09114
1	DIR AMC-FIELD ASSIST IN SCIENCE & TECHNOLOGY ATTN AMC-FAST FT BELVOIR VA 22060-5606	1	CDR HHC SOUTHERN EUROPEAN TASK FORCE ATTN AESE SA BLDG 98 AMC FAST SCIENCE ADVISER APO AE 09630
1	CDR US ARMY FORCES CMD ATTN FCDJ SA BLDG 600 AMC FAST SCIENCE ADVISER FT MCPHERSON GA 30330-6000	1	CDR US ARMY PACIFIC AMC FAST SCIENCE ADVISER ATTN APSA FT SHAFTER HI 96858-5L00
1	CDR I CORPS AND FORT LEWIS AMC FAST SCIENCE ADVISER ATTN AFZH CSS FORT LEWIS WA 98433-5000	1	AMC FAST SCIENCE ADVISERS PCS #303 BOX 45 CS-SO APO AP 96204-0045
1	HQ III CORPS & FORT HOOD OFC OF THE SCIENCE ADVISER ATTN AFZF CS SA FORT HOOD TX 76544-5056	1	CDR & DIR USAE WATERWAYS EXPERIMENTAL STATION ATTN CEWES IM MI R A S CLARK CD DEPT #1153 3909 HALLS FERRY ROAD VICKSBURG MS 39180-6199
1	CDR HQ XVIII ABN CORPS & FT BRAGG OFC OF THE SCI ADV BLDG 1-1621 ATTN AFZA GD FAST FORT BRAGG NC 28307-5000	1	ENGINEERING PSYCH LAB DEPT OF BEHAVIORAL SCIENCES & LEADERSHIP BLDG 601 ROOM 281 US MILITARY ACADEMY WEST POINT NY 10996-1784
1	SOUTHCOM WASHINGTON FIELD OFC 1919 SOUTH EADS ST STE L09 AMC FAST SCIENCE ADVISER ARLINGTON VA 22202	3	DIR SANDIA NATL LAB ENGNRNG MECHANICS DEPT MS 9042 ATTN J HANDROCK Y R KAN J LAUFFER PO BOX 969 LIVERMORE CA 94551-0969
1	HQ US SPECIAL OPERATIONS CMD AMC FAST SCIENCE ADVISER ATTN SOSD MACDILL AIR FORCE BASE TAMPA FL 33608-0442	1	DR SEHCHANG HAH WM J HUGHES TECH CTR FAA NAS HUMAN FACTORS BR ACT-530 BLDG 28 ATLANTIC CITY INTNATL AIRPORT NJ 08405
1	HQ US ARMY EUROPE & 7TH ARMY ATTN AEAGX SA OFC OF THE SCIENCE ADVISER APO AE 09014	1	US ARMY RSCH INST ATTN PERI IK D L FINLEY 2423 MORANDE STREET FORT KNOX KY 40121-5620
1	CDR HEADQUARTERS USEUCOM AMC FAST SCIENCE ADVISER UNIT 30400 BOX 138 APO AE 09128		

NO. OF  
COPIES ORGANIZATION

1 US MILITARY ACADEMY  
MATH SCIENCES CTR OF EXC  
DEPT OF MATH SCIENCES  
ATTN MDN A MAJ HUBER  
THAYER HALL  
WEST POINT NY 10996-1786

1 NAIC/DXLA  
4180 WATSON WAY  
WRIGHT PATTERSON AFB OH  
45433-5648

1 ARL HRED AVNC FLD ELMT  
ATTN AMSRL HR MJ D DURBIN  
BLDG 4506 (DCD) RM 107  
FT RUCKER AL 36362-5000

1 ARL HRED AMCOM FLD ELMT  
ATTN AMSRL HR MI  
BLDG 5464 RM 202  
REDSTONE ARSENAL AL  
35898-5000

1 ARL HRED AMCOM FLD ELMT  
ATTN AMSRL HR MO T COOK  
BLDG 5400 RM C242  
REDSTONE ARS AL 35898-7290

1 ARL HRED USAADASCH FLD ELMT  
ATTN AMSRL HR ME  
K REYNOLDS  
ATTN ATSA CD  
5800 CARTER ROAD  
FORT BLISS TX 79916-3802

1 ARL HRED ARDEC FLD ELMT  
ATTN AMSRL HR MG R SPINE  
BUILDING 333  
PICATINNY ARSENAL NJ  
07806-5000

1 ARL HRED ARMC FLD ELMT  
ATTN AMSRL HR MH C BURNS  
BLDG 1002 ROOM 206B  
1ST CAVALRY REGIMENT RD  
FT KNOX KY 40121

1 ARL HRED CECOM FLD ELMT  
ATTN AMSRL HR ML J MARTIN  
MYER CENTER RM 2D311  
FT MONMOUTH NJ 07703-5630

NO. OF  
COPIES ORGANIZATION

1 ARL HRED FT BELVOIR FLD ELMT  
ATTN AMSRL HR MK  
10170 BEACH RD  
FORT BELVOIR VA 22060-5800

1 ARL HRED FT HOOD FLD ELMT  
ATTN AMSRL HR MV HQ USAOTC  
S MIDDLEBROOKS  
91012 STATION AVE ROOM 111  
FT HOOD TX 76544-5073

1 ARL HRED FT HUACHUCA  
FIELD ELEMENT  
ATTN AMSRL HR MY M BARNES  
RILEY BARRACKS BLDG 51005  
FT HUACHUCA AZ 85613

1 ARL HRED FLW FLD ELMT  
ATTN AMSRL HR MZ A DAVISON  
320 MANSCEN LOOP STE 166  
FT LEONARD WOOD MO 65473-8929

5 ARL HRED NATICK FLD ELMT  
ATTN AMSRL HR MQ M R FLETCHER  
NATICK SOLDIER CTR BLDG 3  
RM 341 AMSSB RSS E  
NATICK MA 01760-5020

1 ARL HRED OPTEC FLD ELMT  
ATTN AMSRL HR MR H DENNY  
ATEC CSTE PM ARL  
4501 FORD AVE RM 870  
ALEXANDRIA VA 22302-1458

1 ARL HRED SC&FG FLD ELMT  
ATTN AMSRL HR MS R ANDERS  
SIGNAL TOWERS RM 303A  
FORT GORDON GA 30905-5233

1 ARL HRED STRICOM FLD ELMT  
ATTN AMSRL HR MT A GALBAVY  
12350 RESEARCH PARKWAY  
ORLANDO FL 32826-3276

1 ARL HRED TACOM FLD ELMT  
ATTN AMSRL HR MU M SINGAPORE  
6501 E 11 MILE RD MAIL STOP 284  
BLDG 200A 2ND FL RM 2104  
WARREN MI 48397-5000

1 ARL HRED USAFAS FLD ELMT  
ATTN AMSRL HR MF L PIERCE  
BLDG 3040 RM 220  
FORT SILL OK 73503-5600

NO. OF  
COPIES ORGANIZATION

- 1 ARL HRED USAIC FLD ELMT  
ATTN AMSRL HR MW E REDDEN  
BLDG 4 ROOM 332  
FT BENNING GA 31905-5400
- 1 ARL HRED USASOC FLD ELMT  
ATTN AMSRL HR MN R SPENCER  
DCSFDI HF  
HQ USASOC BLDG E2929  
FORT BRAGG NC 28310-5000
- 1 ARL HRED HFID FLD ELMT  
ATTN AMSRL HR MP  
D UNGVARSKY  
BATTLE CMD BATTLE LAB  
415 SHERMAN AVE UNIT 3  
FT LEAVENWORTH KS 66027-2326
- 1 CDR AMC - FAST  
JRTC & FORT POLK  
ATTN AFZX GT DR J AINSWORTH  
CMD SCIENCE ADVISOR G3  
FORT POLK LA 71459-5355
- 1 CDR HRED AMEDD  
ATTN AMSRL HR MM N VAUSE  
2250 STANLEY RD STE 322  
FT SAM HOUSTON TX 78234

ABERDEEN PROVING GROUND

- 2 DIRECTOR  
US ARMY RSCH LABORATORY  
ATTN AMSRL CI LP (TECH LIB)  
BLDG 305 APG AA
- 1 LIBRARY  
ARL HRED  
BLDG 459  
APG-AA
- 1 ARL HRED  
ATTN AMSRL HR MB  
F PARAGALLO  
BLDG 459  
APG-AA
- 1 US ATEC  
RYAN BLDG  
APG-AA

# REPORT DOCUMENTATION PAGE

Form Approved  
OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.

1. AGENCY USE ONLY (Leave blank)		2. REPORT DATE March 2002		3. REPORT TYPE AND DATES COVERED Final	
4. TITLE AND SUBTITLE Reducing the Effective Slipperiness of Chemical-Biological Protective Shelter (CBPS) Flooring: Commercial Non-skid Shoe Covers and Alternative Materials				5. FUNDING NUMBERS AMS Code 622716 PR: AH70	
6. AUTHOR(S) Fletcher, M.R. (ARL)					
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) U.S. Army Research Laboratory Human Research & Engineering Directorate Aberdeen Proving Ground, MD 21005-5425				8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES) U.S. Army Research Laboratory Human Research & Engineering Directorate Aberdeen Proving Ground, MD 21005-5425				10. SPONSORING/MONITORING AGENCY REPORT NUMBER ARL-TR-2639	
11. SUPPLEMENTARY NOTES					
12a. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release; distribution is unlimited.				12b. DISTRIBUTION CODE	
13. ABSTRACT (Maximum 200 words)  Teflon®-coated floorings (Chemlam-X22®[A] and X22[B]) of the chemical-biological protective shelter (CBPS) tent system are necessary for decontaminability but are slippery under foot. Under normal walking conditions, soldiers who wore ordinary combat boots reported a slipping hazard; under wet conditions with fast-paced movement, footing is expected to become even more precarious. Commercially available non-skid shoe covers were evaluated in the laboratory as a means of reducing the risk of slipping but did not prove to confer any non-slip advantage. Some alternate materials were identified that can be applied as tread to disposable shoe covers and would provide greater wet and dry slip resistance on the CBPS flooring than uncovered combat boot soles.					
14. SUBJECT TERMS CBPS                      human factors                      non-skid                      slip and fall                      tentage footwear                      MANPRINT                      safety                      slipperiness				15. NUMBER OF PAGES 25	
16. PRICE CODE					
17. SECURITY CLASSIFICATION OF REPORT Unclassified		18. SECURITY CLASSIFICATION OF THIS PAGE Unclassified		19. SECURITY CLASSIFICATION OF ABSTRACT Unclassified	
20. LIMITATION OF ABSTRACT					