•

15 October 1992

FATIGUE IN SINGLE CRYSTAL NICKEL SUPERALLOYS Technical Progress Report

AD-A258 038

Daniel P. DeLuca Principal Investigator

Charles Annis Program Manager



P.O. Box 109600 West Palm Beach, FL 33410-9600 (407)796-6565

Government Engines and Space Propulsion

15 October, 1992

Period of performance 16 September 1992 through 15 October 1992

Contract N00014-91-C-0124


Prepared for: Dr. A. K. Vasudevan, Scientific Officer Code 1222




Office of Naval Research Department of the Navy 800 N. Quincy Street Arlington, Va 22217-5000





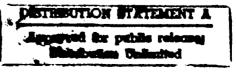

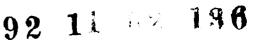

I. Introduction and Program Objective

This program investigates the seemingly unusual behavior of single crystal airfoil materials. The fatigue initiation processes in single crystal (SC) materials are significantly more complicated and involved than fatigue initiation and subsequent behavior of a (single) macrocrack in conventional, isotropic, materials. To understand these differences it is helpful to review the evolution of high temperature airfoils.

Characteristics of Single Crystal Materials

Modern gas turbine flight propulsion systems employ single crystal materials for turbine airfoil applications because of their superior performance in resisting creep, oxidation, and thermal mechanical fatigue (TMF). These properties have been achieved by composition and alloying, of course, but also by appropriate crystal orientation and associated anisotropy.

Early aeroengine turbine blade and vane materials were conventionally cast, equiaxed alloys, such as IN100 and Rene'80. This changed in the late 1960s with the introduction of directionally-solidified (DS) MAR-M200+Hf airfoils. The DS process produces a <001> crys-tallographic orientation, which in superalloys exhibits excellent strain controlled fatigue resistance due to its low elastic modulus. The absence of transverse grain boundaries, a 60% reduction in longitudinal modulus compared with equiaxed grains, and its corresponding improved resistance to thermal fatigue and creep, permitted significant increases in allowable metal temperatures and blade stresses. Still further progress was achieved in the mid-1970s with the development of single crystal airfoils¹.

The first such material, PWA 1480, has a considerably simpler composition than preceding cast nickel blade alloys because, in the absence of grain boundaries, no grain boundary strengthening elements are required. Deleting these grain boundary strengtheners, which are also melting point depressants, increased the incipient melt temperature. This, in turn, allowed nearly complete γ' solutioning during heat treatment and thus a reduction in dendritic segregation. The absence of grain boundaries, the opportunity for full solution heat treatment, and the minimal post-heat treat dendritic segregation, result in significantly improved properties as compared with conventionally cast or directionally solidified alloys. Single crystal castings also share with DS alloys the <001> crystal orientation, along with the benefits of the resulting low modulus in the longitudinal direction.

Pratt & Whitney has developed numerous single crystal materials. Like most, PWA 1480 and PWA 1484 are γ' strengthened cast mono grain nickel superalloys based on the Ni-Cr-Al system. The bulk of the microstructure consists of approximately 60% by volume of cuboidal γ' precipitates in a γ matrix. The precipitate ranges from 0.35 to 0.5 microns and is an ordered Face Centered Cubic (FCC) nickel aluminide compound. The macrostructure of these materials is characterized by parallel continuous primary dendrites spanning the casting without interruption in the direction of solidification. Secondary dendrite arms (perpendicular to solidification) define

¹ Gell, M., D. N. Duhl, and A. F. Giamei, 1980, "The Development of Single Crystal Superalloy Turbine Blades," *Superalloys* 1980, proceedings of the Fourth International Symposium on Superalloys, American Society for Metals, Metal Park, Ohio, pp. 205-214

the interdendritic spacing. Solidification for both primary and secondary dendrite arms proceeds in <001> type crystallographic directions. Undissolved eutectic pools and associated microporosity reside throughout the interdendritic areas. These features act as microstuctural discontinuities, and often exert a controlling influence on the fatigue initiation behavior of the alloy. Also, since the eutectics are structurally dissimilar from the surrounding matrix their fracture characteristics will differ.

Single Crystal Fatigue

The fatigue process in single crystal airfoil materials is a remarkably complex and interesting process. In cast single crystal nickel alloys, two basic fracture modes, crystallographic and non-crystallographic, are seen in combination. They occur in varying proportions depending upon temperature and stress state. Crystallographic orientation with respect to applied load also affects the proportion of each and influences the specific crystallographic planes and slip directions involved. Mixed mode fracture is observed under monotonic as well as cyclic conditions.

Single crystal turbine blades are cast such that the radial axis of the component is essentially coincident with the <001> crystallographic direction which is the direction of solidification. Crystallographic fracture is usually seen as either octahedral along multiple (111) planes or under certain circumstances as (001) cleavage along cubic planes.

Non-crystallographic fracture is also observed. Low temperatures favor crystallographic fracture. At higher temperatures, in the 427C range, small amounts of non-crystallographic propagation have the appearance of transgranular fatigue in a related fine grain equiaxed alloy. Under some conditions, this propagation changes almost immediately to the highly crystallographic mode along (111) shear planes, frequently exhibiting prominent striations emanating from the fatigue origin and continuing to failure in overstress. Under other conditions the noncrystallographic behavior can continue until tensile failure occurs. At intermediate temperatures (around 760C) non-crystallographic propagation is more pronounced and may continue until tensile overload along (111) planes occurs, or may transition to subcritical crystallographic propagation. At 982C, propagation is almost entirely non-crystallographic, similar to transgranular propagation in a polycrystal.

Damage Catalogue

This program will identify and compile descriptions of the fracture morphologies observed in SC airfoil materials under various combinations of temperature and stress associated with advanced Navy aeropropulsion systems. We will suggest fatigue mechanisms for these morphologies and catalogue them as unique damage *states*. Most testing will be accomplished under ancillary fund-, ing, and therefore be available to this effort at no cost. The work is organized into four tasks, which are described in the following paragraphs.

	nownoed []
By	
	ibution/
Avai	lability Codes
D182 A-1	Avail and/or Special

3

II. Program Organization

The program is structured into four tasks, three technical and one reporting. The individual tasks are outlined here.

Task 100 - Micromechanical Characterization

This task will define the mechanisms of damage accumulation for the various types of fracture observed in single crystal alloys. These fracture characteristics will be used to establish a series of Damage States which represent the fatigue damage process. The basis for this investigation will be detailed fractographic assessment of failed laboratory specimens generated in concurrent programs. Emphasis will be on specifically identifying the micromechanical damage mechanisms, relating them to a damage state, and determining the conditions required to transition to an alternate state.

Task 200 - Analytical Parameter Development

This task will extend current methods of fatigue and fracture mechanics analysis to account for microstructural complexities inherent in single crystal alloys. This will be accomplished through the development of flexible correlative parameters which can be used to evaluate the crack growth characteristics of a particular damage state. The proposed analyses will consider the finite element and the hybrid Surface-Integral and Finite Element (SAFE) methods to describe the micromechanics of crack propagation.

Task 300 - Probabilistic Modeling

This task will model the accumulation of fatigue damage in single crystal alloys as a Markov process. The probabilities of damage progressing between the damage states defined in Task 100 will be evaluated for input into the Markov model. The relationship between these transition probabilities and fatigue life will then be exploited to establish a model with comprehensive life predictive capabilities.

Task 400 - Reporting

Running concurrently with the analytical portions of the program, this task will inform the Navy Program Manager and Contracting Officer of the technical and fiscal status of the program through R&D status reports.

III. Technical Progress

Last month we introduced the concept of applied energy versus system energy and how this relates to micromechanics. We discussed the effects of "system energy" and input energy and catagorized a number of microscopic fatigue crack propagation modes. These were termed "the available modes" which could become operative depending upon the input energy level.

FR2198-12

We proposed that the effects of system energy and input energy were likely to be interchangeable in terms of affecting microscopic fracture mode transitions.

In an earlier report we discussed the possibility of conducting fatigue crack growth tests at constant K while varying temperature over a predetermined range. It was theorized that system energy dependent fracture mode transitions could be produced and, as with input energy dependent transitions, the microscopic failure sequence would be determined by the algebraic sign of the gradient.

We are in the process of conducting those tests in a separate program. Constant cyclic stress intensity tests have been run with positive and negative temperature gradients between 77°F and 1400°F with both PWA 1480 and PWA 1484. Early results have verified our hypothesis; this is a significant development.

This suggests a new means² of determining K_{th} by holding stress intensity constant slightly above ΔK_{limit} and increasing (or decreasing) temperature until crack propagation arrests. The stress intensity can then be incremented and temperature again varied until a second arrest point is observed. The technique is described in Figure 1.

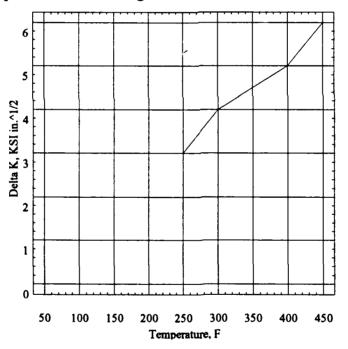


Figure 1: Method for obtaining K_{th} versus temperature. Test starts at $3ksi\sqrt{in}$, 77°F. Temperature is increased with K held constant. Crack arrests at 250°F. K is increased to $4ksi\sqrt{in}$, temperature increased until crack arrests again. The process is repeated. Each point of crack arrest represents a stress intensity-temperature pair.

In the context of the Markov paradigm a K dependent transition to ΔK_{ik} represents a move from a transition state to an absorbing state. This absorbing state equates to that described by Griffith, i.e.:

$$\partial U/\partial \alpha = [-\sigma^2(1-v^2)/E]\beta a$$

FR2198-12

•

15 October, 1992

IV. Current Problems

No technical problems have been encountered during the reporting period.

PORT DOCUMENTATION 11. AEPORT NO. 2.	L. Retisiont's Account Me.
Tite cas Sustile	1. Accest Octo
FATIGUE IN SINGLE CRYSTAL NICKEL SUPERALLOYS	15 October, 1992
Technical Progress Report	6
Chamles Appie	L. Performing Organization Acet. No.
Charles Annis	FR2198-12
United Technologies	
Pratt & Whitney	11. Contractici er Grantici No.
P. 0. Box 109600	(C N00014-91-C-0124
West Palm Beach, FL 33410-9600	(G
Semining Organization Name and Address	13. Type of Reserve & Period Coverse Monthly
Office of Naval Research Department of the Navy	Monthly
800 N. Quincy Street	09/16/92 - 10/15/92
Arlington, VA 22217-5000	14.
	. •
_	
Aberriest (Limit: 200 werds)	
This program investigates the seemingly unusual behave	ion of single crystal sinfail
materials. The fatigue initiation processes in single	a crystal (SC) materials and
significantly more complicated and involved than fatio	to initiation and current
behavior of a (single) macrocrack in conventional is	atronic materials To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, is understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, isc	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this 	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this 	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this 	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this 	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	otropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this Fatigue, Fracture, Single Crystal, PWA 1480, PWA 1484	ptropic, materials. To
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this	s project.
behavior of a (single) macrocrack in conventional, iso understand these differences is the major goal of this Fatigue, Fracture, Single Crystal, PWA 1480, PWA 1484 Fatigue, Fracture, Single Crystal, PWA 1480, PWA 1484 Lange Costan Fractore Unlimited	ptropic, materials. To