

4724

AD-656607

TECHNICAL REPORT NO. 9689 (LL 115)

AD 656607

ANALYSIS OF
ESTIMATED RIVER EXITING PERFORMANCE

July 1967



TECHNICAL LIBRARY
REFERENCE COPY

Reproduced From
Best Available Copy

20020726169

D. A. Sloss
W. J. Baker
D. M. Lassaline
C. X. C. F. Miranda

by

Land Locomotion Division

ATAC

Distribution of this document is unlimited.

COMPONENTS RESEARCH & DEVELOPMENT LABORATORIES
U.S. ARMY TANK AUTOMOTIVE CENTER WARREN, MICHIGAN

AN 30360

The findings in this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

Distribution of this document is unlimited.

**CITATION OF EQUIPMENT IN THIS REPORT
DOES NOT CONSTITUTE AN OFFICIAL
INDORSEMENT OR APPROVAL OF THE USE OF
SUCH COMMERCIAL HARDWARE.**

**Destroy this report when it is no longer
needed. Do not return it to the originator.**

Copy No. 515

TECHNICAL REPORT NO. 9689 (LL 115)

ANALYSIS OF
ESTIMATED RIVER EXITING PERFORMANCE

by

D. A. Sloss
W. J. Baker
D. M. Lassaline
C. X. C. F. Miranda

for

Land Locomotion Division
U. S. Army Tank Automotive Center
Warren, Michigan 48090

Contract No. DA-20-113-AMC-09099 (T)

The University of Detroit
College of Engineering
Detroit, Michigan

ABSTRACT

A previous study of river magnitude and frequency established river exiting as the primary problem for vehicles attempting to cross rivers. Analysis of the exiting problem indicated that the single most important parameter to be considered was the geometric form of the river bank. Evaluation of the probability of an M-113 exiting at each bank surveyed in the magnitude and frequency study was made by relating vehicle performance characteristics to bank descriptions; a determination of the probability of the vehicle exiting was then made on a GO or NO-GO basis. Since much of the environment was extremely severe with respect to M-113 capabilities, this evaluation was fairly straight forward. A numerical method, using a geometric severity to classify bank geometry, was then developed to permit a performance analysis to be conducted on a rational basis.

TABLE OF CONTENTS

Title Page	i
Abstract	ii
Table of Contents	iii
Acknowledgements	v
Foreword	vi
List of Figures	viii
I. Introduction	1
II. Qualitative Analysis of M-113 River-Exiting Performance . .	2
A. Description of environmental data	2
B. M-113 Performance criteria	2
C. Results of performance analysis	3
III. Geometric Severity Classification Scheme	5
A. Objective	5
B. Approach	5
C. Discussion	5
IV. Analysis using the Geometric Severity Factor	7
V. Conclusions	9
VI. References	19
VII. Related Bibliography	20

TABLE OF CONTENTS

(continued)

VIII. Appendix A

A. Table I	Tabulation of survey data	34
B. Table II	Qualitative Analysis of M-113 River Exiting Performance	38
C. Table III	Analysis of M-113 River Exiting Performance using the Geometric Severity Factor	45
D. Table IV	Results of Swamp Fox II Exit Tests	52
E. Table V	Analysis of M-113 River Exiting Performance using the Geometric Severity Factor - Huron River	53
F. Table VI	Analysis of M-113 River Exiting Performance using the Geometric Severity Factor - Black River	59

IX. Distribution List	61
---------------------------------	----

ACKNOWLEDGEMENTS

The work and cheerful cooperation of Mr. L. W. Janowiak and Mrs. M. J. Nagy, who prepared the figures for this report, are gratefully acknowledged.

FOREWORD

A previous study of river magnitude and frequency established river exiting as the primary problem to vehicles attempting to cross rivers (Ref. 1). * Sufficient information was collected in that study to permit analysis of the exiting problem. The first portion of the analysis identified the exiting difficulty as caused primarily by the geometric form of the river bank. The probability of an M-113 exiting at each bank was then estimated by relating M-113 performance characteristics to the bank description and determination of the probability of the vehicle exiting was made on a GO or NO-GO basis. Following this analysis a second, numerical method was developed. This method used a geometric severity factor to classify bank geometry, and allowed the performance analysis to be conducted on a rational basis.

Findings

The qualitative analysis of 226 banks studied in the eastern portion of the country showed that:

Negotiable by a M-113	27 percent
Obstacle due to slope greater than 50 percent	35 percent
Obstacle due to vertical wall greater than 3 feet	23 percent
Trees would prevent exiting	8 percent
Marsh or swamp would prevent exiting	7 percent

A geometric severity factor, developed to classify river bank geometry, was found to correlate well with the qualitative performance analysis and with the limited test data available from the Swamp Fox II Exercise (Ref. 2).

An analysis, using the geometric severity factor to predict vehicle performance, indicated that on the banks surveyed an M-113 would:

negotiate the bank	28 percent
have marginal success	17 percent
not negotiate the bank	55 percent

* Numbers indicate references listed at the end of this report.

An analysis of the banks surveyed on the Black and Huron rivers in Michigan, using the geometric severity factor, showed:

negotiate the bank	58 percent
have marginal success	19 percent
not negotiate the bank	23 percent

Approximately 80 percent of the river banks surveyed had a geometric severity which indicated that they were not insurmountable from a purely geometrical standpoint if an adequate exiting aid were developed.

Conclusions

1. The primary reason for vehicle difficulty in exiting from a river is the geometrical severity of the bank slope.
2. A simple classification scheme can be used to relate vehicle exiting performance to river bank geometry.
3. The fact that 68 percent of bank heights are less than 12 feet and 80 percent of the geometric severity factors are less than 10 feet, indicates that the use of an adequate exiting aid would allow a M-113 type vehicle to exit on approximately 80 percent of the banks encountered in the Eastern United States.
4. The apparent success of a crude system for classifying river banks indicates that it should be possible to develop a more sophisticated scheme for accurately predicting vehicle exiting capability.

Recommendations

1. Vehicle exiting tests should be conducted to verify river exiting performance limits developed by this analysis.
2. A more sophisticated bank classification system should be developed to permit the development of river regime analogs so that extensive river surveys will not be necessary in the future.

LIST OF FIGURES

Figure No.	Title	Page No.
1.	Estimated exiting performance of M-113 for sites 1 through 64 (43° N. latitude, Grand Haven, Mich. to Boston, Mass.).	10
2.	Estimated exiting performance of M-113 for sites 70 through 115 (36° N. latitude, Elizabeth City, N. C. to Knoxville, Tenn.).	11
3.	Bank profile showing geometric severity factor determination using $s = h \sin \theta$ and $s = h \sin^2 \theta$	12
4.	Comparison of $\sin \theta$ and $\sin^2 \theta$	13
5.	Comparison of methods for estimating M-113 exiting performance for sites 1 through 69 (43° N. latitude, Grand Haven, Mich. to Boston, Mass.).	14
6.	Comparison of methods for estimating M-113 exiting performance for sites 70 through 115 (36° N. latitude, Elizabeth City, N. C. to Knoxville, Tenn.).	15
7.	Geometric severity factor occurrence by traverse.	16
8.	Estimated M-113 exiting performance for the Black and Huron Rivers, using the geometric severity factor.	17
9.	Geometric severity factor occurrence for the Black and Huron Rivers.	18

I. INTRODUCTION

A study by the University of Detroit on river frequency and magnitude in the United States identified the river crossing problem as an exiting problem (Ref. 1). The exiting problem was analyzed as being caused by a high incidence of steep slopes and vertical walls greater than that which existing military vehicles could be expected to negotiate.

With the problem thus defined, the next task was an attempt to relate the survey data with vehicle performance. The vehicle chosen was the M-113, Amphibious Armored, Personnel Carrier. The M-113 was chosen because it is considered to be one of the Army's most mobile amphibious vehicles and because performance and test information was available. The first portion of the analysis consisted of estimating the GO or NO-GO performance of the vehicle for each of the 226 banks surveyed in the eastern portion of the frequency study (Ref. 1).

The results of this analysis showed that the M-113 has limited exiting capability. The major deficiency of the analysis was its qualitative nature. Review indicated that the analysis could be improved by the adoption of a simple scheme for classifying the geometric severity of a river bank as an exiting obstacle.

In developing the geometric classification scheme it was assumed that a vertical wall is the most severe exiting obstacle and that a slope can be represented by some equivalent vertical wall. Therefore, in this scheme, bank severity is a single number which represents the height of an equivalent vertical wall.

The classification scheme was found to work well in rating the qualitative analysis of M-113 performance and in evaluating the limited test data available from the Swamp Fox II exercise (Ref. 2). Therefore, the scheme can be a useful tool when used in the proper perspective.

The desirability of further survey work is indicated to substantiate the finding that excessive bank slopes occur so frequently that there is little probability for existing military vehicles to achieve an unaided exit. A more sophisticated bank classification system should also be developed for the analysis of vehicle concepts.

II. QUALITATIVE ANALYSIS OF M-113 RIVER-EXITING PERFORMANCE

A. Description of Environmental Data.

The river frequency study (Ref. 1) made available a number of approximate river cross-sections. Color slides and a description of the vegetation were also available. The information constituted sufficient basis upon which to make an analysis of M-113 GO or NO-GO exiting performance on each of the river banks measured in the survey.

The analysis considered three aspects of river bank environment:

1. Bank geometry.
2. Vegetation.
3. Soil strength.

Each of these factors was considered as having fixed limits. Immobilizing obstacles which individually would not produce a NO-GO condition were not considered because of an inability to identify their synergism. Fortunately, there were very few cases where such an evaluation would have been required; in most cases, a single factor dominated the analysis.

B. M-113 Performance Criteria.

The rated vertical wall capability of the M-113 is a 24 inch vertical wall constructed from wood timbers or concrete (Ref. 3). The M-113 vertical wall capability is limited by the physical arrangement of its suspension system. The theoretical vertical wall capability of the vehicle is calculated as 2 1/2 to 3 feet (Ref. 4). The vehicle could probably climb a 2 1/2 to 3 foot earth wall, particularly if some relief were present and the vehicle utilized its momentum. Therefore, for this analysis, the vehicle was considered to have a 3 foot vertical earth wall capability.

The rated maximum grade capability of the M-113 is 60 percent (Ref. 3). This is measured on a concrete slope with rubber pads installed on the track. The maximum grade capability on an earth slope, with the vehicle exiting from water, is somewhat less. Aberdeen Proving Ground reports: "The vehicle will successfully exit on banks with 5 percent through 30 percent slopes without regard to bank conditions, i. e. , soil, vegetation, etc." (Ref. 5) For the present analysis, therefore, the vehicle was considered to have an absolute maximum of 50 percent earth slope-climbing capability.

Many rivers have dense vegetation along their banks. For an unaided exit, the vehicle must be capable of crushing, uprooting, or shearing off this vegetation. For the present analysis, the M-113 was assumed to be able to negotiate two firmly rooted, 6-inch diameter trees or one 12-inch diameter tree.

Based on the experience of the Land Locomotion Division, qualitative judgment of M-113 soft-soil performance is difficult. Therefore, the maximum vehicle capability was assumed and the vehicle was considered to be able to negotiate the soil unless an extensive marsh or swamp were present.

It appeared, initially, that a large part of the analysis would be based on subjective judgment. Estimating general vehicle cross-country performance requires a rather extensive vehicle background and what could almost be referred to as an occult skill to visualize and relate all of the driver, vehicle, and terrain factors that influence performance. We would be remiss if such an ability were implied in this analysis.

As the analysis progressed, it became evident that much of the measured river environment was extremely severe with respect to M-113 capabilities. Therefore, by relating one environmental factor (slope, vertical wall, marsh, etc. ,) to the vehicle performance capability, the evaluation was conducted on a straight forward basis. Thus, it was concluded that for an analysis of this type, sophisticated techniques for predicting exiting capability are not required.

C. Results of Exiting Performance Analysis.

A summary of the survey data is shown in Table I. * Table II shows the performance analysis for the M-113 for the eastern portion of the 43° N. latitude traverse (Grand Haven, Mich. to Boston, Mass.), sites 1 through 69. The NO-GO incidence was 66 percent. The reasons for the NO-GO evaluations were:

- | | |
|---------------------------------------|------------|
| 1. Slope greater than 50 percent: | 38 percent |
| 2. Vertical wall greater than 3 feet: | 15 percent |
| 3. Trees: | 12 percent |
| 4. Marsh or swamp: | 1 percent |

This analysis is illustrated in Figure 1.

Analysis of the eastern portion of the 36° N. latitude traverse (Elizabeth City, N. C. to Knoxville, Tenn.), sites 70 through 115, showed even more

* All Tables are included in Appendix A.

severe exiting conditions. For this portion of the traverse the NO-GO incidence was 83 percent. The breakdown of NO-GO evaluations shows:

- | | |
|---------------------------------------|------------|
| 1. Slope greater than 50 percent: | 31 percent |
| 2. Vertical wall greater than 3 feet: | 34 percent |
| 3. Trees: | 2 percent |
| 4. Marsh or swamp: | 16 percent |

This analysis is illustrated in Figure 2.

The 16 percent marsh or swamp NO-GO evaluations were made on the basis of marshes or swamps occurring exclusively in the first 90 miles of the traverse (sites 70 through 78). This portion of the traverse was in a low-lying coastal area which included the Dismal Swamp. Heavy vegetation and soft soil conditions make cross-country vehicular travel virtually impossible in this type of terrain.

The tabulation of NO-GO evaluations includes only the primary factor. For example, if a river bank consisted of a steep slope with large trees at the top, the slope was considered the primary factor and was so listed. It can be concluded that the primary cause of M-113 exiting difficulty is steep slopes or vertical walls greater than 3 feet. It should be borne in mind that even if the primary cause of exiting difficulty could be overcome, a secondary cause, which in most cases would be heavy vegetation, might also, by itself, prevent the vehicle from exiting. This type of complication was not considered in the present analysis simply because it was felt that determination of primary causes was of overriding importance and as a first step was sufficient.

The major deficiency of the analysis appeared to be inability to measure the degree of difficulty each bank presented as an exiting obstacle. Thus, while the analysis shows that the vehicle would not be able to exit on 73 percent of the banks surveyed, the analysis does not indicate what additional performance characteristics would be required for an exit.

The analysis shows that in most areas the primary difficulty in exiting can be related to the bank configuration; that is, in 88 percent of the NO-GO cases, the slope is greater than the performance capability of the vehicle. Therefore, a scheme or system which relates river bank geometry to a severity measurement could be used to evaluate most NO-GO cases. Equally important, such a scheme or system could possibly be used to evaluate most of the GO cases.

III. GEOMETRIC SEVERITY CLASSIFICATION SCHEME

A. Objective.

Develop a simple scheme to classify the severity of a river bank as an exiting obstacle. (The scheme was to be suitable for use with the type of input anticipated from simplified surveys and approximate data from maps and air photos.)

B. Approach.

Examination of a number of bank profiles indicated that, for a first approximation, the bank can be represented by a series of straight lines and slope angles. The severity of the bank would then be the degree to which the bank approaches a vertical wall, which is assumed to be the most severe case. The severity of the slope would, therefore, be a function of the height of the slope reduced by a factor which is a function of the slope angle. The severity of a 90 degree slope, or vertical wall, would be a function of its height only. Overhanging banks and banks with slopes greater than 90 degrees (measured from the horizontal) are considered as vertical walls for classification purposes.

C. Discussion.

The function representing the severity of the height of the slope or wall was chosen simply as the height of the slope or wall in feet because this can be easily measured in the field. The modifying factor for the slope angle was chosen as the sine of the slope angle. The sine has a value of 2.0 for a 90 degree slope or vertical wall and 0.0 for level ground. The severity factor is therefore:

$$s = h \sin \theta \quad (1)$$

where h is the height of the slope and θ is the slope angle. In cases where the bank is represented by multiple slopes, the severity factor is the sum of the individual factors. This is illustrated in Figure 3.

When the scheme was applied to field survey data (Ref. 1), certain deficiencies became apparent. The usefulness of the scheme in differentiating between M-113 GO and NO-GO conditions was poor because low-angle slopes had too high a numerical value. To reduce the value of the severity factor for low angles it was redefined as:

$$s = \sin^2 \theta \quad (2)$$

The values for $\sin \theta$ and $\sin^2 \theta$ are shown in Figure 4.

Using equation (2) to evaluate the severity factor, good correlation was obtained between GO and NO-GO evaluations for M-113 performance (see Table III). The scheme was thus found to be useful for assigning numerical values to subjective information. The original evaluation is shown in Table II.

Table IV shows the results of Swamp Fox II (Ref. 2) river exiting tests compared with geometric severity factor ratings. This tabulation shows that the M-113 vehicle could not climb a river bank with a severity factor of $4 \frac{1}{2}$ and only once in five trials could the M-113 exit from a river bank with a severity factor of 4. In Table III the highest GO value for S was $2 \frac{1}{2}$. The lowest NO-GO value for S was $1 \frac{3}{4}$. There is, therefore, some overlapping of GO and NO-GO values. The number of questionable cases was quite small, 6 out of 210. It can, therefore, be concluded, that the existing river exiting tests show that the scheme is reasonable, but may need some refinement.

The scheme has two basic theoretical deficiencies:

1. A very long, gentle slope normally negotiable by a vehicle can have a high severity factor indicating that the bank is not negotiable.
2. A series of steps and/or slopes normally negotiable by a vehicle can have a summation of severity factors indicating that the bank is not negotiable.

These theoretical deficiencies did not appear in the trial evaluation. Examination of the banks surveyed in the study indicates that the above two conditions represent special, rather than general cases. For example, of the 226 banks surveyed on the eastern portion of the survey, only 6.2 percent had a height-to-depth ratio smaller than 1.5. It is clear, however, that a more sophisticated classification scheme should account for the bank height-to-depth aspect ratio and the manner in which factors are summed.

The classification scheme used was admittedly crude. However, much of the available information was equally crude and the scheme does allow banks to be classified numerically, which is at least one step above a simple GO or NO-GO judgment.

The need for a more sophisticated bank classification system has been apparent from the outset of the project. Efforts to develop such a system will continue.

The classification system does not take into account soil or vegetation factors, but it can be modified to include these factors if the usefulness of the system in representing geometric properties can be established.

IV. ANALYSIS OF EXITING PERFORMANCE USING THE GEOMETRIC SEVERITY FACTOR.

The M-113 was judged always to be able to negotiate any bank having a geometric severity factor of 2. This was based on the vehicle's rated vertical wall-climbing ability of two feet.* The vehicle was considered to be able to negotiate some banks having a geometric severity factor of between 2 and 4, and not to be able to negotiate any bank with a factor above 4. This upper value was based on the results of the Swamp Fox II exercise (Ref. 2). The groupings used for this analysis were as follows:

<u>Geometric Severity Factor</u>	<u>Vehicle Capability</u>
0 - 2	will negotiate any bank
2 - 4	will negotiate some banks
4	will negotiate no banks

The analysis was conducted only for sites where the magnitude of the slope and/or vertical wall was considered to be the primary factor in whether the vehicle could exit.

A comparison of the two methods used for estimating the M-113 exiting performance is shown in Figures 5 and 6. The general agreement between the two methods is good. The only important difference is the fact that a higher percentage of marginal cases evolved when the geometric severity factor was used.

* Two feet was used for this analysis because the vehicle can always climb a two foot vertical wall, independent of the wall material. In the previous qualitative analysis a three foot earth wall climbing ability was assumed.

Figure 7 shows the distribution of geometric severity factors in the analysis. This is also the distribution of river bank severity for the eastern portion of the survey. The low occurrence, approximately 20 percent, of geometric severity factors of more than 10 is quite significant. It means that approximately 80 percent of the river banks are not insurmountable from a purely geometrical standpoint, if an exiting aid can be developed.

An intensive study of the Black and Huron Rivers in Michigan, conducted by the University of Detroit (Ref. 6), shows that not all rivers are severe obstacles to vehicles. Figures 8 and 9 show the analysis using the geometric severity factor. On the Huron River where 112 banks were surveyed, over a distance along the river of 5.3 miles, the results of the analysis were:

GO	62 percent occurrence
Marginal	17 percent occurrence
NO-GO	21 percent occurrence

On the Black River where 58 banks were surveyed, over a distance of 1.6 miles, the results were:

GO	51 percent occurrence
Marginal	22 percent occurrence
NO-GO	27 percent occurrence


Thus, the analysis clearly shows that for the two rivers examined, the exiting problem is not as severe as that indicated in the magnitude and frequency survey (Ref. 1). This data is shown in Tables V and VI.

The survey did not, however, take into account the confines of the flood plain.* Had this been done, a higher percentage of difficulty would probably have been indicated. This indicates that any future studies should attempt to consider the total riverine environment.

* Since the survey was only a pilot study conducted before the river crossing problem had been identified as primarily a river exiting problem, it did not include an extensive investigation of banks as obstacles to vehicle exiting.

V. CONCLUSIONS

1. The primary reason for vehicle exiting difficulty is the high incidence of slopes and vertical walls which exceed the vehicle design limitations (Figures 1 and 2). River bank geometry is, therefore, the single most important parameter in the river environment.
2. A numerical method, based on a geometric severity factor, can be used to evaluate vehicle exiting performance when bank geometry is the controlling factor (Figures 5 and 6). The apparent success of this crude scheme to classify river banks for their exiting difficulty indicates that it should be possible to develop a more sophisticated system to make accurate predictions.
3. The occurrence of what normally would be considered "insurmountable" river banks is low. This indicates that an adequate exiting aid would probably be successful in materially improving the exiting performance of military amphibious vehicles (Figure 7).
4. Some rivers exist where unaided exits could be accomplished frequently (Figure 8).

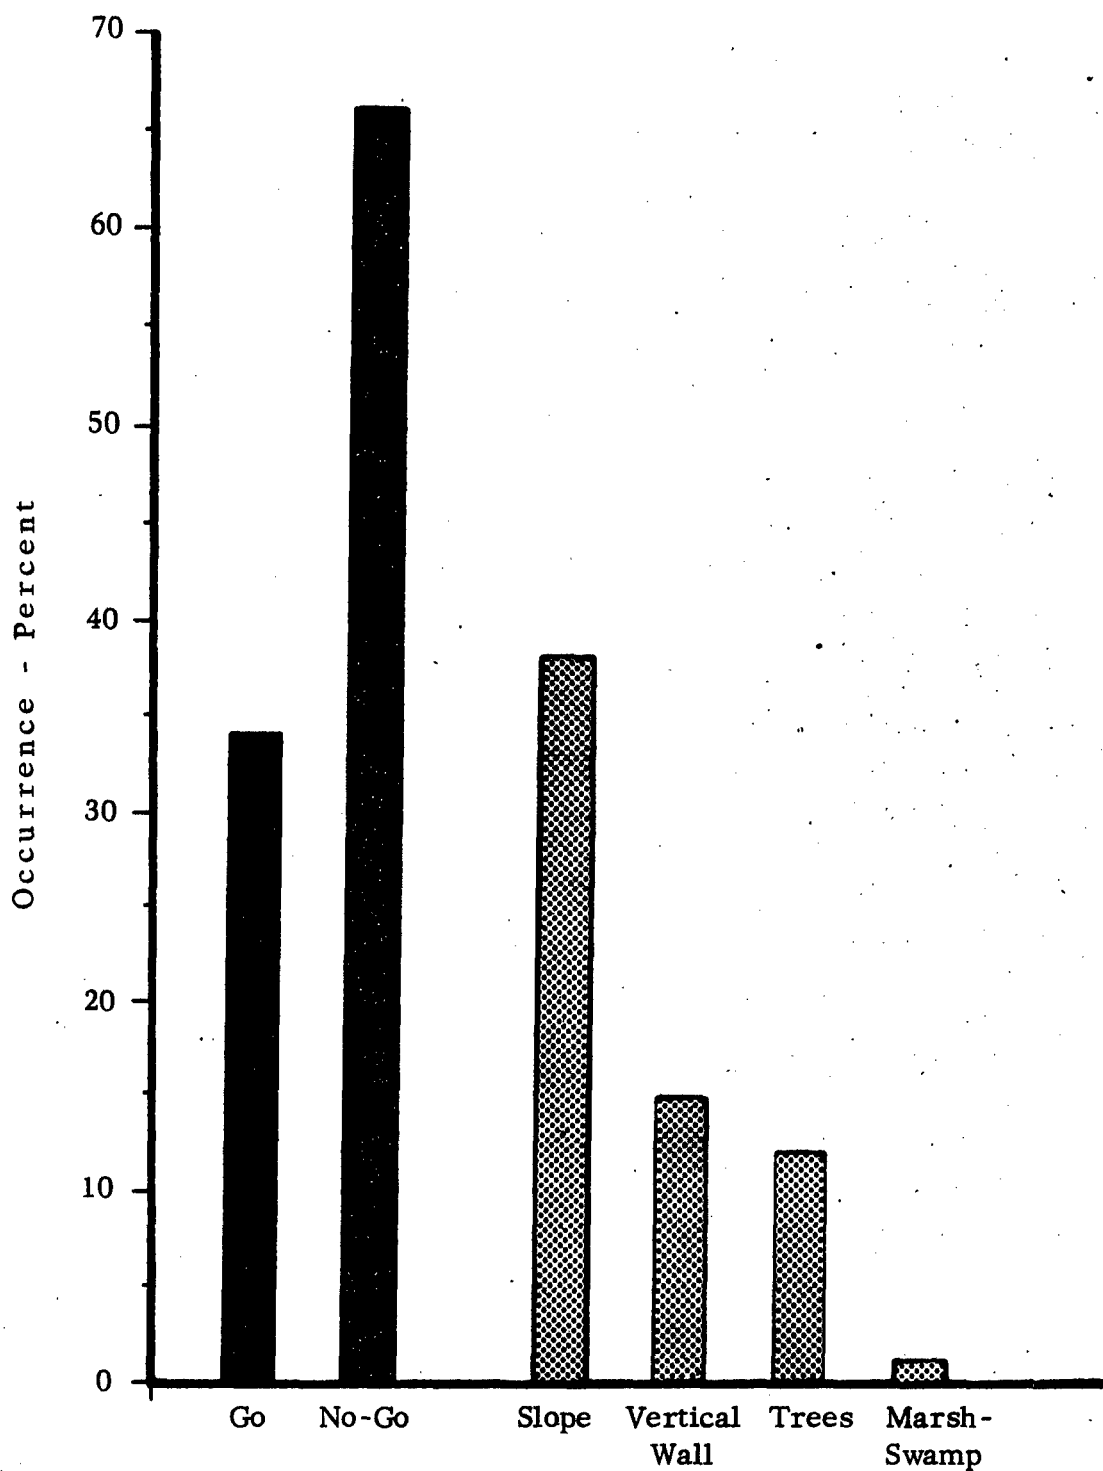


NO-GO ANALYSIS

M-113 EXITING PERFORMANCE

Estimated exiting performance of M-113 for sites 1 through 69
(43° N. latitude traverse, Grand Haven, Mich. to Boston, Mass.).

Figure 1


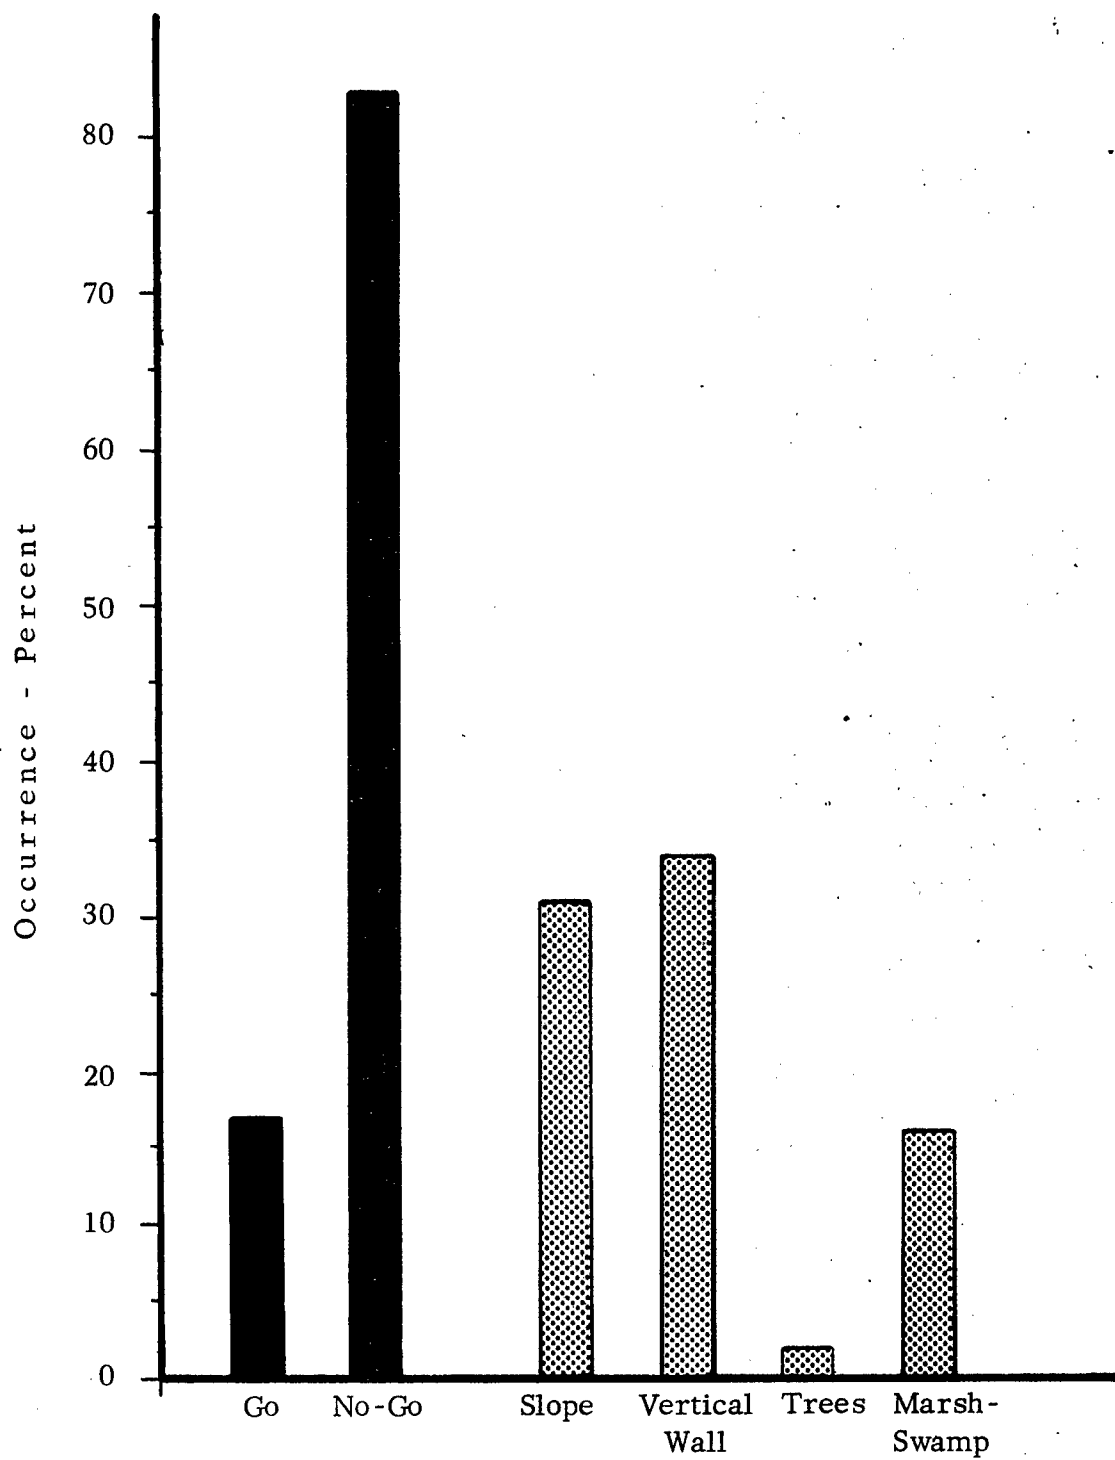


NO-GO ANALYSIS

M-113 EXITING PERFORMANCE

Estimated exiting performance of M-113 for sites 70 through 115
(36° N. latitude traverse, Elizabeth City, N. C. to Knoxville, Tenn.).

Figure 2

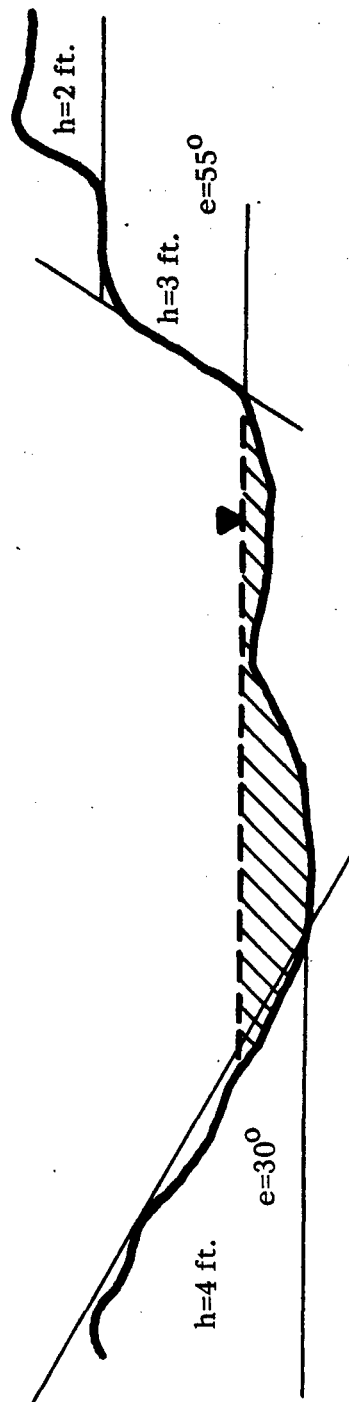

$$s = 4 \sin 30^\circ = 2$$


$$s = 4 \sin^2 30^\circ = 1$$

$$s = (3 \sin 55^\circ) + 2 = 4.3$$

$$s = 3 \sin^2 55^\circ + 2 = 4$$


Bank profile showing geometric severity factor determination
using $s = h \sin \theta$ and $s = h \sin^2 \theta$.

Figure 3

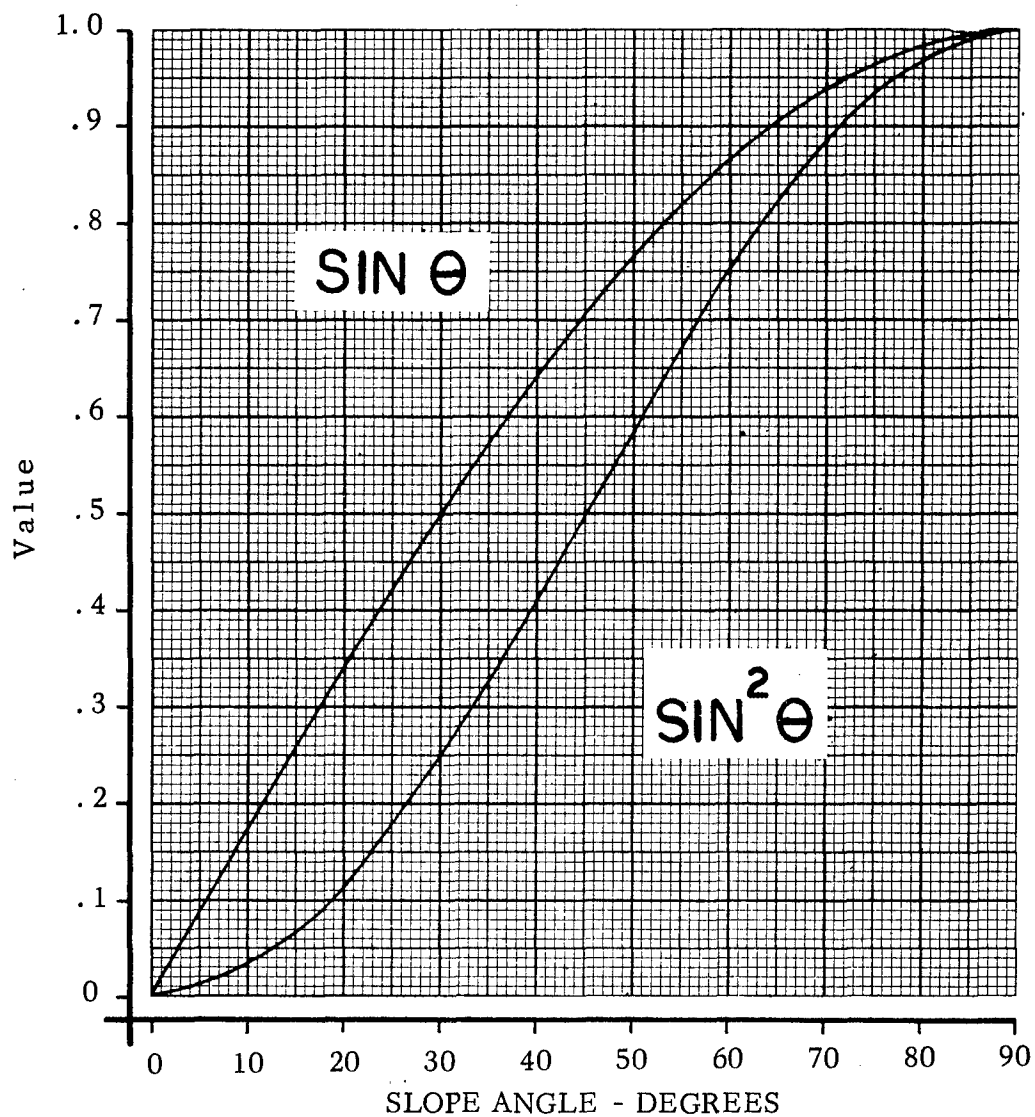


Comparison of $\sin \theta$ and $\sin^2 \theta$.

Figure 4

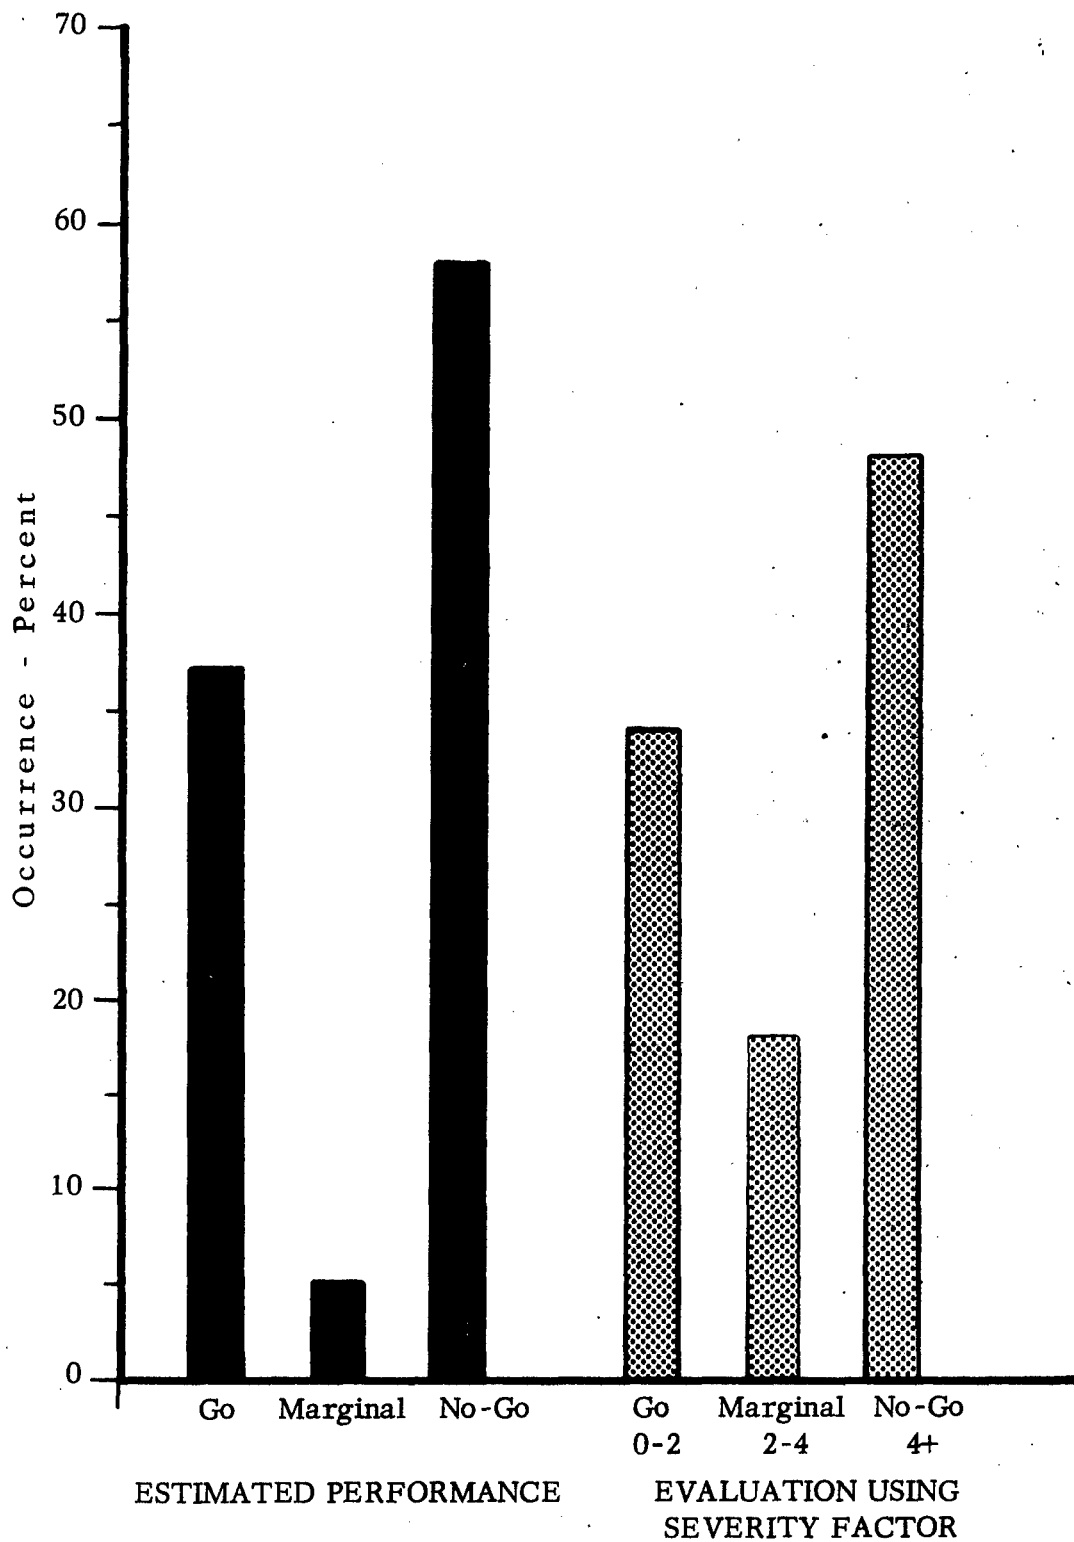

Comparison of methods for estimating M-113 exiting performance
for sites 1 through 69 (43° N. latitude traverse,
Grand Haven, Mich. , to Boston, Mass.).

Figure 5

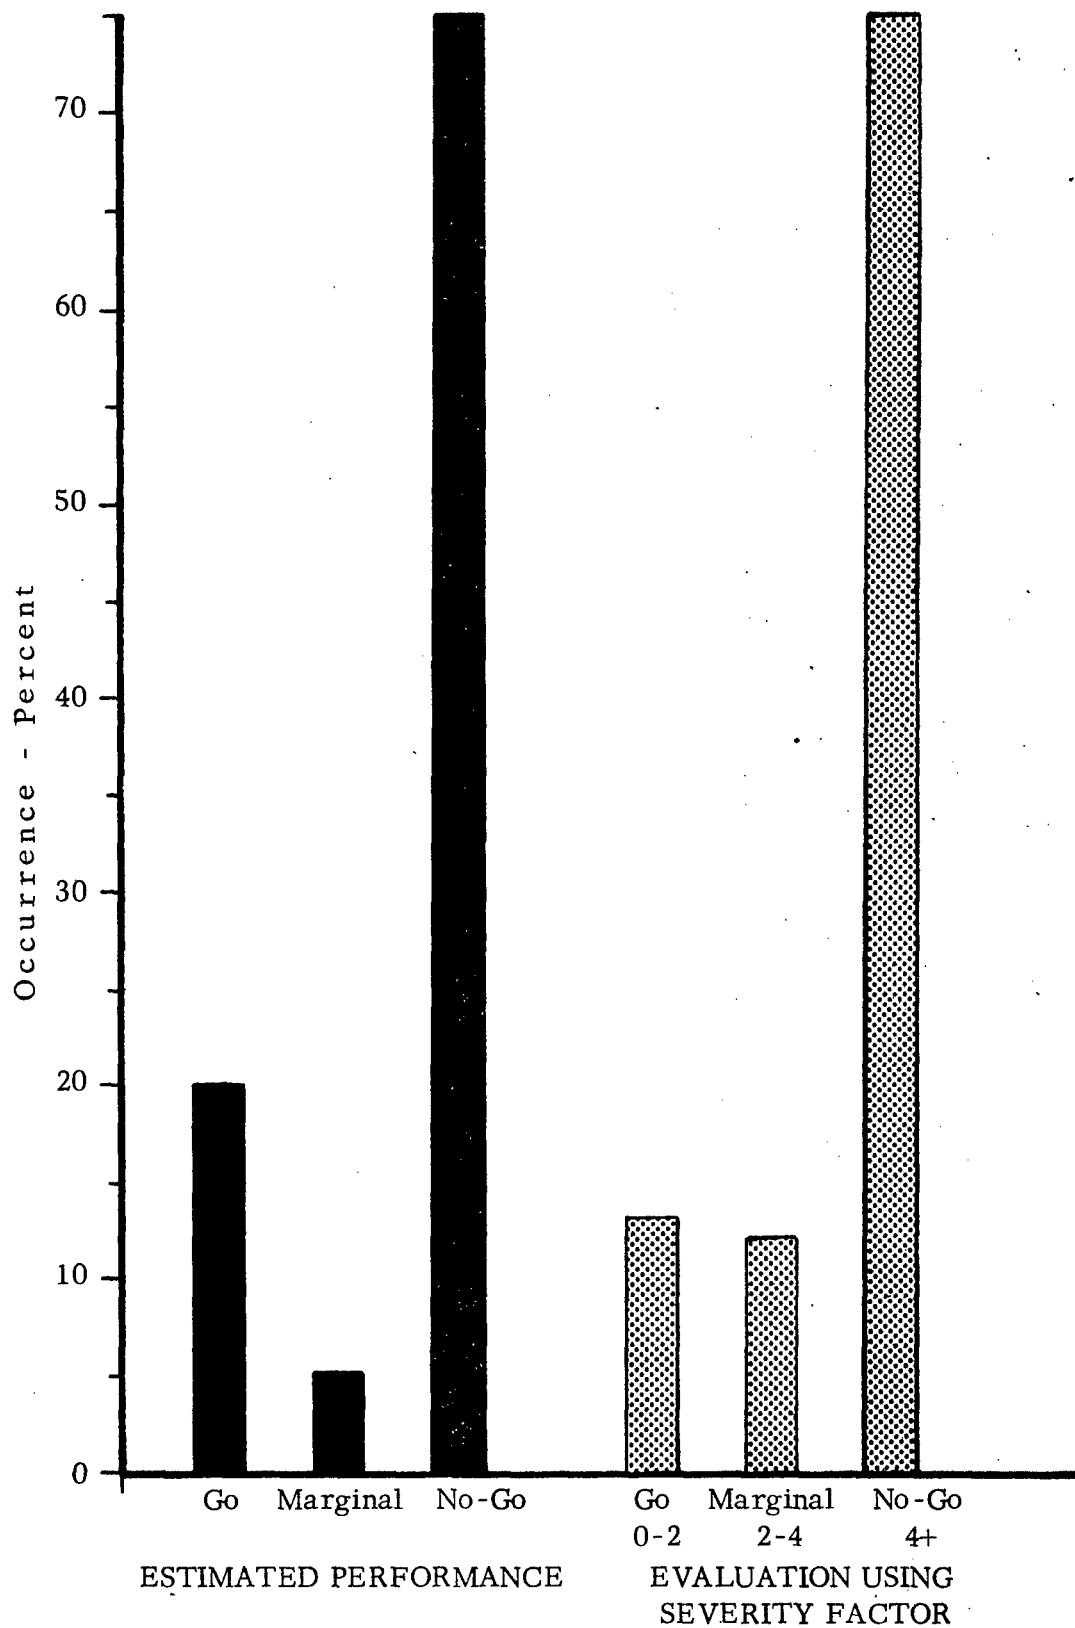

Comparison of methods for estimating M-113 exiting performance for sites 70 through 115 (36° N. latitude traverse, Elizabeth City, N. C., to Knoxville, Tenn.).

Figure 6



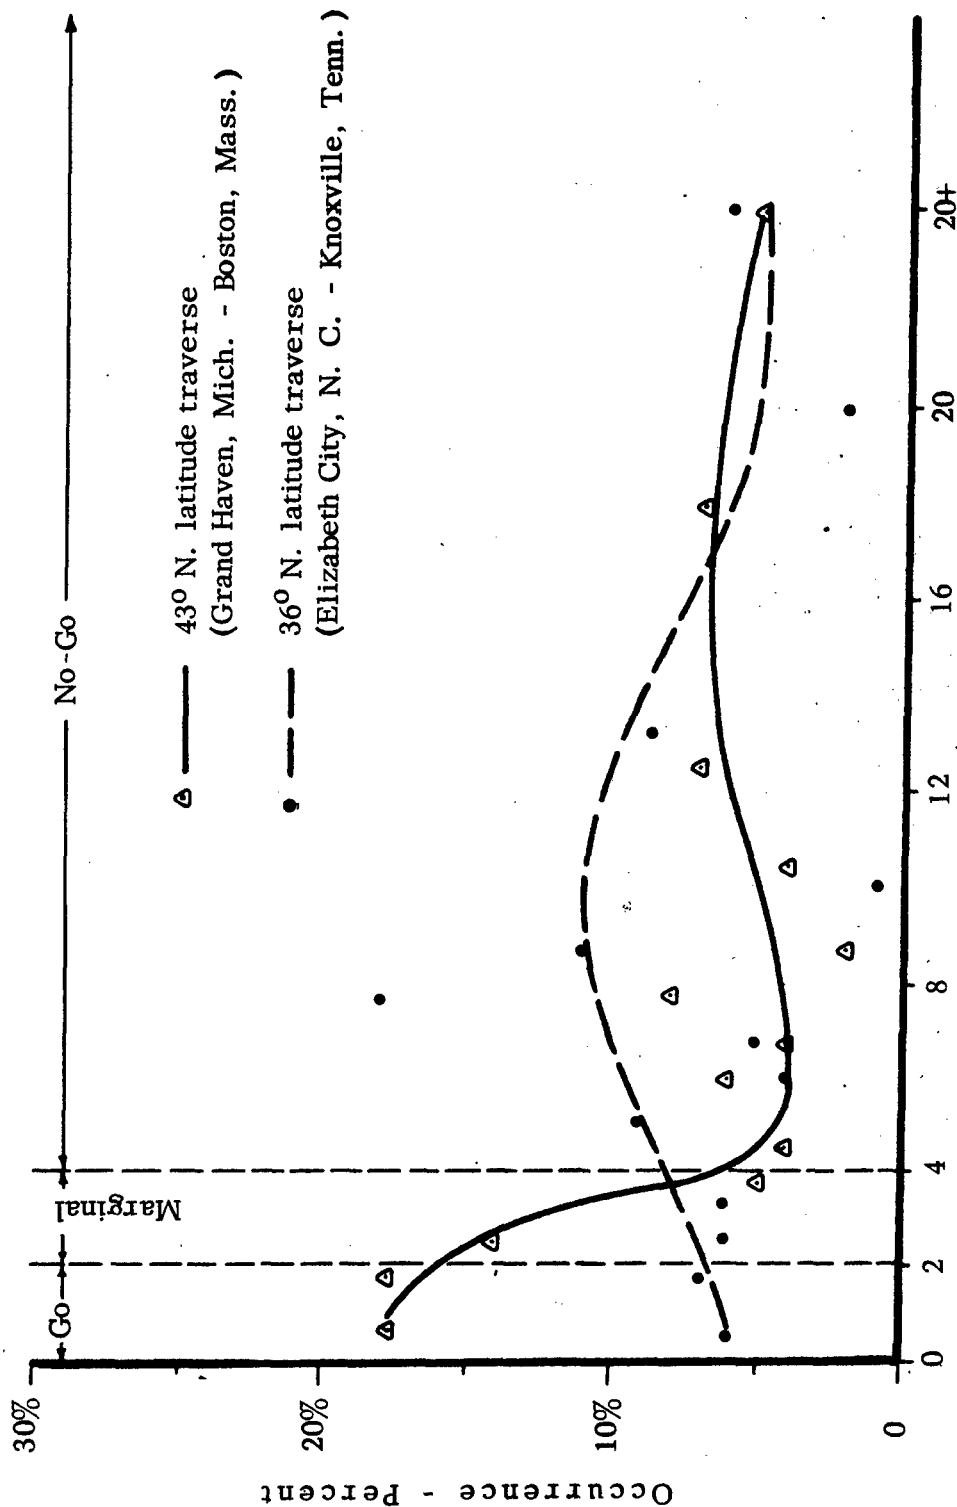


Figure 7
Geometric severity factor occurrence by traverse.

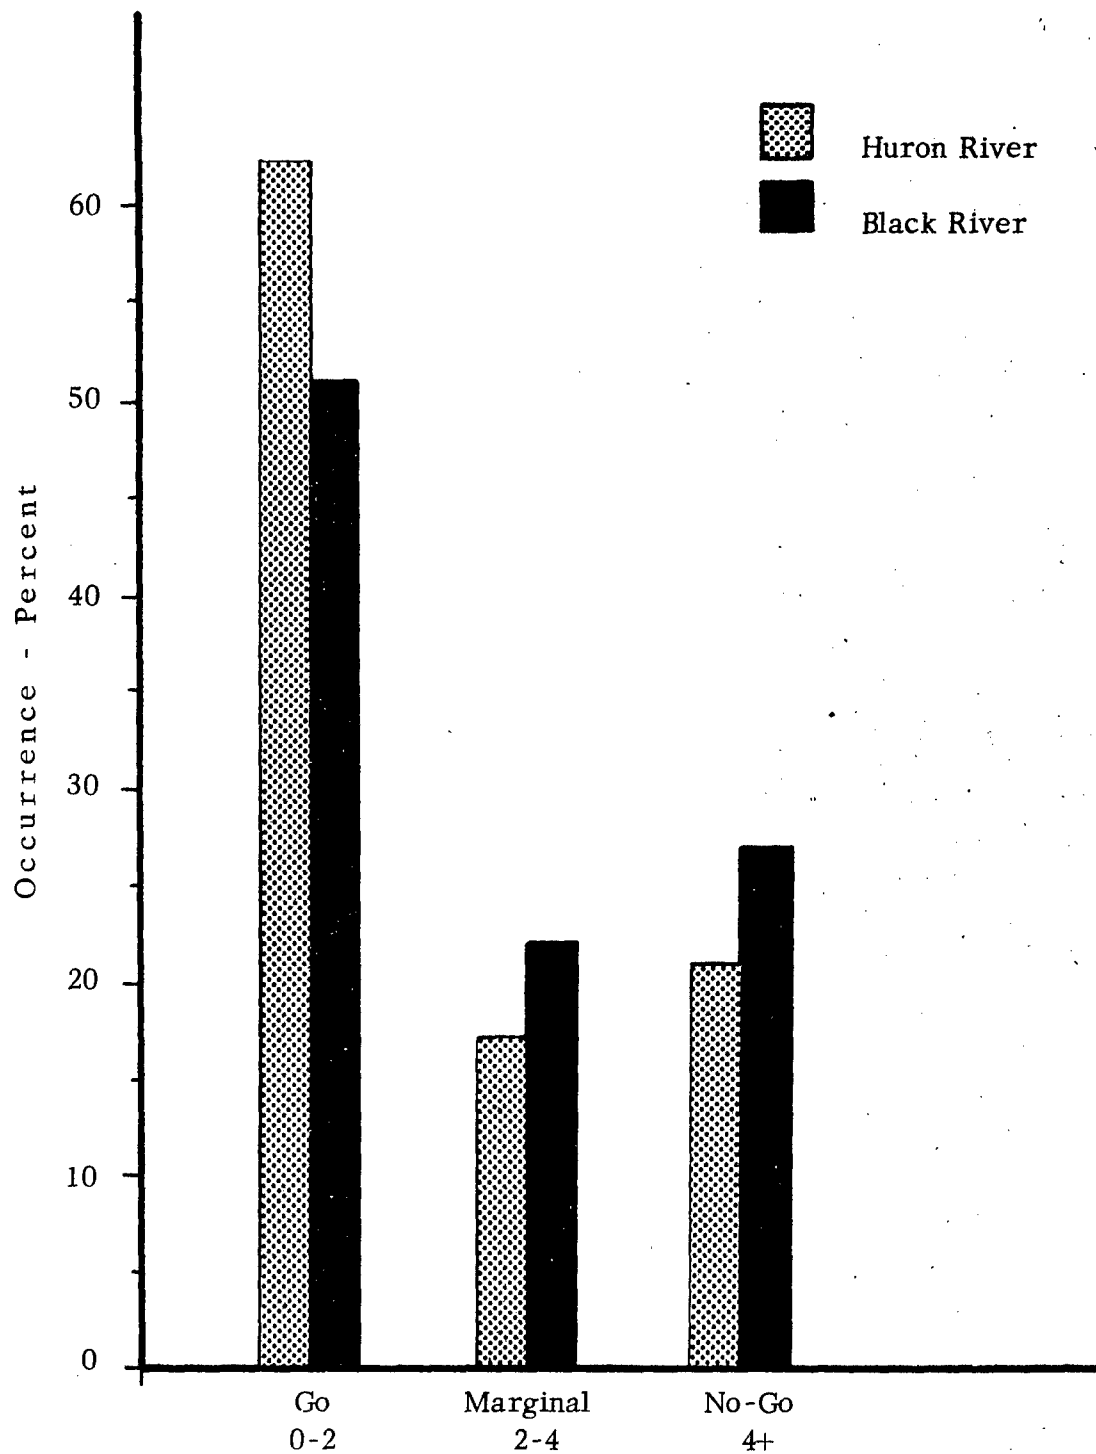

GEOMETRIC SEVERITY FACTOR - FEET
Estimated M-113 exiting performance for the Black and Huron Rivers using the geometric severity factor.

Figure 8

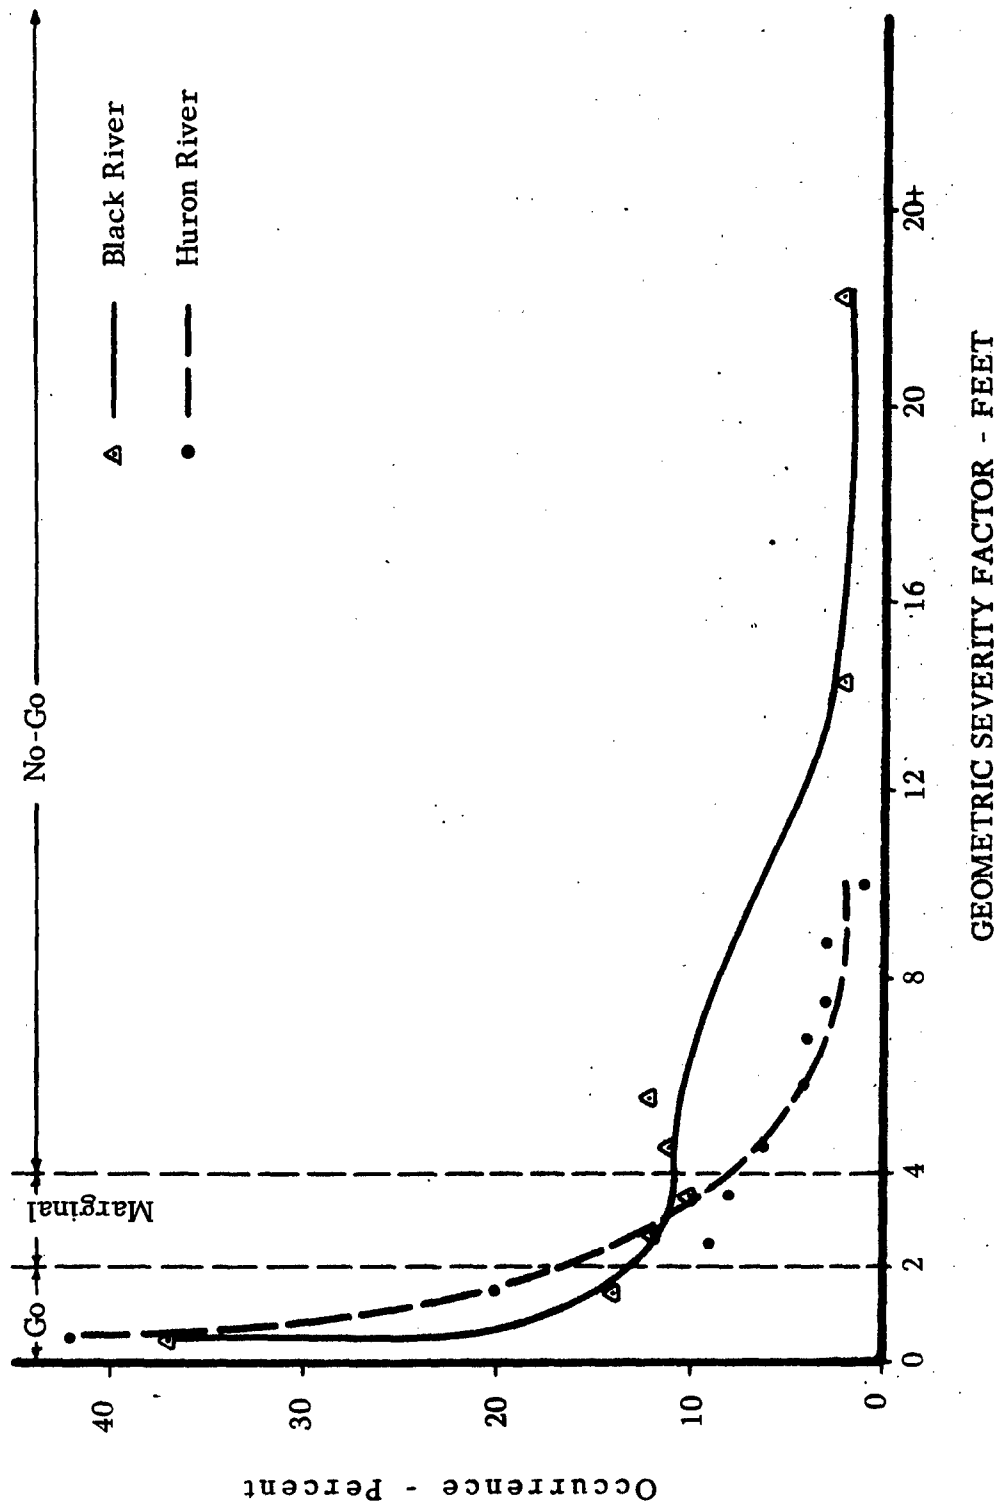

Geometric severity factor occurrence for the Black and Huron rivers.

Figure 9

REFERENCES

1. Sloss, Lassaline, Baker, Miranda, "A Study of River Magnitude and Frequency," March 1967, University of Detroit.
2. Liston, R. A., "Swamp Fox II, Republic of Panama, Volume III," U. S. Army Materiel Command, Washington, D. C., April 1964.
3. Ordnance Tank-Automotive Command, "Characteristic Data - Carrier, Personnel, Full-Track, Armored, M-113," June 1962.
4. Jonosi, Z. J., "Obstacle Performance of Tracklayer Vehicles," Proceedings of the Second International Conference of the International Society for Terrain-Vehicle Systems. August - September 1966.
5. Ford, J. T., "Production Engineering Test of Carrier, Personnel, Full-Track, Armored, M-113 (Amphibious Capabilities)," Report No. DPS-885 (ASTIA 400 694), April 1963.
6. Lassaline, D. M., et al, "Detailed Survey of Riverine Environment," March 1967, University of Detroit.

RELATED BIBLIOGRAPHY

A. VEHICLE ORIENTED REFERENCES

Aberdeen Proving Ground, "Test of Carrier, Cargo, Amphibious, M116, Arctic Winter 1962," AD 286 828 L, July 1962.

Aberdeen Proving Ground, "Feasibility Study of Truck, Cargo, 3/4 ton, 4 x 4, XM-531," AD 286 509 L, October 1962.

Alston, P. D., "Report on Test of Water Jet Propulsion Kit on Carrier, Cargo, Amphibious, Full-Track: T116E1," AD 270 998, Aberdeen Proving Ground, Maryland, February 1962.

Army, Dept. of, "Army Forces in Amphibious Operations (The Army Landing Force)," FM 31 12, March 1961.

Army, Dept. of, "Battle Group Landing Team (Amphibious)," FM 31 13, September 1961.

Army, Dept. of, "Embarkation and Loading - Amphibious," FM 60-30, May 1962.

Army, Dept. of, Headquarters, "Military Floating Bridge Equipment," TM 5-210, August, 1965.

Army, Dept. of, Headquarters, U.S. Army Vietnam, "Mechanized and Armor Combat Operations in Vietnam," March 1967, (for official use only).

Army Armor Board, "Report of USA TECOM Project No. 1-3-3020-31-D, Confirmatory Test of Carrier, Cargo, Amphibious, 1 1/2 ton, M116," AD 414 332, Fort Knox, Kentucky, August 1963.

Army Armor Board, "Report of Project No. 2136, Evaluation of Truck, Cargo, 3/4 ton, 4 x 4, XM 531," AD 287 768, Fort Knox, Kentucky, November, 1962.

Army Combat Developments Command, USA, "Interim Training Text (TT-31-75)," January 1967.

Army Material Command, "Tank Travelling Under Water," AD 477 661, Trans.

Army Tank-Automotive Command, "Preliminary Concepts and Evaluation of Mechanically and Hydraulically Driven Squad Support Devices," AD 297 844, January 1963.

Army Transportation Board, "Carrier, Cargo, Amphibious, M116, (HUSKY) Phase I: Tropical Evaluation," AD 282 626, Fort Eustis, Virginia, July 1962.

Baker, W. J , et al, "Model Studies of Military Amphibious Vehicles Exiting from Rivers," University of Detroit, April 1967. (To be published by the Land Locomotion Division, ATAC.)

Bekker, M. G. , "An Introduction to Research on Vehicle Mobility, Part 1: Stability Problem," Land Locomotion Research Laboratory, Detroit Arsenal, 1957.

Biase, J. de, "Report of USATECOM Project No. 7D-3233-02 Military Potential Test of Transporter, 2-Man, Canadian Jiger," Aberdeen Proving Ground, Md. , AD 405 574 L, May 1963.

Bird, A. "Riverine Operations of Tracked Vehicles," presentation to the Fifth U.S./Canadian Regional Meeting of the International Society for Terrain-Vehicle Systems, Auburn, Alabama, April 1967.

Borg-Warner Corporation, Ingersoll Kalamazoo Division, "Tracked Amphibian Personnel and Cargo Carrier - Feasibility Study, Proposed as Marine Assault Carrier (MAC), Vol. II of II," AD 420 740, November 1961.

Borg-Warner Corporation, Ingersoll Kalamazoo Division, "Tracked Amphibian Personnel and Cargo Carrier - Feasibility Study under Contract NOBS --- 4463 (MAC)," AD 420 739, November 1961.

Borg-Warner Corporation, Ingersoll Kalamazoo Division, "Research, Investigation & Experimentation in the Field of Amphibian Vehicles," AD 155 242 December 1957.

Borris, R. J. (Major, USA), "Vehicle Characteristics Affecting Mobility in Thailand," Joint Thai - U.S. Military Research and Development Center, Bangkok, Thailand, May 1966.

Broughton, J. D., Shamburger, J. H., and Del Mar, D. B., "Mobility Environmental Research Study - Report I - A Literature Survey of Environmental Factors in Thailand," Waterways Experiment Station, Vicksburg, Mississippi, June 1965.

Canadair, Ltd., "Field Evaluation of Carrier, Utility, Articulated XM-571, April 1966.

Chrysler Corporation, "Tracked Amphibian Personnel and Cargo Carrier," AD 420 733, Detroit 31, Michigan, November 1961.

Cohron, G. T., "Vol. I. Relationships Among Climate, River Characteristics, and the Performance of Swimming Vehicles on River Banks, Draft Report: Hydrology and Bank Characteristics of Rivers as Related to Stream Crossing Abilities of Swimming Vehicles," Wilson, Nuttall, Raimond Engineers, Inc., Chestertown, Maryland, July 1966.

Contractor, D. N., and Love, R. H., "An Experimental Investigation of Devices for Reducing the Hydrodynamic Resistance of Amphibious Vehicles," Hydronautics, Inc., October 1965.

Dantz, P. A., "Light-Duty, Expandable Land Anchor (30,000 lb. class). Technical Report R-472," AD 640 232. August 1966.

Davidson Laboratory, "Reports on Hydrodynamic Model Tests of High Speed Wheeled Amphibian Concepts," November 1966.

Dugoff, H., "Vehicle Egress from Streams - a Mathematical Model," Davidson Laboratory. Prepared for Fifth U S./Canadian Regional meeting of the ISTVS, Auburn, Alabama, April 1967.

Dugoff, H., and Ehrlich, I. R., "Model Tests of Buoyant Screw Rotor Configurations," Stevens Institute of Technology, Davidson Laboratory, Sept. 1966.

FMC Corporation, "Concept Study for a Tracked Amphibian Personnel and Cargo Carrier (LVTPX11), Vol. I," AD 420 734, San Jose, California, November 1961.

FMC Corporation, "Concept Study for a Tracked Amphibian Personnel and Cargo Carrier (LVTPX11), Vol. II," AD 420 735, San Jose, California, November 1961.

FMC Corporation, "Concept Study for a Tracked Amphibian Personnel and Cargo Carrier (LVTPX11), Vol. IV," AD 420 737, November 1961.

FMC Corporation, "Concept Study for a Tracked Amphibian Personnel and Cargo Carrier (LVTPX11), Vol. V," AD 420 738, December 1961.

Ford, J. T., "Production Engineering Test of Carrier, Personnel, Full-Tracked Armored, M113 (Amphibious Capabilities)," AD 400 694 (ASTIA), Aberdeen Proving Ground, Maryland, April 1963.

Frost, R. E., Johnson, P. L., Leighty, R. D., Anderson, V. H., Poulin, A. O., and Rinker, J. N., "Mobility Environmental Research Study a Quantitative Method for Describing Terrain for Ground Mobility, Vol. VI, Selected Airphoto Patterns of Terrain Features," CRREL, Hanover, New Hampshire, for WES, Mississippi, May 1966.

Kamm, I. O., "What Price Water Speed Improvements of Amphibians," Stevens Institute of Technology, Davidson Laboratory, August 1966.

Kendall, E. E., "Tandem Vehicle Water Operation Speed," FMC Corporation, San Jose, California, January 1958.

Leo, R. N., and Weaver, L. S., "First Partial Report on Engineering Test of Truck, Cargo, 8 ton, 4 x 4, XM 520 E 1," AD 287 811, Aberdeen Proving Ground, Maryland, September 1962.

Liston, R. A., "Swamp Fox II, Republic of Panama, Vol. III," U.S. Army Material Command, Washington, D. C., April 1964.

Lucas, Harold, "A Method for Comparative Evaluation of Tracked Versus Wheeled Vehicles," U.S. Army Ordnance Tank-Automotive Command, Detroit, Michigan, August 1961.

Mackey, D. S. and Atkinson, B. K., "Engineering Test of Truck, Cargo, 1 1/4 ton, 6 x 6, XM 561, First Partial Report," Report No. DPS-1909, Aberdeen Proving Ground, Maryland, February 1966.

Marine Corps Landing Force Development Center, "Earth Anchor Systems Interim Instructions for Installation of EAW-20 Extendible," AD 631 783, April 1966.

Marine Corps Landing Force Development Center, Quantico, Virginia,
"Lighter, Amphibian, Resupply, Cargo, 5-ton, (LARC-5-3X), Final Report,"
AD 269 070, December 1961.

Marine Corps Landing Force Development Activities, Quantico, Virginia,
"Project No. 46-63-02, Truck, Utility, Cargo/Personnel, 3/4 ton, 4 x 4,
Floater/XM 531; Final report of," AD 402 724 L, April 1963.

Marine Corps Landing Force Development Center, Quantico, Virginia,
"Project No. 46-63-05, Service Test of Lighter, Amphibious Resupply,
Cargo, 5 ton, LARC-5, Final report," AD 458 543, March 1965.

Marine Corps Landing Force Development Center, "Trailer, Cargo,
1/4 ton, 2-wheel, XM-585," AD 296 048 L, February 1963.

McMaster University, "Mobility Research on Small High-Mobility Vehicles,"
AD 475 169, Hamilton, Ontario, August 1965.

Military Engineering Experiment Establishment, "Bank Ferry Exit Gear
Application to FV 432 User Trial," 1965.

Mizen, N. J., "A Review of Current and Future Amphibious Surface
Vehicles. Vol. I. Vehicle Review," AD 801 964, October 1966.

Mueller, W. E., "Performance Testing of XM-561 Test Rigs in Thailand,"
Report No. 7-54320/5R-1477. LTV Aerospace Corporation, Michigan
Division, November 1965.

Nelson, H. O., (Lt. Col. Rtd.), "Trials of River Crossing Surveys with
NX7 Echo Sounder and NX12 Gradient Delineator," F. V. R. D. E., Chobham
Lane, Chertsey, Surrey, England, August 1966.

Neumeyer, M. J. and Gorton, J. V., "Final Test Report on Marsh Screw
Amphibian," AD 456 539, Chrysler Corporation, ARPA, July 1963.

Pacific Car and Foundry Co., "Concept Study for Tracked Amphibian Per-
sonnel and Cargo Carrier LVTPX II," AD 420 741, Renton, Washington,
November 1961.

Pacific Car and Foundry Company, Hydronautics, Inc., "Performance of
Tracked Propulsive Systems," AD 420 742, November, 1961.

Rice, R. S., and Schroeder, E. F., "A Review of Current and Future Amphibious Surface Vehicles. Vol. II, Hydrodynamic Considerations," AD 801 965, October 1966.

Rush, E. S., and Temple, R. G., "Trafficability Tests in Fine-Grained Soils with Two Vehicles with 9- to 10-ton Wheel Loads," Waterways Experiment Station, Vicksburg, Mississippi, March 1967.

Roach, C. D., "Design of Wheeled Amphibians," AD 637 843, U.S. Army Transportation Research Command, Fort Eustis, Va., April 1960.

Rymiszewski, A. J., "Improving Wheeled Vehicle Water Speed by Means of Wheel Shrouding," U.S. Army Tank-Automotive Center, Center Line, Michigan, June 1963.

Selwood, J. L. B., "Test Manual For Engineering Water Testing of High Speed Amphibious Vehicles," AD 633 880, Selwood Research, Inc., Maryland, April 1966.

Senger und Etterlin, Dr. Ferdinand von, "Amphibious Tanks in the West and East (Translation)," AD 475 917, Army Foreign Science and Technology Center, (DDC, Cameron Station, Alexandria, Virginia), January 1965.

Sloss, D. A., Jr., et al, "Analysis of Estimated River Exiting Performance," University of Detroit, March 1967. (To be published by the Land Locomotion Division, ATAC.)

Sloss, D. A., Jr., et al, "The Military Water-Crossing Problem," University of Detroit, April 1967.

Stevens Institute of Technology, Experimental Towing Tank, Hoboken, New Jersey, "Curves of Hydrodynamic Characteristics of 1/10 Scale Model of "DUKW" Equipped With Hydrofoil Supporting Struts (Hydrofoils themselves omitted)," AD 113 567.

Sutherland, Wm. H., Holz, B. W., Kelly, W. C., Dowling, P. M., and Sibbett, M., "Analysis of Means for Moving Logistic Cargo from Ship to Shore (U)," Technical Memorandum ORO-T-361, Johns Hopkins University, November 1957.

Tanner, D. W., "Further Work on the Relationship between Rake Angle and the Performance of Simple Cultivation Implements," Journal of Agricultural Engineering Research. Vol. 5, No. 3, 1960.

Tyler, R. B., and Borris, R. J., "Evaluation and Engineering Tests of the Hovertruck in Thailand," Joint Thai-U. S. Military Research and Development Center, December 1964.

Vauterin, Rear Admiral R., "The Evolution of Amphibious Operations," AD 477 722, La Revue Maritime, No. 198, April 1963, pp. 414-437.

Waterways Experiment Station, "Vicksburg Mobility Exercise a Vehicle Analysis for Remote-Area Operation," Vicksburg, Miss. February 1965.

Waterways Experiment Station, "Plan of Tests for Water-Land Interface Study," Vicksburg, Miss., July 1965.

Weaver, L. S., Jr., "Final Report of Engineering Test (Category II) of Lighter, Amphibious, Resupply, Cargo, 5-ton, 4 x 4, (LARC-V), For Marine Corps, Report No. DPS-1570," AD 458 543, Aberdeen Proving Ground, Maryland, February 1965.

Wilkie, R. F., "Amphibious Operation of Armored Personnel Carrier, M113, In Ocean Waters, 1961, Report No. DPS-477," AD 273 494 L, Aberdeen Proving Ground, Maryland, March 1962.

RELATED BIBLIOGRAPHY

B. REFERENCES RELATED TO STREAM PHYSIOGRAPHY

Aerospace Technology Division Report 66-127, "CBE Factors, Monthly Survey No. 10," AD 642 358, November 1965.

Army, Dept. of, "Correlation of Soil Properties with Geologic Information," TM 286, Reports 1 and 2, Vol. 1, 1949, 20 pp., and Vol. 2, 1951, 22 pp.

Army, Dept. of, "A Quantitative System for Classifying Landforms," Technical report EP-124, Environmental Protection Research Division, Natick, Mass., February 1960.

Army, Dept. of, "River Characteristics and Flow Analysis for Military Purposes," Corps of Engineers, Military Hydraulogy Branch, Washington, D. C., Bulletins 1 - 12, 1957, Bulletin 2.

Army, Dept. of, "Selected Airphoto Patterns for Mobility Studies in Thailand for Project MERS, Vol. I," Cold Regions Research and Engineering Laboratory, March 1965.

Army Material Command, "Bibliography on Soil Dynamics," AD 477 379, Cold Regions Research and Engineering Laboratory. September 1965.

Army Operational Research Establishment (United Kingdom), "Interim Report on a Survey of Water Obstacles in Northwest Europe," Feb. 1964.

Bagnold, R. A., "Some Aspects of the Shape of River Meanders," U.S.G.S., Prof. Paper 282-E, Washington, 1960, pp. 135-144.

Blench, T., "Regime Behavior of Canals and Rivers," London, Butterworth Scientific Publications, 1957, 138 pp.

Brooks, N. H., "Mechanics of Streams with Moveable Beds of Fine Sand," A.S.C.D. Trans., Vol. 123, Paper No. 2931, 1958, pp. 526-549.

Brush, L. M., Jr., "Drainage Basins, Channels, and Flow Characteristics of Selected Streams in Central Pennsylvania," U.S.G.S., Prof. Paper 282-F, 1961, pp. 145-181.

Bunting, B. T., "The Role of Seepage Moisture in Soil Formation, Slope Development and Stream Initiation," American Journal of Science, Vol. 259, 1961, pp. 503-518.

Butler, Stanley S., "Engineering Hydrology," Prentice-Hall, Englewood Cliff, New Jersey, 1957, 356 pp.

Callahan, J. T., Newcomb, L. E., and Geurin, J. W., "Water in Georgia," Geological Survey Water-Supply Paper 1762, Dept. of Interior, 1965.

Carey, W. C., and Keller, M. D., "Systematic Changes in the Beds of Alluvial Rivers," A.S.C.E. Proc. 83, Paper 1331, 1957.

Carlston, C. W., "Drainage Density and Streamflow," U.S.G.S., Dept. of Interior, 1963.

Chatley, H., "The Theory of Meandering," Engineering, Vol. 149, No. 3385, London, 1940, pp. 628-629.

Cobb, W. C., "The Passes of the Mississippi River," A.S.C.E. Trans., Vol. CI, 1953, pp. 1147-1162.

Colby, B. R., "Discharge of Sands and Mean-Velocity Relationships in Sand-Bed Streams," U.S.G.S. Prof. Paper 462-A, 1964.

Colby, B. R., "Effect of Depth of Flow on Discharge of Bed Material - Studies of Flow in Alluvial Channels," U.S.G.S., Water-Supply Paper 1498-D, Dept. of Interior, 1961.

Cohron, G. T., "Relationships Among Climate, River Characteristics, and the Performance of Swimming Vehicles on River Banks," Vol. I, Wilson, Nuttal, Raimond Engineers, Inc., Maryland, July 1966.

Commerce, Dept. of, "World Weather Records, 1951 - 60, Vol. 1, North America," Weather Bureau, Washington, D. C., 1965.

Commerce, Dept. of, "World Weather Records. 1951 - 60. Vol. 2, Europe," Environmental Data Services, Washington, D. C., 1966.

Commerce, Dept. of, "World Weather Records. 1951 - 60. Vol. 3, South America, Central America, West Indies, the Carriibbean, and Bermuda," Environmental Data Services, Washington, D. C., 1966.

Dawdy, D. R. , "Depth-Discharge Relations of Alluvial Streams -- Discontinuous Rating Curves," U. S. G. S. , Water-Supply Paper 1498-C, Dept. of Interior, 1961.

Einstein, H. A. , and Harder, J. A. , "Velocity Distribution and the Boundary Layer of Channel Bends," A. G. U. Trans. , Vol. 35, No. 1, 1954, pp. 114-120.

Fahnestock, R. K. , "Morphology and Hydrology of a Glacial Stream -- White River, Mount Rainier, Washington," U. S. G. S. Prof. Paper 422-A, 1963.

Fighting Vehicle Research Development Establishment, British Army of the Rhine (United Kingdom), "The Crossing of Inland Water Obstacles - Exercise Leander," September 1966.

Fisk, Harold N. , "Mississippi River Valley Geology Relation to River Regime," A. S. C. E. Trans. , Vol. 117, 1952, pp. 667-689.

Friedlin, J. F. , "A Laboratory Study of the Meandering of Alluvial Rivers," Waterways Experiment Station, Vicksburg, Mississippi, 1945, 40 pp.

Garner, H. F. , "Rivers in the Making," Scientific American, Vol. 216, No. 4, April 1967.

Garret, E. E. , "Comparison of Ground Mobility Characteristics of Land-Marine Interfaces of Florida and Thailand," Waterways Experiment Station, Vicksburg, Mississippi, August 1966.

Grabau, W. E. , "Hydrologic Geometry for Military Purposes," Waterways Experiment Station, Vicksburg, Mississippi. (Working paper.)

Grabau, W. E. , "Terrain Evaluation for Mobility Purposes," Journal of Terra Mechanics, Vol. 1, No. 2, Waterways Experiment Station, Vicksburg, Miss. , 1964, pp. 22-32.

Grenke, W. C. , "Soil Characteristics Encountered During Operation Swamp Fox II," Appendix VII, Swamp Fox II, Republic of Panama, Vol. III, Fort Eustis, Virginia, April 1964, pp. 222-245.

Hack, J. T. , "Studies of Longitudinal Stream Profiles in Virginia and Maryland," U. S. G. S. , Prof. Paper 294-B, 1957, pp. 45-97.

Hanamoto, et al, "A Study of River Magnitude and Frequency in Thailand," Land Locomotion Laboratory. (To be published by the Land Locomotion Division, ATAC in 1967.)

Horton, R. E., "Erosional Developments of Streams and Their Drainage Basins: Hydrophysical Approach to Quantitative Morphology," Geol. Soc. Am. Bull., Vol. 56, 1945, pp. 275-370.

Hoyt, W. G., "Studies of Relations of Rainfall and Run-off in the United States," U.S.G.S., Water-Supply Paper 772, 1936, 301 pp.

Interior, Dept. of, "Water Resources Data for Michigan, Part I. Surface Water Records," State of Michigan, 1965.

Interior, Dept. of, "Surface Water Records of Michigan," U.S.G.S., 1962.

Interior, Dept. of, "Surface Water Records of Michigan," U.S.G.S., 1963.

Interior, Dept. of, "Water Resources Research Catalog," Office of Water Resources Research. Washington, D. C., November 1966.

Interior, Dept. of, "Publications of the Geological Survey, 1879 - 1961," Washington, D. C.

Interior, Dept. of, "Publications of the Geological Survey, 1962," Wash. D.C.

Interior, Dept. of, "Publications of the Geological Survey, 1963," Wash. D.C.

Interior, Dept. of, "Publications of the Geological Survey, 1964," Wash. D.C.

Johnson, A. I., "Methods of Measuring Soil Moisture in the Field," Geological Survey Water-Supply Paper 1619-U, 1962.

Kesseli, J. E., "The Concept of the Graded River," Jour. Geol., Vol. 45, 1941, pp. 561-588.

Kilpatrick, F. A. and Barnes, H. H., Jr., "Channel Geometry of Piedmont Streams as Related to Frequency of Floods," U.S.G.S., Dept. of Interior, 1964.

Lassaline, D. M., et al, "Detailed Survey of Riverine Environment," University of Detroit, March 1967. (To be published by the Land Locomotion Division, ATAC.)

Lassaline, D. M., et al, "Pilot Study of Stream Frequency, University of Detroit, March 1967. (To be published by the Land Locomotion Division, ATAC.)

Leopold, L. B., "Rivers," American Scientist, Vol. 50, No. 4, 1962, pp. 511-537.

Leopold, L. B., "The Hydraulic Geometry of Stream Channels and Some Physiographic Implications," U.S.G.S. Prof. Paper 252, reprint 1959, pp. 1 - 56.

Leopold, L. B., and Miller, J. P., "Ephemeral Streams - Hydraulic Factors and Their Relation to the Drainage Net," U.S.G.S., Prof. Paper 282-A, Washington, 1956, pp. 1 - 37.

Leopold, L. B., and Wolman, M. G., "River Channel Patterns . . . Braided, Meandering, and Straight," U.S.G.S., Prof. Paper 282-B, Washington, 1957, pp. 39-85.

Leopold, L. B., "River Meanders," G.S.A. Bulletin, Vol. 71, 1960, pp. 769-794.

Leopold, L. B., and Langbein, W. B., "River Meanders," Scientific American, Vol. 214, No. 6, June 1966.

Leopold, L. B., Wolman, M. G., and Miller, J. P., "Physiographic and Hydraulic Studies of Rivers," U.S.G.S., Prof. Paper 282, Washington, 1956-57.

Macklin, J. H., "Concept of the Graded River," G.S.A. Bulletin, Vol. 59, No. 5, 1948, pp. 453-511.

Matalas, N. C., "Autocorrelation of Rainfall and Streamflow Minimums," U.S.G.S., Dept. of Interior, 1963.

Melton, F. A., "An Empirical Classification of Floodplain Streams," Geogr. Review, Vol. 26, 1936, pp. 593-609.

Myrick, R. M., and Leopold, L. B., "Some Depth and Velocity Relations in Small Rivers: Relation to Troop Crossings. Final Report, 1960 Military Hydrology Project," U.S.G.S., Washington, D. C., June 30, 1960.

Neill, C. R., and Galay, V. J., "Systematic Evaluation of River Regime," Journal of Waterways and Harbors Division, Amer. Soc. of Civ. Engineers, February 1967.

Pegg, John T., "River-crossing Operations," U.S.A.E. District, FM 31-60, Vicksburg, Mississippi, 1958, 70 pp.

Remson, I., Giles, R. F., Drake, R. L., Boles, E. J., and Stiefiel, R. C., "Some Systems for Describing, Classifying, Mapping and Comparing Surface-Water Bodies for Military Purposes," Drexel Institute of Technology, June 1962.

Simonett, D. S., "Future and Present Needs of Remote Sensing in Geography," CRES Report No. 61-12, University of Kansas, April 1966.

Simons, D. B., Richardson, E. V., and Haushild, W. L., "Some Effects of Fine Sediment on Flow Phenomena," Geological Survey Water-Supply Paper 1498-G, 1963.

Schumm, S. A., "The Shape of Alluvial Channels in Relation to Sediment," U.S.G.S., Prof. Paper 352-B, 1960, pp. 17-30.

Sloss, D. A., Jr., et al, "A Study of River Magnitude and Frequency," University of Detroit, March 1967. (To be published by the Land Locomotion Division, ATAC.)

Sloss, D. A., Jr., et al, "A Study of Tropical Soil Strengths," University of Detroit, August 1966.

Thorntwaite, C. W., "An Approach Toward a Rational Classification of Climate," The Geographical Review, Vol. 38, No. 1, 1948, pp. 55-94.

Velz, Clarence J., (B.S.C.E., C.E., M.S.P.H.), "Drought Flow of Michigan Streams," University of Michigan, Michigan Water Resources Commission, 1960.

Water Resources Division, "Military Hydrology Manual No. H-7, Determination of Hydraulic Elements of Rivers by Indirect Methods," U.S.G.S., June 1954.

Waterways Experiment Station, "Environmental Data Collection Manual, Part IX: Hydrologic Geometry," Vicksburg, Mississippi, April 1964.

Waterways Experiment Station, "Environmental Data Collection Manual, Part V: Surface Microgeometry," Vicksburg, Mississippi, April 1964.

Waterways Experiment Station, "Great Soil Group Survey of Selected Study Areas in Thailand," Vicksburg, Mississippi, June 1966.

Waterways Experiment Station, "Environmental Factors Affecting Ground Mobility in Thailand, Appendix C: Soil Trafficability," Technical Report No. 5-625, Vicksburg, Mississippi, May 1963.

Waterways Experiment Station, U. S. Army Corps of Engineers, "The Description and Classification of Hydrologic Characteristics for Military Purposes," Vicksburg, Mississippi, July 1964.

Waterways Experiment Station, U. S. Army Corps of Engineers, "Environmental Factors Affecting Ground Mobility in Thailand - Preliminary Survey - Appendix F: Hydrologic Geometry, Vicksburg, Mississippi, May 1963.

Whipple, W. , Jr. , "Missouri River Slope and Sediment," A.S. C. E. Trans. , Vol. 107, pp. 1178-1214, 1942.

Willow Run Laboratories, "Proceedings of the Fourth Symposium on Remote Sensing of Environment," University of Michigan, Ann Arbor, Michigan, June 1966.

Wolman, M. G. , "The Natural Channel of Brandywine Creek, Pennsylvania," U.S.G.S. Prof. Paper 271 - 1955, 56 pp.

Wolman, M. G. , and Brush, L. M. , "Factors Controlling the Size and Shape of Stream Channels in Coarse Non-cohesive Sands," U.S. G. S. Prof. Paper No. 282-G, Washington, 1951, pp. 191-210.

Wolman, M. G. , and Leopold, L. B. , "River Flood Plains: Some Observations on Their Formation," U.S. G. S. , Prof. Paper 282-C, 1951, pp. 87-107.

Wolman, M. G. , and Miller, J. P. , "Magnitude and Frequency of Forces in Geomorphic Processes," Jour. Geol. , No. 68, 1960, 54 pp.

Yatsu, Eiju, "On the Longitudinal Profile of the Graded River," A. G. U. Trans. , Vol. 36, No. 4, 1955, pp. 655-663.

APPENDIX A

TABLE I

Data from
"A STUDY OF RIVER MAGNITUDE AND FREQUENCY" (Ref. 1)

43° N. Latitude, Grand Haven, Mich. to Boston, Mass.
Sites 1 - 69

36° N. Latitude, Elizabeth City, N. C. to Knoxville, Tenn.
Sites 70 - 115

Site No.	Miles Between Sites	Bank to Bank Width**	Wetted Water Width	Max. Depth* Feet	Measured Depth Feet	Slope ° Min.	Max.	Velocity Ft. / Sec.
1	49.5***	78	31	21.8	1.8	27	44	1/4 1/2
2	0.5	51	33	37.8	2.8	15	20	1/4 1/2
3	9.0	56	23	7.7	3.7	5	22	0
4	6.7	31	21	13.2	3.2	15	19	1/4 1/2
5	8.9	109	45	13	1	18	34	1/4 1/2
6	28.0	150	79	9	2	10	37	1/4 1/2
7	10.7	79	35	12.1	2.1	15	40	0 1/4
8	31.6	105	60	15.6	0.6	20	43	0 1/4
9	0.8	155	116	13.2	3.2	15	60	1/4 1/2
10	6.1	51	44	13.5	3.5	90	90	1/4 1/2
11	18.3	750	750	Dam	Dam	90	90	1/4 1/2
12	8.8	371	350	26.7	6.7	5	50	1/4 1/2
13	11.0	500	450	12	2	90	90	2 3
14	11.1	485	450	15	9	16	50	1/4 1/2
15	49.8	800	800	29	25	90	90	6
16	6.5	68	29	17.3	1.3	40	40	1/4 1/2
17	57.1	85	30	4.5	0.5	5	22	1/4 1/2
18	2.4	289	140	10.9	2.9	3	30	2 3
19	19.0	129	82	6.3	3.3	10	15	1/4 1/2
20	6.5	150	61	5.7	2.7	12	55	1/4 1/2
21	18	128	25	9	2	5	15	2 3
22	12.5	250	74	Dam	6.7	17	45	1/4 1/2
23	12.7	160	31	6.9	3.9	20	40	1/4 1/2
24	9.6	60	34	11.3	2.3	15	35	0 1/4
25	33.9	280	240	19.3	15.3	28	41	1/4 1/2

* Estimated values.

** Width in feet unless miles (m) is specified.

*** Miles from start of traverse.

Site No.	Miles Between Sites	Bank to Bank Width**	Wetted Water Width	Max. Depth* Feet	Measured Depth Feet	Slope°		Velocity Ft. / Sec.	
						Min.	Max.		
26	0.4	550	550	5.8	1.8	90	90	1/2	
27	15.8	94	42	3.7	1.7	10	42	1/4	1/2
28	9.1	128	128	Dam	16.0	90	90	2	3
29	0.2	200	200	Dam	22.0	90	90	2	3
30	19.1	4900*	3900*	Dam	25.0*	90	90	2	3
31	11.7	125	91	6	3*	30	65	1/4	1/2
32	8.4	150	86	2	1*	15	40	0	1/4
33	1.3	225	63	4.5	0.5	29	30	1/4	1/2
34	0.8	260	120	3.8	0.8	30	30	1/4	1/2
35	23.5	72	41	3.3	1.3	7	40	1	
36	12.3	110	82	5.9	0.9	15	25	0	1/4
37	15.0	250	155	18	2*	29	90	1/4	1/2
38	11.7	91	52	7	0	38	50	0	
39	17.8	126	34	4.2	2.2	5	90	1/4	1/2
40	21.8	70	70	5.9	2.9	0	90	0	
41	10.1	300	275	17.8	14.8	7	40	1/4	1/2
42	18.5	41	20	Dam	1*	32	85	2	
43	15.1	41	36	9.1	4.1	60	60	0	1/4
44	16.9	50	33	7.1	1.6	7	90	4	
45	4.3	42	29	6.6	1.6	24	35	2	
46	17.2	70	27	3.8	1.8	29	65	1/2	1
47	18.6	47	28	2.9	0.9	10	60	1/2	1
48	56.5	450	240	12	1	10	11	1/4	1/2
49	14.9	118	67	9.5	4.5	35	45	0	1/4
50	20.6	260	240	10	1	54	54	0	1/4
51	0.3	500	460	29	20	31	90	1/2	1
52	22.6	103	59	5.4	1.4	5	31	2	
53	13.7	63	28	3	1	30	45	4	5
54	2.9	270	238	4.5	1.5	24	24	1/2	1
55	0.7	380	170	4	1*	20	20	1/2	1
56	1.7	50	50	4	2	90	90	2	
57	13.3	85	36	5	2	47	60	4	5
58	5.7	410	295	5.3	2.3	9	16	1	1-1/2
59	2.3	65	20	3.8	0.8	24	24	1	1-1/2
60	7.3	473	300	5.5	2.5	17	26	1/4	1/2
61	1.1	525	255	8.2	2.2	17	30	1-1/2	2
62	10.8	130	81	9	2	10	60	1/4	1/2
63	4.5	210	35	3.5	0.5	39	52	1	

Site No.	Miles Between Sites	Bank to Bank Width**	Wetted Water Width	Max. Depth* Feet	Measured Depth Feet	Slope ^o		Velocity	
						Min.	Max.	Ft.	/ Sec.
64	3.6	730	360	Dam	7*	33	75	1	
65	10.4	305	180	10	1	5	35	2	
66	38.6	224	130	4.5	1.5	13	51	1	
67	6.3	185	155	4	3	90	90	0	1/4
68	15.2	136	109	10	4	5	50	1/4	1/2
69	19.3	240	200	Dam	4*	90	90	1/4	1/2
70	20.0***	500	500	9.2	4.2	0	90	1/4	1/2
71	10.1	23	23	5.6	4.1	0	0	1/4	1/2
72	9.3	1/2 m *	1/2 m*	11	10	0	0	1/4	1/2
73	14.9	104	44	6.4	5.4	0	0	0	
74	0.8	425	425	9.4	8.4	0	0	0	
75	3.5	1.6m +*	1.6m+*	11	10*	0	0	0	
76	5.2	71	71	14.1	13.1	0	0	0	1/4
77	12.3	131	90	12.8	11.8	0	8	0	
78	13.2	280	280	4	2*	0	90	3	
79	34.2	210	105	9	2	20	90	1	
80	21.5	64	54	9	3.5	45	63	1/2	
81	2.1	70	54	5.5	3.5	90	90	0	1/4
82	7.9	35	29.5	3.5	1.5	55	70	0	1/4
83	10.8	120	107	5.5	1.5	90	90	1/2	
84	4.5	25	25	5.2	2.2	0	0	1/4	
85	27.9	108	98	4.5	0.5	45	90	1/4	
86	31.0	55	53	6.2	2.2	90	90	1/4	1/2
87	7.9	51	41	7.5	1.5	54	90	1/4	
88	11.4	65	65	Dam	3*	90	90	1-1/2	
89	19.7	68	38	11.2	1.2	35	40	1/4	1/2
90	15.7	140	140	9.3	3.3	90	90	0	
91	17.7	50	41	12	7	70	70	1/2	1
92	2.7	53	45	11	1	70	70	0	1/4
93	16.1	64	48	11	1	36	90	1/2	1
94	11.0	255	240	12	2*	50	90	2	
95	7.9	56	41	13.2	2.2	36	70	1/4	1/2
96	11.7	125	100	6	2	20	90	2	
97	5.0	80	80	13.2	2.2*	90	90	2	
98	24.5	500	500	Dam	6*	90	90	1/4	1/2
99	50.7	34	31	14	4	70	90	2	
100	17.2	48	48	5.3	1.3	90	90	2	
101	0.7	51	38	5.9	1.9	35	45	3	

*** Miles from start of new traverse, 36° N. latitude.

Site No.	Miles Between Sites	Bank to Bank Width**	Wetted Water Width	Max. Depth* Feet	Measured Depth Feet	Slope ^o		Velocity	
						Min.	Max.	Ft.	/ Sec.
102	3.4	100	43	2.3	0.8	25	70	2	
103	19.1	115	80	3.3	1.3	38	38	1/2	
104	These sites were omitted when a new route was selected because of heavy fog. The distance between sites 103 and 106 is 17.4 miles as shown.								
105									
106	17.4	111	36	4.3	2.3	40	54	3	
107	2.1	65	44	6	1	70	90	3	
108	8.0	145	52	7	3	15	80	4	
109	15.4	170	70	5.7	4.2	18	54	2	
110	6.2	540	310	6	5*	5	11	5	
111	0.2	57	37	6.5	2.5	13	13	2	
112	11.1	520	450	5.5	4*	16	60	1-1/2	
113	12.4	400	350	13	4*	10	90	5	
114	4.5	160	150+	13.7	12.7	30	90	2	
115	44.3	295	280	10.1	2.6	90	90	1/4	1/2

TABLE II

QUALITATIVE ANALYSIS OF

M-113 RIVER EXITING PERFORMANCE

43° N. Latitude (Grand Haven, Mich. to Boston, Mass.),
Sites 1 - 69

36° N. Latitude (Elizabeth City, N. C. to Knoxville, Tenn.)
Sites 70 - 115

Site	Go	No-Go	Remarks*
1E		X	slope > 26° (44°)
1W		X	slope > 26° (41°)
2E	X		1 foot wall + 15° slope
2W	X		1 foot wall + 20° slope
3E	X		2 foot wall + 5° slope
3W	X		1-1/2 foot wall + 22° slope
4E	X		2-3 foot 70° slope then 15° slope v. c. m.
4W	X		2-3 foot 70° slope then 19° slope v. c. m.
5E		X	slope > 26° (2 ft. vert. wall + 12 1/2 ft. 34° slope)
5W	X		18° slope
6E		X	20 ft. 37° slope
6W	X		3 ft. 56° slope n. w. m.
7E	X		10 ft. 27° slope m. c.
7W	X		4 ft. 40° slope
8E	X		6 ft. 20° slope
8W		X	slope > 26° (8 ft. 43° + 15 ft. 31°)
9E	X		4 ft. 35° slope n. w. m.
9W		X	slope > 26° (5 ft. 60° slope) m. c.
10E		X	trees + vertical wall (4 ft.)
10W		X	trees + vertical wall (3 ft.)
11E		X	vertical wall (3 ft. above water; rock)
11W		X	vertical wall (15 ft.)

* n. w. m. = negotiable with momentum
m. c. = marginal case
v. c. m. = vehicle could modify

Site	Go	No-Go	Remarks
12E	X		2 ft. 45° slope n. w. m.
12W		X	slope > 26° (16 ft. 50° slope)
13E		X	vertical wall (20 ft. retaining wall)
13W		X	vertical wall (20 ft. retaining wall)
14E		X	slope > 26° (7 ft. 50° slope) and trees
14W		X	slope > 26° (8 ft. 31° slope) and trees
15E		X	10 ft. vertical wall, above water, rock fill
15W		X	10 ft. vertical wall, above water, rock fill
16E		X	slope > 26° (20 ft. 44° slope) some trees
16W		X	slope > 26° (14 ft. 40° slope) some trees
17E	X		5° slope
17W	X		9° slope
18E	X		5 ft. 3° slope + 2 ft. vertical wall + trees
18W		X	vertical wall (20 ft. 30° + 20 ft. vertical wall + trees)
19E	X		10° to 15° slope
19W	X		2 ft. vertical wall + 15° slope
20E		X	vertical wall (11ft. 80°)
20W		X	slope > 26° (12 ft. 55°)
21E	X		15° slope
21W		X	4 ft. vertical wall + trees
22E		X	slope > 26° (15 ft. 44° + trees)
22W		X	marsh and slope > 26° (marsh + 40 ft. 45°)
23E		X	slope > 26° (5 ft. 32° + 6 ft. vertical wall)
23W		X	vertical wall (3 ft. high + 22 ft. 40° + trees)
24E		X	slope > 26° (6 ft. 56°)
24W	X		3 ft. 35° slope n. w. m., m. c.
25E		X	slope > 26° (4-1/2 ft. 41°) m. c.
25W		X	slope > 26° (13 ft. 28°)
26E		X	vertical wall (6 ft. steel retaining wall)
26W		X	marsh
27E	X		8 ft. 24°
27W		X	slope > 26° (12 ft. 42°)
28E		X	vertical wall (16 ft. Old Welland Canal)
28W		X	vertical wall (16 ft. Old Welland Canal)
29E		X	vertical wall (30 ft. New Welland Canal)
29W		X	vertical wall (30 ft. New Welland Canal)
30E		X	8 ft. concrete wall
30W		X	8 ft. concrete wall
31E		X	slope > 26° (15 ft. 55°)
31W		X	slope > 26° (3 ft. 65° + 15 ft. 30°)

Site	Go	No-Go	Remarks
32E		X	slope > 26° (19 ft. 40°)
32W	X		9 ft. 25°
33E		X	slope > 26° (4 ft. vertical wall + 15 ft. 30° slope)
33W		X	slope > 26° (17 ft. 29°)
34E		X	slope > 26° (30 ft. 30°)
34W		X	slope > 26° (30 ft. 30°)
35E		X	slope > 26° (10 ft. 32°)
35W		X	slope > 26° (3 ft. vert. wall + 7 ft. 40° slope)
36E	X		10 ft. 22°
36W	X		4 ft. 25°
37E		X	slope > 26° (13 ft. 55°)
37W		X	slope > 26° (18 ft. 29°)
38E		X	slope > 26° (5 ft. 38°)
38W		X	slope > 26° (18 ft. 55°)
39E	X		1 ft. vertical wall + 5° slope
39W	X		2 ft. vertical wall + 7° slope
40E		X	marsh m. c.
40W		X	vertical wall (4-1/2 ft. retaining wall)
41E	X		2 ft. 40°
41W	X		5 ft. 28° n. w. m.
42E	X		4-1/2 ft. 65° n. w. m., m. c.
42W		X	slope > 26° (7 ft. 32°)
43E		X	slope > 26° (4-1/2 ft. 61°)
43W		X	slope > 26° (4-1/2 ft. 61°)
44E		X	vertical wall 4 ft., m. c.
44W	X		2 ft. 40°
45E	X		6-1/2 ft. 35° n. w. m., m. c.
45W	X		2 ft. 24°
46E		X	slope > 26° (10 ft. 29°)
46W		X	slope > 26° (20 ft. 65°)
47E	X		2-1/2 ft. 29°
47W	X		4 ft. 10°
48E	X		35 ft. 10°
48W		X	slope > 26° (6 ft. 10° + 8 ft. 60° + 12 ft. 10°)
49E		X	slope > 26° (45° slope + trees)
49W		X	slope > 26° (7 ft. 37° + trees)
50E		X	slope > 26° (25 ft. 54° slope)
50W		X	slope > 26° (25 ft. 54° slope)
51E		X	20 ft. vertical wall
51W		X	slope > 26° (23 ft. 31° slope)

Site	Go	No-Go	Remarks
52E	X		maximum slope 20°
52W		X	slope > 26° (7 ft. 31° slope)
53E		X	slope > 26° (12 ft. 45° slope)
53W		X	slope > 26° (8 ft. 30° slope)
54E	X		14 ft. 24° slope
54W	X		14 ft. 24° slope
55E	X		27 ft. 20° slope
55W	X		27 ft. 20° slope
56E		X	16 ft. vertical wall
56W		X	16 ft. vertical wall
57E		X	12 ft. vertical wall
57W		X	slope > 26° (12 ft. 60° slope)
58E	X		20 ft. 16° slope
58W	X		9 ft. 9° slope
59E	X		7 ft. 24° slope
59W	X		7 ft. 24° slope
60E	X		28 ft. 17° slope
60W		X	slope > 26° (41 ft. 26° slope)
61E		X	slope > 26° (30 ft. 30° slope)
61W	X		30 ft. 17° slope
62E		X	2 ft. vertical wall + 4 ft. 60° slope
62W		X	4 ft. vertical wall
63E		X	slope > 26° (110 ft. 52° slope + trees)
63W		X	slope > 26° (38 ft. 39° slope + trees)
64E		X	slope > 26° (150 ft. 33° slope + trees)
64W		X	slope > 26° (50 ft. 75° slope + trees)
65E	X		2 ft. 5° slope
65W		X	slope > 26° (22 ft. 35° slope + trees)
66E		X	slope > 26° (70 ft. 51° slope + trees)
66W		X	3 ft. vertical wall + trees
67E	X		4 ft. 15° slope
67W	X		1-1/2 ft. vertical wall + 3 ft. 15° slope
68E	X		1-1/2 ft. vertical wall + 1-1/2 ft. 15° slope
68W		X	slope > 26° (15 ft. 50° slope)
69E	X		2 ft. vertical wall + 1-1/2 ft. 12° slope
69W	X		2 ft. vertical wall + 3 ft. 9° slope
70E		X	Swamp
70W		X	5 ft. vertical wall
71E		X	Swamp
71W		X	Swamp

Site	Go	No-Go	Remarks
72E		X	Swamp
72W		X	Swamp
73E	X		4-1/2 ft. 11° slope
73W		X	Swamp
74E		X	Swamp
74W		X	Swamp
75E		X	Swamp
75W		X	Swamp
76E		X	Swamp
76W		X	Swamp
77E		X	Swamp
77W	X		6 ft. 8° slope
78E		X	Swamp
78W		X	5 ft. vertical wall
79E	X		17 ft. 20° slope
79W		X	8 ft. vertical wall
80E		X	slope > 26° (8 ft. 63° slope + trees)
80W		X	slope > 26° (6 ft. 45° slope + trees)
81E		X	5-1/2 ft. vertical wall + trees
81W		X	8-1/2 ft. vertical wall + trees
82E		X	slope > 26° (4 ft. 70° slope + trees)
82W		X	slope > 26° (4 ft. 45° slope + trees)
83E		X	14 ft. vertical wall + trees
83W		X	14 ft. vertical wall + trees
84E	X		slope < 26°
84W		X	slope > 26°
85E		X	12 ft. vertical wall
85W		X	slope > 26° (10 ft. 45° slope)
86E	X		3-1/2 ft. vertical wall n. w. m. , m. c.
86W	X		2-1/2 ft. vertical wall
87E		X	slope > 26° (11 ft. 54° slope + trees)
87W		X	9 ft. vertical wall + trees
88E		X	6 ft. vertical wall
88W		X	6 ft. vertical wall
89E		X	slope > 26° (10 ft. 35° slope)
89W		X	slope > 26° (10 ft. 40° slope)
90E		X	5 ft. vertical wall + trees
90W		X	6.5 ft. vertical wall + trees
91E		X	slope > 26° (6 ft. 70° slope)
91W		X	slope > 26° (6 ft. 70° slope)

Site	Go	No-Go	Remarks
92E		X	slope > 26° (10 ft. 70° slope)
92W		X	slope > 26° (10 ft. 70° slope)
93E		X	9 ft. vertical wall
93W		X	slope > 26° (17-1/2 ft. 36° slope)
94E		X	slope > 26° (14 ft. 50° slope + trees)
94W		X	8 ft. vertical wall + trees
95E		X	slope > 26° (7 ft. 36° slope)
95W		X	slope > 26° (6 ft. 70° slope + 5 ft. 50° slope)
96E	X		2 ft. vertical wall + 7 ft. 20° slope
96W		X	8 ft. vertical wall
97E		X	6 ft. vertical wall
97W		X	6 ft. vertical wall
98E		X	8 ft. vertical wall
98W		X	8 ft. vertical wall
99E		X	slope > 26° (8-1/2 ft. 70° slope)
99W		X	8-1/2 ft. vertical wall
100E		X	9 ft. vertical wall
100W		X	8 ft. vertical wall
101E	X		5 ft. 35° slope n.w.m., m.c.
101W	X		5 ft. 45° slope n.w.m., m.c.
102E		X	slope > 26° (300 ft. 70° + trees)
102W	X		4 ft. 25° slope
103E		X	slope > 26° (33 ft. 38° slope)
103W		X	slope > 26° (30 ft. 38° slope)
104			
105			
106E		X	slope > 26° (18 ft. 40° slope)
106W		X	slope > 26° (100 ft. 54° slope)
107E		X	slope > 26° (9 ft. 70° slope)
107W		X	slope > 26° (14 ft. 64° slope)
108E		X	slope > 26° (50 ft. 80° slope)
108W		X	slope > 26° (20 ft. 40° slope)
109E		X	slope > 26° (10 ft. 54° slope)
109W		X	slope > 26° (70 ft. 50° slope)
110E	X		27 ft. 11° slope
110W		X	8 ft. vertical wall
111E		X	buildings (vertical wall)
111W		X	buildings (vertical wall)
112E		X	slope > 26° (25 ft. 60° slope)
112W		X	18 ft. vertical wall

Site	Go	Go-No	Remarks
113E	X		9 ft. 10° slope
113W		X	10 ft. vertical wall + trees
114E	X		5 ft. 30° slope n. w. m.
114W		X	36 ft. vertical wall
115E	X		2 ft. vertical wall + 4 ft. 18° slope
115W		X	7-1/2 ft. vertical wall

TABLE III
ANALYSIS OF
M-113 RIVER EXITING PERFORMANCE
USING THE GEOMETRIC SEVERITY FACTOR

Site*	Data from original field notes						Severity factor** $s=h(\sin\theta)^2$	Qualitative Evaluation***
	h	θ	h	θ	h	θ		
1E	14	41°	5	31°			7-1/2	No-Go
1W	8	44°	11.5	27°			6-1/4	No-Go
2E	2	15°	1	90°			1-1/4	Go
2W	4	20°					1/2	Go
3E	2	90°	2	5°			2	Go
3W	1-1/2	90°	7-1/2	22°			2-1/4	Go
4E	2-1/2	70°	1	15°			2-1/4	Go
4W	3/4	90°	2	19°			1	Go
5E	2	90°	12-1/2	31°			5-1/4	No-Go
5W	14	17°					1	Go
6E	20	37°					7	No-Go
6W	1-1/2	10°	3	55°	3	25°	2-1/2	Go
7E	10	27°	1-1/2	90°			1-3/4	Go
7W	4	40°	11	15°			2-1/2	Go
8E	6	20°					3/4	Go
8W	2	25°	9	43°	6	21°	5-1/4	No-Go
9E	3-1/2	35°	2	15°			1-1/4	Go
9W	5	60°					3-3/4	No-Go
10E	3-1/2	90°					3-1/2	No-Go
10W	3	90°					3	No-Go
11E	15	90°					15	No-Go
11W	3	90°					3	No-Go
12E	1	5°	2	45°			1	Go
12W	16	50°					9-1/4	No-Go
13E	20	90°					20	No-Go
13W	20	90°					20	No-Go

* E and W refer to East and West banks.

** Values to nearest 1/4.

*** M-113 exiting performance evaluation based on judgment and vehicle performance of 50 percent grade and a 3 ft. vertical wall capability.

Site	Data from original field notes						Severity factor $s=h(\sin\theta)^2$	Qualitative Evaluation
	h	θ	h	θ	h	θ		
14E	7	50°					4	No-Go
14W	5-1/2	16°	8	31°			2-1/2	No-Go
15E	10	90°					10	No-Go
15W	10	90°					10	No-Go
16E	20	44°					9-3/4	No-Go
16W	14	40°					5-3/4	No-Go
17E	1	15°	1-1/2	5°			1/4	Go
17W	6	22°	1-1/2	9°			3/4	Go
18E	1	3°	2	90°	13-1/2	12°	2-1/2	Go
18W	2	10°	5	30°	20	90°	21	No-Go
19E	3-1/2	10°	3	15°			1/2	Go
19W	2	90°	3	15°			2-1/4	Go
20E	5	15°	11	78°			10-3/4	No-Go
20W	12	55°					8	No-Go
21E	2	15°					1/4	Go
21W	4	90°					4	No-Go
22E	15	44°	9	17°			8-1/2	No-Go
22W	40	45°					20	No-Go
23E	5	32°	6	90°			7-1/4	No-Go
23W	3	90°	22	40°			12	No-Go
24E	6	56°					4	No-Go
24W	3	35°					1	Go
25E	4-1/2	41°					1-3/4	No-Go
25W	13	28°					2-1/2	No-Go
26E	6	90°					6	No-Go
26W	Marsh							No-Go
27E	8	24°					1-1/2	Go
27W	12	42°					5	No-Go
28E	16	90°					16	No-Go
28W	16	90°					16	No-Go
29E	30	90°					30	No-Go
29W	30	90°					30	No-Go
30E	8	90°					8	No-Go
30W	8	90°					8	No-Go
31E	15	55°					10	No-Go
31W	3	65°	15	30°			6-1/4	No-Go
32E	19	40°					7-3/4	No-Go
32W	9	25°					1-1/2	Go

Site	Data from original field notes						Severity factor $s=h(\sin\theta)^2$	Qualitative Evaluation
	h	θ	h	θ	h	θ		
33E	4	90°	15	30°			7-3/4	No-Go
33W	17	29°					4-1/4	No-Go
34E	30	30°					7-1/2	No-Go
34W	30	30°					7-1/2	No-Go
35E	10	32°					2-3/4	No-Go
35W	3	90°	7	40°			6	No-Go
36E	10	22°					1-1/4	Go
36W	4	25°					3/4	Go
37E	13	55°					8-3/4	No-Go
37W	18	29°					4-1/2	No-Go
38E	5	38°					2	No-Go
38W	18	55°					12	No-Go
39E	1	90°	2	5°			1	Go
39W	2	90°	7-1/2	6°			2	Go
40E	Marsh							No-Go
40W	4-1/2	90°					4-1/2	No-Go
41E	2	40°					3/4	Go
41W	5	28°					1-1/4	Go
42E	4-1/2	65°					1-3/4	Go
42W	7	32°					1-3/4	No-Go
43E	4-1/2	61°					3-1/2	No-Go
43W	4-1/2	61°					3-1/2	No-Go
44E	4	90°					4	No-Go
44W	2	40°					1	Go
45E	6-1/2	35°					2-1/4	Go
45W	2	24°					1/4	Go
46E	10	29°					2-1/2	No-Go
46W	20	65°					17-1/2	No-Go
47E	2-1/2	29°					3/4	Go
47W	4	10°					0	Go
48E	3-1/2	10°	2	5°	29	10°	1/2	Go
48W	6	10°	8	60°	12	10°	6-3/4	No-Go
49E	3-1/2	35°	8-1/2	45°	26	35°	14	No-Go
49W	7	37°					2-1/2	No-Go
50E	25	54°					10-3/4	No-Go
50W	25	54°					10-3/4	No-Go
51E	20	90°					20	No-Go
51W	23	31°					5-3/4	No-Go
52E	2	20°	3	10°	2	20°	1/2	Go
52W	7	31°					1-3/4	No-Go

Site	Data from original field notes						Severity factor $s=h(\sin\theta)^2$	Qualitative Evaluation
	h	θ	h	θ	h	θ		
53E	12	45°					6	No-Go
53W	8	30°					2	No-Go
54E	14	24°					2	Go
54W	14	24°					2	Go
55E	27	20°					2-3/4	Go
55W	27	20°					2-3/4	Go
56E	16	90°					16	No-Go
56W	16	90°					16	No-Go
57E	12	90°	5	45°			14-1/2	No-Go
57W	12	60°					9	No-Go
58E	20	16°					2-1/2	Go
58W	9	9°					1/4	Go
59E	7	24°					1	Go
59W	7	24°					1	Go
60E	28	17°					2	Go
60W	41	26°					7-1/2	No-Go
61E	3	17°					7-1/2	No-Go
61W	30	17°					2	Go
62E	2	90°	1-1/2	15°	5	60°	5-3/4	No-Go
62W	7	10°	4	90°			4-1/4	No-Go
63E	110	52°					66	No-Go
63W	38	39°					15	No-Go
64E	150	33°					42	No-Go
64W	50	75°					47-1/2	No-Go
65E	2	5°					0	Go
65W	22	35°					7	No-Go
66E	70	51°					40	No-Go
66W	3	90°					3	No-Go
67E	4	15°					1/4	Go
67W	1-1/2	90°	3	15°			1-3/4	Go
68E	1-1/2	90°	1-1/2	15°			1-1/2	Go
68W	15	50°					10	No-Go
69E	2	90°	1-1/2	12°			2	Go
69W	2	90°	3-1/2	9°			2	Go
70E	Swamp							
70W	5	90°					5	No-Go
71E	Swamp							
71W	Swamp							
72E	Swamp							
72W	Swamp							

Site	Data from original field notes					Severity factor $s=h(\sin\theta)^2$	Qualitative Evaluation
	h	e	h	e	h		
73E	4-1/2	11 ⁰				1/4	Go
73W	Swamp						
74E	Swamp						
74W	Swamp						
75E	Swamp						
75W	Swamp						
76E	Swamp						
76W	Swamp						
77E	Swamp						
77W	6	8 ⁰				1/4	Go
78E	Swamp						
78W	5	90 ⁰				5	No-Go
79E	17	20 ⁰				1-3/4	Go
79W	8	90 ⁰				8	No-Go
80E	8	63 ⁰				6-1/2	No-Go
80W	6	45 ⁰				6-1/2	No-Go
81E	5-1/2	90 ⁰				8	No-Go
81W	8-1/2	90 ⁰				8-1/2	No-Go
82E	4	70 ⁰				7-1/4	No-Go
82W	4	45 ⁰				2	No-Go
83E	14	90 ⁰				14	No-Go
83W	14	90 ⁰				14	No-Go
84E	2-1/2	60 ⁰				2	Go
84W	2-1/2	60 ⁰				2	Go
85E	12	90 ⁰				12	No-Go
85W	10	45 ⁰				5	No-Go
86E	3-1/2	90 ⁰				3-1/2	Go
86W	1	90 ⁰	1-1/2	20 ⁰	2-1/2	90 ⁰	Go
87E	11	54 ⁰				7-1/2	No-Go
87W	9	90 ⁰				9	No-Go
88E	3	90 ⁰				3	No-Go
88W	3	90 ⁰				3	No-Go
89E	10	35 ⁰				3-1/4	No-Go
89W	10	40 ⁰				4-1/4	No-Go
90E	5	90 ⁰				5	No-Go
90W	6.5	90 ⁰				6-1/2	No-Go
91E	6	70 ⁰				5	No-Go
91W	6	70 ⁰				5	No-Go
92E	10	70 ⁰				8-3/4	No-Go
92W	10	70 ⁰				8-3/4	No-Go

Site	Data from original field notes						Severity factor $s=h(\sin\theta)^2$	Qualitative Evaluation
	h	θ	h	θ	h	θ		
93E	9	90°					9	No-Go
93W	17-1/2	36°					5-3/4	No-Go
94E	14	50°					8-1/4	No-Go
94W	8	90°					8	No-Go
95E	7	36°					2-1/4	No-Go
95W	6	70°					8-1/4	No-Go
96E	2	90°	5	20°			2-1/2	Go
96W	7	90°	2	20°			7-1/4	No-Go
97E	6	90°					6	No-Go
97W	6	90°					6	No-Go
98E	8	90°					8	No-Go
98W	8	90°					8	No-Go
99E	8-1/2	70°					7-1/2	No-Go
99W	8-1/2	90°					8-1/2	No-Go
100E	9	90°					9	No-Go
100W	8	90°					8	No-Go
101E	5	35°					1-3/4	Go
101W	5	45°					2-1/2	Go
102E	300	70°					275	No-Go
102W	4	25°					3/4	Go
103E	30	38°					12-1/2	No-Go
103W	33	38°					14-1/2	No-Go
106E	18	40°					7	No-Go
106W	100	54°					67-1/2	No-Go
107E	9	70°					8	No-Go
107W	2	90°	14	64°			13	No-Go
108E	20	15°	50	80°			50	No-Go
108W	20	40°					7-1/2	No-Go
109E	10	54°					6-3/4	No-Go
109W	10	18°	70	50°			41-1/4	No-Go
110E	27	11°					1	Go
110W	8	90°					8	No-Go
111E	Buildings							
111W	Buildings							
112E	25	60°					20	No-Go
112W	14	16°	18	90°			19	No-Go
113E	9	10°					1/4	Go
113W	10	90°					10	No-Go
114E	5	30°					1-1/4	Go

Site	Data from original field notes						Severity factor $s=h(\sin\theta)^2$	Qualitative Evaluation
	h	e	h	e	h	e		
114W	36	90°					36	No-Go
115E	7-1/2	90°					7-1/2	Go
115W	2	90°	4	18°			2-1/2	No-Go

TABLE IV
SWAMP FOX II RIVER EXITING TESTS*

Exit	S**	M - 113			M - 114			M - 116		
		Trials	Go	No-Go	Trials	Go	No-Go	Trials	Go	No-Go
1	4-1/2	7		7	5		5	2		2
2	3/4	1	1		1	1				
3	4	5	1	4	3		3	3		3
5	3/4	4	4		4	4				

* Reference 2.

** Geometric severity factor computed by $s = h (\sin \theta)^2$

TABLE V

ANALYSIS OF
M-113 RIVER EXITING PERFORMANCE
USING THE GEOMETRIC SEVERITY FACTOR

HURON RIVER

Site* h	Data from original field notes										Severity Factor** M-113***	
	e	h	e	h	e	h	e	h	e	h		
16R	2.5	35									3/4	Go
16L	1.5	5	1.75	20	5	15					1/2	Go
17R	1.5	30	3	5	5	15					3/4	Go
17L	3	40	1.5	10							1 1/4	Go
18R	5	20	1.5	10							1/2	Go
18L	3.5	75	2	35							4	Marginal
19R	3.5	10	3	10							0	Go
19L	1.25	10	2	30	3.5	10					1/2	Go
20R	2.25	10	2	25							1/4	Go
20L	1.5	45	5	15							1	Go
21R	1	40	2.5	10	1.25	60					1 1/2	Go
21L	5.75	5									0	Go
22R	2	15									1/4	Go
22L	1.5	10	4.75	40							2	Go
23R	18	45									9	No-Go
23L	3	15									1/4	Go
24R	1.25	90	1.25	60	14	20					3 3/4	Marginal
24L	1	30	2	10							1/4	Go
25R	2	20									1/4	Go
25L	1	90	1	10	2	10					1	Go

* L and R refer to left and right banks when looking up stream.

** Values to nearest 1/4.

*** Based on severity factor groupings of 0-2: GO, 2-4: Marginal, and 4+: NO-GO

HURON RIVER
(continued)

Data from original field notes

Site	Data from original field notes										Severity Factor	M-113
	h	e	h	e	h	e	h	e	h	e		
26R	3	15									1/4	Go
26L	1	45	1	15	4.5	5	3.5	20			1	Go
27R	3.5	5	1	10	1.5	5					0	Go
27L	2.5	5	1.5	45	5	10					1	Go
28R	1	10	1	45							1/2	Go
28L	2	10	1.5	45	1.5	10	2.5	5			3/4	Go
29R	1	5	1.5	35							1/2	Go
29L	1	15	3.5	45	2	15	2.5	5			2	Go
30R	1	30									1/4	Go
30L	1	90									1	Go
31R	2	20	4.5	75	14	20					6	No-Go
31L	5	10	1.5	5							1/4	Go
32R	2.75	5									0	Go
32L	1.5	90									1 1/2	Go
33R	3.5	5	3	35	3	10					1	Go
33L	4	5	3.5	10	1.5	90	1	15			1 1/2	Go
34R	3.5	35	9.5	15	5	45					4 1/4	No-Go
34L	2	60									1 1/2	Go
35R	2.5	35	2.5	10							3/4	Go
35L	4	20									1/2	Go
36R	11.5	20									1 1/4	Go
36L	6.5	20									3/4	Go
37R	1.5	40	1.5	10	6.5	25					2 1/4	Marginal
37L	7	25	2	5							1 1/4	Go
38R	1.5	10	10	20							1 1/4	Go
38L	1	15	9	20							1	Go
39R	10	20									1 1/4	Go
39L	85	30									2 3/4	Marginal

HURON RIVER
(continued)

Site	Data from original field notes										Severity	
	h	e	h	e	h	e	h	e	h	e	Factor	M-113
40R	8	40									3 1/4	Marginal
40L	7	60	10	35							8 1/2	No-Go
41R	9.5	30	9	5							2 1/2	Marginal
41L	11.5	10									1/4	Go
42R	3	10	4.5	25	3	10					3/4	Go
42L	3	5	2	15	13.5	30					3 1/2	Marginal
43R	2	5	2	10	3	20	9	60	10	10	7	No-Go
43L	3.5	5	1.5	10	9	60					7 1/4	No-Go
44R	1.5	20	8	45							4 1/4	No-Go
44L	1.5	45	4	90	5.5	25	3.5	15			6	No-Go
45R	4.5	35	1	5	2	20					1 3/4	Go
45L	1.5	10	1	35	2	75	2.5	25	5	75	6 3/4	No-Go
46R	4	20	4	35	4	15					2 1/4	Marginal
46L	1.5	5	3.5	15							1/4	Go
47R	7.5	20	4	10							1	Go
47L	3	5	5	15							1/4	Go
48R	4	25	3	20	1.5	10	1.5	20			1 1/4	Go
48L	2	10	5	75							4 3/4	No-Go
49R	1	10	3	20	4	5					1/4	Go
49L	2	20	5	60	3.5	30					5	No-Go
50R	1.5	20	5.5	20	4	10					1	Go
50L	2.5	15									1/4	Go
51R	1.5	10	4	25	3	60	6	30			4 1/2	No-Go
51L	2	5	3	20							1/4	Go
52R	3	20	8	40	4.5	5	13.5	20			4 3/4	No-Go
52L	3.5	5	5	45	1.5	20					2 3/4	Marginal
53R	4	10	3.5	75							3 1/4	Marginal

HURON RIVER
(continued)

Site	Data from original field notes										Severity	
	h	e	h	e	h	e	h	e	h	e	Factor	M-113
53L	2	15	1	45	1.5	90	3	40	3.5	75	6 1/2	No-Go
54R	4	5	1.5	45	2	10	5	45			5 3/4	No-Go
54L	8	20	6.5	90							7 1/2	No-Go
55R	4	20	5	30							1 3/4	Go
55L	2.5	15	1.5	20	1.5	90	3	25	3.5	20	3	Marginal
56R	11	15									3/4	Go
56L	2	5	3	25	4	15					3/4	Go
57R	3.5	90	1	20							3 1/4	Marginal
57L	4.5	15	6	30							1 3/4	Go
58R	1	10	5.5	45	1.5	10	2.5	25			3 3/4	Marginal
58L	2.5	5	1	15	2	90	9	35			5	No-Go
59R	1.5	25	8.5	90							8 3/4	No-Go
59L	4	10	1	5	9	30					2 1/4	Marginal
60R	1.5	15	10	90							10	No-Go
60L	5	15	2.5	15							3/4	Go
61R	5.5	75	9.5	25							7	No-Go
61L	15	30									3 1/2	Marginal
62R	9	25	5	15							1 3/4	Go
62L											0	Go
63R	12	30									3	Marginal
63L	5	5	4	15							1/4	Go
64R	10.5	30	7.5	20							3 1/2	Marginal
64L	2	10	1.5	25	6	5					1/4	Go
65R	9.5	20									1 3/4	Go
65L	4.5	5	5	25	5	60	10	20			5 1/2	No-Go
66R	2	10	9.5	30							2 1/2	Marginal
66L	2.5	90	2.5	30	4	45	9.5	30			7 3/4	No-Go

HURON RIVER (continued)

Site		Data from original field notes												Severity	
		h	e	h	e	h	e	h	e	h	e	h	e	Factor	M-113
67R	10	30												2 1/2	Marginal
67L	7	25												1 1/4	Go
68R	10	40	1.5	10										1 1/4	Go
68L	9.5	20												1 3/4	Go
69R	3	5	6	90										6	No-Go
69L	3	10	7	25	2	10								1 1/4	Go
70R	1.5	5	7	60										5 1/4	No-Go
70L	5.5	25	14	15										2	Go
71R	2	20	1	90	1	10	1.5	15	2.5	10	10	35		4 1/2	No-Go
71L	2	15	1.5	90	1	5	3	15	1	10	2.5	10		2 1/4	Marginal
72R	2.5	5	6.5	35	5	25								3 1/4	Marginal
72L	2.5	5	4	60	4	10								3	Marginal
73R	3.5	15	1	5	6	10								1/2	Go
73L	7.5	20												1	Go
74R														0	Go
74L	3	15	2.5	20										1/2	Go
75R														0	Go
75L	3	20												1/4	Go
76R	2.5	20	2.5	5	5	15	1	5	4.5	30				1 3/4	Go
76L	2	5	1	15	2.5	5								0	Go
77R	8	5	1	90	30	60								22 1/2	No-Go
77L	2.5	5	2.5	20	4	75								4	Marginal
78R	3	5	5	15	1.5	90	5	35	5	10	9	20		4 3/4	No-Go
78L	3	5	3.5	25	2	10	4.5	90						5 1/4	No-Go
79R	3.5	5	5	30	1.5	90	2	10	6	30	3.5	10	25	5 1/4	No-Go
79L	2.5	5	5	15	4	90								4 1/4	No-Go

HURON RIVER
(continued)

Site	Data from original field notes												Severity Factor	M-113
	h	e	h	e	h	e	h	e	h	e	h	e		
80R	3	10	5	25	1.5	90	2.5	10	6	15	9.5	20	3 1/2	Marginal
80L	3.5	5	5	15	4	90							4 1/4	No-Go
81R	1.5	5	10	45	12.5	30							3	Marginal
81L	1.5	25	5	20	7	10							1	Go
82R	1.5	15	8.5	60	4.5	15	10	60					14 1/4	No-Go
82L	1.5	25	4.5	60	5	20	3.5	10	4	25			4 3/4	No-Go

TABLE VI

ANALYSIS OF
M-113 RIVER EXITING PERFORMANCE
USING THE GEOMETRIC SEVERITY FACTOR

BLACK RIVER

Site* h	Data from original field notes										Severity Factor**	M-113***
	e	h	e	h	e	h	e	h	e	h		
1R	.5	23	3.25	45	2	6					1 3/4	Go
1L	1.25	5	.75	8	2	25					5 1/4	No-Go
2R	1.0	5	1.5	15		3	10				0	Go
2L	1.5	5	2	45	1.5	15					1 1/4	Go
3R	2.5	5	3.5	45	3	15	4	1.5	25		3	Marginal
3L	1.25	5	2.5	90	2.5	15					2 3/4	Marginal
4R	1	35	2.5	60	2	5	15	20			3 3/4	Marginal
4L	5.5	20	3	14							1	Go
5R	1	15	2	20	2.5	5					1/4	Go
5L	2	10	4	20	4	5					1/2	Go
6R	1.75	5	1.5	45	3	20	7.5	10	4.5	20	1 3/4	Go
6L	16.5	15									1	Go
7R	1	25	1	90	2.25	45	2	15	2.75	15	5 1/2	No-Go
7L	3.5	10	2.5	7							0	Go
8R	2	45	5	15	4	45	3.5	10			3 1/4	Marginal
8L	4.5	30									1 1/4	Go
9R	1.75	60	5	15	4.5	35					3	Marginal
9L	3.5	5	2.5	10							0	Go
10R	3	5									0	Go
10L	2.75	5	6.5	15	10	20					1 3/4	Go

* L and R refer to left and right banks when looking up stream.

** Values to nearest 1/4.

*** Based on severity factor grouping of 0-2: GO, 2-4: Marginal, and 4+: NO-GO.

Severity

Data from original field notes

Site	h	e	h	e	h	e	h	e	Factor	M-113
11R	3	5	3	35	2.5	10			1	Go
11L	1.5	10	3	75	3.5	15	17.5	25	6	No-Go
12R	1	10	2	10	2	5			0	Go
12L	2.5	15	3.5	75	5	40			5 1/2	No-Go
13R	2	5	1.5	10	4.5	20			1 1/2	Go
13L	4	10	3	40	3.5	7			1 1/4	Go
14R	3.25	5	2	45	2.5	10			1	Go
14L	2.5	25	3	60	2.5	5			2 3/4	Marginal
15R	1	5	1.5	20	7.5	35	3.5	25	4	Marginal
15L	3	30	6	10					1	Go

DISTRIBUTION LIST

Commanding General U S. Army Tank-Automotive Command Warren, Michigan 48090 Attention:	<u>No. of Copies</u>
Chief Scientist/Technical Director of Laboratories, AMSTA-CL	1
Chief Engineer, AMSTA-CR	1
Director, Development & Engineering Directorate, AMSTA-R	1
Vehicular Components & Materials Laboratory, Attn: General Support Branch, AMSTA-BSG	2
Vehicle Systems Division, AMSTA-RE	2
International Technical Programs Division, AMSTA-RI	1
Engineering Control Systems Division, AMSTA-RS	2
Systems Concept Division, AMSTA-RR	2
Maintenance Directorate, AMSTA-M	2
Quality Assurance Directorate, AMSTA-Q	2
Commodity Management Office, AMSTA-W	2
Vehicular Components & Materials Laboratory Attn: Research Library Branch, AMSTA-BSL	3
Safety & Reliability Division, AMSTA-RB	1
Land Locomotion Division, AMSTA-UL	10
Propulsion Systems Laboratory, AMSTA-G	5
Fire Power & Sub-System Integration Division, AMSTA-HF	1
Frame, Suspension & Track Division, AMSTA-UT	6
Scientific Computer Division, AMSTA-US	1
Technical Data Division, AMSTA-TD	2
Operations Support Division, AMSTA-RP	2
Combat Dev. Comd Liaison Office, CDCLN-A	2
Marine Corp Liaison Office, USMC-LNO	2
AF MIPR Liason Office, SGRPD-USAF	2
Canadian Army Liaison Office, CDLS(D)	2
USA EL Liaison Office, AMSEL-RD-MN	2
USA Weapons Comd Liaison Office, AMSWE-LCV	2
Reliability Engineering Branch, AMSTA-RTT	1
Sheridan Project Managers Office, AMCPM-SH-D	1
General Purpose Vehicles Project Managers Office, AMCPM-GP	1

	<u>No. of Copies</u>
M60, M60A1, M46A3 Project Managers Office, AMCPM-M60	1
Combat Vehicle Liaison Office, AMCPM-CV-D	1
US Frg MBT Detroit Office, AMCPM-MBT-D	1
XM561 Project Managers Office, AMCPM-GG	1
Commanding General U. S. Army Materiel Command Washington, D. C. Attn: AMCRD-DM-G	2
Commander Defense Documentation Center Cameron Station Alexandria, Virginia 22314	20
Marry Diamond Laboratories Attn: Technical Reports Group Washington, D. C.	1
U. S. Naval Civil Engineer Res. & Engr. Lab. Construction Batallion Center Port Hueneme, California	1
Commanding General U.S. Army Test and Evaluation Command Aberdeen Proving Ground, Maryland Attn: AMSTE-BB AMSTE-TA	1 1
Commanding General U. S. Army Supply & Maintenance Command Washington, D. C. , 20310 Attn: AMSSM-MR	1
Commanding General 18th Airborne Corps Fort Bragg, North Carolina 28307	1
Commanding General U. S. Army Alaska APO 409 Seattle, Washington	1

	<u>No. of Copies</u>
Office, Chief of Research & Development Department of the Army Washington, D. C.	2
U. S. Army Deputy Chief of Staff for Logistics Washington, D. C.	2
President U. S. Army Airborne Electronic & Special Warfare Board Fort Bragg, North Carolina 26307	1
President U. S. Army Arctic Test Center APO Seattle, Washington 98733	1
Director, Marine Corps Landing Forces Development Center Quantico, Virginia 22134	1
Commanding Officer Aberdeen Proving Ground, Maryland 21005 Attn: STEAP-TL	1
Commanding General Headquarters USARAL APO 949 Seattle, Washington Attn: ARAOD	2
Commanding General U. S. Army Aviation School Office of the Librarian Fort Rucker, Alabama Attn: AASPI-L	1
Plans Officer (Psychologist) PP&A Div, G3, Hqs, USACDCBC Fort Ord, California 93941	1

	<u>No. of Copies</u>
Commanding General Hq, U. S. Army Materiel Command Research Division Research and Development Directorate Washington, D. C. 20025	1
Canadian Army Staff 2450 Massachusetts Avenue Washington, D. C.	4
British Joint Service Mission Ministry of Supply Staff 1800 K Street, N. W. Washington, D. C.	6
Commander U. S. Marine Corps Washington, D. C. Attn: AO-rH	1
Commanding Officer U. S. Army Aviation Material Labs Fort Eustis, Virginia Attn: TCREC-SDL	1
Commanding General U. S. Army General Equipment Test Activity Fort Lee, Virginia 23801 Attn: Transportation Logistics Test Directorate	1
Commanding General U. S. Army Medical Services Combat Developments Agency Fort Sam Houston, Texas 78234	2
Commanding Officer Signal Corps Fort Monmouth, New Jersey 07703 Attn: CSRDL	2
Commanding Officer Yuma Proving Ground Yuma, Arizona 85364 Attn: STEYP-TE	1

	<u>No. of Copies</u>
Corps of Engineers U. S. Army Engineer Research & Development Labs. Fort Belvoir, Virginia 22060	1
President U. S. Army Maintenance Board Fort Knox, Kentucky 40121	1
President U. S. Army Armor Board Fort Knox, Kentucky 40121	1
President U. S. Army Artillery Board Fort Sill, Oklahoma 73503	1
President U. S. Army Infantry Board Fort Benning, Georgia 31905	1
Director U. S. Army Engineer Waterways Experiment Station Corps of Engineers P.O. Box 631 Vicksburg, Mississippi 39181	3
Unit X Documents Expediting Project Library of Congress Washington, D. C. Stop 303	4
Exchange and Gift Division Library of Congress Washington, D. C. 20025	1
United States Navy Industrial College of the Armed Forces Washington, D. C. Attn: Vice Deputy Commandant	10

	<u>No. of Copies</u>
Continental Army Command Fort Monroe, Virginia	1
Department of National Defense Dr. N. W. Morton Scientific Advisor Chief of General Staff Army Headquarters Ottawa, Ontario, Canada	1
Chief Office of Naval Research Washington, D. C.	1
Superintendent U. S. Military Academy West Point, New York Attn: Prof. of Ordnance	1
Superintendent U. S. Naval Academy Annapolis, Maryland	1
Chief, Research Office Mechanical Engineering Division Quartermaster Research & Engineering Command Natick, Massachusetts	1

unclassified

Security Classification

DOCUMENT CONTROL DATA - R&D

(Security classification of title, body of abstract and indexing annotation must be entered when the overall report is classified)

1. ORIGINATING ACTIVITY (Corporate author) University of Detroit College of Engineering Civil Engineering Department		2a. REPORT SECURITY CLASSIFICATION unclassified	
		2b. GROUP N/A	
3. REPORT TITLE ANALYSIS OF ESTIMATED RIVER EXITING PERFORMANCE			
4. DESCRIPTIVE NOTES (Type of report and inclusive dates) Analysis of estimated M-113 APC exiting performance on rivers surveyed in the eastern U. S.			
5. AUTHOR(S) (Last name, first name, initial) Sloss, Jr., David A., Baker, Warren J., Lassaline, David M., Miranda, Constanzio X. C. F.			
6. REPORT DATE	7a. TOTAL NO. OF PAGES 31	7b. NO. OF REFS 5	
8a. CONTRACT OR GRANT NO. DA-20-113-AMC-09099 (T)	9a. ORIGINATOR'S REPORT NUMBER(S) NONE		
b. PROJECT NO.			
c.	9b. OTHER REPORT NO(S) (Any other numbers that may be assigned this report)		
d.	NONE		
10. AVAILABILITY/LIMITATION NOTICES Distribution of this document is unlimited.			
11. SUPPLEMENTARY NOTES		12. SPONSORING MILITARY ACTIVITY Land Locomotion Division U. S. Army Tank Automotive Command Warren, Michigan 48090	
13. ABSTRACT A previous study of river magnitude and frequency established river exiting as the primary problem for vehicles attempting to cross rivers. Analysis of the exiting problem indicated that the single most important parameter to be considered was the geometric form of the river bank. Evaluation of the probability of an M-113 exiting at each bank surveyed in the magnitude and frequency study was made by relating vehicle performance characteristics to bank descriptions; a determination of the probability of the vehicle exiting was then made on a GO or NO-GO basis. Since much of the environment was extremely severe with respect to M-113 capabilities, this evaluation was fairly straight forward. A numerical method, using a geometric severity to classify bank geometry, was then developed to permit a performance analysis to be conducted on a rational basis.			

14. KEY WORDS	LINK A		LINK B		LINK C	
	ROLE	WT	ROLE	WT	ROLE	WT
VEHICLE EXITING PERFORMANCE RIVER BANK GEOMETRY GEOMETRIC SEVERITY FACTOR SLOPE SEVERITY FACTOR BANK HEIGHT-TO-DEPTH RATIO ANALYSIS OF VEHICLE EXITING PERFORMANCE						

INSTRUCTIONS

1. **ORIGINATING ACTIVITY:** Enter the name and address of the contractor, subcontractor, grantee, Department of Defense activity or other organization (*corporate author*) issuing the report.
- 2a. **REPORT SECURITY CLASSIFICATION:** Enter the overall security classification of the report. Indicate whether "Restricted Data" is included. Marking is to be in accordance with appropriate security regulations.
- 2b. **GROUP:** Automatic downgrading is specified in DoD Directive 5200.10 and Armed Forces Industrial Manual. Enter the group number. Also, when applicable, show that optional markings have been used for Group 3 and Group 4 as authorized.
3. **REPORT TITLE:** Enter the complete report title in all capital letters. Titles in all cases should be unclassified. If a meaningful title cannot be selected without classification, show title classification in all capitals in parenthesis immediately following the title.
4. **DESCRIPTIVE NOTES:** If appropriate, enter the type of report, e.g., interim, progress, summary, annual, or final. Give the inclusive dates when a specific reporting period is covered.
5. **AUTHOR(S):** Enter the name(s) of author(s) as shown on or in the report. Enter last name, first name, middle initial. If military, show rank and branch of service. The name of the principal author is an absolute minimum requirement.
6. **REPORT DATE:** Enter the date of the report as day, month, year, or month, year. If more than one date appears on the report, use date of publication.
- 7a. **TOTAL NUMBER OF PAGES:** The total page count should follow normal pagination procedures, i.e., enter the number of pages containing information.
- 7b. **NUMBER OF REFERENCES:** Enter the total number of references cited in the report.
- 8a. **CONTRACT OR GRANT NUMBER:** If appropriate, enter the applicable number of the contract or grant under which the report was written.
- 8b, 8c, & 8d. **PROJECT NUMBER:** Enter the appropriate military department identification, such as project number, subproject number, system numbers, task number, etc.
- 9a. **ORIGINATOR'S REPORT NUMBER(S):** Enter the official report number by which the document will be identified and controlled by the originating activity. This number must be unique to this report.
- 9b. **OTHER REPORT NUMBER(S):** If the report has been assigned any other report numbers (*either by the originator or by the sponsor*), also enter this number(s).

10. **AVAILABILITY/LIMITATION NOTICES:** Enter any limitations on further dissemination of the report, other than those imposed by security classification, using standard statements such as:

- (1) "Qualified requesters may obtain copies of this report from DDC."
- (2) "Foreign announcement and dissemination of this report by DDC is not authorized."
- (3) "U. S. Government agencies may obtain copies of this report directly from DDC. Other qualified DDC users shall request through _____."
- (4) "U. S. military agencies may obtain copies of this report directly from DDC. Other qualified users shall request through _____."
- (5) "All distribution of this report is controlled. Qualified DDC users shall request through _____."

If the report has been furnished to the Office of Technical Services, Department of Commerce, for sale to the public, indicate this fact and enter the price, if known.

11. **SUPPLEMENTARY NOTES:** Use for additional explanatory notes.

12. **SPONSORING MILITARY ACTIVITY:** Enter the name of the departmental project office or laboratory sponsoring (*paying for*) the research and development. Include address.

13. **ABSTRACT:** Enter an abstract giving a brief and factual summary of the document indicative of the report, even though it may also appear elsewhere in the body of the technical report. If additional space is required, a continuation sheet shall be attached.

It is highly desirable that the abstract of classified reports be unclassified. Each paragraph of the abstract shall end with an indication of the military security classification of the information in the paragraph, represented as (TS), (S), (C), or (U).

There is no limitation on the length of the abstract. However, the suggested length is from 150 to 225 words.

14. **KEY WORDS:** Key words are technically meaningful terms or short phrases that characterize a report and may be used as index entries for cataloging the report. Key words must be selected so that no security classification is required. Identifiers, such as equipment model designation, trade name, military project code name, geographic location, may be used as key words but will be followed by an indication of technical context. The assignment of links, rules, and weights is optional.